

Reissued: 9-Jul-03

Model: Adonis-C3	Date: 26-Jun-03	No.: MB082001a
------------------	-----------------	----------------

Serial Number Update

The Serial Number information has been updated.

Modified Article: Pressure Roller		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Other	☐ To meet standards ()

The Pressure Roller has been changed to further minimize wrinkling.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AE020123	AE020125	Pressure Roller:Mm32:Ass'y	1	X/O	51	20	

RAI (China) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035	115/60	USA	B079-17	J5836500042
Gestetner 3532	220/50	Europe, Asia	B079-22	J5836502233
Nashuatec 3545				
Rex Rotary 3518				
Lanier LD035	220/50	Europe	B079-24	L1343850001
IS2035	220/50	Europe	B079-26	1R28530001
Ricoh Aficio 2035	220/50	Europe, etc	B079-27	J5836502324
Ricoh Aficio 2035	220/50,60	Asia	B079-29	J58366xxxxx
Ricoh Aficio 2045	115/60	USA	B082-17	J5936500001
Gestetner 4532	220/50	Europe, Asia	B082-22	J5936501683
Nashuatec 4545				
Rex Rotary 4518				
Lanier LD045	220/50	Europe	B082-24	L1353850001
IS2045	220/50	Europe	B082-26	1R38530001
Ricoh Aficio 2045	220/50	Europe, etc	B082-27	J5936501782
Ricoh Aficio 2045	220/50,60	Asia	B082-29	J5936501263

Reissued: 9-Jul-03

Model: Adonis-C3

Date: 26-Jun-03

No.: MB082001a

RPL (U.K.) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035G	120/60	USA (GSA)	B079-57	J583300XXXX
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-62	J583300XXXX
Lanier : LD035	220/50	Europe, etc	B079-64	L134326XXXX
IS2035	220/50	Europe	B079-66	1R2253XXXX
Ricoh Aficio 2035	220/50	Europe, etc	B079-67	J5833001395
Ricoh Aficio 2045G	120/60	USA (GSA)	B082-57	J593300XXXX
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-62	J593300XXXX
Lanier : LD045	220/50	Europe, etc	B082-64	L135326XXXX
IS2035	220/50	Europe	B082-66	1R3253XXXX
Ricoh Aficio 2045	220/50	Europe, etc	B082-67	J593300XXXX

Reissued: 26Feb-04

Model: Adonis-C3	Date: 2-Jul-03	No.: MB082002a
------------------	----------------	----------------

Serial Number Update

The Serial Number information has been updated.

Modified Article: Terminal – Charge Roller		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Other	☐ To meet standards ()

The following have been changed to further ensure proper contact of the Charge Roller terminals.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
54472681	G0652681	Snap Ring	3-3	O/O	45	10	
A2322308	G0652308	Rear Terminal – Charge Roller	1-1	O/O	45	19	
A2322354	G0652354	Front Terminal – Charge Roller	1-1	O/O	45	27	
G0652270	G0652271	Receptacle – Charge Roller	1-1	O/O	43	9	

RAI (China) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035	115/60	USA	B079-17	J5836600001
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-22	J5836601382
Lanier LD035	220/50	Europe	B079-24	L1343860001
IS2035	220/50	Europe	B079-26	1R28630001
Ricoh Aficio 2035	220/50	Europe, etc	B079-27	J5836601477
Ricoh Aficio 2035	220/50,60	Asia	B079-29	J5836601101
Ricoh Aficio 2045	115/60	USA	B082-17	J5936600001
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-22	J5936601006
Lanier LD045	220/50	Europe	B082-24	L1353860001
IS2045	220/50	Europe	B082-26	1R38630001
Ricoh Aficio 2045	220/50	Europe, etc	B082-27	J5936601091
Ricoh Aficio 2045	220/50,60	Asia	B082-29	J5936600749

Reissued: 26Feb-04

Model: Adonis-C3	Date: 2-Jul-03	No.: MB082002a
------------------	----------------	----------------

RPL (U.K.) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035G	120/60	USA (GSA)	B079-57	Service parts only
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-62	Service parts only
Lanier : LD035	220/50	Europe,etc	B079-64	Service parts only
IS2035	220/50	Europe	B079-66	Service parts only
Ricoh Aficio 2035	220/50	Europe, etc	B079-67	Service parts only
Ricoh Aficio 2045G	120/60	USA (GSA)	B082-57	Service parts only
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-62	Service parts only
Lanier : LD045	220/50	Europe,etc	B082-64	Service parts only
IS2035	220/50	Europe	B082-66	Service parts only
Ricoh Aficio 2045	220/50	Europe, etc	B082-67	Service parts only

Reissued: 12-Nov-03

Model: Adonis-C3	Date: 24-Jul-03	No.: MB082003a
------------------	-----------------	----------------

Serial Number Update

The Serial Number information has been updated.

Modified Article: Operation Panel - Assembly		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☒ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☐ Other	

The following have been changed due to a vendor change.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0825219	B0825222	Touch Panel : HVGA	1	O/O	17	3	
B0776387	B0776355	Keytop : 10keyAA	1	O/O	17	23	
B0776352	B0776362	Sheet:Power Souce :NA	1	O/O	17	31	
B0776353	B0776363	Case Operation Sub unit :EU	1	O/O	17	32	

RAI (China) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035	115/60	USA	B079-17	J5836700741
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-22	J58368xxxxx
Lanier LD035	220/50	Europe	B079-24	L1343870013
IS2035	220/50	Europe	B079-26	1R2883xxxx
Ricoh Aficio 2035	220/50	Europe, etc	B079-27	J5836703783
Ricoh Aficio 2035	220/50,60	Asia	B079-29	J58368xxxxx
Ricoh Aficio 2045	115/60	USA	B082-17	J5936700001
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-22	J59367xxxxx
Lanier LD045	220/50	Europe	B082-24	L1353870001
IS2045	220/50	Europe	B082-26	1R3883xxxx
Ricoh Aficio 2045	220/50	Europe, etc	B082-27	J5936702244
Ricoh Aficio 2045	220/50,60	Asia	B082-29	J5936701988

Reissued: 12-Nov-03

Model: Adonis-C3	Date: 24-Jul-03	No.: MB082003a
------------------	-----------------	----------------

RPL (U.K.) Production


MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035G	120/60	USA (GSA)	B079-57	J583340XXXX
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-62	J583340XXXX
Lanier : LD035	220/50	Europe,etc	B079-64	L1343310001
IS2035	220/50	Europe	B079-66	1R2253XXXX
Ricoh Aficio 2035	220/50	Europe, etc	B079-67	J583330XXXX
Ricoh Aficio 2045G	120/60	USA (GSA)	B082-57	J593300XXXX
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-62	J5933400001
Lanier : LD045	220/50	Europe,etc	B082-64	L1353300001
IS2035	220/50	Europe	B082-66	1R3253XXXX
Ricoh Aficio 2045	220/50	Europe, etc	B082-67	J5933500001

Model: Adonis-C3		Date: 4-Sep-03	No.: MB082004
Modified Article: Changing the service unit of the Transfer Unit		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

The Right Cover, already registered as an individual service part, has been removed from the "Transfer Unit" service part. Therefore the new Transfer Unit below is comprised simply of the unit itself.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0047270	B0049015	Transfer Unit	1-1	O/O	47	40	*

*: New index

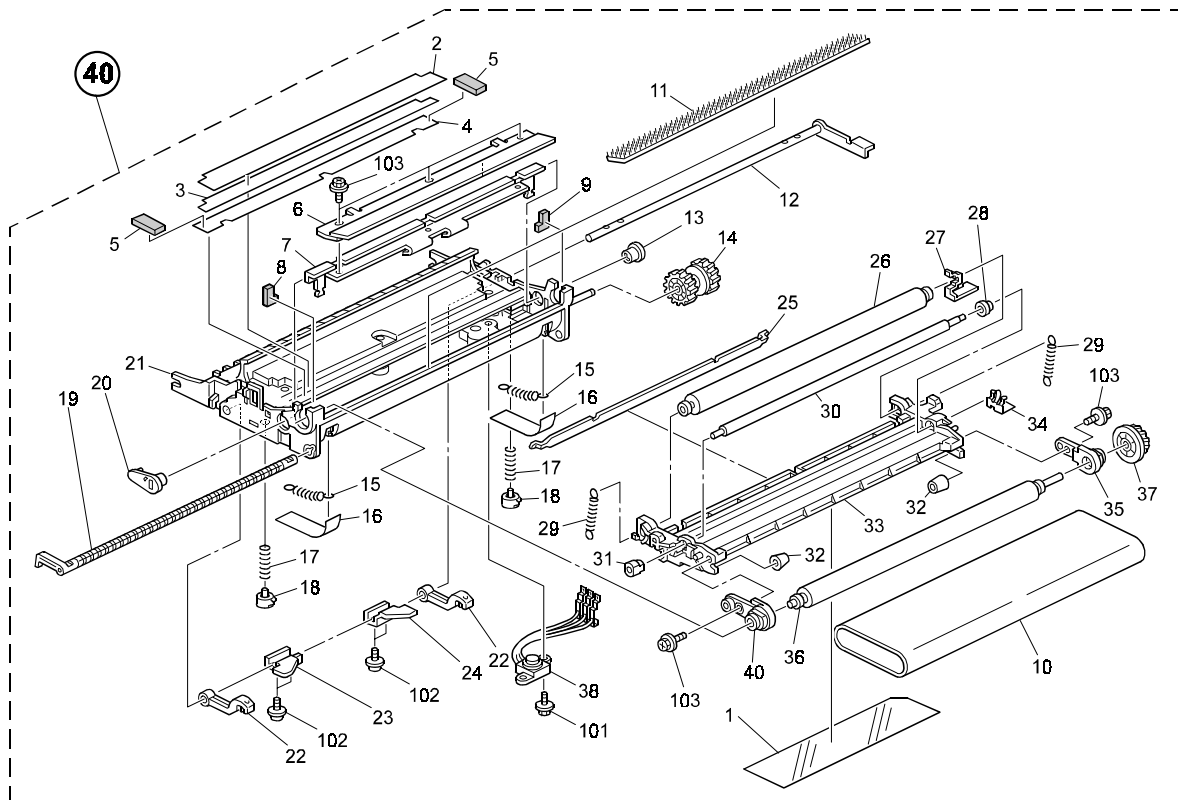

Reissued: 26-Feb-04

Model: Adonis-C3	Date: 8-Sep-03	No.: MB082005a
------------------	----------------	----------------

MB Correction


The items in bold italics have been corrected or added.

Modified Article: Hot Roller Stripper, Tension Spring		Prepared by: Y. Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

To minimize toner dropping onto copies from the Hot Roller Strippers, the width of the Hot Roller Stripper has been decreased from 3mm to 0.5mm and the pressure of the Tension Spring decreased from 300mN to 50mN.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AA060879	AA060948	Tension Spring	1-1	X/X	51	9	A
AE044030	AE044056	Hot roller stripper	7-7	X/X	51	10	A

Note: When installing for the first time, these parts should be changed **together as a set (X/O)**.

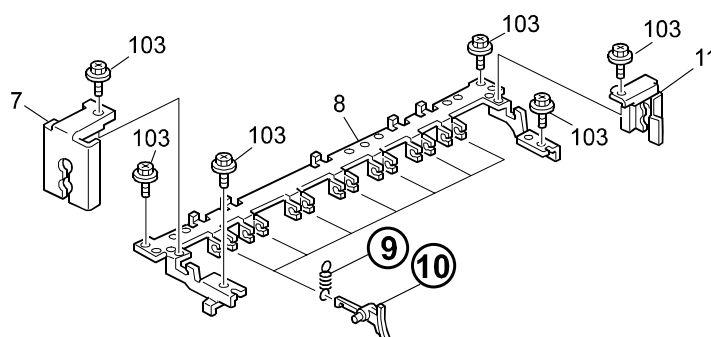

Reissued: 26-Feb-04

Model: Adonis-C3	Date: 8-Sep-03	No.: MB082005a
------------------	----------------	----------------

RAI (China) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035	115/60	USA	B079-17	J5836800081
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-22	J5836900229
Lanier LD035	220/50	Europe	B079-24	L134370xxxxx
IS2035	220/50	Europe	B079-26	1R28930001
Ricoh Aficio 2035	220/50	Europe, etc	B079-27	J58370xxxxx
Ricoh Aficio 2035	220/50,60	Asia	B079-29	J5836900001
Ricoh Aficio 2045	115/60	USA	B082-17	J5936800491
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-22	J5936900222
Lanier LD045	220/50	Europe	B082-24	L135390xxxx
IS2045	220/50	Europe	B082-26	1R38930001
Ricoh Aficio 2045	220/50	Europe, etc	B082-27	J59370xxxxx
Ricoh Aficio 2045	220/50,60	Asia	B082-29	J59370xxxxx

RPL (U.K.) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035G	120/60	USA (GSA)	B079-57	Service parts only
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-62	Service parts only
Lanier : LD035	220/50	Europe,etc	B079-64	Service parts only
IS2035	220/50	Europe	B079-66	Service parts only
Ricoh Aficio 2035	220/50	Europe, etc	B079-67	Service parts only
Ricoh Aficio 2045G	120/60	USA (GSA)	B082-57	Service parts only
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-62	Service parts only
Lanier : LD045	220/50	Europe,etc	B082-64	Service parts only
IS2035	220/50	Europe	B082-66	Service parts only
Ricoh Aficio 2045	220/50	Europe, etc	B082-67	Service parts only

Reissued: 12-Nov-03

Model: Adonis-C3	Date: 25-Sep-03	No.: MB082006a
------------------	-----------------	----------------

Serial Number Update

The Serial Number information has been updated.

Modified Article: Cleaning Blade : Ass'y		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The following has been changed to further improve drum cleaning efficiency.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AD041095	AD041105	Cleaning Blade: Ass'y	1-1	O/O	45	25	

RAI (China) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035	115/60	USA	B079-17	J5836802519
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-22	J58370xxxxx
Lanier LD035	220/50	Europe	B079-24	L1343890001
IS2035	220/50	Europe	B079-26	1R28930001
Ricoh Aficio 2035	220/50	Europe, etc	B079-27	J5836900100
Ricoh Aficio 2035	220/50,60	Asia	B079-29	J5836900001
Ricoh Aficio 2045	115/60	USA	B082-17	J5936802152
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-22	J5936900222
Lanier LD045	220/50	Europe	B082-24	L1353890001
IS2045	220/50	Europe	B082-26	1R38930001
Ricoh Aficio 2045	220/50	Europe, etc	B082-27	J5936800357
Ricoh Aficio 2045	220/50,60	Asia	B082-29	J5936900001

Reissued: 12-Nov-03

Model: Adonis-C3	Date: 25-Sep-03	No.: MB082006a
------------------	-----------------	----------------

RPL (U.K.) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035G	120/60	USA (GSA)	B079-57	J583350XXXX
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-62	J583350XXXX
Lanier : LD035	220/50	Europe,etc	B079-64	L134331XXXX
IS2035	220/50	Europe	B079-66	1R2253XXXX
Ricoh Aficio 2035	220/50	Europe, etc	B079-67	J583350XXXX
Ricoh Aficio 2045G	120/60	USA (GSA)	B082-57	J593300XXXX
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-62	J5933400938
Lanier : LD045	220/50	Europe,etc	B082-64	L135329XXXX
IS2035	220/50	Europe	B082-66	1R3253XXXX
Ricoh Aficio 2045	220/50	Europe, etc	B082-67	J593340XXXX

Reissued: 14-May-04

Model: Adonis-C3	Date: 26-Nov-03	No.: MB082007b
------------------	-----------------	----------------

MB Correction


The items in bold italics have been corrected or added.

Modified Article: Hot Roller – 39.8mm T0.4		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☒ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☐ Other	

The following has been changed due to a vendor change.

Note: This modification applies to the Adonis-C3 only.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AE011071	AE011092	Hot Roller – 39.8mm T0.4	1-1	<i>X/O</i>	51	15	

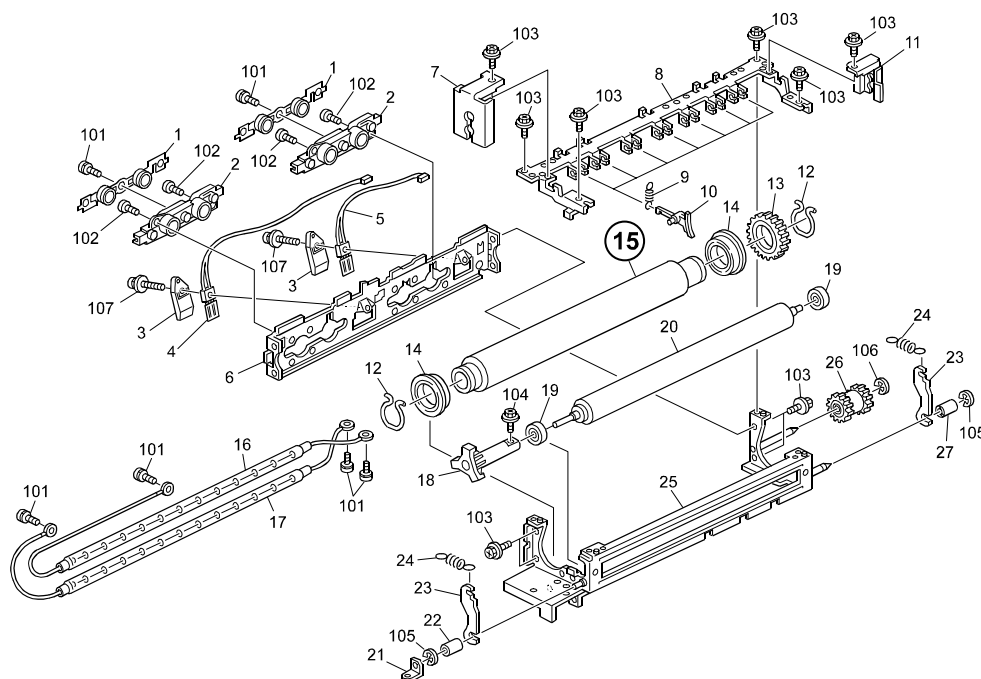

Reissued: 14-May-04

Model: Adonis-C3	Date: 26-Nov-03	No.: MB082007b
------------------	-----------------	----------------

RAI (China) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035	115/60	USA	B079-17	J5837101274
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-22	J58372xxxxx
Lanier LD035	220/50	Europe	B079-24	L1343910001
IS2035	220/50	Europe	B079-26	1R29130001
Ricoh Aficio 2035	220/50	Europe, etc	B079-27	J58372xxxxx
Ricoh Aficio 2035	220/50,60	Asia	B079-29	J5837100117
Ricoh Aficio 2045	115/60	USA	B082-17	J5937100338
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-22	J5937100160
Lanier LD045	220/50	Europe	B082-24	L1353910001
IS2045	220/50	Europe	B082-26	1R39130001
Ricoh Aficio 2045	220/50	Europe, etc	B082-27	J5937100148
Ricoh Aficio 2045	220/50,60	Asia	B082-29	J5937100088


RPL (U.K.) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035G	120/60	USA (GSA)	B079-57	J583360XXXX
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-62	J583360XXXX
Lanier : LD035	220/50	Europe,etc	B079-64	L134332XXXX
IS2035	220/50	Europe	B079-66	1R2253XXXX
Ricoh Aficio 2035	220/50	Europe, etc	B079-67	J583360XXXX
Ricoh Aficio 2045G	120/60	USA (GSA)	B082-57	J5933600006
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-62	J593360XXXX
Lanier LD045	220/50	Europe,etc	B082-64	L1353310001
IS2035	220/50	Europe	B082-66	1R3253XXXX
Ricoh Aficio 2045	220/50	Europe, etc	B082-67	J593350XXXX

Model: Adonis-C3		Date: 3-Dec-03	No.: MB082008
Modified Article: Developer Cartridge – sub ass'y		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Please note the following revision made to the A-C3 Parts Catalog, which was applied from the beginning of mass production.


Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	BB0823255	Developer Cartridge – sub ass'y	0-1		43	31	

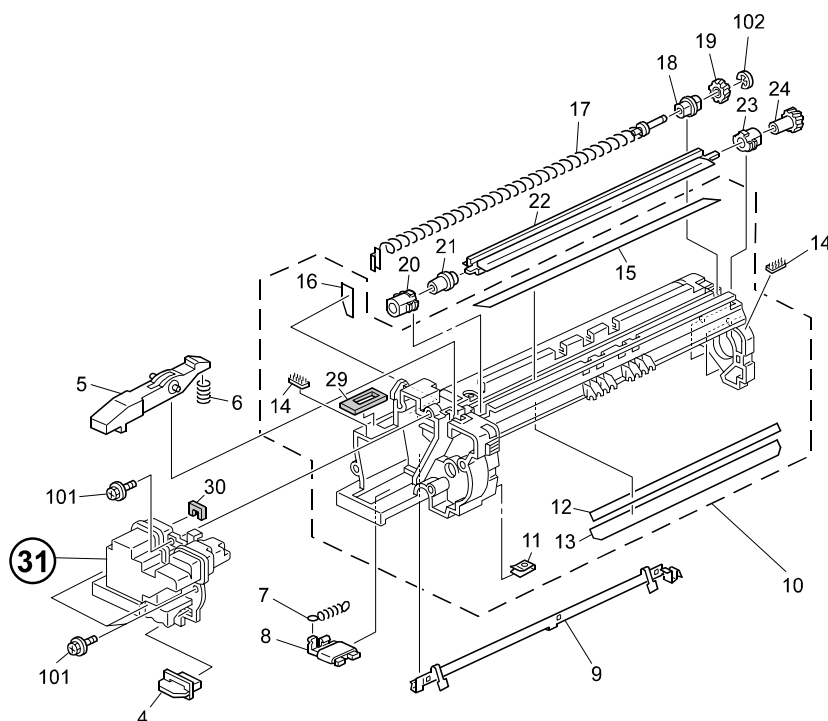

Model: Adonis-C3		Date: 2-Feb-04	No.: MB082009
Modified Article: Cleaning blade bracket		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Please apply the following description correction to your Parts Catalogs.

Part Number	Incorrect Description	Correct Description	Q'ty	Int	Page	Index	Note
B0822312	Second Cleaning blade	Cleaning blade bracket	1-1		45	16	

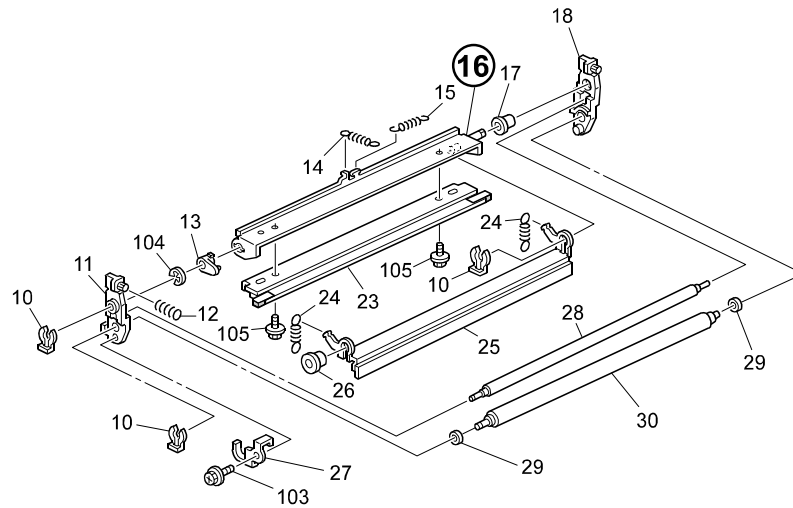

Model: Adonis-C3		Date: 26-Jul-04	No.: MB082010
Modified Article: Fusing Cleaning Roller		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Other	☐ To meet standards ()

A coating was applied to the cleaning roller surface.

Reason: To ensure toner melting on the cleaning roller does not occur. Melting can cause grays bands or fusing jams.

Old part number	New part number	Description	Q'ty	Int.	Page	Index	Note
AE042054	AE042070	Fusing Cleaning Roller	1	X /O	49	17	

Model: Adonis-C3	Date: 26-Jul-04	No.: MB082010
------------------	-----------------	---------------

RAI (China) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035 SAVIN 4035 Gestetner 3532 LANIER LD035	115/60	USA	B079-17	TBA
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-22	TBA
LANIER LD035	220/50	Europe	B079-24	TBA
IS2035	220/50	Europe	B079-26	TBA
Ricoh Aficio 2035	220/50	Europe, etc	B079-27	TBA
Ricoh Aficio 2035 Gestetner 3532 LANIER LD035	220/50,60	Asia	B079-29	TBA
Ricoh Aficio 2045 SAVIN 4045 Gestetner 4532 LANIER LD045	115/60	USA	B082-17	TBA
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-22	TBA
LANIER LD045	220/50	Europe	B082-24	TBA
IS2045	220/50	Europe	B082-26	TBA
Ricoh Aficio 2045	220/50	Europe, etc	B082-27	TBA
Ricoh Aficio 2045 Gestetner 4532 LANIER LD045	220/50,60	Asia	B082-29	TBA

Model: Adonis-C3

Date: 26-Jul-04

No.: MB082010

RPL (U.K.) Production


MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035G SAVIN 4135g Gestetner 4235g LANIER LD035	120/60	USA (GSA)	B079-57	TBA
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-62	TBA
LANIER LD035	220/50	Europe,etc	B079-64	TBA
IS2035	220/50	Europe	B079-66	TBA
Ricoh Aficio 2035	220/50	Europe, etc	B079-67	TBA
Ricoh Aficio 2045G SAVIN 4145g Gestetner 4234g LANIER LD045	120/60	USA (GSA)	B082-57	TBA
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-62	TBA
LANIER LD045	220/50	Europe,etc	B082-64	TBA
IS2045	220/50	Europe	B082-66	TBA
Ricoh Aficio 2045	220/50	Europe, etc	B082-67	TBA

Model: Adonis-C3		Date: 29-Jul-04	No.: MB082011
Modified Article: Bushing		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Please apply the following index number correction to your Parts Catalogs.

Part Number	Description	Q'ty	Int	Page	Incorrect Index	Correct Index	Note
AA082070	Bushing – 8x16x7	1		33	12	107	
08053480	Bushing – 6mm	-		33	107	12	(Right side of illustration only)

Important: Make sure to correct **only the large index numbers** shown below. All other index numbers are correct.

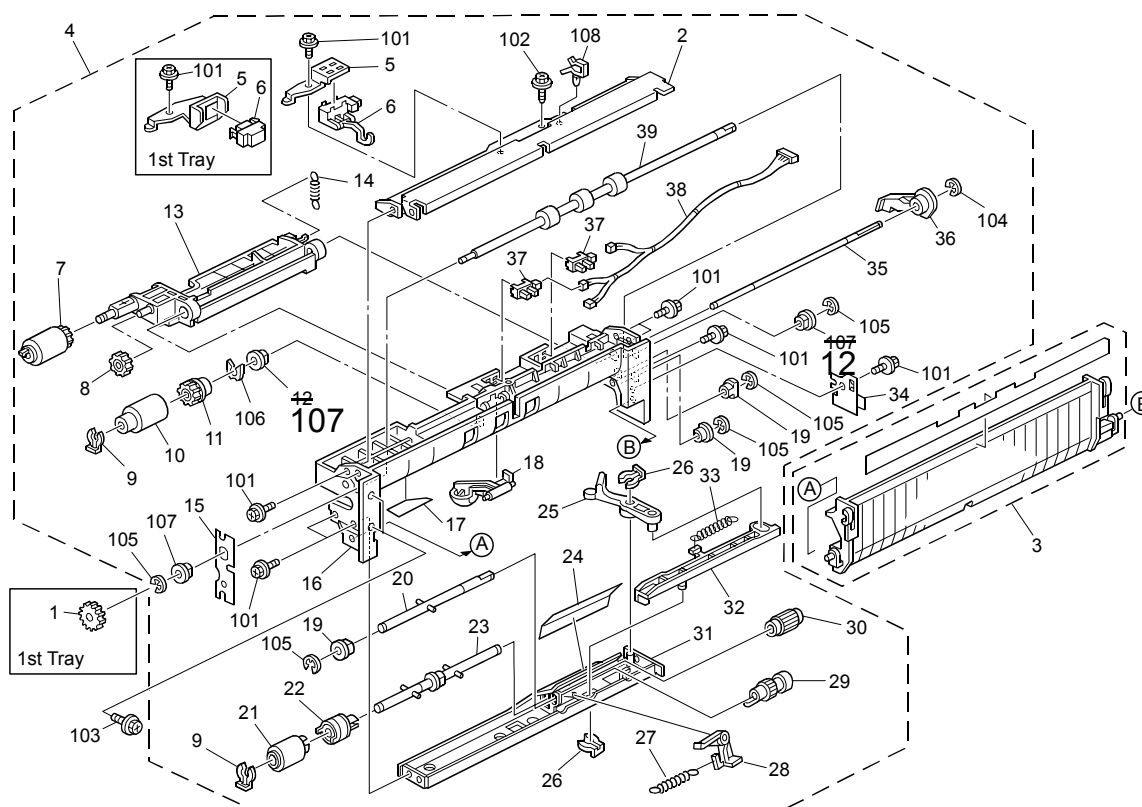

Model: Adonis-C3		Date: 17-Aug-04	No.: MB082012
Modified Article: LCD HVGA		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☒ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The following has been changed due to a vendor change

Old part number	New part number	Description	Q'ty	int	Page	Index	Note
B0825218	B101 5257	LCD HVGA SH BL	1	O/O	17	6	


Model: Adonis-C3		Date: 21-Oct-04	No.: MB082013
Modified Article: Upper Inner Cover Seals		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Other	☐ To meet standards ()

Old part number	New part number	Description	Q'ty	Int.	Page	Index	Note
	B0821371	Inner Cover: Upper: Sub Assy	0-1		13	38	
B0821372	B0821372	Inner Cover: Upper	1	-	13	23	
	B0821373	Seal: Inner Cover: Middle	0-1		13	39	
	B0821374	Seal: Inner Cover: Upper	0-1		13	40	
	B0821375	Seal: Inner Cover: Left	0-1		13	41	
	B0821379	Seal: Side Plate: Front: Switch	0-1		13	42	

Change: Four seals were added to the upper inner cover and frame.

Reason: To ensure that toner does not cover the contacts of the upper right cover switch.

- This can cause random black lines along the main scan direction, a laser synchronization error, or "Door open" to be displayed.

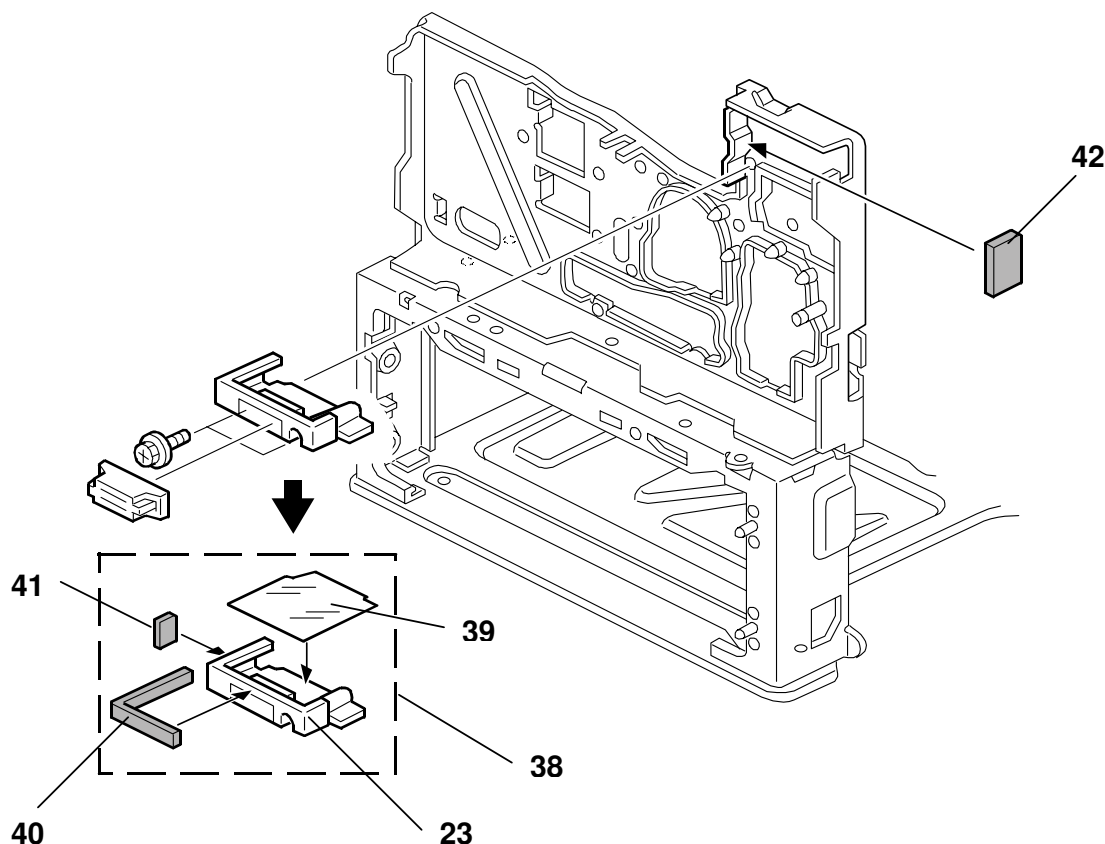

Model: Adonis-C3		Date: 29-Oct-04	No.: MB082014
Modified Article: Spring - Cleaning Blade		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☒ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

The following part has been changed to add proper contact pressure between the cleaning blade and OPC drum.

Note: Spring pressure decreased from 5.8 -> 3.0N. The new spring has a silver (metallic) color, as opposed to the older springs which are black.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AA062255	AA062258	Spring – Cleaning Blade	2	X/O	45	24	


Model: Adonis-C3		Date: 17-Dec-04	No.: MB082015
Modified Article: Pressure Lever		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☒ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0774056	B0824160	Lever: Pressure	2	X/O	51	23	

Change: Shape of the pressure lever.

Reason: To further ensure that the gap between the fusing hot roller and fusing pressure roller is normal.

Note: If the gap is too wide, streaks can occur on copies.

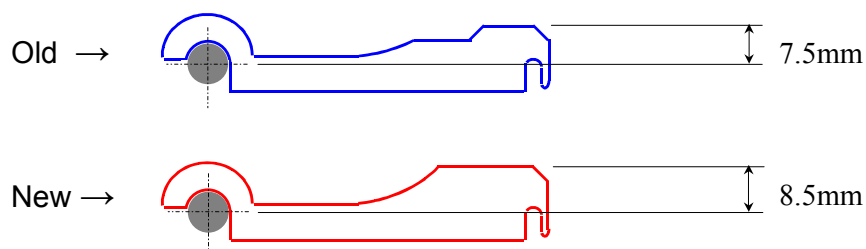

Model: Adonis-C3		Date: 4-Oct-05	No.: MB082016
Modified Article: Fusing Cleaning Roller		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Other	☐ To meet standards ()

Old part number	New part number	Description	Q'ty	Int.	Page	Index	Note
AE042070	AE042084	Fusing Cleaning Roller	1	X/O	49	17	

Change: The surface coating for the fusing cleaning roller was changed.

Reason: To ensure that the fusing cleaning roller functions correctly, and black spots do not appear on the outputs.

Model: Adonis-C3		Date: 18-Oct-05	No.: MB082017
Modified Article: Parts Catalog Correction		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Part number	Description	Q'ty	Int	Page	Incorrect Index	Correct Index	Note
A2323069	Rear Bias Terminal - Development	1	-	41	22	28	
B0043062	Ground Plate – Doctor Blade	1	-	41	28	22	

Change/Reason: The index was corrected.

Model: Adonis-C3		Date: 8-Nov-05	No.: MB082018
Modified Article: Transfer unit		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☒ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	B0049015	Transfer unit	0-1		47	40	

Change: This unit was added as a service part.

Reason: A request was received from the field.

Model: Adonis-C3		Date: 8-Dec-05	No.: MB082019
Modified Article: Cleaning Blade – Transfer Belt		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Other	☐ To meet standards ()

To improve transfer cleaning, the following P/N has been changed.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2323830	B0823831	Cleaning Blade – Transfer Belt	1-1	X/O	47	6	
B0823923	B0823920	Bracket:Claning Blade:0.6	1-1	X/O	47	7	
A2323894	B0823894	Drive Roller – Transfer Belt	1-1	X/O	47	36	

RAI (China) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035	115/60	USA	B079-17	J5836600551
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-22	J5836601382
Lanier LD035	220/50	Europe	B079-24	L1343860001
IS2035	220/50	Europe	B079-26	1R28630001
Ricoh Aficio 2035	220/50	Europe, etc	B079-27	J5836601477
Ricoh Aficio 2035	220/50,60	Asia	B079-29	J5836601101
Ricoh Aficio 2045	115/60	USA	B082-17	J5936600248
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-22	J5936601006
Lanier LD045	220/50	Europe	B082-24	L1353860001
IS2045	220/50	Europe	B082-26	1R38630001
Ricoh Aficio 2045	220/50	Europe, etc	B082-27	J5936601091
Ricoh Aficio 2045	220/50,60	Asia	B082-29	J5936600749

Model: Adonis-C3

Date: 8-Dec-05

No.: MB082019

RPL (U.K.) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035G	120/60	USA (GSA)	B079-57	J58ymm(+24)xxxxx
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-62	J58ymm(+24)xxxxx
Lanier : LD035	220/50	Europe,etc	B079-64	L135ymm(+20)xxxx
IS2035	220/50	Europe	B079-66	1R2mm(+20)yxxxx
Ricoh Aficio 2035	220/50	Europe, etc	B079-67	J58ymm(+24)xxxxx
Ricoh Aficio 2045G	120/60	USA (GSA)	B082-57	J59ymm(+24)xxxxx
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-62	J59ymm(+24)xxxxx
Lanier : LD045	220/50	Europe,etc	B082-64	L135ymm(+20)xxxx
IS2035	220/50	Europe	B082-66	1R3mm(+20)yxxxx
Ricoh Aficio 2045	220/50	Europe, etc	B082-67	J59ymm(+24)xxxxx

Model: Adonis-C3		Date: 11-Jan-06	No.: MB082020
Modified Article: Cleaning Blade		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☒ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Change: The materials for these parts were changed to more environmentally-friendly types.

Reason: This is part of Ricoh's ongoing application of in-house environmental standards.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0822353	B2132354	Cleaning Blade: Ass'y	1-1	O/O	45	23	

RAI (China) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035	115/60	USA	B079-17	J58xxxxxxx
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-22	J58xxxxxxx
Lanier LD035	220/50	Europe	B079-24	L134xxxxxxx
IS2035	220/50	Europe	B079-26	1R2xxxxxxx
Ricoh Aficio 2035	220/50	Europe, etc	B079-27	J58xxxxxxx
Ricoh Aficio 2035	220/50,60	Asia	B079-29	J58xxxxxxx
Ricoh Aficio 2045	115/60	USA	B082-17	J59xxxxxxx
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-22	J59xxxxxxx
Lanier LD045	220/50	Europe	B082-24	L135xxxxxxx
IS2045	220/50	Europe	B082-26	1R3xxxxxxx
Ricoh Aficio 2045	220/50	Europe, etc	B082-27	J59xxxxxxx
Ricoh Aficio 2045	220/50,60	Asia	B082-29	J59xxxxxxx

Model: Adonis-C3

Date: 11-Jan-06

No.: MB082020

RPL (U.K.) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035G	120/60	USA (GSA)	B079-57	J58ymm(+24)xxxxx
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-62	J58ymm(+24)xxxxx
Lanier : LD035	220/50	Europe,etc	B079-64	L134ymm(+20)xxxxx
IS2035	220/50	Europe	B079-66	1R2mm(+20)yxxxx
Ricoh Aficio 2035	220/50	Europe, etc	B079-67	J58ymm(+24)xxxxx
Ricoh Aficio 2045G	120/60	USA (GSA)	B082-57	J59ymm(+24)xxxxx
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-62	J59ymm(+24)xxxxx
Lanier : LD045	220/50	Europe,etc	B082-64	L135ymm(+20)xxxx
IS2035	220/50	Europe	B082-66	1R3ymm(+20)xxxx
Ricoh Aficio 2045	220/50	Europe, etc	B082-67	J59ymm(+24)xxxxx

Model: Adonis-C3		Date: 27-Jan-06	No.: MB082021
Modified Article: Parts Catalog Correction		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☒ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Incorrect part number	Correct Part number	Description	Q'ty	Int	Page	Index	Note
AW010048		Photosensor – GP2A28N1	1	O/O	59	3	
↳	AW010049	Photo Reflection Sensor					

Change/Reason: The incorrect P/N and description were corrected.

Old part number	New Part number	Description	Q'ty	Int	Page	Index	Note
AW010049		Photo Reflection Sensor	1	O/O	59	3	
↳	AW010117	Paper Feed Sensor					
AW010048	AW010106	Photosensor – GP2A28N1	1	O/O	61 37	15 19	

Change: The materials for these parts were changed to more environmentally-friendly types.

Reason: This is part of Ricoh's ongoing application of in-house environmental standards.

Model: Adonis-C3

Date: 27-Jan-06

No.: MB082021

Global

RAI (China) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio XXXX	115/60	USA	BXXX-17	XXXXXXXXXXXX
Gestetner XXXX Nashuatec XXXX Rex Rotary XXXX	220/50	Europe, Asia	BXXX-22	XXXXXXXXXXXX
Lanier LDXXX	220/50	Europe	BXXX-24	XXXXXXXXXXXX
Infotec ISXXXX	220/50	Europe	BXXX-26	XXXXXXXXXXXX
Ricoh Aficio XXXX	220/50	Europe, etc	BXXX-27	XXXXXXXXXXXX
Ricoh Aficio XXXX	220/50,60	Asia	BXXX-29	XXXXXXXXXXXX

Model: Adonis-C3		Date: 27-Jan-06	No.: MB082022
Modified Article: Cleaning Blade		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☒ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0823831	B2133831	Cleaning Blade – Transfer Belt	1-1	O/O	47	6	

Change: The materials for these parts were changed to more environmentally-friendly types.

Reason: This is part of Ricoh's ongoing application of in-house environmental standards.

Global

RAI (China) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio XXXX	115/60	USA	BXXX-17	XXXXXXXXXXXX
Gestetner XXXX Nashuatec XXXX Rex Rotary XXXX	220/50	Europe, Asia	BXXX-22	XXXXXXXXXXXX
Lanier LDXXX	220/50	Europe	BXXX-24	XXXXXXXXXXXX
Infotec ISXXXX	220/50	Europe	BXXX-26	XXXXXXXXXXXX
Ricoh Aficio XXXX	220/50	Europe, etc	BXXX-27	XXXXXXXXXXXX
Ricoh Aficio XXXX	220/50,60	Asia	BXXX-29	XXXXXXXXXXXX

Model: Adonis-C3		Date: 27-Jan-06	No.: MB082023
Modified Article: Drive Roller		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☒ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0823894	B2133894	Drive Roller – Transfer Belt	1-1	O/O	47	36	

Change: The materials for these parts were changed to more environmentally-friendly types.

Reason: This is part of Ricoh's ongoing application of in-house environmental standards.

Global

RAI (China) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio XXXX	115/60	USA	BXXX-17	XXXXXXXXXXXX
Gestetner XXXX Nashuatec XXXX Rex Rotary XXXX	220/50	Europe, Asia	BXXX-22	XXXXXXXXXXXX
Lanier LDXXX	220/50	Europe	BXXX-24	XXXXXXXXXXXX
Infotec ISXXXX	220/50	Europe	BXXX-26	XXXXXXXXXXXX
Ricoh Aficio XXXX	220/50	Europe, etc	BXXX-27	XXXXXXXXXXXX
Ricoh Aficio XXXX	220/50,60	Asia	BXXX-29	XXXXXXXXXXXX

Model: Adonis-C3		Date: 5-Apr-06	No.: MB082024
Modified Article: NVRAM		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	B0229590	NVRAM – ZERO COUNTER	1	-	93	3	

Change: This part was added.

Reason: It was missing from the Parts Catalog.

Note: The initial value of this counter is 0.

Model: Adonis-C3		Date: 5-Apr-06	No.: MB082025
Modified Article: TD Sensor		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☒ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0823065	B0823064	Density Sensor: Development	1-1	O/O	41	26	

Change: Materials change.

Reason: Ricoh's ongoing changes toward more environmentally-friendly materials

Model: Adonis-C3		Date: 6-Apr-06	No.: MB082026
Modified Article: TD Sensor		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☒ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0823064	B2133065	Density Sensor: Development	1-1	O/O	41	26	

Change/Reason: Parts standardization with the A-C4 (B195).

Model: Adonis-C3		Date: 24-Apr-06	No.: MB082027
Modified Article: Parts catalog correction		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Incorrect part number	Correct part number	Description	Q'ty	Int	Page	Index	Note
B0774716		Guide Plate: Right					
	B0774710	Guide Plate: Open and close: Right	1-1	-	57	20	

Change/Reason: The P/N and description written in the Parts Catalog were corrected.

Model: Adonis-C3		Date: 8-May-06	No.: MB082028
Modified Article: Receptacle		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☒ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AD021127	B2131127	Receptacle	1-1	O/O	37	35	

Change: The materials for these parts were changed to more environmentally-friendly types.

Reason: This is part of Ricoh's ongoing application of in-house environmental standards.

Model: Adonis-C3		Date: 26-Jun-06	No.: MB082029
Modified Article: PCU		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☒ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0822202	B0822203	PCU: Adonis-C3: Ass'y	1-1	O/O	43	1	

Change: The materials for these parts were changed to more environmentally-friendly types.

Reason: This is part of Ricoh's ongoing application of in-house environmental standards.

Model: Adonis-C3		Date: 26-Jun-06	No.: MB082030
Modified Article: Electrical Clutch		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☒ Other
	☐ To facilitate assembly	☐ To improve reliability	☐ To meet standards
	☐ Part standardization	☐ Product Safety	()

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AX200138		Electrical Clutch – Mice-13	1-1	O/O	37	37	
	AX200280	Electrical Clutch: 0.5N.M:28Z	1-1	O/O	67	26	

Change: The materials for this part were changed to more environmentally-friendly types.

The description was changed.

Reason: This is part of Ricoh's ongoing application of in-house environmental standards.

Model: Adonis-C3		Date: 11-Aug-06	No.: MB082031
Modified Article: Driven Roller		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Product Safety	☐ Other ☐ To meet standards ()

The following part has been changed to prevent toner from sticking to the driven roller.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AF040575	AF040600	Driven Roller	1-1 2-2	X/O X/O	29 53	42 19	

Global

RAI (China) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035	115/60	USA	B079-17	J 5836200001
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-22	J5836200790
Lanier LD035	220/50	Europe	B079-24	L1343820001
IS2035	220/50	Europe	B079-26	1R28230001
Ricoh Aficio 2035	220/50	Europe, etc	B079-27	J5836200887
Ricoh Aficio 2035	220/50,60	Asia	B079-29	J5836200590
Ricoh Aficio 2045	115/60	USA	B082-17	J 5936200001
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-22	J5936200508
Lanier LD045	220/50	Europe	B082-24	L1353820001
IS2045	220/50	Europe	B082-26	1R38230001
Ricoh Aficio 2045	220/50	Europe, etc	B082-27	J5936200608
Ricoh Aficio 2045	220/50,60	Asia	B082-29	J5936200328

Model: Adonis-C3		Date: 11-Aug-06	No.: MB082032
Modified Article: Thermistor		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Product Safety	☐ Other ☐ To meet standards ()

The following parts have been changed to prevent toner from dropping into the fusing unit.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AW100052	AW100085	Thermistor - Center	1-1	X/O	51	4	
AW100053	AW100086	Thermistor - Rear	1-1	X/O	51	5	
AA063664	→ AA063668	Spring: Fusing Cleaning Roller: 5n Spring: Fusing Cleaning Roller: 8n	2-2	X/O	49	19	

Global

RAI (China) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035	115/60	USA	B079-17	J5836200001
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-22	J5836200790
Lanier LD035	220/50	Europe	B079-24	L1343820001
IS2035	220/50	Europe	B079-26	1R28230001
Ricoh Aficio 2035	220/50	Europe, etc	B079-27	J5836200887
Ricoh Aficio 2035	220/50,60	Asia	B079-29	J5836200590
Ricoh Aficio 2045	115/60	USA	B082-17	J59ymm(+60)xxxxx
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-22	J5936200508
Lanier LD045	220/50	Europe	B082-24	L1353820001
IS2045	220/50	Europe	B082-26	1R38230001
Ricoh Aficio 2045	220/50	Europe, etc	B082-27	J5936200608
Ricoh Aficio 2045	220/50,60	Asia	B082-29	J5936200328

Model: Adonis-C3		Date: 11-Aug-06	No.: MB082033
Modified Article: Clutch		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Product Safety	☒ Other ☐ To meet standards ()

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AX210081	AX210093	Transfer Unit Clutch	1-1	O/O	63	9	
AW020097	AW020159	Photointerrupter	1-1	O/O	63	10	

Change: The materials for these parts were changed to more environmentally-friendly types.

Reason: This is part of Ricoh's ongoing application of in-house environmental standards.

RAI (China) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035	115/60	USA	B079-17	J58ymm(+60)xxxxx
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-22	J58ymm(+60)xxxxx
Lanier LD035	220/50	Europe	B079-24	L134ymm(+80)xxxxx
IS2035	220/50	Europe	B079-26	1R2mm(+80)yxxxx
Ricoh Aficio 2035	220/50	Europe, etc	B079-27	J58ymm(+60)xxxxx
Ricoh Aficio 2035	220/50,60	Asia	B079-29	J58ymm(+60)xxxxx
Ricoh Aficio 2045	115/60	USA	B082-17	J59ymm(+60)xxxxx
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-22	J59ymm(+60)xxxxx
Lanier LD045	220/50	Europe	B082-24	L135ymm(+80)xxxx
IS2045	220/50	Europe	B082-26	1R3mm(+80)yxxxx
Ricoh Aficio 2045	220/50	Europe, etc	B082-27	J59ymm(+60)xxxxx
Ricoh Aficio 2045	220/50,60	Asia	B082-29	J59ymm(+60)xxxxx

Model: Adonis-C3		Date: 23-Aug-06	No.: MB082034
Modified Article: HDD		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Product Safety	☐ Other ☐ To meet standards ()

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B5485863		Hard Disk					
	→ B1795995	HDD:HITACHI:40GB:PATH-KAI:ROHS	1-1	O/O	77	17	

Change/Reason: Parts standardization with the A-C4.

Model: Adonis-C3		Date: 11-Sep-06	No.: MB082035
Modified Article: Touch Panel		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☒ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0825222	B2135222	Touch Panel: HVGA	1-1	O/O	17	3	

Change: The part number for this part was changed.

Reason: Vendor change.

Note: The function and shape of this part have not been changed.

Model: Adonis-C3		Date: 20-Sep-06	No.: MB082036
Modified Article: Special Tool		Prepared by: K. Hamada	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Part number	Description	Q'ty	Int	Page	Incorrect Index	Correct Index	Note
A2309003	Adjusting Cam – Laser Unit	-	-	99	2	1	
A2309004	Positioning Pin Laser Unit	-	-	99	1	2	

Change/Reason: The index was corrected.

Model: Adonis-C3		Date: 25-Apr-07	No.: MB082037
Modified Article: Transfer Belt Cleaning Blade		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☒ To improve reliability ☐ To meet standards () ☐ Part standardization ☐ Product Safety		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AA060927		Springcleaning Blade: 5.1n	2-0	X/O	47	15	
	AA060939	Springcleaning Blade: 4.4n	0-2		47	15	

Change: The strength of the spring was decreased.

Reason: To optimize the pressure of the transfer belt cleaning blade.


RAI (China) Production

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Ricoh Aficio 2035	115/60	USA	B079-17	J5836200001
Gestetner 3532 Nashuatec 3545 Rex Rotary 3518	220/50	Europe, Asia	B079-22	J5836200790
Lanier LD035	220/50	Europe	B079-24	L1343820001
IS2035	220/50	Europe	B079-26	1R28230001
Ricoh Aficio 2035	220/50	Europe, etc	B079-27	J5836200887
Ricoh Aficio 2035	220/50,60	Asia	B079-29	J5836200590
Ricoh Aficio 2045	115/60	USA	B082-17	J5936200001
Gestetner 4532 Nashuatec 4545 Rex Rotary 4518	220/50	Europe, Asia	B082-22	J5936200508
Lanier LD045	220/50	Europe	B082-24	L1353820001
IS2045	220/50	Europe	B082-26	1R38230001
Ricoh Aficio 2045	220/50	Europe, etc	B082-27	J5936200608
Ricoh Aficio 2045	220/50,60	Asia	B082-29	J5936200328

Model: Adonis-C3		Date: 28-May-07	No.: MB082038
Modified Article: Parts Catalog Correction		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction	☐ Vendor change	☐ Other
	☐ To facilitate assembly	☐ To improve reliability	☐ To meet standards
	☐ Part standardization	☐ Product Safety	()

Part number	Description	Q'ty	Int	Page	Index	Note
G0652233	Seal Drum Front	1		43	32	
G0652234	Seal Drum Rear	1		43	33	
A2322399	Seal – Blade 13x9.5x3	2	-	43	34	
A2322348	Seal Blade 12x7x3	2	-	43	35	
A2322350	Seal - Entrance	2	-	43	36	

Change/Reason: The descriptions for these parts were missing from the Parts Catalog.

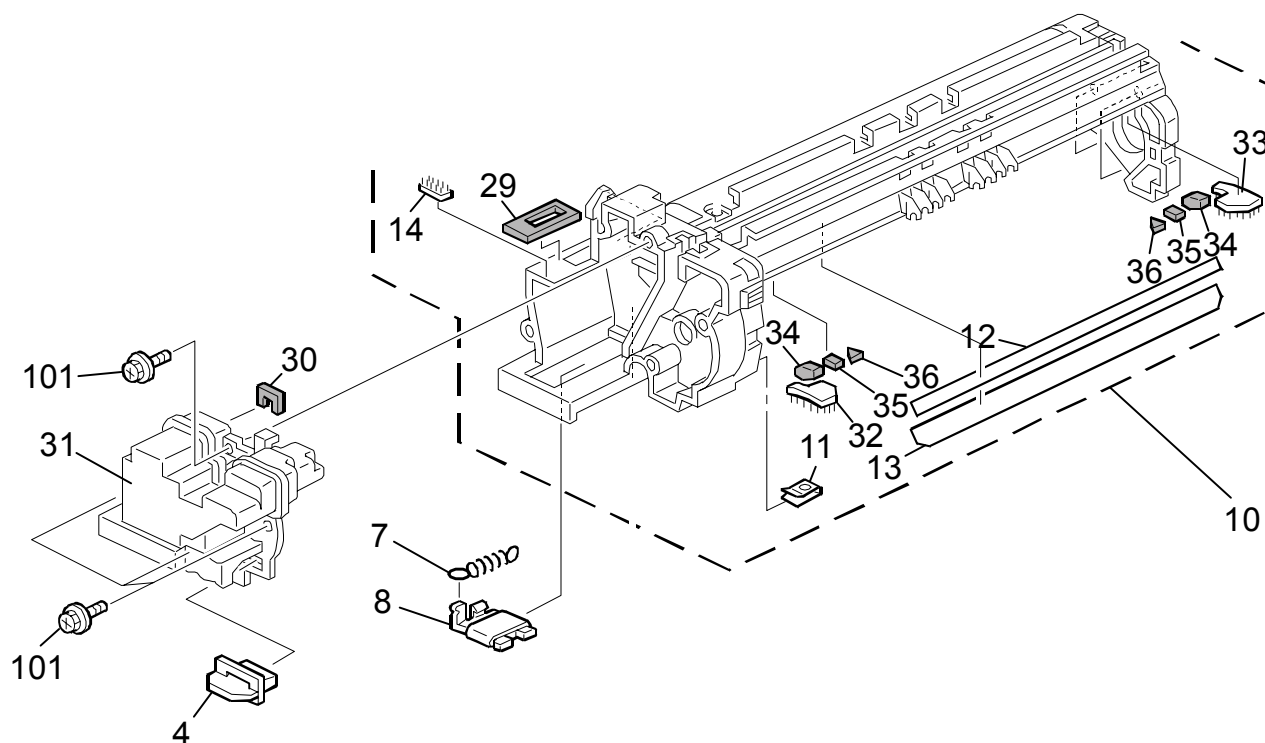

Model: Adonis-C3		Date: 28-May-07	No.: MB082039
Modified Article: Fusing unit assembly		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☒ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0827320	B0827321	Fusing Unit Assembly : NA	1-1	O/O	49	1	
B0827720	B0827721	Fusing Unit Assembly : EU	1-1	O/O	49	1	

Change: The P/N was changed.

Reason: P/N management (the P/N suffix of the old part was Z).

Model: Adonis-C3		Date: 28-May-07	No.: MB082040
Modified Article: Harness		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☒ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0045608	B2135608	Main Harness - Fusing Unit (EU)	1-1	O/O	71	6	
B0045609	B2135609	Main Harness - Fusing Unit (NA)	1-1	O/O	71	6	
B0045611	B2135611	Harness - Heater	1-1	O/O	75,69	21,17	
A2327756	B2135603	Harness - Circuit Breaker	1-1	O/O	69	19	
B0825453	B2135453	Harness: DC: Development: Drawer	1-1	O/O	65	5	

Change: The materials for these parts were changed to more environmentally-friendly types.

Reason: Ricoh's ongoing application of in-house environmental standards.

Model: Adonis-C3		Date: 28-May-07	No.: MB082041
Modified Article: Toner Supply Unit		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☒ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0823208	B0823209	TONER SUPPLY UNIT:C3:ASS'Y	1-1	X/O	39	1	
A2323230	A2323233	CASE - TONER SUPPLY ASS'Y	1-1	X/O	39	7	

Change: The shapes of the parts in the table were changed.

Reason: To further ensure that toner is not spilled when the toner bottle is replaced.

Model: Adonis-C3		Date: 21-Sep-07	No.: MB082042
Modified Article: Toner Overflow Sensor		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☒ To meet standards (RoHS) ☐ Part standardization ☐ Product Safety		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AW310006	AW310007	Toner Overflow Sensor	1-1	O/O	47	38	

Change: The materials of these parts were changed.

Reason: RoHS compliance

Model: Adonis-C3		Date: 25-Sep-07	No.: MB082043
Modified Article: Used Toner Sensor Harness		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☒ To meet standards (RoHS) ☐ Part standardization ☐ Product Safety		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0825466	B2135467	Harness: Used Toner Sensor	1-1	O/O	35	35	

Change: The materials of these parts were changed.

Reason: RoHS compliance

Model: Adonis-C3		Date: 25-Sep-07	No.: MB082044
Modified Article: PCU Parts		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☒ To meet standards (RoHS) ☐ Part standardization ☐ Product Safety		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AX500046		Quenching Lamp	1-1	O/O	73	12	
	AX500092	LED Array: QL					
B0822290		Bracket: Idler: Ass'y	1-1	O/O	43	25	
	B2132290	Bracket: Idler					
B0822312		Cleaning blade bracket	1-1	O/O	45	16	
	B2132312	Bracket: Cleaning Blade					
B0822316	B2132316	Stud: Contact Point: Cleaning	1-1	O/O	45	1	
B0822292	B2132292	Toner Collection Coil: Ass'y	1-1	O/O	43	17	
A2322367		ID Sensor	1-1	O/O	37	33	
	B2132367	Density Sensor					

Change: The materials of these parts were changed.

Reason: RoHS compliance

Model: Adonis-C3		Date: 26-Sep-07	No.: MB082045
Modified Article: Quenching Lamp		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☒ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AX500092		LED Array: QL	1-1	O/O	73	12	
→	AX500094	LED Array: QL: Ass'y					

Due to a vendor change, the part number has been changed

Model: Adonis-C3		Date: 26-Sep-07	No.: MB082046
Modified Article: LCD: HVGA		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☒ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B1015257	B1805259	LCD: HVGA: SH: BL	1-1	O/O	17	6	

Change/Reason: Parts standardization with the Model A-C4 (B195).

Model: Adonis-C3		Date: 26-Sep-07	No.: MB082047
Modified Article: Total Counter		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☒ To meet standards (RoHS) ☐ Part standardization ☐ Product Safety		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AX310039		Total Counter	1-1	O/O	13	28	
→	AX310046	Total Counter: 7FIG: 24V					

Change: The materials of these parts were changed.

Reason: RoHS compliance

Model: Adonis-C3		Date: 28-Sep-07	No.: MB082048
Modified Article: ADF Exposure Glass		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☒ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B3516522		ADF Exposure Glass	1-1	X/O	19	7	
→	BC012002	Exposure Glass:Sheet Through:344X20					

Change/Reason: The part number in the table was changed, because a coat was added to the exposure glass surface to prevent contamination.

Model: Adonis-C3		Date: 4-Oct-07	No.: MB082049
Modified Article: LCD: HVGA		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☒ To meet standards (RoHS) ☐ Part standardization ☐ Product Safety		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B1805259	B2135225	LCD: HVGA: SH: BL	1-1	O/O	17	6	

Change: The materials of these parts were changed.

Reason: RoHS compliance

Model: Adonis-C3		Date: 14-Feb-08	No.: MB082050
Modified Article: Polygon Scanner Motor		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☒ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AX060245 →		POLYGON SCANNER:27300RPM:M	1-1	O/O	25	10	
	AX060303	POLYGON SCANNER MOTOR					

The above part has been changed due to part standardization with the Adonis-C4.

Model: Adonis-C3		Date: 15-May-08	No.: MB082051
Modified Article: Cleaning Blade Assy		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☒ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B2132354		CLEANING BLADE:ASS'Y	1-1	O/O	45	23	
→	B2912354	CLEANING BLADE					

The above part has been changed due to part standardization with the Adonis-C4.5.



Part Change Information List

Date: March 18, 2009

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number
Adonis-C3	B079	200903		A2321257	B2981257	CAP:COVER:UPPER	1	1	O/O		13	11					V0803798
Adonis-C3	B082	200903		A2321257	B2981257	CAP:COVER:UPPER	1	1	O/O		13	11					V0803798



Part Change Information List

Date: April 30, 2009

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number
Adonis-C3	B079	200904		B2135222	H3106173	TOUCH PANEL:HVGA:FU-ACF	1	1	X/O		17	3					V0804330
Adonis-C3	B082	200904		B2135222	H3106173	TOUCH PANEL:HVGA:FU-ACF	1	1	X/O		17	3					V0804330



Part Change Information List

Date: December 29, 2009

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3	B079	200912		B0825445	B2135445	HARNESS:LASER DIODE CONTROL	1	1	X/O		25	7					T0603284	5091317
A-C3	B082	200912		B0825445	B2135445	HARNESS:LASER DIODE CONTROL	1	1	X/O		25	7					T0603284	5091317
A-C3	B079	200912		A2326051	B2136051	DC SOLENOID:PICKUP:SUB-ASS'Y	1	1	X/O		29	27					V0903006	4071464
A-C3	B082	200912		A2326051	B2136051	DC SOLENOID:PICKUP:SUB-ASS'Y	1	1	X/O		29	27					V0903006	4071464



Part Change Information List

Date: February 26, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3	B079	201002		B0045542	B2135542	HARNESS - SBU-50WICK 80MM	1	1	X/O		19	21					T0501710	5020523
A-C3	B082	201002		B0045542	B2135542	HARNESS - SBU-50WICK 80MM	1	1	X/O		19	21					T0501710	5020523
A-C3	B079	201002		B0822329	G7902329	BRUSH ROLLER:CLEANER:CHARGE:AMABUKI:ASS'Y	1	1	O/O		45	28					V0902273	
A-C3	B082	201002		B0822329	G7902329	BRUSH ROLLER:CLEANER:CHARGE:AMABUKI:ASS'Y	1	1	O/O		45	28					V0902273	
A-C3	B079	201002		AW020126	AW020158	PAPER FEED SENSOR	1	1	X/O		61	9					V0903006	4071464
A-C3	B082	201002		AW020126	AW020158	PAPER FEED SENSOR	1	1	X/O		61	9					V0903006	4071464



Part Change Information List

Date: March 31, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3	B079	201003		AF020514	AF020649	EXIT ROLLER	1	1	X/O		55	3					V1000184	
A-C3	B079	201003		AF020649	AF020694	EXIT ROLLER	1	1	X/O		55	3					V1000193	
A-C3	B082	201003		AF020514	AF020649	EXIT ROLLER	1	1	X/O		55	3					V1000184	
A-C3	B082	201003		AF020649	AF020694	EXIT ROLLER	1	1	X/O		55	3					V1000193	
A-C3	B079	201003		A2324484	B2134484	DC SOLENOID:EXIT:ASS'Y	1	1	X/O		55	6					V0903006	4071464
A-C3	B082	201003		A2324484	B2134484	DC SOLENOID:EXIT:ASS'Y	1	1	X/O		55	6					V0903006	4071464
A-C3	B079	201003		AF020515	AF020658	TRANSPORT ROLLER	1	1	X/O		55	15					V1000184	
A-C3	B079	201003		AF020658	AF020698	TRANSPORT ROLLER	1	1	X/O		55	15					V1000193	
A-C3	B082	201003		AF020515	AF020658	TRANSPORT ROLLER	1	1	X/O		55	15					V1000184	
A-C3	B082	201003		AF020658	AF020698	TRANSPORT ROLLER	1	1	X/O		55	15					V1000193	
A-C3	B079	201003		B0824472	B2134472	SIDE PLATE:REAR:ASS'Y	1	1	X/O		55	17					V1000184	
A-C3	B082	201003		B0824472	B2134472	SIDE PLATE:REAR:ASS'Y	1	1	X/O		55	17					V1000184	
A-C3	B079	201003		B0774793	B2134793	BRACKET:LINK	2	2	X/O		57	8					V1000184	
A-C3	B082	201003		B0774793	B2134793	BRACKET:LINK	2	2	X/O		57	8					V1000184	
A-C3	B079	201003		AF020512	AF020653	ROLLER:DRIVEN	2	2	X/O		57	17					V1000184	
A-C3	B082	201003		AF020512	AF020653	ROLLER:DRIVEN	2	2	X/O		57	17					V1000184	
A-C3	B079	201003		AF020509	AF020659	REVERSE ROLLER	2	2	X/O		59	12					V1000184	
A-C3	B082	201003		AF020509	AF020659	REVERSE ROLLER	2	2	X/O		59	12					V1000184	
A-C3	B079	201003		B0774642	B2134642	SIDE PLATE:REAR:ASS'Y	1	1	X/O		59	13					V1000184	
A-C3	B082	201003		B0774642	B2134642	SIDE PLATE:REAR:ASS'Y	1	1	X/O		59	13					V1000184	
A-C3	B079	201003		B0774666	B2134666	BRACKET:STEPPER MOTOR:REVERSE	1	1	X/O		59	21					V1000184	
A-C3	B082	201003		B0774666	B2134666	BRACKET:STEPPER MOTOR:REVERSE	1	1	X/O		59	21					V1000184	
A-C3	B079	201003		B0774638	B2134638	SIDE PLATE:FRONT:ASS'Y	1	1	X/O		59	25					V1000184	
A-C3	B082	201003		B0774638	B2134638	SIDE PLATE:FRONT:ASS'Y	1	1	X/O		59	25					V1000184	
A-C3	B079	201003		AF020513	AF020654	TRANSPORT ROLLER:MIDDLE	1	1	X/O		61	6					V1000184	
A-C3	B079	201003		AF020654	AF020697	DUPLEXTRANSPORT ROLLER - MIDDLE	1	1	X/O		61	6					V1000193	
A-C3	B082	201003		AF020513	AF020654	TRANSPORT ROLLER:MIDDLE	1	1	X/O		61	6					V1000184	
A-C3	B082	201003		AF020654	AF020697	DUPLEXTRANSPORT ROLLER - MIDDLE	1	1	X/O		61	6					V1000193	
A-C3	B079	201003		B0774678	B2134678	BRACKET:STEPPER MOTOR:PAPER FEED	1	1	X/O		61	12					V1000184	
A-C3	B082	201003		B0774678	B2134678	BRACKET:STEPPER MOTOR:PAPER FEED	1	1	X/O		61	12					V1000184	
A-C3	B079	201003		B0774790	B2134790	LINK:DUPLEX	1	1	X/O		61	20					V1000184	
A-C3	B082	201003		B0774790	B2134790	LINK:DUPLEX	1	1	X/O		61	20					V1000184	



Part Change Information List

Date: April 30, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3	B079	201004		A2326049	B2136049	BRACKET:DC SOLENOID	1	1	X/O		29	37					V0903006	4071464
A-C3	B082	201004		A2326049	B2136049	BRACKET:DC SOLENOID	1	1	X/O		29	37					V0903006	4071464
A-C3	B079	201004		AF021059	AF021083	REGISTRATION ROLLER:DRIVEN:MM16	1	1	X/O		37	23					V1000184	
A-C3	B082	201004		AF021059	AF021083	REGISTRATION ROLLER:DRIVEN:MM16	1	1	X/O		37	23					V1000184	
A-C3	B079	201004		B0044486	B2134486	DC SOLENOID:ENTRANCE:ASS'Y	1	1	X/O		55	18					V0903006	4071464
A-C3	B082	201004		B0044486	B2134486	DC SOLENOID:ENTRANCE:ASS'Y	1	1	X/O		55	18					V0903006	4071464
A-C3	B079	201004		AF020653	AF020696	DRIVEN ROLLER-DUPLEX	2	2	X/O		57	17					V1000193	
A-C3	B082	201004		AF020653	AF020696	DRIVEN ROLLER-DUPLEX	2	2	X/O		57	17					V1000193	
A-C3	B079	201004		AF020659	AF020699	DUPLEXREVERSE ROLLER	2	2	X/O		59	12					V1000193	
A-C3	B082	201004		AF020659	AF020699	DUPLEXREVERSE ROLLER	2	2	X/O		59	12					V1000193	
A-C3	B079	201004		B0044664	B2134664	STEPPER MOTOR:DUPLEX:DC24V 28.8W	2	2	X/O		59	22					V0903006	4071464
A-C3	B082	201004		B0044664	B2134664	STEPPER MOTOR:DUPLEX:DC24V 28.8W	2	2	X/O		59	22					V0903006	4071464
A-C3	B079	201004		B0044690	B2134690	DC SOLENOID:UNIT	1	1	X/O		59	24					V0903006	4071464
A-C3	B082	201004		B0044690	B2134690	DC SOLENOID:UNIT	1	1	X/O		59	24					V0903006	4071464
A-C3	B079	201004		B0044664	B2134664	STEPPER MOTOR:DUPLEX:DC24V 28.8W	2	2	X/O		61	14					V0903006	4071464
A-C3	B082	201004		B0044664	B2134664	STEPPER MOTOR:DUPLEX:DC24V 28.8W	2	2	X/O		61	14					V0903006	4071464



Part Change Information List

Date: May 31, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3	B079	201005		11070899	11071053	FUSE:HT-5A-N5	1	1	O/O		69	111					V1000289	
A-C3	B082	201005		11070899	11071053	FUSE:HT-5A-N5	1	1	O/O		69	111					V1000289	



Part Change Information List

Date: Jun 30, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3	B079	201006		B2136049	B2136048	PICKUP SOLENOID	1	1	X/O		29	37					V1001108	
A-C3	B082	201006		B2136049	B2136048	PICKUP SOLENOID	1	1	X/O		29	37					V1001108	



Part Change Information List

Date: Jul 30, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3	D079	201007		B0821142	B2131136	DEVELOPMENT DRIVE UNIT:ASS'Y	1	1	X/O		63	35					T0501401	
A-C3	D082	201007		B0821142	B2131136	DEVELOPMENT DRIVE UNIT:ASS'Y	1	1	X/O		63	35					T0501401	



Part Change Information List

Date: September 30, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3	B079	201009		AX060239	AX060330	BRUSHLESS MOTOR:MAIN:ASS'Y	1	1	X/O		63	37					V1001932	
A-C3	B079	201009		AX060240	AX060332	BRUSHLESS MOTOR:PAPER FEED:DEVELOPMENT:ASS'Y	1	1	X/O		63	37					V1001932	
A-C3	B082	201009		AX060239	AX060330	BRUSHLESS MOTOR:MAIN:ASS'Y	1	1	X/O		63	37					V1001932	
A-C3	B082	201009		AX060240	AX060332	BRUSHLESS MOTOR:PAPER FEED:DEVELOPMENT:ASS'Y	1	1	X/O		63	37					V1001932	
A-C3	B079	201009		B0772990	B2132990	SUPPORTER:PAPER TRAY	2	2	X/O		75	11					V1000184	
A-C3	B082	201009		B0772990	B2132990	SUPPORTER:PAPER TRAY	2	2	X/O		75	11					V1000184	



Part Change Information List

Date: November 30, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3	D079	201007	Cancel	B0821142	B2131136	DEVELOPMENT DRIVE UNIT:ASS'Y	+	+	X/O		63	35				This information was incorrect.	T0501401	



Part Change Information List

Date: February 28, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3	B079	201102		AW010061	AW010118	PAPER FEED SENSOR	1	1	O/O		35	19					T0500509	05020330
A-C3	B082	201102		AW010061	AW010118	PAPER FEED SENSOR	1	1	O/O		35	19					T0500509	05020330



Part Change Information List

Date: June 30, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3	B079	201105		B0822781	D0892781	BRACKET:SENSOR	1	1	X/O		33	5					V1002614	10101257
A-C3	B082	201105		B0822781	D0892781	BRACKET:SENSOR	1	1	X/O		33	5					V1002614	10101257
A-C3	B079	201105		AW010084	AW010122	PHOTO REFLECTION SENSOR:PAPER FEED	1	1	X/O		33	6					T0600575	
A-C3	B082	201105		AW010084	AW010122	PHOTO REFLECTION SENSOR:PAPER FEED	1	1	X/O		33	6					T0600575	
A-C3	B079	201105		AX640142	AX640161	FAN:SIROCCO:DC24V:3350RPM	1	1	O/O		71	5					T0501498	05041215
A-C3	B082	201105		AX640142	AX640161	FAN:SIROCCO:DC24V:3350RPM	1	1	O/O		71	5					T0501498	05041215



Part Change Information List

Date: June 30, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3	B079	201106		B0041091	B1981077	GRIP:REAR	2	2	X/O		75	5					V1002986	
A-C3	B082	201106		B0041091	B1981077	GRIP:REAR	2	2	X/O		75	5					V1002986	



Part Change Information List

Date: January 31, 2012

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3	B135	201201		B0771250	B0776314	COVER:UPPER:EU	1	1	O/O		13	35					V1100089	11010199
A-C3	B138	201201		B0771250	B0776314	COVER:UPPER:EU	1	1	O/O		13	35					V1100089	11010199



Part Change Information List

Date: March 30, 2012

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3	B079	201203		B0771305	B0776322	INNER COVER:RIGHT:EU	1	1	O/O		35	9					V1100089	11010199
A-C3	B082	201203		B0771305	B0776322	INNER COVER:RIGHT:EU	1	1	O/O		35	9					V1100089	11010199
A-C3	B135	201203		B0771305	B0776322	INNER COVER:RIGHT:EU	1	1	O/O		35	9					V1100089	11010199
A-C3	B138	201203		B0771305	B0776322	INNER COVER:RIGHT:EU	1	1	O/O		35	9					V1100089	11010199



Part Change Information List

Date: September 28, 2012

Model	Code	PCIL Nr.	PCIL Correction	Old part Number	New part Number	Description	Old Qty	New Qty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3	B079	201209		B54111111	B71411111	SIDE PLATE:FRONT-ASSY	1	1	O/O		59	25					V1202115	

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3	B079	201211		AX310046	AX310050	TOTAL COUNTER:7FIG:24V	1	1	O/O		13	28					V1201380	
A-C3	B082	201211		AX310046	AX310050	TOTAL COUNTER:7FIG:24V	1	1	O/O		13	28					V1201380	
A-C3	B135	201211		AX310046	AX310050	TOTAL COUNTER:7FIG:24V	1	1	O/O		13	28					V1201380	
A-C3	B138	201211		AX310046	AX310050	TOTAL COUNTER:7FIG:24V	1	1	O/O		13	28					V1201380	



Part Change Information List

Date: February 28, 2013

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
A-C3	B079	201302		AZ500062	AZ500067	STABILIZER:XENON LAMP	1	1	O/O		19	10					V1202862	
A-C3	B082	201302		AZ500062	AZ500067	STABILIZER:XENON LAMP	1	1	O/O		19	10					V1202862	
A-C3	B135	201302		AZ500062	AZ500067	STABILIZER:XENON LAMP	1	1	O/O		19	10					V1202862	
A-C3	B138	201302		AZ500062	AZ500067	STABILIZER:XENON LAMP	1	1	O/O		19	10					V1202862	



Part Change Information List

Date: January 31, 2014

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
A-C3	B079	201401		B0825521	B2135521	HARNESS:DC:DC POWER SUPPLY	1	1	X/O		69	16					V1304151	
A-C3	B082	201401		B0825521	B2135521	HARNESS:DC:DC POWER SUPPLY	1	1	X/O		69	16					V1304151	
A-C3e/f	B135	201401		B0825521	B2135521	HARNESS:DC:DC POWER SUPPLY	1	1	X/O		69	16					V1304151	
A-C3e/f	B138	201401		B0825521	B2135521	HARNESS:DC:DC POWER SUPPLY	1	1	X/O		69	16					V1304151	



Part Change Information List

Date: May 8, 2015

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
A-C3e/f	B135	201504		AA080234	AA080281	BUSHING - 12X18X5.5	1	1	O/O	N	41	14					V1401590	
A-C3e/f	B138	201504		AA080234	AA080281	BUSHING - 12X18X5.5	1	1	O/O	N	41	14					V1401590	
A-C3e/f	B135	201504		AZ320124	AZ320145	POWER PACK:CBT	1	1	X/O	N	69	5					V1402610	
A-C3e/f	B138	201504		AZ320124	AZ320145	POWER PACK:CBT	1	1	X/O	N	69	5					V1402610	



Part Change Information List

Date: November 2, 2015

[illegible]



Part Change Information List

Date: July 1, 2016

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
A-C3e_f	B135	201607		B0771291	B0776328	COVER:REAR:EU	1	1	O/O	N	13	10					V1100089	11010199
A-C3e_f	B138	201607		B0771291	B0776328	COVER:REAR:EU	1	1	O/O	N	13	10					V1100089	11010199



Part Change Information List

Date: July 5, 2017

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
A-C3e_f	B135	201706		B1015257	B2135225	LCD:HVGA:SH:BL	1	1	O/O	N	17	6					V1701022	
A-C3e_f	B138	201706		B1015257	B2135225	LCD:HVGA:SH:BL	1	1	O/O	N	17	6					V1701022	



Part Change Information List

Date: June 5, 2018

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
A-C3e_f	B135	201805		B2475238	B2479101	HDD:PATH2:40GB_CLIP:MASTER:RC	2	2	O/O	N	69	11					V1702208	
A-C3e_f	B138	201805		B2475238	B2479101	HDD:PATH2:40GB_CLIP:MASTER:RC	2	2	O/O	N	69	11					V1702208	

Part Change Information List

Date: December 28, 2018

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
A-C3	B079	201811		B1795995	B2479101	HDD:PATH2:40GB_CLIP:MASTER:RC	2	2	O/O	N	77	17			Y		V1702208	
A-C3	B082	201811		B1795995	B2479101	HDD:PATH2:40GB_CLIP:MASTER:RC	2	2	O/O	N	77	17			Y		V1702208	