

Model: Brz-P1

Technical Bulletin

Reissued: 07-Mar-17

Date: 23-May-16

No.: RM281002c

RTB Reissue

		<i>lics</i> ha	IVe
Subject: Firmware Heekasenslootaplenginta		been corrected or	adeeepared by: T. Tachibana
From: 2nd Tech S	ervice Sect., MFP/Printer Tec	ch Service Dept.	
Classification:	 Troubleshooting Mechanical 	Part information	 Action required Service manual revision
	Paper path	Transmit/receive	Retrofit information
	Product Safety	🛛 Other (Firmware)	🖾 Tier 2

This RTB has been issued to announce the firmware release information for the Engine.

Version	Program No.	Effective Date	Availability of RFU
01.05:01	M2815830A	May 2016 production	Available
01.04:01	M2815830	1st Mass production	Available

Note: Definition of Availability of RFU via @Remote "Available": The firmware can be updated via RFU or SD card. "Not available": The firmware can only be updated via SD card.

Version	Modified Points or Symptom Corrected	
01.05:01	Symptom corrected: The machine may freeze with "printing" displayed on the operation panel.	
01.04:01	1st Mass production	

HC model for USA/Europe

Version	Program No.	Effective Date	Availability of RFU
01.05a:01	M2815830A_LR0817	1st Mass production	Available
Note: Definition of Accilebility of DEU als OD smalls			

Note: Definition of Availability of RFU via @Remote "Available": The firmware can be updated via RFU or SD card.

Version	Modified Points or Symptom Corrected
01.05a:01	1st Mass production

RICOH Reissued: 09-Nov-16

Model: Brz-P1

Date: 23-May-16

No.: RM281003c

RTB Reissue

The items in *bold italics* have been corrected or added.

Subject: Firmware Release Note: Engine(IPU)			Prepared by: T. Tachibana
From: 2nd Tech Se			
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 Part information Electrical Transmit/receive Other (Firmware) 	 Action required Service manual revision Retrofit information Tier 2

This RTB has been issued to announce the firmware release information for the Engine (IPU).

Version	Program No.	Effective Date	Availability of RFU
1.04:04	M2815810C	November 2016 production	Available
1.03:04	M2815810B	June 2016 production	Available
1.02:04	M2815810A	1st Mass production	Available

Note: Definition of Availability of RFU via @Remote "Available": The firmware can be updated via RFU or SD card. "Not available": The firmware can only be updated via SD card.

Version	Modified Points or Symptom Corrected
1.04:04	 Symptom corrected: Attempting to resolve an SC by power cycling the machine OFF/ON may cause an SC991. Serial number information stored in SP5-811-001 is corrupted and the following may not work: @Remote registration via external appliances User authentication in SDK application
1.03:04	Symptom corrected: SC670 may occur after running approximately 3500 jobs keeping the power ON continuously and not entering energy saver mode.
1.02:04	1st Mass production



PAGE: 1/1

Model: Brz-P1

Date: 23-May-16

No.: RM281006

Subject: Firmware Release Note: NetworkDocBox			Prepared by: T. Tachibana
From: 2nd Tech Se			
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 Part information Electrical Transmit/receive Other (Firmware) 	 Action required Service manual revision Retrofit information Tier 2

This RTB has been issued to announce the firmware release information for the **NetworkDocBox**.

ĺ	Version	Program No.	Effective Date	Availability of RFU
	1.00	M2815754B	1st Mass production	Available

Note: Definition of Availability of RFU via @Remote

"Available": The firmware can be updated via RFU or SD card.

Version	Modified Points or Symptom Corrected	
1.00	1st Mass production	

Reissued: 11-Jan-17 Model: Brz-P1

Date: 23-May-16

No.: RM281007b

RTB Reissue

The items in *bold italics* have been corrected or added.

Subject: Firmware Release Note: Web Support			Prepared by: T. Tachibana
From: 2nd Tech Se			
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 Part information Electrical Transmit/receive Other (Firmware) 	 Action required Service manual revision Retrofit information Tier 2

This RTB has been issued to announce the firmware release information for the Web Support.

Version	Program No.	Effective Date	Availability of RFU
1.02	M2815750D	January 2017 production	Available
1.01	M2815750C	December 2016 production	Available
1.00	M2815750B	1st Mass production	Available

Note: Definition of Availability of RFU via @Remote

"Available": The firmware can be updated via RFU or SD card.

Version	Modified Points or Symptom Corrected
1.02	Other changes:
	- Minor changes.
1.01	 Symptom corrected: When downloading "Eco-friendly Counter" data in "Status/Information > Display Eco-friendly Counter", the SYSTEM counter data for that period is not included in the exported .csv file.
1.00	1st Mass production



PAGE: 1/1

Model: Brz-P1

Date: 23-May-16

No.: RM281008

Subject: Firmware Release Note: PowerSaving Sys			Prepared by: T. Tachibana
From: 2nd Tech Service Sect., MFP/Printer Tech Service Dept.			
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 Part information Electrical Transmit/receive Other (Firmware) 	 Action required Service manual revision Retrofit information Tier 2

This RTB has been issued to announce the firmware release information for the **PowerSaving Sys.**

Version	Program No.	Effective Date	Availability of RFU
1.L3.06	M2815775A	1st Mass production	Available

Note: Definition of Availability of RFU via @Remote

"Available": The firmware can be updated via RFU or SD card.

Version	Modified Points or Symptom Corrected	Modified Point
1.L3.06	1st Mass production	

Reissued: 02-Dec-16 Model: Brz-P1

Date: 23-May-16

No.: RM281009b

RTB Reissue

The items in *bold italics* have been corrected or added.

Subject: Firmware Release Note: PCL			Prepared by: T. Tachibana
From: 2nd Tech Service Sect., MFP/Printer Tech Service Dept.			
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 Part information Electrical Transmit/receive Other (Firmware) 	 Action required Service manual revision Retrofit information Tier 2

This RTB has been issued to announce the firmware release information for the PCL.

Version	Program No.	Effective Date	Availability of RFU
1.04	M2815759D	December 2016 production	Available
1.03	M2815759C	September 2016 production	Available
1.02	M2815759B	1st Mass production	Available

Note: Definition of Availability of RFU via @Remote "Available": The firmware can be updated via RFU or SD card. "Not available": The firmware can only be updated via SD card.

Version	Modified Points or Symptom Corrected
1.04	 Symptom corrected: PCL macros that were uploaded to the HDD cannot be printed. (GFPR#RE16080014) When characters that contain the incorrect TrueType font data are printed, not only are incorrect characters missing but so are correct characters that follow incorrect characters. (GFPR#RE16030046)
1.03	Symptom corrected: Some lines of text and/or dotted lines might be missing when using the PCL overlay macro. (GFPR#RC16040013)
1.02	1st Mass production



PAGE: 1/1

Model: Brz-P1

Date: 23-May-16

No.: RM281010

Subject: Firmware Release Note: PS3			Prepared by: T. Tachibana
From: 2nd Tech Service Sect., MFP/Printer Tech Service Dept.			
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 Part information Electrical Transmit/receive Other (Firmware) 	 Action required Service manual revision Retrofit information Tier 2

This RTB has been issued to announce the firmware release information for the **PS3**.

Version	Program No.	Effective Date	Availability of RFU
1.00	M2815760A	1st Mass production	Available

Note: Definition of Availability of RFU via @Remote

"Available": The firmware can be updated via RFU or SD card.

Version	Modified Points or Symptom Corrected	
1.00	1st Mass production	



PAGE: 1/1

Model: Brz-P1

Date: 23-May-16

No.: RM281012

Subject: Firmware Release Note: XPS			Prepared by: T. Tachibana
From: 2nd Tech Service Sect., MFP/Printer Tech Service Dept.			
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 Part information Electrical Transmit/receive Other (Firmware) 	 Action required Service manual revision Retrofit information Tier 2

This RTB has been issued to announce the firmware release information for the **XPS**.

Version	Program No.	Effective Date	Availability of RFU
1.34	M5005738	1st Mass production	Available

Note: Definition of Availability of RFU via @Remote

"Available": The firmware can be updated via RFU or SD card.

Version	Modified Points or Symptom Corrected	
1.34	1st Mass production	



PAGE: 1/1

Model: Brz-P1

Date: 23-May-16

No.: RM281013

Subject: Firmware Release Note: PCL Font			Prepared by: T. Tachibana
From: 2nd Tech Se			
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 Part information Electrical Transmit/receive Other (Firmware) 	 Action required Service manual revision Retrofit information Tier 2

This RTB has been issued to announce the firmware release information for the PCL Font.

Version	Program No.	Effective Date	Availability of RFU
1.10	M2815286	1st Mass production	Available

Note: Definition of Availability of RFU via @Remote

"Available": The firmware can be updated via RFU or SD card.

Version	Modified Points or Symptom Corrected	
1.10	1st Mass production	



PAGE: 1/1

Model: Brz-P1

Date: 23-May-16

No.: RM281014

Subject: Firmware Release Note: PS3 Font			Prepared by: T. Tachibana
From: 2nd Tech Se			
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 Part information Electrical Transmit/receive Other (Firmware) 	 Action required Service manual revision Retrofit information Tier 2

This RTB has been issued to announce the firmware release information for the PS3 Font.

Version	Program No.	Effective Date	Availability of RFU
1.19	M2815275	1st Mass production	Available

Note: Definition of Availability of RFU via @Remote

"Available": The firmware can be updated via RFU or SD card.

Version	Modified Points or Symptom Corrected	
1.19	1st Mass production	



PAGE: 1/1

Model: Brz-P1

Date: 23-May-16

No.: RM281015

Subject: Firmware Release Note: Font EXP			Prepared by: T. Tachibana
From: 2nd Tech Se			
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 Part information Electrical Transmit/receive Other (Firmware) 	 Action required Service manual revision Retrofit information Tier 2

This RTB has been issued to announce the firmware release information for the Font EXP.

Version	Program No.	Effective Date	Availability of RFU
1.00	M2815765	1st Mass production	Available

Note: Definition of Availability of RFU via @Remote

"Available": The firmware can be updated via RFU or SD card.

Version	Modified Points or Symptom Corrected	
1.00	1st Mass production	



Reissued: 02-Mar-17

Model: Brz-P1, Brz-MF1, BR-C2, BR-P2, CH-C1 Office/ <i>Pro,</i> <i>Cor-C1.5, Gim-MF1.5dM, GR-C3,</i> MT-C6, MET-C2ab, MET-C2cde, MET-C2yz, <i>MET-P2, Midas-P3, Vesta-P1d_15S</i>	Date: 23-May-16	No.: RD255020b

RTB Reissue

The items in *bold italics* have been corrected or added.

Subject: Firmware	Prepared by: T. Tachibana		
From: 2nd Tech Se			
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 Part information Electrical Transmit/receive Other (Firmware) 	 Action required Service manual revision Retrofit information Tier 2

This RTB has been issued to announce the firmware release information for the OptionSD FONT.

Version	Program No.	Effective Date	Availability of RFU
0.00	D3BC5277	1st Mass production	Available

Note: Definition of Availability of RFU via @Remote "Available": The firmware can be updated via RFU or SD card. "Not available": The firmware can only be updated via SD card.

Version	Modified Points or Symptom Corrected	
0.00	1st Mass production	

Technical Bulletin

PAGE: 1/1

Model: Brz-P1/MF1 Date: 31			Date: 31-M	lay-16	No.: RD255021	
Subject: Supplementary information on the two engine firmware				Prepared by: T. Tachibana		
From: 2nd Tech Service Sect., MFP/P Tech Service Dept.						
Classification:	Mechanical Paper path	Part inform Electrical Transmit/re Other (firm	eceive	Action re Service n Retrofit ir	nanual revision	

This bulletin provides supplementary information on the engine firmware.

- There is two engine firmware for two engine boards.

Board name	Firmware name	Program No.	Explanation
BiCU	Engine (IPU)	D2555810	Engine board designed by Ricoh.
IOB	Engine	D2555830	Engine board designed by Supplier.

Technical Bulletin

Reissued: 17-Jan-17

Model: Brz-P1

Date: 26-Aug-16 No.

No.: RM281016a

RTB Reissue

The item in *Bold Italics* has been added.

Subject: The default value of the "Permit SSL/TLS Communication" setting has been changed from "Ciphertext Priority" to "Ciphertext/Cleartext"			Prepared	d by: H. Morishima
From: 2nd Tech Support Sec. Service Support Dept.				
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 Part information Electrical Transmit/rection Other (Action required Service manual revision Retrofit information Tier 2

At Machine Installation

The default value of the "Permit SSL/TLS Communication" setting has been changed from "Ciphertext Priority" to "Ciphertext/Cleartext" depending on the Network Support firmware version:

- "Ciphertext Priority" will be the default in devices that have Network Support v15.57 or earlier installed from mass production.

- "Ciphertext/Cleartext" will be the default in devices that have Network Support v15.58 or later installed from mass production.

Note: Configurations will not be automatically changed when the firmware is updated.

Cut-in Serial Numbers

Network Support v15.58 has been applied to device in the factory as of the following serial numbers:

Name	Destination.	Product Code	Serial #
	NA	M281-17	Y026X702514~
SP5300	EU	M281-27	Y026X702717~
	AP	M281-29	Y026X804070~
	NA	M282-17	Y126X701633~
SP5310	EU	M282-27	Y126X702038~
	AP	M282-29	Y126X902509~

Technical Bulletin

PAGE: 1/1

Model: Brz-P1			Date: 31-Aug-16			No.: RM281017
Subject: Parts Catalog Correction on Operation Panel					d by: T. T	achibana
From: 2nd Tech Service Sect., MFP/P Tech Service Dept.						
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 ☑ Part info ☑ Electrica ☑ Transmit ☑ Other (al		Servic	required e manual revision it information

Change/Reason: The following part numbers were corrected.

Correct part number	Description	Q'ty	Int	Page	Index	Note
M2811423	SHIELD LCD	1		4	21	
M2811492	HARNESS:FFC:SENSOR	1		4	22	
M1291470	PCB:4.3-P:SENSOR:ASS'Y	1		4	23	

Technical Bulletin

PAGE: 1/1


Model: Brz-P1 Da			Date: 6-Dec-16			No.: RM281018
Subject: Parts Catalog:EEPROM on IOB				Prepared by: T. Tachibana		
From: 2nd Tech S	Service Sect., MFP/P Tech Ser	vice Dept.				
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	Part info Electric Transm	al		Servic	n required ce manual revision fit information

Change: The part is newly added.

Reason: The parts was missing from the parts catalog.

Part number	Description	Q'ty	Int	Page	Index	Note
D2555321	PARTS_IC_EEPROM	1		6	22	

2. Frames

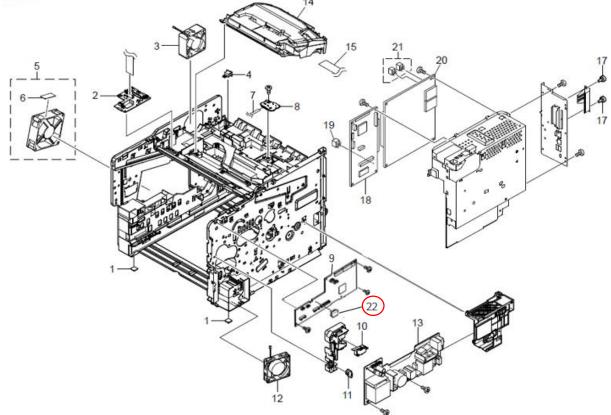

PAGE: 1/1


Model: Brz-P1 Dat			Date: 16-Dec-16		No.: RM281019			
Subject: Parts Catalog Correction: Actuator deleted					Prepared by: H. Morishima			
From: 2nd Tech S	Service Sect., MFP/P Tech Ser	vice Dept.						
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	Part info	al		Servic	n required ce manual revision fit information		

Change: The illustration of the actuator outlined in red was deleted.

Reason: Brz-P1 does not have this actuator.

4. Paper Feed Section

RICOH

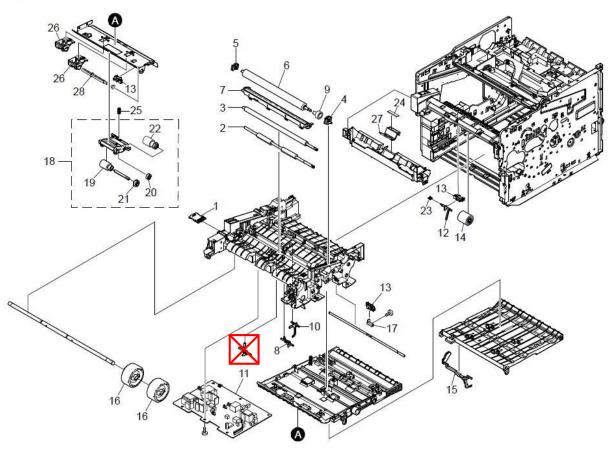

Technical Bulletin

PAGE: 1/1


Model: Brz-P1			Dat	te: 21-Jul-1	7	No.: RM281020
Subject: Parts Catalog correction: Operation panel				Prepared	by: T.Ta	achibana
From: 2nd Tech S	Service Sect., MFP/P Tech Serv	vice Dept.				
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 ☑ Part info ☑ Electrica ☑ Transmit ☑ Other (al	eive [Servic	required e manual revision it information

Change: These parts are newly added.

Reason: To meet requests received from the field.

Part number	Description	Q'ty	Int	Page	Index	Note
M2811420	LID OPERATION	1		4	35	
M2811424	KEY A	1		4	36	
M2811425	KEY PAUSE	1		4	37	
M2811427	LENS LED	3		4	38	

1.Covers

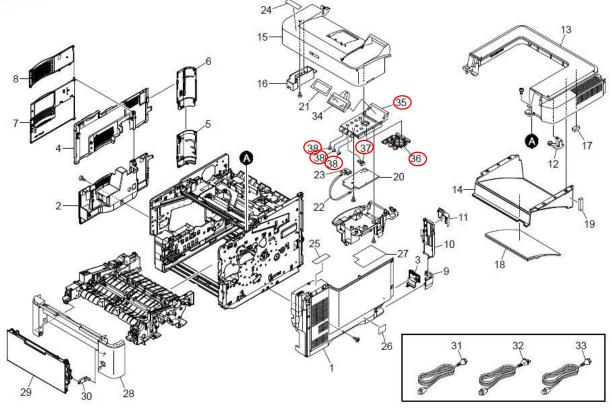

Technical Bulletin

PAGE: 1/1


Model: Brz-P1			ate: 15-Sep	-17	No.: RM281022		
Subject: Parts Ca	atalog correction: Paper feed tray	Prepared	d by: T.Ta	achibana			
From: 2nd Tech S	From: 2nd Tech Service Sect., MFP/P Tech Service Dept.						
Classification:	Mechanical Paper path	Part inform Electrical Transmit/re Other (Servic	required e manual revision it information		

Change: These parts are newly added.

Reason: To meet requests received from the field.

Part number	Description	Q'ty	Int	Page	Index	Note
M2812860	SW.PUSH	1		6	23	

2. Frames

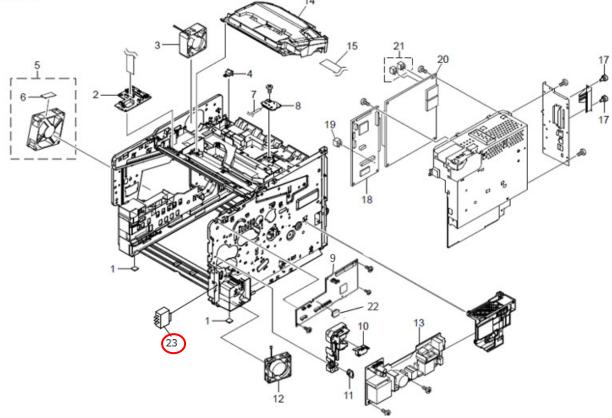

Technical Bulletin

Reissued: 12-Oct-18

Date: 14-Sep-17

No.: RM281021a

RTB Reissue

Model: Brz-P1

The items in *bold italics* have been corrected.


Subject: Parts Catalog Correction for Guide Cassette R			Prepared by: T. Tachibana		
From: 2nd Tech Service Sect., MFP/P Tech Service Dept.					
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	Part informat		 Action required Service manual revision Retrofit information Tier 2 	

Change: The guide cassette has been registered as a service part.

Reason: To address the field inquiry.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	M2811182	GUIDE CASSETTE R	0-1	-	20	14	

9. Drive Section

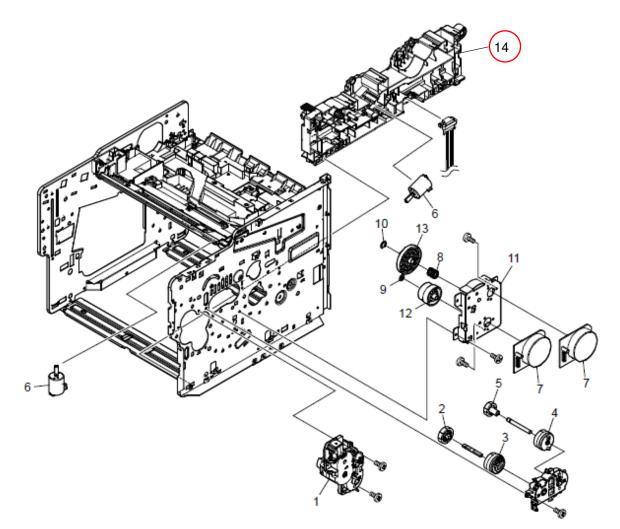


Technical Bulletin

Reissued: 12-Oct-18 Model: Brz-P1

1 Date: 14-Sep-17 No.: RM281021a

Note:

The shafts circled in red have been modified because they may turn white or break. If the shafts are broken, SC501-01(Paper Feed Tray Lift Motor Error (Tray 1)) appears.

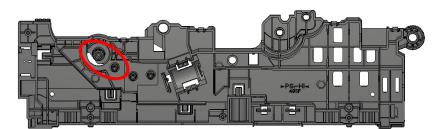

Old:

New: The shape of the parts circled in blue have been modified.



Cut-In Serial Number:

The modified parts are provided as a service parts.

Product name	Destination	Code	Cut-in S/N
	NA	M281-17	Y027X716486
SP 5300DN	EU	M281-27	Y027X716870
3F 5500DN	AA	M281-29	Y027X716822
	CHN	M281-21	Y028Z100097
	NA	M282-17	Y127X704606
SP 5310DN	EU	M282-27	Y127X704696
3F 3310DN	AA	M282-29	Y127X704865
	CHN	M282-21	TBD


RICOH Reissued: 12-Oct-18


Model: Brz-P1	Date: 14-Sep-17	No.: RM281021a
---------------	-----------------	----------------

The procedure to replace the guide cassette:

- 1. Remove all covers except for the front cover.(FSM p256~)
- 2. Remove the fusing unit. (FSM p314~)
- 3. Remove the toner cartridge, development unit, and drum unit. (FSM p303~)
- 4. Remove the controller box.(FSM p354~)
- 5. Remove the PSU and PSU fan.(FSM p378~, p383~)
- Loosen the two screws circled in red on the left frame, and remove bottom stay 1 & 2.(screw x7)


Left frame (rotated 90 degrees):

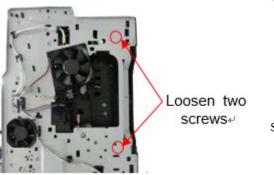

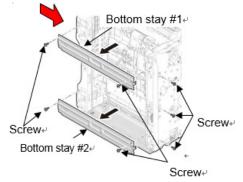


From the bottom side of the machine:

- 7. Remove the duplex unit.(FSM p335~)
- 8. Remove three connectors, release four hooks, remove a screw, and then remove the guide cassette installed inside this frame.

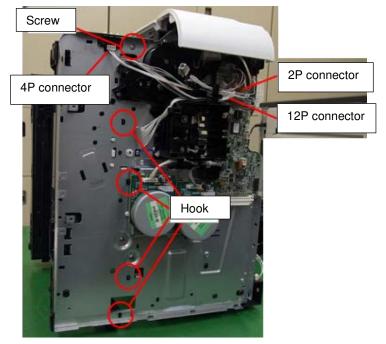

9. Reinstall the attached parts to the guide cassette to the new one.

Technical Bulletin

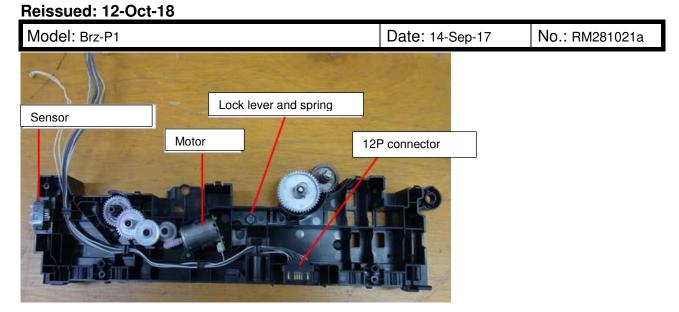

Technical Bulletin

PAGE: 1/1


Model: Brz-P1			Dat	e: 23-Oct-17	No.: RM281023
Subject: Parts Ca	atalog correction: Gear of Guide	Prepared by: T.	Tachibana		
From: 2nd Tech Service Sect., MFP/P Tech Service Dept.					
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 ☑ Part info ☑ Electric ☑ Transm ☑ Other (al	 □ Serv	on required rice manual revision ofit information 2

Change: This parts is newly added.

Reason: To meet requests received from the field.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	M2811130	GEAR Z35S-Z13S B	0-1	-	20	15	

9. Drive Section

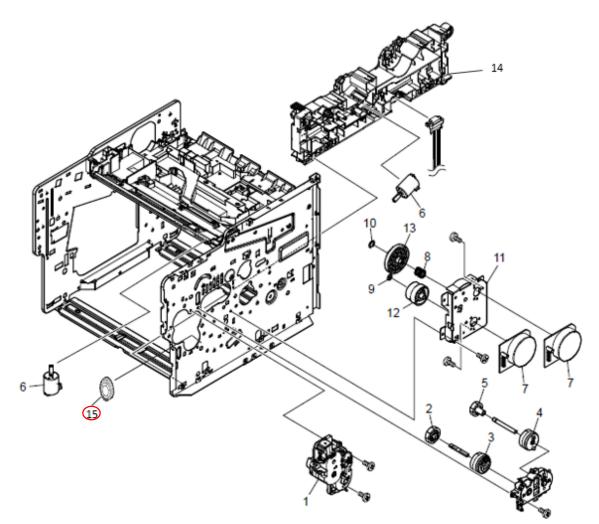

Technical Bulletin

PAGE: 1/1

Model: Brz-MF1/P1			Date: 28-J	ul-16	No.: RD255027
Subject: FSM correction on after replacement of development unit					by: T. Tachibana
From: 2nd Tech Se	ervice Sect., MFP/P Tech Se				
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	Part inform Electrical Transmit/re Other (Action re Service n Retrofit ir Tier 2	nanual revision

Service Manual Correction:

Please add the following descriptions in bold to your field service manual.

4. Replacement and Adjustment > Development Unit (P.305~)

After replacement of development unit:

1. Execute SP3-900-001 to supply toner to the development unit.

Technical Bulletin

PAGE: 1/1

Model: Brz-MF1/P1			Date: 23-A	ug-16	No.: RD255029
Subject: FSM correction: SC636-01 description added					by: H. Morishima
From: 2nd Tech Se	ervice Sect., MFP/P Tech Se	ervice Dept.			
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	Part inform Electrical Transmit/re Other (Action re Service n Retrofit ir	nanual revision

Description of SC636-01 was added to the following section of the field service manual: 6. Troubleshooting > Service Call 622-691 > SC600 (Controller) (p.531)

SC No.	Туре	Error Name/Error Condition/Major Cause/Solution
SC636-01	D	IC Card Error (Expanded authentication module error)
		Issued when expanded authentication management is set to "ON" but either of the following occur.
		 There is no expanded authentication module in the machine.
		 The SD card or the file of the expanded authentication module is broken.
		There is no DESS module in the machine.
		 There is no DESS module in the machine (models on which the function is optional).
		 There is no expanded authentication module in the machine.
		 The SD card or the file of the expanded authentication module is broken.
		• Set a working SD card/expanded authentication module file.
		 Install the DESS module.
		 In the SSP mode set SP5-401-160 to "0".
		 In the SSP mode, set SP5-401-161 to "0".
		 Replace the NVRAM.

Technical Bulletin

PAGE: 1/2

Model: Brz-MF/P		Date: 29-A	Aug-16 No.: RD25503		
Subject: FSM correction on After Installing the HDD					by: T. Tachibana
From: 2nd Tech Service Sect., MFP/P Tech Service Dept.					
Classification:	 Troubleshooting Part information Mechanical Paper path Product Safety Other (Action re Service n Retrofit ir	nanual revision

Service Manual Correction:

Please apply the following corrections to your service manual.

- 2. Installation > Enhanced Security HDD Option Type M10 (D792-09)
- > Installation Procedure (MP 501/601) > After Installing the HDD (P109 ~)

After Installing the HDD

- 4. Turn the main power OFF/ON after a message tells you formatting is finished.
- 5. Enter the SP mode.
- 6. Execute SP5-853-001 to copy the preset stamp data from the firmware to the hard disk. Follow the instructions on the screen. This will require three or four minutes.
- -7. Execute SP5-846-040 to copy the address book to the hard disk from the controller board.
- -8. Execute SP5-846-041 to let the user have access to the address book.-
 - 9. Turn the main power OFF/ON.

Model: Brz-MF/P	Date: 29-Aug-16	No.: RD255031
-----------------	-----------------	---------------

- Installation > Enhanced Security HDD Option Type M10 (D792-09)
 Installation Procedure (SP 5300/5310) > After Installing the HDD (P126 ~)
- 2. Installation > Hard Disk Drive Option Type P8 (M500-05) (SP 5300/5310 Only) > Installation Procedure > After Installing the HDD (P143 ~)

After Installing the HDD

RICOH

1. Connect the power cord and turn ON the main power.

The message "Hard Disk is replaced. Format Hard Disk." is displayed.

- 2. Select [Format]. The message "Formatting Hard Disk...Please wait, also make sure the main power switch is not turned off." is displayed.
- 3. Wait for the machine to finish formatting the hard disk.

Co Important

- Do not touch the power switch while the hard disk format is in progress. Wait for the machine
 to tell you that the formatting is finished. When the formatting is finished, the message "Hard
 Disk is formatted. Turn main power switch off then on" is displayed.
- 4. Turn the main power OFF/ON after the message tells you formatting is finished.
- 5. Enter the SP mode.
- 6. Execute SP5-846-041 to let the user have access to the address book.
- 7. Turn the main power OFF/ON.

Technical Bulletin

Model: Brz-MF1/P	1	Date: 18-N	-Nov-16 No.: RD25503		
Subject: FSM correction on the engine firmware type					by: H. Morishima
From: 2nd Tech Service Sect., MFP/P Tech Service Dept.					
Classification:	 Troubleshooting Part inform Mechanical Paper path Product Safety Other (Action re Service n Retrofit ir	nanual revision

Service Manual Correction:

Please apply the following corrections to your service manual.

< MP501/601 >

5. System Maintenance > Firmware Update > Firmware type (P.404)

MP 501/601

Firmware type	Firmware position	Message display
FONT (Font EXP)	Controller board	GW13e_prt_SAMf
FONT1 (PCL Font)	Controller board	GW3a_pcl_fntl
FONT2 (PS3 Font)	Controller board	GW2e_prt_psfnt8
Engine	BIEU IOB	BRMF1a_eplot
Engine (IPU)	BiCU	BRMF1a_eipu

< SP5300/5310 >

5. System Maintenance > Firmware Update > Firmware type (P.405)

SP 5300/5310

Firmware type	Firmware position	Message display
FONT (Font EXP)	Controller board	GW13e_prt_SAMf
FONT1 (PCL Font)	Controller board	GW3a_pcl_fntl
FONT2 (PS3 Font)	Controller board	GW2e_prt_psfnt8
Engine	BIEU IOB	BRP1a_eplot
Engine (IPU)	BiCU	BRP1a_eipu

Technical Bulletin

PAGE: 1/3

Model: Brz-MF1/P	1(for NA/EU only)	Jan-17 No.: RD25504			
Subject: FSM/Part	s Catalog revision for HC r	Prepared I	by: T. Tachibana		
From: 2nd Tech Se	ervice Sect., MFP/P Tech S				
Classification:	☑ Troubleshooting ☑ Part information ☑ Mechanical ☑ Electrical ☑ Paper path ☑ Transmit/red ☑ Product Safety ☑ Other (Action red Service n Retrofit ir	nanual revision

For NA/EU only

The following new HC models, targeting only the NA/EU market, will be added to the MF501SPF/SP 5300DN/ PB1100 series.

NA:

Product Code	Product Name	Differences between the HC model and standard models:
D255-17	MP 501SPF TL	- Paper Tray with key and lock
M281-17	SP 5300DN TL	- Side fences with Teflon tapes
D3C2-01	Paper Feed Unit PB1100TE	- Paper Tray with key and lock
D3C2-01	Paper Feed Unit PB1100LE	- Side fences with Teflon tapes

EU:

Product Code	Product Name	Differences between the HC model and standard models:
D255-27	MP 501SPF	
M281-27	SP 5300DN	- Side fences with Teflon tapes
D3C2-01	Paper Feed Unit PB1100	

Due to this addition, the FSM and Parts Catalog were revised.

Note that the following component is unique to the standard models:

• Tray cassette

RICOHTechnical BulletinPAGE: 2/3Model: Brz-MF1/P1(for NA/EU only)Date: 30-Jan-17No.: RD255045Field Service Menual Provision for HC model:

Field Service Manual Revision for HC model:

2. Installation >Main Machine Installation > Installation Procedure (P29~)

Installation procedure (for HC model only)

Print settings for label paper (including wristbands) are not available under Paper Type. If your customer prints on label paper, please instruct them to select "Middle Thick" as paper type on both the driver and the machine.

🔁 Important 🔵

On the machine, set the paper type as "Middle Thick" for the tray loaded with label paper.

[User Tools] > [Machine Features] > [System Settings] > [Tray Paper Settings] > [Paper Type: Tray #] > [Paper Thickness] > [Middle Thick]

🔂 Important

Instruct the user to select "Middle Thick" as paper type on the printer driver when printing on label paper.

6. Troubleshooting >Troubleshooting Guide > Image Quality (P585~)

Troubleshooting Guide (for HC model only)

Symptom

- White spots / Black spots appear on the printouts in 96mm pitch.
- Black spots appear on the printouts in 30mm pitch.

<u>Cause</u>

Adhesives contained in label paper adhere to the drum, and then to the charge roller.

Solution

- Set A4 (or LT) paper on the bypass tray and execute "Drum Refresh" mode. MP 501: [User Tools] > [Machine Features] > [Maintenance] > [Drum Refresh] SP 5300: [Menu] > [Quality Maintenance] > [Drum Refresh]
- 2. Remove the charge roller unit and clean the surface of the roller with dry cloth.




Model: Brz-MF1/P1(for NA/EU only)

Date: 30-Jan-17

No.: RD255045

Parts Catalog Revision for HC model:

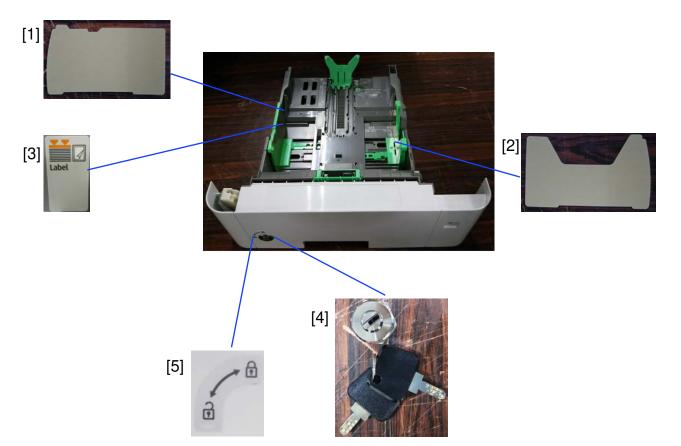

Index No.	Part No.	Description	Q'ty	Note 1 (Destination)	Note 2 (Machine Code)
1	D3DC2841	SHEET:SIDE FENCE:LEFT	1	NA / EU	D255-17/ D255-27/
2	D3DC2842	SHEET:SIDE FENCE:RIGHT	1	NA / EU	M281-17/ M281-27/
3	D3DC2843	DECAL:SIDE FENCE	1	NA / EU	D3C2-01
4	D3DC2891	KEY:SN-711-8-D:SPECIAL ORDER	1	NA	D255-17/ M281-17/
5	D3DC2894	DECAL:KEY	1	NA	D3C2-01

Note: The key (p/n: D3DC2891) comes with two spare keys.

Technical Bulletin

PAGE: 1/1

Model: Brz-MF1/P	1	Date: 17-M	1ar-17	No.: RD255048		
Subject: FSM correction: Type of SC819					Prepared by: H. Morishima	
From: 2nd Tech Se	ervice Sect., MFP/P Tech S	ervice Dept.				
Classification:	 Troubleshooting Mechanical Paper path Product Safety Other (Action re	nanual revision	

Service Manual Correction:

Please delete following descriptions crossed out in red and add the descriptions **in bold** to your field service manual.

6. Troubleshooting > Service Call 816-899 > SC800 (Controller) (P.540~)

No.	Туре	Error Name/Error Condition/Major Cause/Solution
SC819-00	C	Kernel halt error [xxxx]: Detailed error code Due to a control error, a RAM overflow occurred during system processing. One of the following messages was displayed on the operation panel.

Note:

SC819 appears on the operation panel, and then logged after the machine automatically reboots.

Technical Bulletin


Model: Brz-P1		Dat)ate: 16-Apr-18		No.: RM281024	
Subject: Parts Catalog Correction: SPRING ACTUATOR DU					d by: T. T	achibana
From: 1st Tech S	Service Sect., MFP/P Tech Service					
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 ☑ Part info ☑ Electrica ☑ Transmi ☑ Other (al		Servic	required e manual revision it information

Change: A new part has been added.

Reason: To make it possible to replace the spring individually when a duplex jam occurs (Jam code: 86).

Part number	Description	Q'ty	Int	Page	Index	Note
M2814458	SPRING ACTUATOR DU	1		18	17	

8. Exit Section

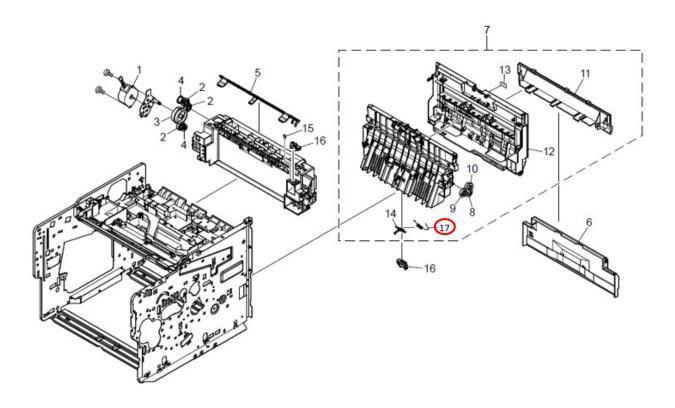

Technical Bulletin


Model: Brz-P1		Da	te: 11-May-18		No.: RM281025			
Subject: Parts Catalog correction: Duplex clutch				Prepared by: T.Tachibana				
From: 1st Tech S								
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	Part info	al		Servic	required e manual revision it information		

Change: The duplex clutch is newly added.

Reason: This part was missing from the parts catalog.

Part number	Description	Q'ty	Int	Page	Index	Note
M2811127	PARTS CLUTCH 20-2W Z35R	1-2	-	20	4	

9. Drive Section

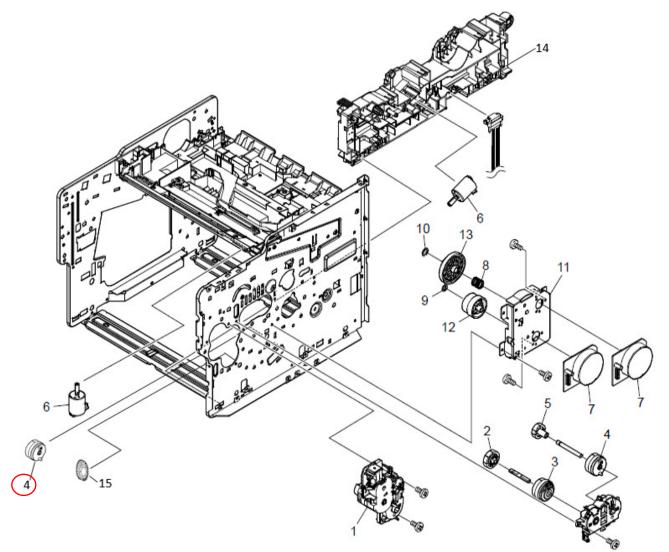

Technical Bulletin

PAGE: 1/1


Model: Brz-P1 D		Da	ate: 3-Jul-18		No.: RM281026			
Subject: Parts Catalog Correction: EXIT UNIT				Prepared by: T. Tachibana				
From: 1st Tech Service Sect., MFP/P Tech Service Dept.								
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	Part info	al		Servic	required e manual revision it information		

Change: A new part has been added.

Reason: To meet requests received from the field.

Part number	Description	Q'ty	Int	Page	Index	Note
M2824457	PARTS EXIT UNIT SP	1		18	18	

8. Exit Section

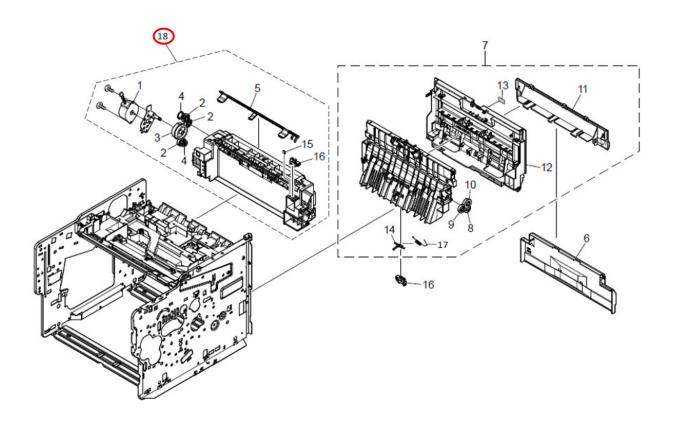

Technical Bulletin

PAGE: 1/1


Model: Brz-P1		Date: 19-Jul-	-18	No.: RM281027		
Subject: Parts Ca	atalog Correction: ARM COUPL	Prepare	Prepared by: T. Tachibana			
From: 1st Tech Service Sect., MFP/P Tech Service Dept.						
Classification:	Mechanical	 ☑ Part inforr ☑ Electrical ☑ Transmit/r ☑ Other (Servic	required e manual revision it information	

Change: This part is newly added.

Reason: To meet requests received from the field.

Part number	Description	Q'ty	Int	Page	Index	Note
M2811139	ARM COUPLING	1		4	40	

1.Covers

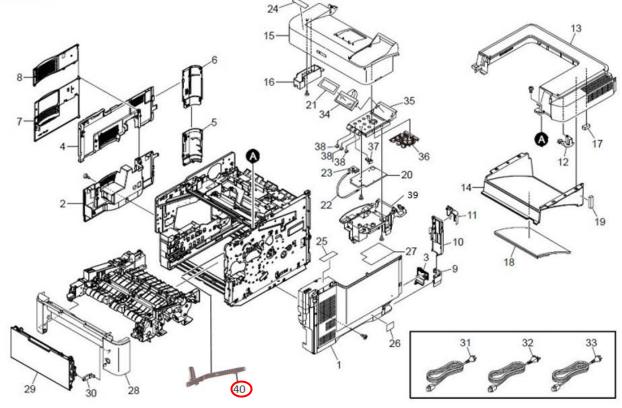

Technical Bulletin


Model: Brz-P1			Da	te: 23-Aug	-18	No.: RM281028			
Subject: Parts Catalog Correction: Thermistor PCB (Temperature Sensor)					Prepared by: T. Tachibana				
From: 1st Tech S	ervice Sect., MFP/P Tech Serv	vice Dept.							
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	Part info	al		Servic	required e manual revision it information			

Change: This part is newly added.

Reason: To meet requests received from the field.

Part number	Description	Q'ty	Int	Page	Index	Note
M2811430	PARTS PWB ASSY THERMISTOR SP			4	41	
	(Temperature Sensor)					
M2815403	HARNESS:PANEL-THERM	1		4	42	

1.Covers

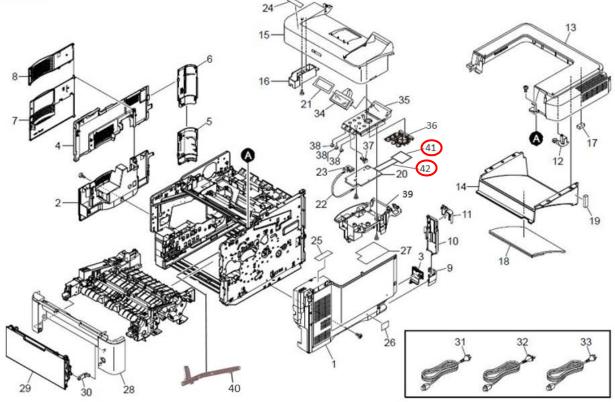

Technical Bulletin

PAGE: 1/2

Model: Brz-MF1/P	Date: 4-Se	p-18	No.: RD255066		
Subject: FSM corr	Prepared by: T. Tachibana				
From: 1st Tech Se	rvice Sect., MFP/P Tech Se	rvice Dept.			
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	Part inform Electrical Transmit/re Other (Action re Service n Retrofit ir Tier 2	nanual revision

Service Manual Correction:

Please add the descriptions in blue to your field service manual.

6. Troubleshooting > Service Call 303-396 > SC300 (Engine: Imaging 1: Charge, Development) (P.489)

SC No.	Туре	Error Name/Error Condition/Major Cause/Solution						
SC302-00	D	Charger Current Error						
SC303-00	С	When the charging voltage is applied by changing the voltage three levels, the current value is less than 20uA in one of three evels.						
		Connector defective or disconnected Power pack defective IOB defective						
		 Connector defective or disconnected Reconnect the following connectors. Then perform a conduction inspection. If there is no conduction, replace the connector. Drum Unit – Power Pack connector Power Pack – IOB connector Power pack defective Replace the power pack. IOB defective Replace the IOB. 						

Note: SC302 or SC303 might occur under the error conditions listed above.

SC No.	Туре	Error Name/Error Condition/Major Cause/Solution
SC321-00	C	Development Unit Non-Installing Error
SC322-00	D	The sensor output value is 31 or less continuously for 5 seconds.



T echnical	R ullatin
echnical	Duiletin

PAGE: 2/2

Model: Brz-MF1/P1			Date: 4-Sep-18	No.: R	D255066			
SC No.	Туре	Error Name/Error Condition	Error Name/Error Condition/Major Cause/Solution					
		 Connector defective or disco Toner density sensor defecti Connect-Left PCB defective IOB defective 						
		 Connect-Left PCB – IOE Toner density sensor defecti Replace the toner density set Connect-Left PCB defective Replace the Connect-Left PC IOB defective Replace the IOB. 	nectors. Then perform a re is no conduction, repla im PCB connector nection PCB connector – Connect-Left PCB conn 3 connector ve ensor.	ace the				

Note: SC321 or SC322 might occur under the error conditions listed above.

PAGE: 1/1


Model: Brz-P1	Dat	te: 19-Dec	-18	No.: RM281030				
Subject: Parts Catalog Correction: GUIDE TURN MPF					Prepared by: T. Tachibana			
From: 1st Tech Service Sect., MFP/P Tech Service Dept.								
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	Part info	al		Servic	required e manual revision it information		

Change: This part is newly added.

Reason: To meet requests received from the field.

Part number	Description	Q'ty	Int	Page	Index	Note
M2812851	GUIDE TURN MPF A	1		10	29	

4. Paper Feed Section

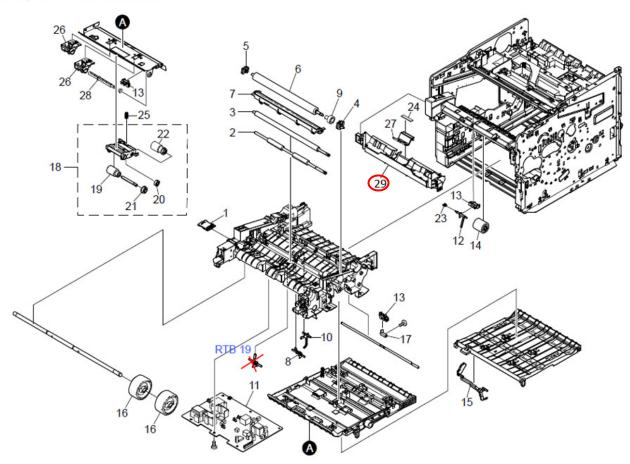

PAGE: 1/1


Model: Brz-P1 Da				t e : 19-Dec	-18	No.: RM281031		
Subject: Parts Catalog Correction: GUIDE CASSETTE L					Prepared by: T. Tachibana			
From: 1st Tech Service Sect., MFP/P Tech Service Dept.								
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 ☑ Part info ☑ Electrica ☑ Transmi ☑ Other (al		Servic	required e manual revision it information		

Change: This part is newly added.

Reason: To meet requests received from the field.

Part number	Description	Q'ty	Int	Page	Index	Note
M2811183	GUIDE CASSETTE L	1		20	16	

9. Drive Section

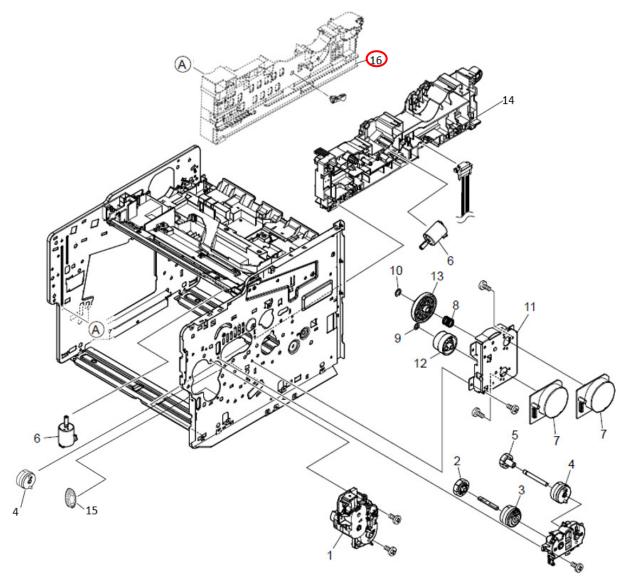

Reissued: 19-Feb-19

Model: Brz-P1	Date: 14-Feb-19	No.: RM281032a

RTB Reissue

The items in *bold italics* were corrected or added.

Subject: SC995-	02 cannot be reset		Prepared	d by: J. Mochizuki
From: Overseas	Field Info Sec., OP/OS PQM I	Dept		
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 Part informat Electrical Transmit/rec Other (Action required Service manual revision Retrofit information Tier 2

SYMPTOM

SC995-02 cannot be reset after replacing the NVRAM (M2819590) on the controller board with the service parts NVRAM.

CAUSE

Firmware bug: SP5-811-001 does not work correctly.

Note: This SP is used to program the serial number once a new NVRAM is installed.

SOLUTION

The *System* firmware was modified to fix this bug.

In the field:

If the symptom occurs,

- 1. Install *System* version 1.12 or later.
- 2. Turn the main power switch OFF/ON.
- 3. If the symptom still occurs, reboot the machine again.

Note:

- The firmware can be installed while the SC is displayed.
- You do not need to do SP5-811-001 after installing ver. 1.12.

PAGE: 1/1


Model: Brz-P1 Da			Date: 22-Feb-19			No.: RM281033
Subject: Parts Ca	oel)	Prepared	d by: T. T	achibana		
From: 1st Tech Service Sect., MFP/P Tech Service Dept.						
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 ☑ Part info ☑ Electrica ☑ Transmi ☑ Other (al		Servic	required e manual revision it information

Change: This part is newly added.

Reason: To meet requests received from the field.

Part number	Description	Q'ty	Int	Page	Index	Note
M2811316	LABEL_DIAL	1		8	22	

3. Paper Cassette

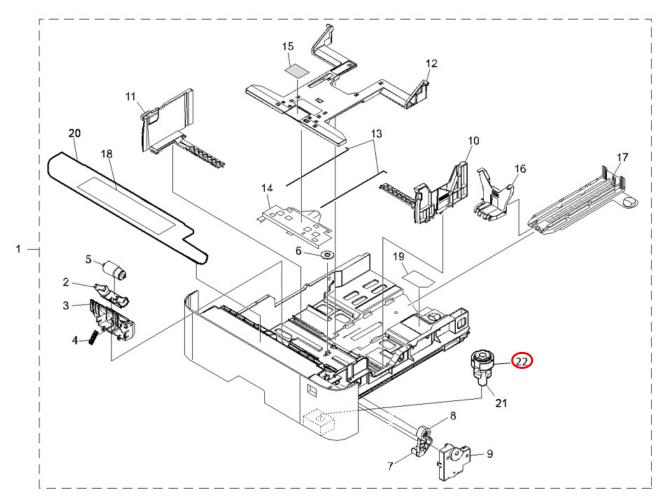

Technical Bulletin

Reissued : 4-Apr-19 Model: Brz-MF1/P1

Date: 15-Mar-19

No.: RD255075a

RTB Reissue

The items in *bold italics* have been corrected or added.

Subject: Smell red	uction fan		Prepared by: T. Tachibana
From: 1st Tech Se	rvice Sect., MFP/P Tech Se	ervice Dept.	
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 Part information Electrical Transmit/receive Other () 	 Action required Service manual revision Retrofit information Tier 2 Tier 0.5

SYMPTOM

The machine sometimes gives off an unpleasant, chemical smell.

CAUSE

This machine only contains intake fans. Smells generated inside the machine, such as the smell of heated toner, are released through the paper exit.

SOLUTION

Install the smell reduction fan.

Part number	Description	Q'ty	Int	Page	Index	Note
M2810081	FILTER:FAN:ASS'Y	1				

Note 1: The fan continues to run when the machine is in sleep mode.

Note 2: The power consumption is 0.90 W.

Note 3: If the filter needs to be replaced after installation, please check the parts information below.

Part number	Description	Q'ty	Note
M2812415	FILTER:NHC-MKB2:198X52.5	1	Part #2 in the Accessory
			Check in Installation

Technical Bulletin

Reissued : 4-Apr-19 Model: Brz-MF1/P1

Brz-MF1/P1	Date: 15-Mar-19	No.: RD255075a

Installation:

Accessory Check

No.	Description	Q'ty	
1	Deodorant Fan	1	
2	Filter	1	
3	Cover (only for the Printer model)	1	



Installation Procedure

1. Place the Filter in the Deodorant Fan.






Reissued : 4-Apr-19

Model: Brz-MF1/P1

Date: 15-Mar-19 No.: RD

No.: RD255075a

2. Pull 2~7 mm of tape and fold it as shown below.

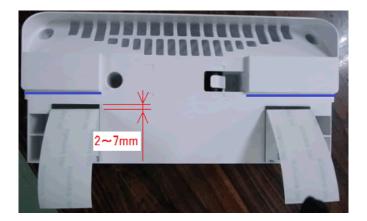

3. (**MF model only**) Align the blue line on the fan with the red line on the mainframe to make sure the fan is placed correctly. Fan (Underside):



Mainframe (Rear side):






Model:

Reissued : 4-Apr-19

Brz-MF1/P1	Date: 15-Mar-19	No.: RD255075a
	Datorioniario	

4. (**Printer model only**) Align the blue line on the fan (shown in #2) with the red circle on the mainframe. Then, align the cover with the green circles.

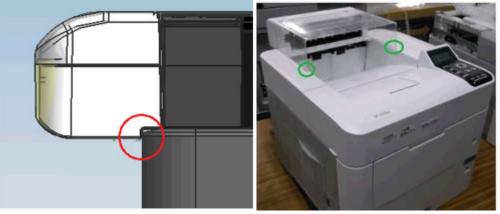

5. Pull out the tape slowly from the front of the machine. MF model: Printer model:





6. Connect the USB cable. MF model:



Printer model:



Technical Bulletin

PAGE: 1/1


Model: Brz-P1			Date: 17-Apr-19			No.: RM281034	
Subject: Parts Catalog Correction: Duplex parts			Prepared by: T. Tachibana				
From: 1st Tech Service Sect., MFP/P Tech Service Dept.							
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	Part info	al		Servic	required e manual revision it information	

Change: These parts are newly added.

Reason: To meet requests received from the field.

Part number	Description	Q'ty	Int	Page	Index	Note
M2812852	BASE_DU	1		10	30	
M2817502	GUIDE DU	1		10	31	
M2817503	PULLEY PA	4		10	32	
M2817504	SPRING DU	4		10	33	
M2816684	LEVER_DU_RELEASE	1		10	34	

4. Paper Feed Section

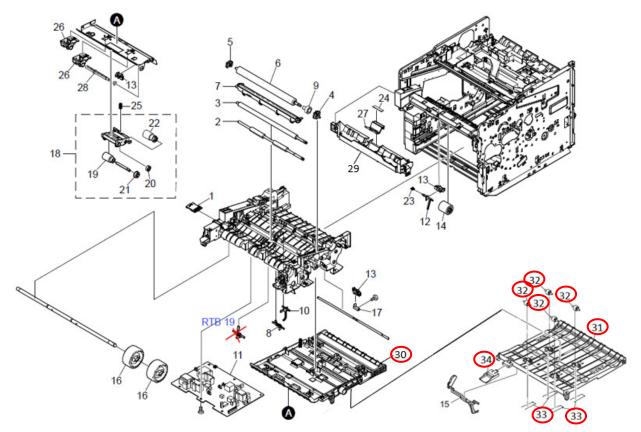

Technical Bulletin

PAGE: 1/1


Model: Brz-P1			Dat	te: 17-Apr-19	Э	No.: RM281035
Subject: Parts Ca	Prepared I	by: т. т.	achibana			
From: 1st Tech S	ervice Sect., MFP/P Tech Servic					
Classification:	Mechanical	 Part infor Electrical Transmit/ Other (l	eive	Servic	required e manual revision t information

Change: These parts are newly added.

Reason: To meet requests received from the field.

Part number	Description	Q'ty	Int	Page	Index	Note
M2812543	GEAR Z36L-Z20S	1		20	17	
M2812542	GEAR Z46S-Z13S	1		20	18	
M2812541	GEAR Z34S-Z13S	1		20	19	
M2817501	GEAR Z34S INPUT	1		20	20	

9. Drive Section

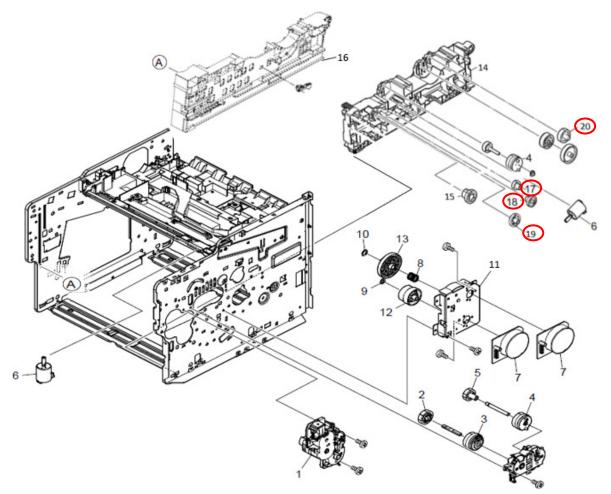

Technical Bulletin

PAGE: 1/1


Model: Brz-P1 D			Dat	e: 23-May	-19	No.: RM281036			
Subject: Parts Catalog Correction: SHEET REGIST					Prepared by: T. Tachibana				
From: 1st Tech S	ervice Sect., MFP/P Tech Servi								
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 ☑ Part infor ☑ Electrical ☑ Transmit ☑ Other (I		Servic	required e manual revision it information			

Change: This part is newly added.

Reason: To meet requests received from the field.

Part number	Description	Q'ty	Int	Page	Index	Note
M2817505	SHEET REGIST	2		10	35	

4. Paper Feed Section

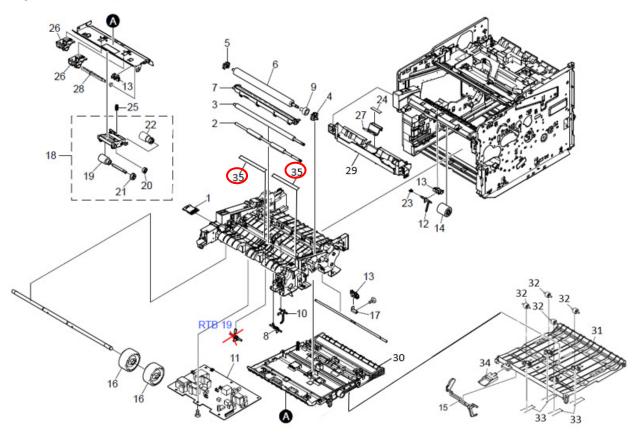

Technical Bulletin


Model: Brz-P1			Da	te: 23-May	/-19	No.: RM281037
Subject: Parts Catalog Correction: LEVER LOCK CASSETTE					d by: т. т	achibana
From: 1st Tech Service Sect., MFP/P Tech Service Dept.						
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	Part info	al		Servic	required e manual revision it information

Change: This part is newly added.

Reason: To meet requests received from the field.

Part number	Description	Q'ty	Int	Page	Index	Note
M2817506	LEVER LOCK CASSETTE L	1		20	21	

9. Drive Section

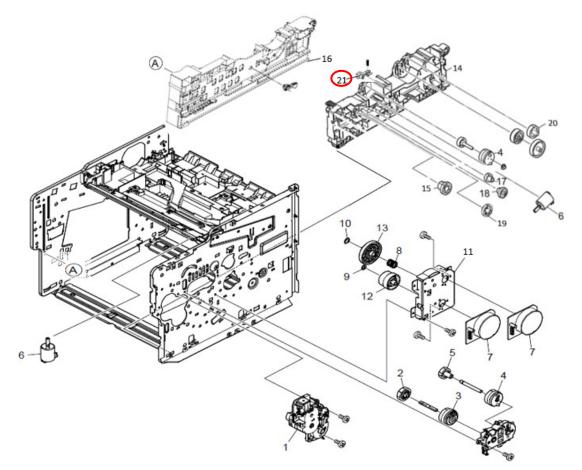

Technical Bulletin

Model: Brz-P1 Date: 2-Ju			l-19	No.: RM281038	
Subject: Parts Cat	Prepared by: T. Tachibana				
From: 1st Tech Se	rvice Sect., MFP/P Tech Se				
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	Part inform		Action red Service n Retrofit ir	nanual revision

The controller board (CTL board) have been updated with the System/Copy firmware.

Old part number	New part number	Description	Q'ty	Int
M2815544	M2815535	PCB:CTL:BRA-P1A:50PPM	1	O/O
M2815545	M2815536	PCB:CTL:BRA-P1B:60PPM	1	O/O

The System/Copy firmware version has been changed as shown below:

M2815770M -> M2815745

Ver.1.12 Ver.1.13

Caution

- The old System/Copy firmware (version 1.12) is not compatible with the new CTL board.
- The new System/Copy firmware (version 1.13) is compatible with both old and new CTL board.
- If you use a new CTL board, do not downgrade the System/Copy firmware to version 1.12. If the old System firmware is installed to the new CTL board, SC878 (TPM authentication error) will occur.
- If SC878 occurs after downgrading the firmware, the CTL board must be replaced with a new one to solve the SC878 error.

Change/Reason:

An IC on the CTL board has been discontinued. The new IC is not compatible with the old one and required a firmware change.

Technical Bulletin


Model: Brz-P1			Dat	te: 22-Aug	-19	No.: RM281039	
Subject: Parts Catalog Correction: 4. Paper Feed Section					d by: T. T	achibana	
From: 1st Tech S	ervice Sect., MFP/P Tech Serv						
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	Part info	al		Servic	required e manual revision it information	

Change: The bold italic parts are newly added.

Reason: To meet requests received from the field.

Part number	Description	Q'ty	Int	Page	Index	Note
D2552851	GUIDE TURN MPF A	1		10	29	
M2812852	BASE_DU	1		10	30	
M2817502	GUIDE DU	1		10	31	
M2817503	PULLEY PA	4		10	32	
M2817504	SPRING DU	4		10	33	
M2816684	LEVER_DU_RELEASE	1		10	34	
M2817505	SHEET REGIST	2		10	35	
M2812859	LOCK ENVELOPE R	1		10	36	
M2812855	LOCK ENVELOPE L	1		10	37	

4. Paper Feed Section

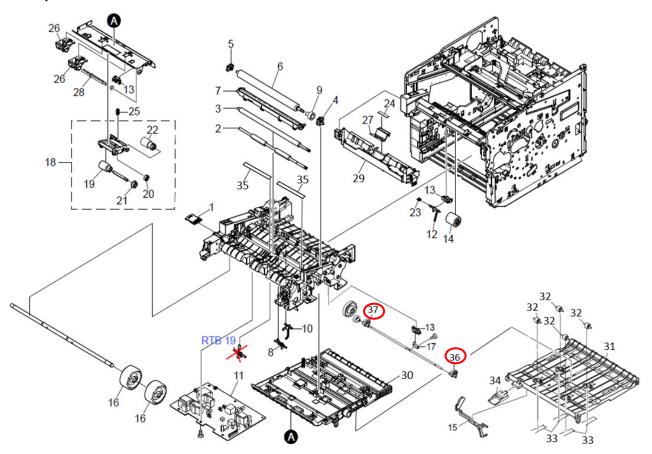

Technical Bulletin

PAGE: 1/1


Model: Brz-P1			Dat	te: 25-Oct-	19	No.: RM281041			
Subject: Parts Catalog Correction: 7. Fusing Section					Prepared by: T. Tachibana				
From: 1st Tech S	ervice Sect., MFP/P Tech Serv								
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 ☑ Part infor ☑ Electrica ☑ Transmit ☑ Other (l		Servic	required e manual revision it information			

Change: This part is newly added.

Reason: To meet requests received from the field.

Part number	Description	Q'ty	Int	Page	Index	Note
M2811087	COVER SENSOR	1		16	3	

7. Fusing Section

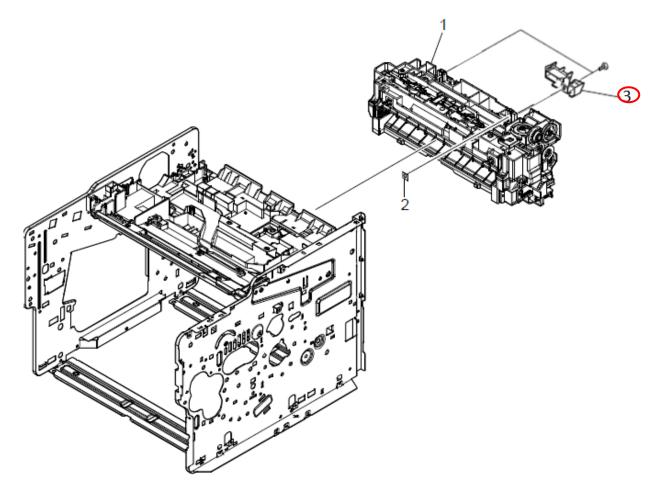

Technical Bulletin

Reissued: 21-Nov-19

Model: Brz-P1

Date: 25-Oct-19 No.: RM281040a

RTB Reissue

The items in *bold italics* were added.


Subject: Parts Catalog Correction: 1. Covers			Prepared by: T. Tachibana			
From: 1st Tech S	ervice Sect., MFP/P Tech Serv	vice Dept.				
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	Part informat		 Action required Service manual revision Retrofit information Tier 2 		

Change: The bold italic part is newly added.

Reason: To meet requests received from the field.

Part number	Description	Q'ty	Int	Page	Index	Note
M2811420	LID OPERATION	1		4	35	
M2811424	KEY A	1		4	36	
M2811425	KEY PAUSE	1		4	37	
M2811427	LENS LED	3		4	38	
M2811422	COVER_OPERATION	1		4	39	
M2811139	ARM COUPLING	1		4	40	
M2811088	HOLDER KEY SW	1		4	41	
M2811247	PAPER STOPPER	1		4	42	

1.Covers

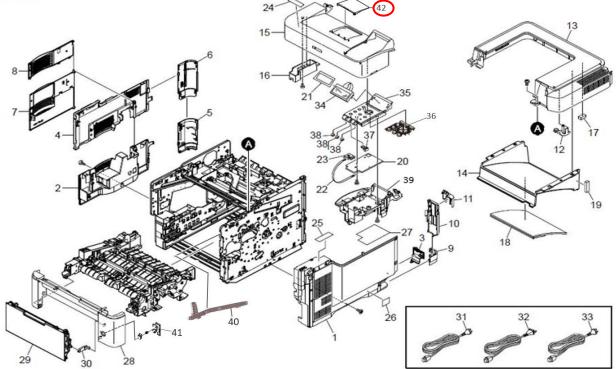

Technical Bulletin

Model: Brz-P1		Date: 21-Nov-		v-19	No.: RM281042		
Subject: Parts Catalog Correction: 9. Drive Section			Prepared by: T. Tachibana				
From: 1st Tech Service Sect., MFP/P Tech Service Dept.							
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	 ☑ Part info ☑ Electrica ☑ Transmite ☑ Other (al		Servic	required e manual revision it information	

Change: The bold italic part is newly added.

Reason: To meet requests received from the field.

Part number	Description	Q'ty	Int	Page	Index	Note
M2811182	GUIDE CASSETTE R	1		20	14	
M2811130	GEAR Z35S-Z13S B	1		20	15	
M2811183	GUIDE CASSETTE L	1		20	16	
M2812543	GEAR Z36L-Z20S	1		20	17	
M2812542	GEAR Z46S-Z13S	1		20	18	
M2812541	GEAR Z34S-Z13S	1		20	19	
M2817501	GEAR Z34S INPUT	1		20	20	
M2817506	LEVER LOCK CASSETTE L	1		20	21	
M2811246	SPRING LOCK CASSETTE	1		20	22	



Model: Brz-P1

Date: 21-Nov-19 No.: RM

No.: RM281042

9. Drive Section

