

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2		Date: 31-Mar-06	No.: RD025000v
Subject: Troubleshooting		Prepared by: H. Someya	
From: 1st Tech. Support Sec. Service Support Dept.			
Classification:	<input checked="" type="checkbox"/> Troubleshooting <input type="checkbox"/> Mechanical <input type="checkbox"/> Paper path <input type="checkbox"/> Product Safety	<input type="checkbox"/> Part information <input type="checkbox"/> Electrical <input type="checkbox"/> Transmit/receive <input type="checkbox"/> Other ()	<input type="checkbox"/> Action required <input type="checkbox"/> Service manual revision <input type="checkbox"/> Retrofit information

This bulletin is a troubleshooting guide for symptoms that have occurred in the past, all with known solutions. For most items below, there are related MBs and RTBs containing modification details and adjustment procedures.

Note: This RTB is numbered "000" since the information contained in it has already been announced.

E-3100 Controller: More than one patch file may be needed, and the order in which they are applied may be important. See the RTB for the required patch file(s), and the correct procedure to use.

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

Table of contents

1. Paper Feed Errors	6
Jam	
A, B, C Jam indicated together but there is no jam	
Tandem tray	
2. Copy Process	6
"Toner End" display	
Waste toner near-end/end display	
3. Connectivity	7
Web SmartDeviceMonitor	
Web Image Monitor	
Fax	
IP-fax	
WPA	
Wireless LAN	
DHCP	
Gigabit Ethernet	
Cannot access the machine	
Scanned documents not delivered	
No thumbnails	
Various connectivity issues	
Domain name overwritten	
Cannot send email	
SMB	
Remote Manager	
SSL	
Machine's icon not shown	
Cannot install driver	
Cannot use network functions	
Cannot use connectivity applications	
Internet Explorer	
@Remote	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

4. **Printing**..... 12

- Driver settings
- Jobs cancelled
- Jobs not accepted
- Problems with PCL
- PDF direct printing
- Jobs not printed
- Printer function disabled
- Macro used on wrong page
- Errors when handling cancelled jobs
- Font problem
- Job reset
- Printing stops
- Duplex
- 2-up
- PostScript

5. **Scanning**..... 15

- Scan to SMB
- Scan to NCP
- Wrong file type generated
- Scanning does not stop
- Cannot start scanning
- Cannot send scan data
- Scan to folder

6. **Operation Panel**..... 17

- Display freezes
- Incorrect display
- Operation panel does not work
- Application buttons do not work
- No display
- Display goes black
- 'Please wait'
- Software keyboard
- Displayed image
- User tools screen
- Language

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

7. Security 19

Unauthenticated access to Web Image Monitor is possible

Windows authentication

Cannot assign group privileges

LDAP authentication

"Authenticating... Please wait".

Cannot login

Cannot logout

Job log

Problems with logs

Unnecessary login/logout recorded

Data not logged

Password change recorded, by mistake

Users not logged out

Garbled user data

Account locked

Account not locked

Cannot recognize user

Users logged out

Cannot display user name

Kerberos Authentication

8. Error Codes and Messages..... 23

SC 202, 203, 204, 552, 555, 620, 672, 687, 816, 819, 863, 899, 990, 991, 997

"Functional problem detected."

"Please wait"

"Supplies Order Call Failed"

9. Optional Units 26

Booklet finisher

USB/SD card reader

USB devices

Card Authentication Package

E-3100 Controller

500-sheet finisher

Stapling

Shift tray

SDK

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

10. Image Problems 29

Black streaks
 Missing characters
 Missing graphics
 Single pages split into two pages
 Color separation
 Images combined and printed on one page
 Vertical lines
 Areas printed in the wrong colour
 Horizontal lines
 Dirty background
 Objects in the wrong position
Image partly blacked out
 Image problem (undefined)
 Text overlaps
 Gradation
 Color missing
 Cropped image
 Scale to Fit/Full Bleed
Lines added or missing

11. Mechanical Problems 31

Motor operates at the wrong time
 Original not detected
 ADF not detected

12. Others 32

Machine stalls
 Scanning stalls
 Incorrect characters printed
 Debug log
 Energy saver mode
 Firmware update
 Printing is slow
 Jobs go to the wrong tray
 Setting changes not applied
 Some jobs not shown
 Settings revert to defaults
 Unexpected behavior
 Hard disk
 Memory leak
 Counters
 "NullPointerException"

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

1. Paper Feed Errors

Subject	Symptom	RTB #	Cause	Solution	Note
Jam	Jam 17 After recovering from a staple jam	D025 002c	Engine firmware	Install version 1.54:09 or later.	
Jam	JAM 64 or 67 in the duplex unit	D025 049	High temperature and mechanical load cause the fusing entrance guide plate to bend.	Replace the guide plate with the new part (D0294492).	
Jam	Jam 1 in the bridge unit	D025 002e D025 053	Engine firmware	Install version 1.56:09 or later.	
A, B, C Jam indicated but there is no jam	Paper is resting inside the machine, but is not jammed	D025 034	A specific lot of the Paper Exit Sensor is faulty.	Replace the sensor if it is defective. See the RTB for details on how to test and replace the sensor.	
Tandem tray	Paper is not supplied to the tandem tray when paper runs out, even though the switch for limitless paper feed (SP5195-01) is enabled.	D025 012k	System/Copy firmware	Install version 1.24 or later.	

2. Copy Process

Subject	Symptom	RTB #	Cause	Solution	Note
"Toner End" display	Not cleared when the toner bottle is replaced.	D025 050	Pump unit not working properly, so toner not supplied correctly	See the flow chart in the RTB. You MUST identify the root cause using the flow chart and check the cut-in serial number before you replace the pump units. If the root cause is different, the symptom will reoccur within a short period.	
Waste toner near-end/end display	Not displayed	D025 002f	Engine firmware	Install version 1.57:09 or later.	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

3. Connectivity

Subject	Symptom	RTB #	Cause	Solution	Note
Web SmartDevice Monitor	Job names that include "%s" prevent Web SDM from retrieving the job list.	D025 005a	Network DocBox firmware	Install version 1.02 or later.	
Web SmartDevice Monitor	Mismatched Entry ID and User Name in the access log	D025 012b	System/Copy firmware	Install version 1.15 or later.	
Web SmartDevice Monitor	Access Log > "Machine Data Encryption Key Change" > "Start Date/Time" and "End Date/Time" fields are blank.	D025 012b	System/Copy firmware	Install version 1.15 or later.	
Web Image Monitor	Job names that include "%s" prevent the document server from being accessed by the web service. The result is that the Document Server cannot be seen from Web Image Monitor.	D025 005a	Network DocBox firmware	Install version 1.02 or later.	
Web Image Monitor	If both SNTP and Date/Time settings are configured in WIM, WIM might not be accessible.	D025 006a	Network Support firmware	Install version 8.25 or later.	
		D025 012b	System/Copy firmware	Install version 1.15 or later.	
Web Image Monitor	Firmware versions of the Fax and Finisher options are not recorded in the Access Log	D025 012c	System/Copy firmware	Install version 1.16 or later.	
Web Image Monitor	Paper sizes missing from the display	D025 012f	System/Copy firmware	Install version 1.19 or later.	
		D025 013b	Web Support firmware	Install version 1.09.1 or later.	
Web Image Monitor	Locks up when applications access the MFP by http.	D025 006d	Network Support firmware	Install version 8.31 or later.	
Web Image Monitor	If SSDP = Active and there is a high load on the CPU	D025 006d	Network Support firmware	Install version 8.31 or later.	
Web Image Monitor	Wording errors (Chinese)	D025 013e	Web Support firmware	Install version 1.12 or later.	
Fax	The PC fax job history cannot be accessed after a PC fax transmission is sent.	D025 010b	Remote Fax firmware	Install version 02.00.00 or later.	
Fax	Cannot receive a fax while in Energy Saver Mode	D025 020b	FCU firmware	Install version 05.00.00 or later.	
Fax	Received fax documents stored in memory cannot be printed	D025 003d	Fax firmware	Install version 05.00.00 or later.	

Updated: End of March 2017: Changes in bold *italics*
Model: Model AT-C2

Date: 31-Mar-06

No.: RD025000v

Subject	Symptom	RTB #	Cause	Solution	Note
Fax	Line interrupt error occurs when receiving a fax from a specific fax server, due to an RTC misdetection.	D025 020c	FCU firmware	Install version 06.00.00 or later.	
Fax	When an ESA application sends a fax using multibyte characters, the sender is garbled on the recipient device.	Gene 050c	Java VM4 Update Tool	Install version 4.28.00 or later.	
		Gene 056c	Java VM v4 for eDC		
Fax	A stored received fax is deleted if a paper loading error occurs during printing	D025 003e	Fax firmware	Install version 06.00.00 or later.	
Fax	The machine does not recover from an error during transfer and does not report the error.	B025 020e	FCU firmware	Install version 08.00.00 or later.	
Fax	Paperless faxes are deleted and not forwarded to the shared folder, and the documents and corresponding error report are not printed.	GenF 025	GWFCU3-13 (WW) firmware	Install version 08.00.00 or later.	
IP-Fax	IP-fax not working	D025 010c	Remote Fax firmware	Install version 03.00.00 or later.	
WPA	If the device fails to establish a WPA or WPA2 connection once, it will not try again until rebooted.	D025 006a	Network Support firmware	Install version 8.25 or later.	
Wireless LAN	Cannot roam between access points using different versions of the IEEE 802.11 standard	D025 006a	Network Support firmware	Install version 8.25 or later.	
Wireless LAN	Sudden loss of wireless network connectivity with an error message "Problems with the wireless card."	D025 012c	System/Copy firmware	Install version 1.16 or later.	
DHCP	The machine doesn't advertise its hostname via DHCP option 12. The DNS server might not be updated by DHCP.	D025 006a	Network Support firmware	Install version 8.25 or later.	
Gigabit Ethernet	The machine does not display warnings about IPv6 address collisions	D025 012b	System/Copy firmware	Install version 1.15 or later.	
Cannot access the machine	From multiple Windows Vista/Server 2008 PCs through IPsec	D025 006b	Network Support firmware	Install version 8.27 or later.	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2

Date: 31-Mar-06

No.: RD025000v

Subject	Symptom	RTB #	Cause	Solution	Note
Cannot access the machine	The MFP's IP address lease renewal request is incorrectly formatted and rejected by DHCP relay agents. This causes a loss of connectivity until the MFP reinitializes the network connection (10 seconds).	D025 006b	Network Support firmware	Install version 8.27 or later.	
Cannot access the machine	If either of the WSD Printer or Netware functions are enabled	D025 006b	Network Support firmware	Install version 8.27 or later.	
Cannot access the machine	When encrypted communication is established between the device and server and then a communication error occurs between the device and server	D025 012i	System/Copy firmware	Install version 1.22 or later.	
Cannot access the machine	Machine with an EFI controller cannot be discovered by WSD.	D025 006c	Network Support firmware	Install version 8.30 or later.	
Cannot access the machine	MFP with an external controller: If the network settings were changed often and the MFP's "NetWare" setting was "Active" before the network settings were changed.	D025 006d	Network Support firmware	Install version 8.31 or later.	
Cannot access the machine	If SSDP is enabled.	D025 006d	Network Support firmware	Install version 8.31 or later.	
Scanned documents not delivered	Delivery of a scanned document fails via Scan to ScanRouterEX (using the MFP Browser), and the device will not attempt to resend the document.	D430A 01A	Browser Unit firmware	Install version 1.72 or later.	
No thumbnails	In the document reception screen	D025 003c	Fax firmware	Install version 04.00.00 or later.	
Various connectivity issues	Caused by the new MAC address codes	D025 042	Update connectivity firmware	See the RTB for the modules that must be updated.	
Domain name overwritten	When the device IP address and DNS server location are obtained from DHCP, the domain specified by the device setting "IPv4 > Domain Name > Specify" will be overwritten	D025 006c	Network Support firmware	Install version 8.30 or later.	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2

Date: 31-Mar-06

No.: RD025000v

Subject	Symptom	RTB #	Cause	Solution	Note
Cannot send email	If the MFP/LP has a statically configured IP address and domain, it always sends a HELO using just its hostname. SMTP servers that require client HELOs to include the client's FQDN will close the connection.	D025 006c	Network Support firmware	Install version 8.30 or later.	
SMB	Cannot Scan to SMB to Windows 7 or Windows Server 2008 R2 destinations that have Windows Live ID Sign-in assistant installed.	D025 006c	Network Support firmware	Install version 8.30 or later.	
SMB	Cannot Scan to SMB to Windows 98/98SE/Me/NT4.0 destinations specified using an IP address.	D025 006c	Network Support firmware	Install version 8.30 or later.	
SMB	The SMB retry function fails to retry the sending of failed SMB transfers (Scan to SMB or Fax delivery).	D025 006c	Network Support firmware	Install version 8.30 or later.	
SMB	If the MFP's IP address is changed to an IP address of another subnet, users cannot browse the network (using Scan to SMB) until the MFP is rebooted.	D025 006c	Network Support firmware	Install version 8.30 or later.	
SMB	The Scan to SMB "Connection Test" fails if performed on a directory located directly below a DFS root.	D025 006c	Network Support firmware	Install version 8.30 or later.	
SMB	After changing the MFP's DNS server address or Domain name, Scan to SMB destinations specified using a hostname are not found.	D025 006c	Network Support firmware	Install version 8.30 or later.	
SMB	Problems when using across subnets due to short timeout	D025 006c	Network Support firmware	Install version 8.30 or later.	
SMB	Cannot Scan to SMB to a destination that is not specified using an FQDN.	D025 006c	Network Support firmware	Install version 8.30 or later.	
SMB	Cannot Scan to SMB to destinations that are using both LM Authentication and Samba v2.x.	D025 006c	Network Support firmware	Install version 8.30 or later.	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

Subject	Symptom	RTB #	Cause	Solution	Note
Remote Manager	Remote Manager v2 cannot communicate with the device if it takes more than 1 minute to assign the device an IP address via DHCP.	M413 001e	VM card firmware	Install version 4.24.03 or later.	
SSL	An SSL connection cannot be established if a x509 certificate is used but contains a "CRL Distribution Point".	M413 001e	VM card firmware	Install version 4.24.03 or later.	
SSL	Vulnerability to the re-negotiation of SSL/TLS	M413 002a	Java VM4 for eDC firmware	Install version 4.25.07 or later.	
		M413 001f	VM card firmware	Install version 4.25.07 or later.	
Machine's icon not shown	Not shown in the Windows "Network" dialogue if SSDP is enabled.	D025 006d	Network Support firmware	Install version 8.31 or later.	
Cannot install driver	If the IPP Authentication setting is enabled, cannot install on Windows 2008 R2 SP1 or 7 SP1 using an IPP port.	D025 006d	Network Support firmware	Install version 8.31 or later.	
Cannot use network functions	If DHCP and DDNS are both enabled	D025 006e	Network Support firmware	Install version 8.33 or later.	
Cannot use connectivity applications	Affected applications include Web Image Monitor, IPP Printing and @Remote.	D025 006e	Network Support firmware	Install version 8.33 or later.	
Internet Explorer	On Internet Explorer 10, the Setup/Configure window is blank.	D025 074	Apply the required Patch File(s) for E-3100 system version 1.0.		
@Remote	Auto calls not sent	D025 012p	Engine firmware	Install version 2.02 or later.	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

4. Printing

Subject	Symptom	RTB #	Cause	Solution	Note
Driver settings	If Bypass Tray Setting Priority is "Driver/Command Settings", jobs sent to the bypass tray that contain a Paper Type definition will cause the bypass tray's Paper Thickness setting to be overwritten with "Plain Paper".	D025 008b	Printer firmware	Install version 1.17 or later.	
Jobs cancelled	LPR jobs submitted by an HP-UX, AIX or Netware 6.5 (SP6 or SP7) host	D025 006a	Network Support firmware	Install version 8.25 or later.	
Jobs cancelled	IPP	D025 006a	Network Support firmware	Install version 8.25 or later.	
Jobs cancelled	Batch printing of PDF documents	D025 017b	PS3/PDF firmware	Install version 1.02 or later.	
Jobs cancelled	PCL XL	D025 016d	Option PCL firmware	Install version 1.04 or later.	
Jobs not accepted	After a job consisting of a multiple of exactly 8KB (8192 bytes) is submitted via IPP	D025 006a	Network Support firmware	Install version 8.25 or later.	
Problems with PCL	The device stops printing PCL5 macros after 500 or more pages and omits macros from PCL5 jobs until the device is rebooted.	D025 016b	Option PCL firmware	Install version 1.02 or later.	
PDF direct printing	Printing of PDFs containing multiple images causes the PS error "limitcheck"	D025 017a	PS3/PDF firmware	Install version 1.01 or later.	
Jobs not printed	When jobs are submitted to the device's lpr port repeatedly	D025 006b	Network Support firmware	Install version 8.27 or later.	
Jobs not printed	If IPP authentication is enabled, and printing through an IPP port from a Windows Vista/Server 2008 client	D025 006b	Network Support firmware	Install version 8.27 or later.	
Jobs not printed	Printing does not start if the copier is in energy save mode.	D025 028	Apply the required Patch File(s) for E-3100 system version 1.0.		

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

Subject	Symptom	RTB #	Cause	Solution	Note
Jobs not printed	Jobs not containing PDL commands are held by the device and not printed until another job is submitted or a button is pressed on the device. This occurred if the device entered in energy saver mode immediately after printing a diagnostics page	D025 008f	Printer firmware	Install version 1.24 or later.	
Job not printed	Job does not print from Print queue when Enable Printed Queue is OFF	D025 067	Apply the required Patch File(s) for E-3100 system version 1.0.		
Printer function disabled	After recovery from Energy Saver Mode	D025 012j	System/Copy firmware	Install version 1.23 or later.	
Macro used on wrong page	Should be used on first page only	D025 016d	Option PCL firmware	Install version 1.04 or later.	
Errors when handling cancelled jobs	Saved to the MFP hard disk and retained until the next reboot.	D025 008g	Printer firmware	Install version 1.24.1 or later.	
Errors when handling cancelled jobs	Sent by the MFP to capture servers such as ScanRouter or eCabinet.	D025 008g	Printer firmware	Install version 1.24.1 or later.	
Font problem	If printing a PDF Direct job that calls a "download font" from the hard disk (or RAM disk), one of the other resident fonts is used	D025 017c	PS3/PDF firmware	Install version 1.03 or later.	
Font problem	Multiple-glyph fonts are not printed	D025 016e	Option PCL firmware	Install version 1.05 or later.	
Font problem	PCL soft font reverts to system font in the middle of the job.	D025 044	Apply the required Patch File(s) for E-3100 system version 1.0.		
Job reset	PDF Direct jobs containing a mask that was created using tiling	D025 017c	PS3/PDF firmware	Install version 1.03 or later.	
Job reset	Chunk Transfer Encoding over an IPP port	D025 006d	Network Support firmware	Install version 8.31 or later.	
Printing stops	When sending a fax and printing a job at the same time.	D025 029	Apply the required Patch File(s) for E-3100 system version 1.0.		
Duplex	Some pages in Mixed Media that should be printed in duplex are printed in simplex.	D025 045	Apply the required Patch File(s) for E-3100 system version 1.0.		

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

Subject	Symptom	RTB #	Cause	Solution	Note
Duplex	Duplex printing issue with PCL5 data.	D025 067		Apply the required Patch File(s) for E-3100 system version 1.0.	
2-up	Errors	D025 054		Apply the required Patch File(s) for E-3100 system version 1.0.	
PostScript	PS error occurs while processing a specific file.	D025 061		Apply the required Patch File(s) for E-3100 system version 1.0.	
PostScript	PS error occurs when printing certain PDF files using the PS driver.	D025 061		Apply the required Patch File(s) for E-3100 system version 1.0.	
PostScript	When Staple 2 at center is specified, Fiery shows PS error (Range check Error).	D025 067		Apply the required Patch File(s) for E-3100 system version 1.0.	

Updated: End of March 2017: Changes in bold *italics*

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

5. Scanning

Subject	Symptom	RTB #	Cause	Solution	Note
Scan to SMB	Cannot send documents to a hostname containing 2-byte characters.	D025 006a	Network Support firmware	Install version 8.25 or later.	
Scan to SMB	Fails if the file submitted to the DFS folder in the destination already has as a file of the same name	D025 006d	Network Support firmware	Install version 8.31 or later.	
Scan to SMB	Document not sent if an IP address is used	D025 006d	Network Support firmware	Install version 8.31 or later.	
Scan to SMB	Fails in certain cases (see the RTB)	D025 006d	Network Support firmware	Install version 8.31 or later.	
Scan to SMB	Scan to Folder (SMB) does not work when specifying the destination's IP address.	D025 012m	System/Copy firmware	Install version 1.25 or later.	
Scan to SMB	Scan to SMB does not work correctly	D025 054	Apply the required Patch File(s) for E-3100 system version 1.0.		
Scan to SMB	"General SMB operation error": Fiery cannot connect to a Mac OS X 10.9 shared folder.	D025 077	Apply the required Patch File(s) for E-3100 system version 1.0.		
Wrong file type generated	A scan configured to output a Multi-page TIFF actually output a PDF.	D025 011e	Scanner firmware	Install version 1.24 or later.	
Wrong file type generated	TIFF output as PDF	D025 011f	Scanner firmware	Install version 1.25 or later.	
Scan to NCP	Fails or is slow if some conditions are met (see the RTB for details)	D025 011d	Scanner firmware	Install version 1.23 or later.	
		D025 012i	System/Copy firmware	Install version 1.22 or later.	
Scanning does not stop	Mixed size scanning	D025 012m	System/Copy firmware	Install version 1.25 or later.	
Cannot start scanning	When starting "Off mode" after printing a large quantity of data, cannot start scan	D025 029	Apply the required Patch File(s) for E-3100 system version 1.0.		
Cannot send scan data	Cannot send to Mac OS X 10.7 share location	D025 070	Apply the required Patch File(s) for E-3100 system version 1.0.		
Scan to folder	Cannot scan to shared folders	D025 006f	Network Support firmware	Install version 8.33 or later.	
Scan to folder	When NBT is OFF	D025 006e	Network Support firmware	Install version 8.33 or later.	
Scan to folder	If "CNAME" is specified as the destination folder, ScanTo Folder will abort.	D025 006e	Network Support firmware	Install version 8.33 or later.	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

Subject	Symptom	RTB #	Cause	Solution	Note
Scan to folder	Cannot scan to shared folders in Mac OS X 10.7 or Mac OS X 10.8.	D025012o	System/Copy firmware	Install version 2.01 or later.	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

6. Operation Panel

Subject	Symptom	RTB #	Cause	Solution	Note
Display freezes	If the Java™Platform button is pressed twice when the main power is turned on.	M344 001b	VM card firmware	Install version 4.14 or later.	RTB for VM card option
Display freezes	If wireless LAN setting was wrong	D025 012o	System/Copy firmware	Install version 2.01 or later.	
Display freezes	If left for more than 5 minutes on a login screen	D025 012o	System/Copy firmware	Install version 2.01 or later.	
Display freezes	SDK start logo does not change	M413 002a	Java VM4 for eDC firmware	Install version 4.25.07 or later.	
		M413 001f	VM card firmware	Install version 4.25.07 or later.	
Display freezes	Operation panel freezes when the software keyboard is closed	Gene 050b	Java VM4 Update Tool	Install version 4.26.05 or later.	
Incorrect display	The LCD display for the [Extended Auto Tray Switching] title is blank, in some languages:	D025 001b	Language Install firmware	Install version 1.07 or later.	
		D025 004b	LCDC firmware	Install version 1.08 or later.	
Incorrect display	Paper sizes missing from the display	D025 012f	System/Copy firmware	Install version 1.19 or later.	
		D025 013b	Web Support firmware	Install version 1.09.1 or later.	
Operation panel does not work	The panel does not respond at all, or The positions of the buttons shift (even after calibration)	D025 032b	An adhesive in the assembly is expanding, causing damage to the unit.	Replace the touch panel as explained in this RTB.	
Operation panel does not work	Cannot use Start key	M413 001	VM card firmware	Install version 4.17-01 or later.	
Application buttons do not work	If either of the WSD Printer or Netware functions are enabled	D025 006b	Network Support firmware	Install version 8.27 or later.	
No display	When the machine recovers from energy saver or Off/sleep mode	D025 004c D025 040	LCDC firmware	Install version 1.09 or later.	
No display	Only the Standby LED is lit.	D025 055a	Cracked soldering on polygon mirror motor board	Replace with new ass'y (P/N AX060396).	
No display	After changing language settings	M413 001	VM card firmware	Install version 4.15 or later.	
'Please wait'	Does not change to "Ready" after warming up at power ON or after recovering from Energy Saver Mode.	D025 048	AC voltage to the PSU is cut, causing corruption of data on the HDD. As a result, the fax function cannot boot up.	See the flow chart in the RTB.	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

Subject	Symptom	RTB #	Cause	Solution	Note
Display goes black	This only occurs if User Authentication is enabled or the MFP had a Device Accounting Unit such as a coin collector or charge card reader.	D025 011e	Scanner firmware	Install version 1.24 or later.	
		D025 012k	System/Copy firmware	Install version 1.24 or later.	
Software keyboard	Cannot close after using an SDK application	M413 001	VM card firmware	Install version 4.15 or later.	
Displayed image	Incomplete	M413 001	VM card firmware	Install version 4.17-01 or later.	
Displayed image	Character string not displayed correctly	M413 001	VM card firmware	Install version 4.17-01 or later.	
Displayed image	JPEG images not displayed	M413 001	VM card firmware	Install version 4.17-01 or later.	
User tools screen	Cannot exit	M413 001	VM card firmware	Install version 4.17-01 or later.	
Language	Cannot switch	M413 001	VM card firmware	Install version 4.17-01 or later.	
Language	Wording errors in SDK application screens	M413 001a	VM card firmware	Install version 4.20.04 or later.	

Updated: End of March 2017: Changes in bold *italics*

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

7. Security

Subject	Symptom	RTB #	Cause	Solution	Note
Unauthenticated access to Web Image Monitor is possible	If Selective User Authentication (SP5-420-041) and User Authentication are both enabled, unauthenticated users can access the urls of WIM's Printer Job History, Printer Error Log and Print Job List.	D025 008a	Printer firmware	Install version 1.12 or later.	
Unauthenticated access to Web Image Monitor is possible	Personal Information Protect (SP5-888-001 = 1) cannot stop users accessing the urls of WIM's Printer Job History, Printer Error Log and Print Job List.	D025 008a	Printer firmware	Install version 1.12 or later.	
Windows authentication	Fails on a domain controller whose hostname contains 2 byte characters.	D025 006a	Network Support firmware	Install version 8.25 or later.	
Windows authentication	Cannot use Kerberos when being authenticated on a Windows 2008 or Windows 2008 R2 server.	D025 006c	Network Support firmware	Install version 8.30 or later.	
Windows authentication	Unable to retrieve the Windows group name from a Windows 2008 R2 server during Windows Authentication.	D025 006c	Network Support firmware	Install version 8.30 or later.	
Windows authentication	Fails if the username or password includes lower-case European characters.	D025 006c	Network Support firmware	Install version 8.30 or later.	
Cannot assign group privileges	Cannot assign them to a logged in user if that group has a name consisting of more than 20 bytes	D025 006c	Network Support firmware	Install version 8.30 or later.	
LDAP authentication	If the login name or password contains extended ASCII characters (e.g. umlaut), authentication will fail.	D025 012b	System/Copy firmware	Install version 1.15 or later.	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2

Date: 31-Mar-06

No.: RD025000v

Subject	Symptom	RTB #	Cause	Solution	Note
"Authenticating. .. Please wait".	If a user logs back in after their session has timed out, the machine stalls with this message	D025 012b	System/Copy firmware	Install version 1.15 or later.	
Cannot login	With IC card: See the RTB for the conditions in which this occurs	M344 001b	VM card firmware	Install version 4.14 or later.	RTB for VM card option
Cannot login	If user name/password contains certain characters	M413 001	VM card firmware	Install version 4.17-01 or later.	
Cannot login	Application authentication fails	Gene 050b	Java VM4 Update Tool	Install version 4.26.05 or later.	
Cannot logout	When swiping the card	D025 012o	System/Copy firmware	Install version 2.01 or later.	
Cannot logout	If User Authentication settings are changed many times	M413 001	VM card firmware	Install version 4.17-01 or later.	
Job log	Stops recording User ID, Username or Usercode if WIM is accessed more than 300 times using authentication.	D025 012b	System/Copy firmware	Install version 1.18 or later.	
Job log	Job log CSV file contains the wrong "User Entry ID" for scanner jobs that were sent from the document server.	D025 011b	Scanner firmware	Install version 01.21 or later.	
Job log	The Job log displayed by Web SDM contains the wrong "User Code/User Name", "User Entry ID" and "User display name" for scanner jobs that were sent from the document server.	D025 011b	Scanner firmware	Install version 01.21 or later.	
Job log	Multiple stored jobs submitted for printing simultaneously not all recorded individually	D025 005b	Network DocBox firmware	Install version 1.03 or later.	
		D025 011c	Scanner firmware	Install version 1.22 or later.	
		D025 013c	Web Support firmware	Install version 1.10 or later.	
		D025 014a	Web Uapl firmware	Install version 1.08 or later.	
Job log	The administrator's user name not recorded in the job log when printing a Print Configuration page.	D025 008c	Printer firmware	Install version 1.21 or later.	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2

Date: 31-Mar-06

No.: RD025000v

Subject	Symptom	RTB #	Cause	Solution	Note
Problems with logs	The Result column in the "Scanner: Stored File Sending" log is blank	D025 005b	Network DocBox firmware	Install version 1.03 or later.	
Problems with logs	Some "File Access Privilege Change" log entries for the CSV file downloaded via WIM have problems (see the RTB for details).	D025 012i	System/Copy firmware	Install version 1.22 or later.	
Problems with logs	Data not transferred to the Web SmartDeviceMonitor server or Remote communication Gate S Pro.	D025 005c	Network DocBox firmware	Install version 1.04 or later.	
Unnecessary Login/logout recorded	An admin login/logout logged when the administrator accesses a new WIM page.	D025 008c	Printer firmware	Install version 1.21 or later.	
		D025 012h	System/Copy firmware	Install version 1.21 or later.	
		D025 013c	Web Support firmware	Install version 1.10 or later.	
		D025 014a	Web Uapl firmware	Install version 1.08 or later.	
Unnecessary Login/logout recorded	An admin login/logout logged every time an Auto Email Notification or On-demand Email Notification is sent	D025 012h	System/Copy firmware	Install version 1.21 or later.	
		D025 013c	Web Support firmware	Install version 1.10 or later.	
Data not logged	If the Password Policy is enabled, "Target User Entry ID" and "Target User Code/User Name" are not logged in the CSV file from WIM and in the Web SDM's Access Log List when a user tries and fails to change their password.	D025 012h	System/Copy firmware	Install version 1.21 or later.	
Data not logged	Some Lockout entries in the Access log are missing	D025 012h	System/Copy firmware	Install version 1.21 or later.	
Password change recorded by mistake	If the Program/Change Administrator screen is opened via WIM and the OK button is pressed	D025 012h	System/Copy firmware	Install version 1.21 or later.	
Password change recorded by mistake	If a new UserCode is added to the address book	D025 012h	System/Copy firmware	Install version 1.21 or later.	

Updated: End of March 2017: Changes in bold *italics*
Model: Model AT-C2

Date: 31-Mar-06

No.: RD025000v

Subject	Symptom	RTB #	Cause	Solution	Note
Users not logged out	User code authentication, and SDK/J on the operation panel	M413 001	VM card firmware	Install version 4.15 or later.	
Users not logged out	If a user was logged in when the On/Off button is used to turn the device off	M413 001e	VM card firmware	Install version 4.24.03 or later.	
Users not logged out	After pressing the "Logout" button on the "User Tools" screen when using CAP with basic authentication.	M413 001e	VM card firmware	Install version 4.24.03 or later.	
Garbled user data	The captured user name is garbled if User Administrator Authentication is enabled	D025 005c	Network DocBox firmware	Install version 1.04 or later.	
Account locked	Repeated failures to login with an IC card	D025 012o	System/Copy firmware	Install version 2.01 or later.	
Account not locked	If User Code authentication is enabled or if "External Optional Counter Type" = 0	D025 012o	System/Copy firmware	Install version 2.01 or later.	
Cannot recognize user	SDK applications cannot recognize whether Administrator or User Authentication is enabled or whether an admin or user has already logged in.	M413 001	VM card firmware	Install version 4.17-01 or later.	
Users logged out	When User Code Authentication is used and an SDK application is installed	M413 001a	VM card firmware	Install version 4.20.04 or later.	
Cannot display user name	Basic Authentication	M413 001b	VM card firmware	Install version 4.21.05 or later.	
Kerberos Authentication	Slow	Gene 050b	Java VM4 Update Tool	Install version 4.26.05 or later.	
Kerberos Authentication	AES-256 used for encryption but was not specified	Gene 050c	Java VM4 Update Tool	Install version 4.28.00 or later.	
		Gene 056c	Java VM v4 for eDC		

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

8. Error Codes

Subject	Symptom	RTB #	Cause	Solution	Note
SC 202		D025 055a	Cracked soldering on polygon mirror motor board	Replace with new ass'y (P/N AX060396).	
SC 203		D025 055a	Cracked soldering on polygon mirror motor board	Replace with new ass'y (P/N AX060396).	
SC 204		D025 055a	Cracked soldering on polygon mirror motor board	Replace with new ass'y (P/N AX060396).	
SC 552	Melted fusing lamp	D025 002d D025 041	Engine firmware	Install version 1.55:09 or later.	220 V model only
SC 555	Melted fusing lamp	D025 002d D025 041	Engine firmware	Install version 1.55:09 or later.	220 V model only
SC 620		D366 001a	ARDF firmware	Install version 03.430:03 or later	
SC 620	Unnecessary occurrences	D025 060	Engine firmware	Install version 1.56:09 or later. If this does not solve the SC, replace the harness that connects the mainframe and ARDF.	
SC 672	If a job containing a BW image is stored on the HDD (e.g. Locked Print) after the machine has just returned from Energy Saver mode. Only for machines with the Media Link Board.	D025 012a	System/Copy firmware	Install version 1.14.3 or later.	
SC 672	If an Internet fax and On-demand E-mail Notification are received while the machine is in energy saver mode	D025 005a	Network DocBox firmware	Install version 1.01 or later.	
SC 687	After a DF jam	D025 002a	Engine firmware	Install version 1.52:09 or later.	
SC 687	Continuous printing of IPDS jobs for 5-6 hours	D025 012b	System/Copy firmware	Install version 1.15 or later.	
SC 816	If the machine receives a ping or ARP while in Energy Saver mode.	D025 007a	Subsystem firmware	Install version F.12 or later.	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2

Date: 31-Mar-06

No.: RD025000v

Subject	Symptom	RTB #	Cause	Solution	Note
SC 816	When the machine enters Auto Off mode from the Ready condition.	D025 012g	System/Copy firmware	Install version 1.20 or later.	
SC 816	If a PC connected by a USB cable enters or recovers from Standby mode (low power mode) while the printer is in STR mode (Energy Saver mode).	D025 007c	Subsystem firmware	Install version F.14 or later.	
SC 816	SC816-38/90	D025 012m	System/Copy firmware	Install version 1.25 or later.	
SC 816	SC816-38/90	D025 007e	Subsystem firmware	Install version F.16 or later.	
SC 816	SC816-49	D025 007e	Subsystem firmware	Install version F.17 or later.	
SC 819	Repeatedly inserting and removing a USB device	D025 006a	Network Support firmware	Install version 8.25 or later.	
SC 819	Quickly inserting then immediately removing USB memory from the USB2.0/SD Slot option	D025 012d	System/Copy firmware	Install version 1.17 or later.	
SC 819	When a print job is interrupted by a paper full condition (during a booklet job) or a toner end condition, after the error is cleared.	D025 002c	Engine firmware	Install version 1.54:09 or later.	
SC 819	When browsing the network using SMB.	D025 006c	Network Support firmware	Install version 8.30 or later.	
SC 863		D025 048	AC voltage to the PSU is cut, causing corruption of data on the HDD. As a result, the fax function cannot boot up.	See the flow chart in the RTB.	
SC 899	After the machine recovers from Energy Saver Mode	D025 012o	System/Copy firmware	Install version 2.01 or later.	
SC 899		D025 003e	Fax firmware	Install version 06.00.00 or later.	
SC 990	When a print job is interrupted by a paper full condition (during a booklet job) or a toner end condition, after the error is cleared.	D025 002c	Engine firmware	Install version 1.54:09 or later.	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

Subject	Symptom	RTB #	Cause	Solution	Note
SC 990	If a paper jam occurs when printing from an EFI controller, the error occurs after the jam is cleared and the job restarted.	D025 012i	System/Copy firmware	Install version 1.22 or later.	
SC 990	Multiple jobs containing at least 50 pages each	D025 012i	System/Copy firmware	Install version 1.22 or later.	
SC 990	When calibrating a Fiery server	D025 061	Apply the required Patch File(s) for E-3100 system version 1.0.		
SC 990	After firmware update with @Remote	D639 014	Due to a Java VM bug, Java VM will not start up correctly if the device is rebooted while an SDK application is starting up.	Install Java f/w version V4.3 or newer.	
SC 991	If DHCP and DDNS are both enabled	D025 006e	Network Support firmware	Install version 8.33 or later.	
SC 997		Gen 028b	Global Scan NX firmware	Install version 1.1.3.0 or later.	
SC 997	After logging out	M413 001	VM card firmware	Install version 4.15 or later.	
SC 997	If the auto-off timer of the device is set to 1 minute and an SDK application is set to automatically start up	M413 001b	VM card firmware	Install version 4.21.05 or later.	
SC 997	Jobs including the "@PJL DEFAULT" environment variable RESOLUTION or BITSPERDOT	D025 008c	Printer firmware	Install version 1.21 or later.	
"Functional problem detected."	Continuous printing of IPDS jobs for 5-6 hours	D025 012b	System/Copy firmware	Install version 1.15 or later.	
"Please wait"	If the main power is turned off during a firmware update, "Please wait" is displayed and the machine cannot be rebooted.	D025 012c	System/Copy firmware	Install version 1.16 or later.	
"Supplies Order Call Failed"	When the @Remote connection is broken/lost.	D025 012i	System/Copy firmware	Install version 1.22 or later.	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

9. Optional Units

Subject	Symptom	RTB #	Cause	Solution	Note
Booklet finisher	Jam with thick paper, A3, stapling and punching	B793 001a	Booklet finisher firmware	Install version 1.24:13 or later.	
Booklet finisher	Paper Jam	B793 002	Dried vaporized glue on the motor shafts causes the motors to lock	Do the procedure in the RTB.	
Booklet finisher	Double (two-way) postcards stop at the punch stack position when fed in the LEF direction.	B793 001c	Booklet finisher firmware	Install version 1.20:13 or later.	
Booklet finisher	Jam 139 if a punched B5 sheet (LEF) is output to the shift tray while a different size (interrupt job) is output to the proof tray.	B793 001c	Booklet finisher firmware	Install version 1.14:07 or later.	
Booklet finisher	Jam 145 if SP6-137-001 (Fin. Free Run 1) is executed.	B793 001c	Booklet finisher firmware	Install version 1.13:06 or later.	
Booklet finisher	Some sheets not stapled properly, which may cause Jam 134.	B793 001c	Booklet finisher firmware	Install version 1.13:06 or later.	
Booklet finisher	The fold is not in the correct position when printing out simplex copies in Booklet mode.	B793 001c	Booklet finisher firmware	Install version 1.13:06 or later.	
Booklet finisher	1-sheet booklet job cannot be folded.	D025 038	Apply the required Patch File(s) for E-3100 system version 1.0.		
Booklet finisher	Booklet job not printed.	D025 031	Defective HDD	Perform the corrective action as described in the RTB	
USB/SD card reader	USB flash drives or SD cards will not be recognized by the device at startup.	D025 006a	Network Support firmware	Install version 8.25 or later.	
USB/SD card reader	Stops working	M413 001b	VM card firmware	Install version 4.21.05 or later.	
USB devices	The machine does not recognize USB devices	D025 012b	System/Copy firmware	Install version 1.15 or later.	
		D025 006c	Network Support firmware	Install version 8.30 or later.	
Card Authentication package	Cannot be installed over an earlier version.	M344 001b	VM card firmware	Install version 4.14 or later.	RTB for VM card option

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2

Date: 31-Mar-06

No.: RD025000v

Subject	Symptom	RTB #	Cause	Solution	Note
E-3100 Controller: More than one patch file may be needed, and the order in which they are applied may be important. See the RTB for the required patch file(s), and the correct procedure to use.					
E-3100 Controller	When printing a very large job to the Document Server, no alert message is displayed on the copier panel.	D025 029	Apply the required Patch File(s) for E-3100 system version 1.0.		
E-3100 Controller	Printed Docs and held jobs cannot be opened from Webtools.	D025 029	Apply the required Patch File(s) for E-3100 system version 1.0.		
E-3100 Controller	Configuration page does not print	D025 035	Apply the required Patch File(s) for E-3100 system version 1.0.		
E-3100 Controller	Some custom color profile settings are not saved.	D025 036	Apply the required Patch File(s) for E-3100 system version 1.0.		
E-3100 Controller	Calibration problem	D025 046	Apply the required Patch File(s) for E-3100 system version 1.0.		
E-3100 Controller	Controller cannot boot up	D025 031	Defective HDD	Perform the corrective action as described in the RTB	
E-3100 Controller	Separator page setting does not work correctly.	D025 054	Apply the required Patch File(s) for E-3100 system version 1.0.		
E-3100 Controller	Alignment Page cannot be printed out on any paper except "Plain" paper.	D025 058	Apply the required Patch File(s) for E-3100 system version 1.0.		
E-3100 Controller	When calibrating a Fiery server	D025 061	Apply the required Patch File(s) for E-3100 system version 1.0.		
E-3100 Controller	The Job List is not displayed in chronological order on the panel.	D025 061	Apply the required Patch File(s) for E-3100 system version 1.0.		
E-3100 Controller	Image Pattern collapses when trying to process a file.	D025 067	Apply the required Patch File(s) for E-3100 system version 1.0.		
E-3100 Controller	HDD space does not change after doing Clear Server	D025 069	Apply the required Patch File(s) for E-3100 system version 1.0.		
E-3100 Controller	Cannot launch Configure window if Java 7u51 is installed.	D025 076	Apply the required Patch File(s) for E-3100 system version 1.0.		
500-sheet finisher	Single-sheet jobs are stapled	D372 001c	500-sheet finisher firmware	Install version 01.100:03 or later.	
Stapling	The final page or the pages near the end of the 1st copy are stapled into the 2nd copy.	D025 002e D025 062	Engine firmware	Install version 1.56:09 or later.	
Shift tray	If a PCL6 job is printed to a shift tray after a PCL5 job, each page of the PCL6 job is shifted instead of each job or copy being shifted.	D025 016e	Option PCL firmware	Install version 1.05 or later.	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

Subject	Symptom	RTB #	Cause	Solution	Note
SDK	Cannot switch between SDK applications	M413 001	VM card firmware	Install version 4.15 or later.	
SDK	Cannot install SDK application	M413 001a	VM card firmware	Install version 4.20.04 or later.	
SDK	SDK application crashes	M413 001a	VM card firmware	Install version 4.20.04 or later.	
SDK	SDK application installed on wrong SD card	M413 001b	VM card firmware	Install version 4.21.05 or later.	
SDK	SDK application locks up	M413 001b	VM card firmware	Install version 4.21.05 or later.	
SDK	SDK application does not load	M413 001c	VM card firmware	Install version 4.22.03 or later.	
SDK	SDK application does not communicate with DNS server	M413 001c	VM card firmware	Install version 4.22.03 or later.	
SDK	Application disappears	Gene 050b	Java VM4 Update Tool	Install version 4.26.05 or later.	
SDK	Application sends wrong original size data	Gene 050c	Java VM4 Update Tool	Install version 4.28.00 or later.	
		Gene 056c	Java VM v4 for eDC		
SDK	Applications do not restart automatically after reboot failure	Gene 050d	Java VM4 Update Tool	Install version 4.29.00 or later.	
		Gene 056c	Java VM v4 for eDC		
SDK	SDK platform does not boot up	Gene 050e	Java VM4 Update Tool	Install version 4.30.00 or later.	
		Gene 056d	Java VM v4 for eDC		

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

10. Image Problems

Subject	Symptom	RTB #	Cause	Solution	Note
Black streaks		D025 002a	Engine firmware	Install version 1.52:09 or later.	
Missing characters	PCL Configuration/Font Page	D025 016a	Option PCL Firmware	Install version 1.01 or later.	
Missing characters	Missing from the printouts of jobs containing HP-GL/2.	D025 016e	Option PCL firmware	Install version 1.05 or later.	
Missing characters	Character disappears at random when an EPS file is printed	D025 054	Apply the required Patch File(s) for E-3100 system version 1.0.		
Missing graphics	Part of pentagon shaped graphics not printed.	D025 016a	Option PCL Firmware	Install version 1.01 or later.	
Single pages split into two	Single page PCL jobs containing a Vertical Cursor Positioning command are split in two and printed on 2 pieces of paper.	D025 016a	Option PCL Firmware	Install version 1.01 or later.	
Color separation	Separation of CMY and K parts of images, if the same image is used on multiple pages with different orientations, and if margin adjustments (operation panel setting) had been applied.	D025 012i	System/Copy firmware	Install version 1.22 or later.	
Images combined and printed on one page	Color jobs without collation: If a batch of A3 print jobs is followed by a batch of A4 print or copy jobs	D025 012i	System/Copy firmware	Install version 1.22 or later.	
Vertical lines	Vertical black or colored lines intervals of 110 mm (the pitch of the drum).	D025 052	Lubrication shaft not grounded	Ground plate modified	See the RTB for how to install the new plate.
Areas printed in the wrong colour	Overlapping portions of objects are printed in black even if they were not black objects.	D025 016d	Option PCL firmware	Install version 1.04 or later.	
Horizontal lines	Black or coloured, parallel to paper feed direction	D025 056	Dirty charge roller	Depending on counter values (see the RTB), change the drum unit or clean the charge roller. If cleaning the charge roller does not work, change the drum unit.	See the RTB for detailed procedures.

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

Subject	Symptom	RTB #	Cause	Solution	Note
Dirty background		D025 056	Dirty charge roller	Depending on counter values (see the RTB), change the drum unit or clean the charge roller. If cleaning the charge roller does not work, change the drum unit.	See the RTB for detailed procedures.
Dirty background	White backgrounds of 1200 or 600 dpi images are printed in color.	D025 016e	Option PCL firmware	Install version 1.05 or later.	
Objects in the wrong position	In PCL5 jobs containing HP-GL/2 and macro.	D025 016e	Option PCL firmware	Install version 1.05 or later.	
Image partly blacked out	After image rotation	D025 016e	Option PCL firmware	Install version 1.05 or later.	
Image partly blacked out	When printing a PCL job that contains black and white	D025 016f	Option PCL firmware	Install version 1.06 or later.	
Image problem (undefined)	When receiving a JBIG (B) fax from a Xerox machine.	D025 020d	FCU firmware	Install version 07.00.00 or later.	
Text overlaps	Some texts overlap each other.	D025 029	Apply the required Patch File(s) for E-3100 system version 1.0.		
Gradation	Gradation images print incorrectly with setting Composite Overprint: ON	D025 057	Apply the required Patch File(s) for E-3100 system version 1.0.		
Color missing	Cyan color is not printed, when the job is printed with the default settings.	D025 061	Apply the required Patch File(s) for E-3100 system version 1.0.		
Cropped image	The image is cropped for a particular file after applying the 1-185XQN patch.	D025 067	Apply the required Patch File(s) for E-3100 system version 1.0.		
Scale to Fit and Full Bleed	Do not always work properly in combination.	D025 065	Apply the required Patch File(s) for E-3100 system version 1.0.		
Lines added or missing	If a PCL5 job contains a picture frame that is drawn by HP/GL2	D025 016f	Option PCL firmware	Install version 1.06 or later.	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

11. Mechanical Problems

Subject	Symptom	RTB #	Cause	Solution	Note
Motor operates at the wrong time	The fusing exit motor continues rotating after the job is completed.	D025 002a	Engine firmware	Install version 1.52:09 or later.	
Original not detected	After recovery from Energy Saver Mode	D025 012m	System/Copy firmware	Install version 1.25 or later.	
		D025 007e	Subsystem firmware	Install version F.16 or later.	
ADF not detected	After recovery from Energy Saver Mode	D025 012m	System/Copy firmware	Install version 1.25 or later.	
		D025 007e	Subsystem firmware	Install version F.16 or later.	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

12. Others

Subject	Symptom	RTB #	Cause	Solution	Note
Machine stalls	If the machine receives a ping or ARP while in Energy Saver mode.	D025 007a	Subsystem firmware	Install version F.12 or later.	
Machine stalls	When 150 or more jobs are printed continuously.	D025 012c	System/Copy firmware	Install version 1.16 or later.	
Machine stalls	If a job is submitted with user name and password at the same time as someone is logging into the device with an IC card	M344 001b	VM card firmware	Install version 4.14 or later.	RTB for VM card option
Machine stalls	If a user logs in and out repeatedly using an IC card (Card Authentication Package option) at the same time as the address book is being updated by a delivery server such as ScanRouter	D025 012e	System/Copy firmware	Install version 1.18 or later.	
Machine stalls	Users prevented from printing in color (via UserCode authentication) crash the printer if they try to print multiple stored BW jobs.	D025 008c	Printer firmware	Install version 1.21 or later.	
Machine stalls	If the Auto Continue setting is "Immediate" and the source tray runs out of paper	D025 008d	Printer firmware	Install version 1.21.1 or later.	
Machine stalls	A print job is submitted while another print job is already being processed	D025 012i	System/Copy firmware	Install version 1.22 or later.	
Machine stalls	A print job is submitted while the TWAIN driver is scanning	D025 012i	System/Copy firmware	Install version 1.22 or later.	
Machine stalls	When using certain fonts	D025 016d	Option PCL firmware	Install version 1.04 or later.	
Machine stalls	If the driver's "CMYK Simulation Profile" setting is anything other than OFF	D025 017c	PS3/PDF firmware	Install version 1.03 or later.	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

Subject	Symptom	RTB #	Cause	Solution	Note
Machine stalls	When printing documents that have more than 65,535 Bezier curves	D025 016e	Option PCL firmware	Install version 1.05 or later.	
Machine stalls	While forwarding an image to the fax folder	D025 020d	FCU firmware	Install version 07.00.00 or later.	
Machine stalls	Using the MLB	D025 005c	Network DocBox firmware	Install version 1.04 or later.	
Machine stalls	If User Authentication settings are changed many times	M413 001	VM card firmware	Install version 4.17-01 or later.	
Machine stalls	If the password of a stored file is changed	D025 012o	System/Copy firmware	Install version 2.01 or later.	
Scanning stalls	If a print job is already being processed	D025 012i	System/Copy firmware	Install version 1.22 or later.	
Scanning stalls	"Updating the destination List. Please wait..." is on the operation panel. This occurs if the address book is updated via ScanRouter in Sleep Mode.	D025 011a	Scanner firmware	Install version 1.19 or later.	
Scanning stalls	If the privileges of a Stored File are changed.	D025 012h	System/Copy firmware	Install version 1.21 or later.	
Scanning stalls	Trying and failing to login to a Scan destination three times	D025 006c	Network Support firmware	Install version 8.30 or later.	
Incorrect characters printed	On the Scanner Sending History in certain regions.	D025 011a	Scanner firmware	Install version 1.20 or later.	
Debug log	The setting that controls access to the Debug Log (SP5842-001 bit #7) has no effect.	D025 005a	Network DocBox firmware	Install version 1.02 or later.	
Energy saver mode	Cannot stay in Energy Saver mode if the On Board NIC is disabled (SP5-985-001 = 0).	D025 007a	Subsystem firmware	Install version F.12 or later.	
Energy saver mode	Does not reply to an IPv6 ping while in Energy Saver mode.	D025 007b	Subsystem firmware	Install version F.13 or later.	
Energy saver mode	No recovery from energy saver mode	D025 012j	System/Copy firmware	Install version 1.23 or later.	
Energy saver mode	Cannot enter energy saver mode	M413 001a	VM card firmware	Install version 4.20.04 or later.	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

Subject	Symptom	RTB #	Cause	Solution	Note
Energy saver mode	Machine enters sleep mode instead of energy saver mode	M413 001a	VM card firmware	Install version 4.20.04 or later.	
Firmware update	Fails when done from an SD card	D025 012b	System/Copy firmware	Install version 1.15 or later.	
Firmware update	Cannot recover from firmware update failure	D025 002b	Engine firmware	Install version 01.53:09 or later.	
Firmware update	"Update done" is not displayed after the SubSystem firmware is updated	D025 012f	System/Copy firmware	Install version 1.19 or later.	
Firmware update	Program number "D3775901" version update fails.	Gene 050b	Java VM4 Update Tool	Install version 4.25.07a or later.	
Jobs go to the wrong tray	After a PCL5 job is printed, all PCL6 jobs after that will be output to the same tray as the PCL5 job.	D025 016a	Option PCL firmware	Install version 1.01 or later.	
Printing is slow	Jobs smaller than 2Kb cause slow printing if the Printer Language is AUTO.	D025 008d	Printer firmware	Install version 1.21.1 or later.	
Printing is slow	The use of SDK applications that access the GPS Filter (such as the PDL filter)	D025 008e	Printer firmware	Install version 1.22 or later.	
Printing is slow	If Windows Authentication is on, printing a large number of copies takes a long time	D025 006d	Network Support firmware	Install version 8.31 or later.	
Setting changes not applied	If either of the WSD Printer or Netware functions are enabled	D025 006b	Network Support firmware	Install version 8.27 or later.	
Setting changes not applied	The timer used for the "Access Violation" setting's time interval	D025 012o	System/Copy firmware	Install version 2.01 or later.	
Some jobs not shown	Stored jobs (Locked Print, Sample Print, etc.) not shown in the operation panel if the DOS Unit is installed.	D025 012i	System/Copy firmware	Install version 1.22 or later.	
Settings revert to defaults	Network configuration settings	D025 006d	Network Support firmware	Install version 8.31 or later.	
Unexpected behavior	Unexpected behavior during printing	D025 031	Defective HDD	Perform the corrective action as described in the RTB	

Updated: End of March 2017: Changes in bold italics

Model: Model AT-C2	Date: 31-Mar-06	No.: RD025000v
--------------------	-----------------	----------------

Subject	Symptom	RTB #	Cause	Solution	Note
Unexpected behavior	After internal file open and close operations, such as SDK application installation.	Gene 050b	Java VM4 Update Tool	Install version 4.26.05 or later.	
		Gene 056a	Java VM v4 for eDC	Install version 4.27.00 or later.	
Hard disk	Formatting timeout (EFI controller HDD) when reloading system software after replacing the hard disk	Gen RTB 060	The usable storage capacity of the HDD mentioned above was not "capped"	Replace the HDD with the following: D5021020 (clipped from 500GB to 80GB)	
Memory leak	Using an SDK application	M413 001	VM card firmware	Install version 4.15 or later.	
Memory leak	If the Auto Logout timer is On	D025 012o	System/Copy firmware	Install version 2.01or later.	
Counters	Development counter error when printing from the Document Server.	D025 072	Apply the required Patch File(s) for E-3100 system version 1.0.		
"NullPointerException"		Gene 050c	Java VM4 Update Tool	Install version 4.28.00 or later.	
		Gene 056c	Java VM v4 for eDC		