

Model: Adonis-C1		Date: 23-Jan-01	No.: MA283006
Modified Article: Printer Firmware History		Prepared by: S. Tomoe	
From: Technical Services Dept., GTS Division			
Reason for Modification:	<input type="checkbox"/> Parts catalog correction <input type="checkbox"/> To facilitate assembly <input type="checkbox"/> Part standardization	<input type="checkbox"/> Vendor change <input type="checkbox"/> To improve reliability <input checked="" type="checkbox"/> Other	<input type="checkbox"/> To meet standards ()

Printer firmware history for the Adonis-C1

Other Models

B3586080	Version	C. SUM	Production
A	1.88	03E4	1st Mass Prod.
B	1.92	D344	May Prod. '00
C	1.97	1769	November Prod. '00

Lanier Models

B3586081	Version	C. SUM	Production
A	1.88	03E4	1st Mass Prod.
B	1.92	D344	May Prod. '00
C	1.97	1769	November Prod. '00

Symptom Corrected	Other models	Lanier
<i>After Danish has been set as the language, extra characters are printed out.</i>	C	C
<i>When the Dazel system is used, there is no job completion notification.</i>	C	C
<i>-With PortNavi, the job completion notification is either printed out but incorrect, or is not printed out at all. -Jobs performed without using registered user codes do not appear on the job history list.</i>	C	C
This firmware has been modified to support Job MIB.	B	B
This version is DAZEL certified.	B	B
The position of the image is different when using the PCL driver vs. the PS driver.	B	B
The firmware has been modified to allow downloading of document formats.	B	B
This firmware has been modified to support Page Count MIB.	B	B
SC2001 sometimes occurs during a print job if Auto Tray Select has been selected.	B	B
SC365 sometimes occurs during a duplex print job.	B	B
A paper jam sometimes occurs after Auto Reset has been performed.	B	B
Any of the fonts that have been downloaded to the HDD can be set as the default font.	B	B

Reissued: 08-Mar-01

Model: Adonis-C1	Date: 24-Jan-01	No.: RA283006a
------------------	-----------------	----------------

RTB Correction

The items in bold italics have been corrected or added.

Subject: Printer Firmware History		Prepared by: S. Tomoe	
From: Technical Services Dept., GTS Division			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input checked="" type="checkbox"/> Other ()		

Printer firmware history for the Adonis-C1.

Other Models

B3586080	Version	C. SUM	Production
A	1.88	03E4	1st Mass Prod.
B	1.92	D344	May Prod. '00
C	1.97	1769	November Prod. '00
<i>D</i>	<i>1.98</i>	<i>576D</i>	<i>February Prod. '01</i>

Lanier

B3586081	Version	C. SUM	Production
A	1.88	03E4	1st Mass Prod.
B	1.92	D344	May Prod. '00
C	1.97	1769	November Prod. '00
<i>D</i>	<i>1.98</i>	<i>576D</i>	<i>February Prod. '01</i>

Symptom Corrected	Other models	Lanier
<i>When performing a mixed copy job with Letter and Legal paper, the machine does not switch between the trays from an AS400 system.</i>	<i>D</i>	<i>D</i>
<i>Grid lines do not appear on MS-Excel originals.</i>	<i>D</i>	<i>D</i>
<i>When printing from an SAP application, extra sheets of paper are fed.</i>	<i>D</i>	<i>D</i>

Reissued: 13-Feb-02

Model: Adonis-C1	Date: 24-Jan-01	No.: RA283006b
------------------	-----------------	----------------

RTB Correction

The items in bold italics have been corrected or added.

Subject: Printer Firmware History		Prepared by: S. Tomoe	
From: Technical Services Dept., GTS Division			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input checked="" type="checkbox"/> Other ()		

Printer firmware history for the Adonis-C1

For Models other than Lanier

B3586080	Version	C. SUM	Production
A	1.88	03E4	1st Mass Prod.
B	1.92	D344	May Prod. '00
C	1.97	1769	November Prod. '00
D	1.98	576D	February Prod. '01
<i>E</i>	<i>2.01</i>	<i>BC8F</i>	<i>September Prod. '01</i>

For Lanier Models

B3586081	Version	C. SUM	Production
A	1.88	03E4	1st Mass Prod.
B	1.92	D344	May Prod. '00
C	1.97	1769	November Prod. '00
D	1.98	576D	February Prod. '01
<i>E</i>	<i>2.01</i>	<i>BC8F</i>	<i>September Prod. '01</i>

Symptom Corrected	Other models	Lanier
<i>SmartNetMonitor shows the wrong total counter value.</i>	<i>E</i>	<i>E</i>
<i>The right edge of the image is missing when printing out from an AS400 system.</i>	<i>E</i>	<i>E</i>
<i>Cannot perform auto conversion for A4/Letter.</i>	<i>E</i>	<i>E</i>

Reissued: 18-Feb-02

Model: Adonis-C1	Date: 24-Jan-01	No.: RA283006c
------------------	-----------------	----------------

RTB Correction

The items in bold italics have been corrected or added.

Subject: Printer Firmware History		Prepared by: S. Tomoe	
From: Technical Services Dept., GTS Division			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input checked="" type="checkbox"/> Other ()		

Printer firmware history for the Adonis-C1.

For Models Other than Lanier

B3586080	Version	C. SUM	Production
A	1.88	03E4	1st Mass Prod.
B	1.92	D344	May Prod. '00
C	1.97	1769	November Prod. '00
D	1.98	576D	February Prod. '01
E	2.01	BC8F	September Prod. '01
<i>F</i>	<i>2.02</i>	<i>B89C</i>	<i>February Prod. '02</i>

For Lanier Models

B3586081	Version	C. SUM	Production
A	1.88	03E4	1st Mass Prod.
B	1.92	D344	May Prod. '00
C	1.97	1769	November Prod. '00
D	1.98	576D	February Prod. '01
E	2.01	BC8F	September Prod. '01
<i>F</i>	<i>2.02</i>	<i>B89C</i>	<i>February Prod. '02</i>

Symptom Corrected	Other models	Lanier
<i>After NIB reset has been performed, "NIB Initializing" is sometimes displayed, and the machine does not enter stand-by mode.</i>	<i>F</i>	<i>F</i>
<i>When using the Smart Net Monitor, sometimes nothing is printed out.</i>	<i>F</i>	<i>F</i>
<i>When printing two pages from a UNIX system, a blank page may be inserted in between.</i>	<i>F</i>	<i>F</i>

Reissued: 1-Jul-03

Model: Adonis-C1	Date: 24-Jan-01	No.: RA283006d
------------------	-----------------	----------------

RTB Correction

The items in bold italics have been corrected or added.

Subject: Printer Firmware History		Prepared by: S. Tomoe	
From: 1st Tech. Support Sec. Service Support Dept.			
Classification:	<input type="checkbox"/> Troubleshooting <input type="checkbox"/> Mechanical <input type="checkbox"/> Paper path <input checked="" type="checkbox"/> Other ()	<input type="checkbox"/> Part information <input type="checkbox"/> Electrical <input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Action required <input type="checkbox"/> Service manual revision <input type="checkbox"/> Retrofit information

Printer firmware history for the Adonis-C1.

(For Other Models)

B3586080	Version	C. SUM	Production
A	1.88	03E4	1st Mass Prod.
B	1.92	D344	May Prod. '00
C	1.97	1769	November Prod. '00
D	1.98	576D	February Prod. '01
E	2.01	BC8F	September Prod. '01
F	2.02	B89C	February Prod. '02
<i>G</i>	<i>2.03</i>	<i>2E14</i>	<i>March Prod. '02</i>
<i>H</i>	<i>2.05</i>	<i>5112</i>	<i>May Prod. '02</i>

(For Lanier Models)

B3586081	Version	C. SUM	Production
A	1.88	03E4	1st Mass Prod.
B	1.92	D344	May Prod. '00
C	1.97	1769	November Prod. '00
D	1.98	576D	February Prod. '01
E	2.01	BC8F	September Prod. '01
F	2.02	B89C	February Prod. '02
<i>G</i>	<i>2.03</i>	<i>2E14</i>	<i>March prod. '02</i>
<i>H</i>	<i>2.05</i>	<i>5112</i>	<i>May Prod. '02</i>

Reissued: 1-Jul-03

Model: Adonis-C1	Date: 24-Jan-01	No.: RA283006d
------------------	-----------------	----------------

Symptom Corrected	Other models	Lanier
<i>All characters from Euro symbol sets are printed out in Arial regardless of the font selected (except for Times New Roman).</i>	<i>H</i>	<i>H</i>
<i>Added Euro symbol sets (containing the Euro currency symbol) to match the capability of HP printers (PCL5e, PCLXL).</i>	<i>G</i>	<i>G</i>
<i>A PS job is deleted when the Bypass tray is selected as the default tray in the PS driver.</i>	<i>G</i>	<i>G</i>
After NIB reset has been performed, "NIB Initializing" is sometimes displayed, and the machine does not enter stand-by mode.	F	F
When using the Smart Net Monitor, sometimes nothing is printed out.	F	F
When printing two pages from a UNIX system, a blank page may be inserted in between.	F	F
SmartNetMonitor shows wrong total counter value.	E	E
The right edge of the image is missing when printing out from the AS400.	E	E
Cannot perform auto conversion for A4/Letter.	E	E
When performing a mixed copy job with Letter and Legal, the machine does not switch between the trays from an AS400 system.	D	D
Grid lines do not appear on MS-Excel originals.	D	D
When printing from an SAP application, extra sheets of paper are fed.	D	D
After Danish has been set as the language, extra characters are printed out.	C	C
When the Dazel system is used, there is no job completion notification.	C	C
-With PortNavi, the job completion notification is either printed out but incorrect, or is not printed out at all. -Jobs performed without using registered user codes do not appear on the job history list.	C	C
This firmware has been modified to support Job MIB.	B	B
This version is DAZEL certified.	B	B
The position of the image is different when using the PCL driver vs. the PS driver.	B	B
The firmware has been modified to allow downloading of document formats.	B	B
This firmware has been modified to support Page Count MIB.	B	B
SC2001 sometimes occurs during a print job if Auto Tray Select has been selected.	B	B
SC365 sometimes occurs during a duplex print job.	B	B
A paper jam sometimes occurs after Auto Reset has been performed.	B	B
Any of the fonts that have been downloaded to the HDD can be set as the default font.	B	B