

Model: Model S-C3		Date: 15-Mar-07	No.: RB872001
Subject: ADF parts change for paper slipping noise		Prepared by: Y.Yoshida	
From: 1st Tech. Support Sec. Service Support Dept.			
Classification:	<input checked="" type="checkbox"/> Troubleshooting <input type="checkbox"/> Mechanical <input type="checkbox"/> Paper path <input type="checkbox"/> Product Safety	<input type="checkbox"/> Part information <input type="checkbox"/> Electrical <input type="checkbox"/> Transmit/receive <input type="checkbox"/> Other ()	<input type="checkbox"/> Action required <input type="checkbox"/> Service manual revision <input type="checkbox"/> Retrofit information

SYMPTOM

During a duplex job, the sound of paper slipping can be heard during the switchback stage.

Cause

The tension on the tension belt for the torque limiter is too high. As a result, the reverse roller stops too suddenly and the paper slips on the roller.

Solution

Install the following parts if the symptom is reported:

- Bracket: Mortor: PaperFeed B8724141
- Roller: Reverse: Drive B8723261
- Flange: Pulley B7894257 (Newly-added part)

Cut-in Serial Number:

M0477400175

3. Original Feed 2 (B872)

