RIGOH

Technical Bulletin

PAGE: 1/1

Reissued: 30-Apr-99

| | . | |
|----------------------------|-----------------|----------------|
| Model: F401/411/421/C-Bird | Date: 15-Apr-99 | No.: RA175012a |

RTB Correction

The items (cut-in serial number) in bold italics have been corrected.

| · · · · · · · · · · · · · · · · · · · | , | | |
|---------------------------------------|-----------------------------|----------------|----------------------------|
| Subject: DJF So | ftware Modification History | | Prepared by: F. Noguchi |
| From: Technical | Service Dept., GTS Division | | |
| Classification: | | Part informa | • |
| | | Electrical | Service manual revision |
| | ☐ Paper path | ☐ Transmit/red | ceive Retrofit information |
| | Other () | | |

DJF modifications and history are as follows.

Main ROM(A6105820) modification history

| Suffix | Description | Cut-in Serial Number |
|--------|--|--|
| С | This ROM was used from the first production run. | A610-15: A16060001 |
| | | A610-17: A7146060001 |
| | | A610-22: AB86060001 |
| | T | A610-26: J90660001 |
| D | To prevent original jams: | Not implemented |
| | In the limitless mode, if a new original is fed while the | |
| | paper trays are being switched, a jam will occur. | A040 45 0A40400004 |
| E | This version is the same as that of "C". | A610-15: 6A16120001 |
| | Notes | A610-17: A7146110001 |
| | A software change will not prevent original jams in the | A610-22: AB87010001 |
| | limitless mode if a new original is fed while the paper | A610-26: 3J90170001 |
| | trays are being switched. | |
| | Since the occurrence rate of this problem is extremely low, this is being treated as a product limitation. | |
| F | Standardization with the Penguin series | A610-15: 6A18030001 |
| - | Standardization with the Penguin Series | A610-13: 6A16030001 A610-17: A714803000 |
| | | A610-22: AB88030001 |
| | | A610-26: 3J90680001 |
| G | To prevent the following problems when the 2 in 1 mode | A610-15: 6A18060001 |
| | is used: | A610-17: A7148060001 |
| | The machine stops (but the print key remains red) after | A610-22: AB88060001 |
| | the job if the number of originals and the number | A610-26: 3J90680001 |
| | input on the main unit differ. | |
| | After an odd number of originals is used, the image in | |
| | the next copy job is elongated or a paper jam | |
| | occurs. | |
| Н | To prevent original non-feed out in European version | A610-15: 6A18100001 |
| | main frame machines: | A610-17: A7148100001 |
| | Due to the difference in the feed-in and feed-out timing | A610-22: AB88100001 |
| | for the B6Y size paper, three originals will be set on the | A610-26: 3J91080001 |
| | exposure glass at the same time as opposed to two. | |