

Model: CH-C1 Pro Color Controller E-42B		Date: 16-Jul-13	No.: RD728001
Subject: Composite Patch (1-1K7B08.exe) release note for Color Controller E-42B System Software Version 1.0		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release note for **PLP(Post Launching Patch)** for System Software Version 1.0 for Color Controller E-42B.

Table of contents:

- **About this Post Launching Patch**
- **Issues addressed with the PLP**
- **Preparation**
- **Patch installation instructions.**

About this Post Launching Patch

Files included in this release	
File name	File size
1-1K7B08.exe	14.7 MB

Product name

Color Controller E-42B Ver.1.0

Notes:

- This patch is already applied from the 1st lot of mass-production units.
- There are **no prerequisites** for installing the **PLP (1-1K7B08)**.
- If you wish to **reinstall the system**, install the patches as follows:
System software Ver1.0 + **PLP (1-1K7B08)**

Issues addressed with the PLP

This **PLP** addresses the following defects:

- When printing subset job in which "Fold" was specified, the wrong error message is displayed.
- When the copier is in SP mode, remote scan is available.
- Printing of the parameter of configuration sheet is thin.
- Print job is left in the Job List after recovery from the STR mode.
- The description about the Output Profile differs from the specification.
- Making Paper catalog in engine makes different name in CWS.
- A6,B6,Post card,etc are not made in Paper catalog.
- Cannot start printing with "Processing" status if a job is sent in STR status.
- SC919 occurs after paper jam recovery with Compose job.
- "Video Board Internal Error" occurred after cancelling multiple jobs.
- The name of paper catalog is not displayed correctly.
- When specific paper catalog is added, SC899 occurs.
- Fiery has Chinese.
- If the Energy Saver mode is triggered on keyboard screen, Panel is stuck with dark screen.
- A waiting job doesn't start if many composed jobs are sent and cancelled continuously.

Model: CH-C1 Pro Color Controller E-42B	Date: 16-Jul-13	No.: RD728001
---	-----------------	---------------

- Print does not start after paper jam with A4/A3+Bypass tray.
- Cannot resume from Suspend while sending and printing massive jobs.
- Copy count on the Panel is less than actual count when the Paper End occurred during Staple job

Preparation

1. Known issues listed below, read before installing **1-1K7B08.exe** patch:

None.

2. The following prerequisites must be installed in the order specified before the **1-1K7B08.exe** patch is installed:

None.

3. Do NOT install any of the following patch(es) after installing the **1-1K7B08.exe** patch. If you must install any of the patch(es) below, do so before installing the **1-1K7B08.exe** patch:

None.

4. This patch is exclusive. It must be installed by itself, and the server must be rebooted once. After the reboot, other patches may be installed.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **1-1K7B08.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, **please wait up to 60 seconds until the file is done processing.**
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (*If you choose to Restart later, make sure you manually reboot the server for the changes to take effect*)
6. Wait until the Fiery controller reaches Idle, print the Configuration page.
7. Verify that the **System Updates Log** section contains the patch number **1-1K7B08**.

Model: CH-C1 Pro Color Controller E-42B		Date: 22-Jul-13	No.: RD728002
Subject: Important notes for installing the Color Controller E-42B		Prepared by: C.Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input checked="" type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input type="checkbox"/> Other ()	<input type="checkbox"/> Tier 2

This Technical Bulletin contains important notes concerning the installation of the Color Controller E-42B for Model CH-C1.

Approved Firmware for the Model CH-C1 for connection with the E-42B Controller

Make sure that the firmware modules for Model CH-C1 are upgraded as follows at the E-42B installation.

- Engine: D1365520E / 1.22:08 or newer
- System Copy: D1365760D / 1.04 or newer
- TDCU: D1365530F / 2.00.4:04 or newer
- LCDC (OpePanel): D1365790B / 1.04 or newer
- FAX: D1365762C / 3.00.00 or newer
- Network Support (Websys): D1365765C / 1.11 or newer
- Network DocBox: D1365770B / 1.01 or newer

SP mode setting for E-42B Controller

As written in the service manual, the following SP value of Model CH-C1 must be changed at the E-42B installation.

SP#: 5193-001

Value: **1** (Default:0)

*The valid external controller will be specified as “Fiery controller”.

SP#: 5895-001

Value: **1** (Default:0)

*This setting disables the pre-installed GW printer feature.

GW printer must be disabled when using E-42B.

Note: If all machine data is cleared with the “Erase All Memory” security function, these SP values are also cleared to Default:0.

Model: CH-C1 Pro Color Controller E-42B

Date: 22-Jul-13

No.: RD728002

Information: System Software DVD/User DVD is included in the box.

System Software DVD/User DVD are included in the product carton box. These DVDs should be used when the controller has any problem (system software problem, HDD replacement, etc.).

On the System Software DVD label, it is printed “For Service Only”.

The USB Prep Tool (a utility that lets you install the system software from a USB drive) will be provided via the firmware download site.

USB Prep Tool Ver.1.3.2 or newer must be used for E-42B.

Reissued: 06-Sep-13

Model: CH-C1 Pro Color Controller E-42B	Date: 16-Jul-13	No.: RD728001a
---	-----------------	----------------

RTB Correction

The items **colored in BLUE** have been corrected or added.

Subject: Composite Patch (1-1K7B08.exe) release note for Color Controller E-42B System Software Version 1.0		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

IMPORTANT NOTICE

This patch is no longer distributed to the field due to the following reason:

*** Installation of patch “1-1K7B08.exe” is unnecessary as the same fix is included in the succeeding patch “1-1KIRSX.exe”.**

See RTB No. RD728003 for details on “1-1KIRSX.exe”.

This RTB has been issued to announce the release note for **PLP(Post Launching Patch)** for System Software Version 1.0 for Color Controller E-42B.

Table of contents:

- **About this Post Launching Patch**
- **Issues addressed with the PLP**
- **Preparation**
- **Patch installation instructions.**

About this Post Launching Patch

Files included in this release	
File name	File size
1-1K7B08.exe	14.7 MB

Product name

Color Controller E-42B Ver.1.0

Notes:

- This patch is already applied from the 1st lot of mass-production units.
- There are **no** prerequisites for installing the **PLP (1-1K7B08)**.
- If you wish to **reinstall the system**, install the patches as follows:
System software Ver1.0 + **PLP (1-1K7B08)**

Issues addressed with the PLP

Reissued: 06-Sep-13

Model: CH-C1 Pro Color Controller E-42B	Date: 16-Jul-13	No.: RD728001a
--	------------------------	-----------------------

This **PLP** addresses the following defects:

- When printing subset job in which "Fold" was specified, the wrong error message is displayed.
- When the copier is in SP mode, remote scan is available.
- Printing of the parameter of configuration sheet is thin.
- Print job is left in the Job List after recovery from the STR mode.
- The description about the Output Profile differs from the specification.
- Making Paper catalog in engine makes different name in CWS.
- A6,B6,Post card,etc are not made in Paper catalog.
- Cannot start printing with "Processing" status if a job is sent in STR status.
- SC919 occurs after paper jam recovery with Compose job.
- "Video Board Internal Error" occurred after cancelling multiple jobs.
- The name of paper catalog is not displayed correctly.
- When specific paper catalog is added, SC899 occurs.
- Fiery has Chinese.
- If the Energy Saver mode is triggered on keyboard screen, Panel is stuck with dark screen.
- A waiting job doesn't start if many composed jobs are sent and cancelled continuously.
- Print does not start after paper jam with A4/A3+Bypass tray.
- Cannot resume from Suspend while sending and printing massive jobs.
- Copy count on the Panel is less than actual count when the Paper End occurred during Staple job

Preparation

1. Known issues listed below, read before installing **1-1K7B08.exe** patch:
None.
2. The following prerequisites must be installed in the order specified before the **1-1K7B08.exe** patch is installed:
None.
3. Do NOT install any of the following patch(es) after installing the **1-1K7B08.exe** patch.
If you must install any of the patch(es) below, do so before installing the **1-1K7B08.exe** patch:
None.
4. This patch is exclusive. It must be installed by itself, and the server must be rebooted once. After the reboot, other patches may be installed.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **1-1K7B08.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.

Reissued: 06-Sep-13

Model: CH-C1 Pro Color Controller E-42B	Date: 16-Jul-13	No.: RD728001a
---	-----------------	----------------

4. Before rebooting the system, to ensure that the patch file is completely processed, **please wait up to 60 seconds until the file is done processing.**
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (*If you choose to Restart later, make sure you manually reboot the server for the changes to take effect*)
6. Wait until the Fiery controller reaches Idle, print the Configuration page.
7. Verify that the **System Updates Log** section contains the patch number **1-1K7B08**.

Reissued: 10-Apr-14

Model: CH-C1 Color Controller E-42B	Date: 30-Aug-13	No.: RD728003a
-------------------------------------	-----------------	----------------

RTB Correction

The items **colored in BLUE** have been corrected or added.

Subject: Composite Patch (1-1KIRSX.exe) release note for Color Controller E-42B System Software Version 1.0		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	<input type="checkbox"/> Tier 2

IMPORTANT NOTICE

This patch is no longer distributed to the field due to the following reason:

*** Installation of patch “1-1KIRSX.exe” is unnecessary as the same fix is included in the succeeding patch “1-1KPCFP.exe”.**

See RTB No. RD728005 for details on “1-1KPCFP.exe”.

This RTB has been issued to announce the release note for Composite Patch for System Software Version 1.0 for Color Controller E-42B.

Table of contents:

- **About this Composite Patch**
- **Issues addressed with the Composite Patch**
- **Important Notes**
- **Patch installation instructions**

About this Composite Patch

Files included in this release	
File name	File size
1-1KIRSX.exe	28.80 MB

Product name

Color Controller E-42B Ver.1.0

Note:

- This patch includes not only new corrections but also previous corrections that was included in the previous patch 1-1K7B08.exe

Therefore, 1-1K7B08.exe is no more necessary to install on system ver.1.0.

Reissued: 10-Apr-14

Model: CH-C1 Color Controller E-42B	Date: 30-Aug-13	No.: RD728003a
-------------------------------------	-----------------	----------------

Issues addressed with the Composite Patch (1-1KIRSX.exe)

1) New corrections:

- Cannot print the job with Cover Interposer Tray which is specified by Paper Catalog.
- On CommandWorkStation, copies column of some Sequential Print job become empty.
- Scan jam occurs after pressing the Interrupt button twice==>Remove Paper==>Press the Start button.
- Back cover paper handling does not work correctly with paper catalog.
- "Add as Smart media for BypassTray" does not work if 7.25x10.5inch SEF is set in Bypass Tray.
- "Unknown error" occurs when Gangup is set with particular file.
- When Paper Catalog is used with Auto Tray Select mode, printing with interposer tray may not work correctly.
- When the page range of a printed job is changed and re-printed, print job may stall.
- SEF paper is always required if cover page print is specified with Auto Tray select mode.
- Fiery connection is lost when attempting to print without entering a user code that is not allowed to print in color mode.
- Fiery connection is lost when attempting to print without entering a user code that is not allowed to print in color mode.
- With Mac PC, when ColorWise is set to OFF, sometimes single color data (CMY) is printed in two colors.
- Even if LEF paper is loaded in Tray 1, in some cases, SEF paper is required for printing the PS test page.
- Paper end error popup shows two times.
- Some images of E-42B shows incorrect on the WebTools or Command Wokstation..

2) Common corrections with previous patch 1-1K7B08.exe:

- When printing subset job in which "Fold" was specified, the wrong error message is displayed.
- When the copier is in SP mode, remote scan is available.
- Printing of the parameter of configuration sheet is thin.
- Print job is left in the Job List after recovery from the STR mode.
- The description about the Output Profile differs from the specification.
- Making Paper catalog in engine makes different name in CWS.
- A6,B6,Post card,etc are not made in Paper catalog.
- Cannot start printing with "Processing" status if a job is sent in STR status.
- SC919 occurs after paper jam recovery with Compose job.
- "Video Board Internal Error" occurred after cancelling multiple jobs.
- The name of paper catalog is not displayed correctly.
- When specific paper catalog is added, SC899 occurs.
- Fiery has Chinese.
- If the Energy Saver mode is triggered on keyboard screen, Panel is stuck with dark screen.
- A waiting job doesn't start if many composed jobs are sent and cancelled continuously.
- Print does not start after paper jam with A4/A3+Bypass tray.
- Cannot resume from Suspend while sending and printing massive jobs.
- Copy count on the Panel is less than actual count when the Paper End occurred during Staple job

Reissued: 10-Apr-14

Model: CH-C1 Color Controller E-42B

Date: 30-Aug-13

No.: RD728003a

Important Notes

1. About supported patch configuration with this composite patch:

Both (A) and (B) are supported.

(A) System Ver.1.0 + **1-1KIRSX**

If you have a controller that has only System 1.0, or if you have a plan to re-install the system, apply the 1-1KIRT4.ps directly on system ver.1.0.

(B) System Ver.1.0 + 1-1K7B08 + **1-1KIRSX**

If you have a controller that has already 1-1K7B08 installed, the controller can still be supported when you apply the **1-1KIRSX.exe** on top of the 1-1K7B08.

2. Do NOT install any of the following patch(es) after installing the **1-1KIRSX.exe** patch. If you must install any of the patch(es) below, do so before installing the **1-1KIRSX.exe** patch:
 - 1-1K7B08.EXE
3. This patch is exclusive. It must be installed by itself, and the server must be rebooted once. After the reboot, other patches may be installed.
4. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **1-1KIRSX.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 Before rebooting the system, to ensure that the patch file is completely processed, **please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
- 6 Wait until the Fiery controller reaches Idle, print the Configuration page.
- 7 Verify that the System Updates Log section contains the patch number **1-1KIRSX**.


Model: Color Controller E-42		Date: 27-Sep-13	No.: RD728004
Subject: Parts catalog correction – Front cover decal		Prepared by: A. Takada	
From: PP Tech Service Dept., 1st PP Tech Service Sect.			
Classification:	<input type="checkbox"/> Troubleshooting	<input checked="" type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input type="checkbox"/> Other ()	<input type="checkbox"/> Tier 2

Change: The following part was deleted from the parts catalog.

Reason: Description in the parts catalog was incorrect. This part cannot be procured as an individual service part.

New part number	Description	Q'ty	Int	Page	Index	Note
D7281136	DECAL: NAME PLATE	1	-	3	12	Delete

1. Color Controller-1 (D728)

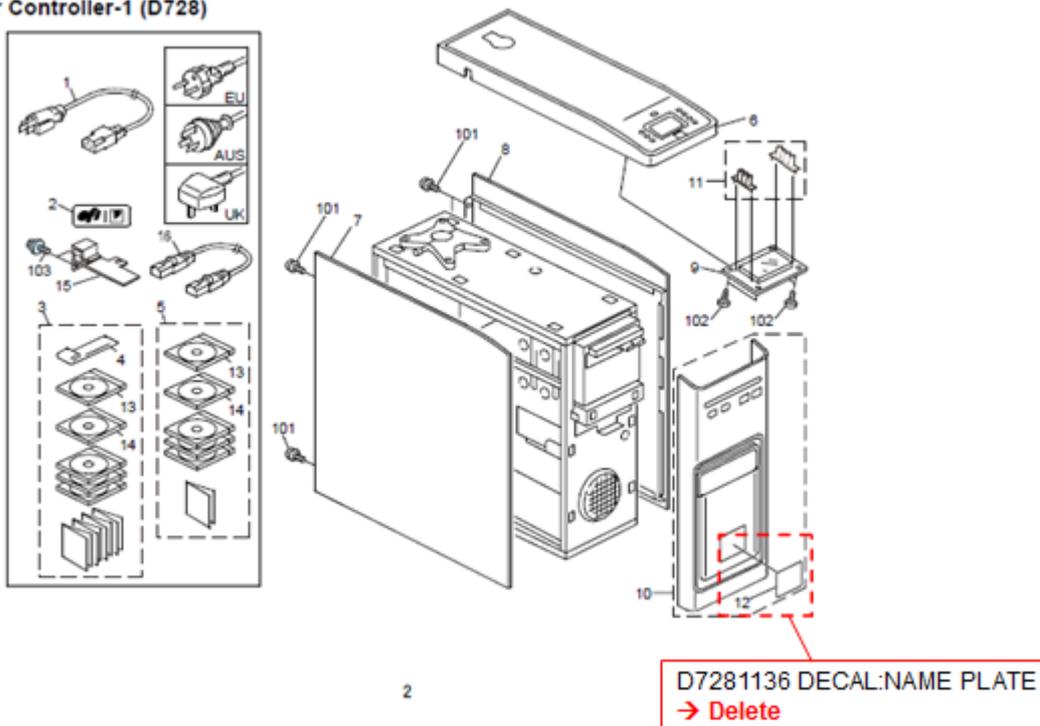

Model: CH-C1 Color Controller E-42B		Date: 08-Apr-14	No.: RD728005
Subject: Composite Patch (1-1KPCFP.exe) release note for Color Controller E-42B System Software Version 1.0			
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release note for Composite Patch for System Software Version 1.0 for Color Controller E-42B.

Table of contents:

- **About this Composite Patch**
- **Issues addressed with the Composite Patch**
- **Important Notes**
- **Patch installation instructions**

About this Composite Patch

Files included in this release	
File name	File size
1-1KPCFP.exe	47.07 MB

Product name

Color Controller E-42B Ver.1.0

Issues addressed with the Composite Patch (1-1KPCFP.exe)

1) New corrections:

- Cannot print the custom size booklet with SR4090/4100.
- VeriSign certificate will expire on September 22, 2013
- SC919-00 occurs with the JAM at the booklet tray in SR4090/4100.
- SC occurs when rebooting after the installation of Patch to Fiery.
- Fiery may not be connected to engine after "Factory Default" is performed
- Configuration Sheet is not printed in a specific situation.
- If custom size job is sent by Excel, the Status LED lit in red but error is not indicated.
- Forced print is not available for Custom Size on Command WorkStation.
- SC911-00 occurs after rebooting the Fiery.
- Command WorkStation alert requests A4 LEF when A4 SEF is set in Tray.
- The printing result rotates 180 at the specific settings.
- On Staple job, engine takes paper from Bypass Tray after the Paper End at Tray1.
- SC819 occurs while printing specific data.
- Unexpected blank sheet is inserted if the Cover Page is set with VDP Create Master.
- "Internal/General Error" occurs with specific PDF file and Gangup setting.
- Cannot store the N-up job to the Document Server.
- Cannot Print from Microsoft Publisher.
- SC819 occurs while printing specific settings.
- (PCL) Connection with Fiery is lost when accumulating a job to the document server.
- Job cannot be resumed by Resume Printing button on the Panel.
- Paper End popup and the beep repeats after the paper is refilled on the paper tray.
- When feed error happens with mixed size originals with the document feeder, some pages are not printed or are printed twice.
- The job doesn't resume even after the Continue button is pressed on the popup.
- Cannot save a job to the Document Server if the job is saved as dbp by SeeSequence.
- The suspended job is not resumed.
- Staple job can exceed the limit on SR4090/4100.
- Fiery does not respond to client PC when 802.1x authentication is enabled.
- When Combine Separation is set to ON, an object of Spot color is printed in black.
- A specific user/password fails on FTP scan.
- Document server file and user name become corrupted if 2 byte letter is used.
- Job stalls when the "Continue" is selected if paper is stuck in SR4090/SR4100 staple tray.
- Fiery crashes when finishing jam occurs.
- PS Driver: When Update button is clicked, toner information is displayed on the upper left for a moment.
- Fiery service stops when print a specific file.

Model: CH-C1 Color Controller E-42B	Date: 08-Apr-14	No.: RD728005
--	-----------------	---------------

Important Notes

.

1. Prerequisite patch(es): None

This patch includes not only new corrections but also previous corrections that were included in previous patches 1-1K7B08.exe and 1-1KIRSX.exe

Therefore, 1-1K7B08.exe and 1-1KIRSX.exe is no more necessary to install on system ver.1.0.

2. Do NOT install any of the following patch(es) after installing the **1-1KPCFP.exe** patch:
 - 1-1K7B08.exe
 - 1-1KIRSX.exe
3. This patch is exclusive. It must be installed by itself, and the server must be rebooted once. After the reboot, other patches may be installed.
4. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **1-1KPCFP.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 Before rebooting the system, to ensure that the patch file is completely processed, **please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
- 6 Wait until the Fiery controller reaches Idle, print the Configuration page.
- 7 Verify that the System Updates Log section contains the patch number **1-1KPCFP**.

Model: CH-C1 Color Controller E-42B		Date: 17-Jun-14	No.: RD728006
Subject: Composite Patch (FIT212992.exe) release note for Color Controller E-42B System Software Version 1.0		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release note for Composite Patch for System Software Version 1.0 for Color Controller E-42B.

Table of contents:

- **About this Composite Patch**
- **Issues addressed with the Composite Patch**
- **Important Notes**
- **Patch installation instructions**

About this Composite Patch

Files included in this release	
File name	File size
FIT212992.exe	19.6 MB

Product name

Color Controller E-42B Ver.1.0

Note: When this patch is applied, the system version will be upgraded to Ver.1.1

Model: CH-C1 Color Controller E-42B	Date: 17-Jun-14	No.: RD728006
--	-----------------	---------------

Issues addressed with the Composite Patch (FIT212992.exe)

1) New corrections:

- Job cannot be cancelled, if a paper jam occurs during the job cancellation.
- Blank page is not printed when Color Wise=OFF is specified by PS Driver.
- If a Scan document is loaded in SEF direction, "Erase Border" works upside down.
- If the system runs out of toner while printing a job, the job cannot be recovered.
- Specific illustrator data cannot be printed correctly.
- Win8: Installation of PS driver via WSD (Windows Services for Device) cannot be done.
- Fiery driver shows out of paper or offline.
- Print quality of small black texts and thin lines degrades and becomes worse than "Normal", if "Best" is selected for Text/Graph. (*1)
- Punch/Staple/Saddle-stitch function is available with coated paper on SR4090/SR4100. (*1)
- Supports Staple/Booklet/Fold/Punch options with paper fed from the bypass tray.(*1)

*1: PS Printer Driver Ver.1.1 / PCL Printer Driver Ver. 1.1.0.0 or later should be used with this patch set.

Notes: About PS Printer Driver Ver.1.1 (Temporary Solution)

PS Printer Driver Ver.1.1 for E-42B is planned to be published on Printer Driver Download site in July, 2014.

Until the PS Printer Driver Ver. 1.1 or newer driver for E-42B can be found on the Printer Driver Download site (=official web site), please obtain the PS Printer Driver Ver.1.1 in the following way.

- 1 Apply this patch FIT212992.exe and reboot the controller.
- 2 Apply the next patch FIT214829.exe which will replace the current embedded PS printer driver with PS printer driver Ver.1.1, and reboot the controller.
- 3 Access to the controller with WebTools (With the web browser, enter the IP address of the controller).
- 4 Move to "Downloads" tab.
- 5 Download the "Printer Files (Windows or Macintosh)"

Important Notes

1. The following prerequisites must be installed in the order specified before the FIT212992.exe patch is installed
 - 1-1KPCFP.exe (Composite Patch 03)
2. This patch is exclusive. It must be installed by itself, and the server must be rebooted once. After the reboot, other patches may be installed.
3. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT212992.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 Before rebooting the system, to ensure that the patch file is completely processed, **please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (*If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.*)
- 6 Wait until the Fiery controller reaches Idle, print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT212992** .and the system version is updated to Ver.1.1.

Model: CH-C1 Color Controller E-42B		Date: 17-Jun-14	No.: RD728007
Subject: Patch (FIT214829.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch "FIT214829.exe" for the Color Controller E-42B **system software version 1.1**.

Table of contents:

- **About this Patch**
- **Issues addressed with this Patch**
- **Important Notes**
- **Patch Installation Instructions**

About this Patch

Files included in this release	
File name	File size
FIT214829.exe	167268800 B

Product name

Color Controller E-42B Ver.1.1

Note: If the system software version is still Ver.1.0, upgrade the system with FIT212992.exe first.

Issues Addressed with this Patch

- This patch will replace the current embedded printer driver on the system software of E-42B with PS printer driver (Win/Mac) Ver.1.1

Important Notes:

1. The following prerequisite(s) must be installed in the order specified before installing **FIT214829.exe**:
 - **1-1KPCFP.exe** (Composite Patch 03)
 - **FIT212992.exe** (Composite Patch 04)
2. This patch is exclusive, it must be installed by itself, and the server must be rebooted or restarted once. After that, other patches can be applied to the server.
3. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT214829.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
4. Logon must be admin. This is fixed and cannot be modified.
5. Password is the Fiery administrator login password.
6. Hostname can be the IP address or the Fiery server name.
7. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
8. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
9. Wait until the Fiery controller reaches Idle and print the Configuration page.
10. If the controller does not eventually reach Idle, please manually start the Fiery service.
11. Verify that the **System Updates Log** section contains the patch number **FIT214829**.

Model: CH-C1 Color Controller E-42B		Date: Jul-07-14	No.: RD728008
Subject: Patch (FIT204560.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT204560” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT204560.exe	<ul style="list-style-type: none"> Unable to launch Configure window when Java 7u51 is installed.

Before installing FIT204560:

- The following prerequisite(s) must be installed in the order specified before installing **FIT204560.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT204560.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT204560.exe** patch:
 - None
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT204560.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (*If you choose to Restart later, make sure you manually reboot the server for the changes to take effect*)
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If, after multiple patches are manually installed, the Fiery does not reach Idle after approximately five minutes, please manually start the Fiery service by right-clicking on the Fiery bar and selecting Restart Fiery.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT204560**.

Model: CH-C1 Color Controller E-42B	Date: Jul-07-14	No.: RD728008
-------------------------------------	-----------------	---------------

Make sure that the Fiery printer controller reaches Idle.

1. Execute **FIT204560.exe** and follow the instructions in the Fiery Patch Downloader.
2. Notes about the Fiery Patch Downloader
3. Logon must be admin. This is fixed and cannot be modified.
4. Password is the Fiery administrator login password.
5. Hostname can be the IP address or the Fiery server name.
6. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
7. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
8. Wait until the Fiery controller reaches Idle and print the Configuration page.
9. If the controller does not eventually reach Idle, please manually start the Fiery service.
10. Verify that the System Updates Log section contains the patch number **FIT204560**.

Model: CH-C1 Color Controller E-42B		Date: 07-Jul-14	No.: RD728009
Subject: Patch (FIT191877.exe) release notes for Color Controller E-42B System Software Version 1.0/1.1		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT191877” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT191877.exe	<ul style="list-style-type: none"> iOS7 compatibility reference patch for Windows-based Fiery products.

Before installing FIT191877:

- The following prerequisite(s) must be installed in the order specified before installing **FIT191877.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
- Do **NOT** install any of the following patch(es) after installing the **FIT191877.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT191877.exe** patch:
 - None
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT191877.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT191877**.

Model: CH-C1 Color Controller E-42B	Date: 07-Jul-14	No.: RD728009
--	-----------------	---------------

Make sure that the Fiery printer controller reaches Idle.

1. Execute **FIT191877.exe** and follow the instructions in the Fiery Patch Downloader.
2. Notes about the Fiery Patch Downloader
3. Logon must be admin. This is fixed and cannot be modified.
4. Password is the Fiery administrator login password.
5. Hostname can be the IP address or the Fiery server name.
6. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
7. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
8. Wait until the Fiery controller reaches Idle and print the Configuration page.
9. If the controller does not eventually reach Idle, please manually start the Fiery service.
10. Verify that the System Updates Log section contains the patch number **FIT191877**.

Model: CH-C1 Color Controller E-42B		Date: Jul-07-14	No.: RD728010
Subject: Patch (FIT212196.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT212196” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT212196.exe	<ul style="list-style-type: none"> • Tab job created using mixed media causes extra tab pages to eject.

Before installing FIT212196:

- The following prerequisite(s) must be installed in the order specified before installing **FIT212196.exe** is applied:
 - **1-1KPCFP.exe** (Composite Patch 03)
 - **FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - **FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT212196.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT212196.exe** patch:
 - None
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT212196.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (*If you choose to Restart later, make sure you manually reboot the server for the changes to take effect*)
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT212196**.

Model: CH-C1 Color Controller E-42B	Date: Jul-07-14	No.: RD728010
-------------------------------------	-----------------	---------------

Make sure that the Fiery printer controller reaches Idle.

1. Execute **FIT212196.exe** and follow the instructions in the Fiery Patch Downloader.
2. Notes about the Fiery Patch Downloader
3. Logon must be admin. This is fixed and cannot be modified.
4. Password is the Fiery administrator login password.
5. Hostname can be the IP address or the Fiery server name.
6. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
7. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
8. Wait until the Fiery controller reaches Idle and print the Configuration page.
9. If the controller does not eventually reach Idle, please manually start the Fiery service.
10. Verify that the System Updates Log section contains the patch number **FIT212196**.

Model: CH-C1 Color Controller E-42B		Date: 07-Jul-14	No.: RD728011
Subject: Patch (FIT212362.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT212362” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT212362.exe	<ul style="list-style-type: none"> White objects do not appear even when Composite Overprint is set to OFF

Before installing FIT212362:

- The following prerequisite(s) must be installed in the order specified before installing **FIT212362.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT212362.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT212362.exe** patch:
 - None
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT212362.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (*If you choose to Restart later, make sure you manually reboot the server for the changes to take effect*)
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT212362**.

Model: CH-C1 Color Controller E-42B	Date: 07-Jul-14	No.: RD728011
-------------------------------------	-----------------	---------------

Make sure that the Fiery printer controller reaches Idle.

1. Execute **FIT212362.exe** and follow the instructions in the Fiery Patch Downloader.
2. Notes about the Fiery Patch Downloader
3. Logon must be admin. This is fixed and cannot be modified.
4. Password is the Fiery administrator login password.
5. Hostname can be the IP address or the Fiery server name.
6. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
7. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
8. Wait until the Fiery controller reaches Idle and print the Configuration page.
9. If the controller does not eventually reach Idle, please manually start the Fiery service.
10. Verify that the System Updates Log section contains the patch number **FIT212362**.

Model: CH-C1 Color Controller E-42B		Date: 07-Jul-14	No.: RD728012
Subject: Patch (FIT217012.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT217012” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT217012.exe	<ul style="list-style-type: none"> Printer does not resume from the Energy Saver mode.

Before installing FIT217012:

- The following prerequisite(s) must be installed in the order specified before installing **FIT217012.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT217012.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT217012.exe** patch:
 - None
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT217012.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT217012**.

Model: CH-C1 Color Controller E-42B	Date: 07-Jul-14	No.: RD728012
-------------------------------------	-----------------	---------------

Make sure that the Fiery printer controller reaches Idle.

1. Execute **FIT217012.exe** and follow the instructions in the Fiery Patch Downloader.
2. Notes about the Fiery Patch Downloader
3. Logon must be admin. This is fixed and cannot be modified.
4. Password is the Fiery administrator login password.
5. Hostname can be the IP address or the Fiery server name.
6. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
7. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
8. Wait until the Fiery controller reaches Idle and print the Configuration page.
9. If the controller does not eventually reach Idle, please manually start the Fiery service.
10. Verify that the System Updates Log section contains the patch number **FIT217012**.

Model: CH-C1 Color Controller E-42B		Date: 07-Jul-14	No.: RD728013
Subject: Patch (FIT215199.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch "FIT215199" for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT215199.exe	<ul style="list-style-type: none"> If a job is run using paper unsupported in both size and weight with SR4110 included in the configuration, the operation panel displays "printing...." instead of an error message.

Before installing FIT215199:

- The following prerequisite(s) must be installed in the order specified before installing **FIT215199.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT215199.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT215199.exe** patch:
 - FIT217012.exe**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT215199.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT215199**.

Model: CH-C1 Color Controller E-42B	Date: 07-Jul-14	No.: RD728013
-------------------------------------	-----------------	---------------

Make sure that the Fiery printer controller reaches Idle.

1. Execute **FIT215199.exe** and follow the instructions in the Fiery Patch Downloader.
2. Notes about the Fiery Patch Downloader
3. Logon must be admin. This is fixed and cannot be modified.
4. Password is the Fiery administrator login password.
5. Hostname can be the IP address or the Fiery server name.
6. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
7. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
8. Wait until the Fiery controller reaches Idle and print the Configuration page.
9. If the controller does not eventually reach Idle, please manually start the Fiery service.
10. Verify that the System Updates Log section contains the patch number **FIT215199**.

Reissued: 17-Jul-14

Model: CH-C1 Color Controller E-42B	Date: 07-Jul-14	No.: RD728014a
--	-----------------	----------------

RTB Correction

The items **colored in BLUE** have been corrected or added.

Subject: Patch (FIT217014.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch "FIT217014" for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT217014.exe	<ul style="list-style-type: none"> Fiery controller does not restart when C5100S/C5110S attempts to resume printing after a shutdown by the weekly timer setting. Tray priority "Driver/Command" for Bypass Tray is not honored. This tray priority could cause problems where the image is falsely rotated 90 degrees. Support of maximum custom paper size (1259.98mm/49.61inch) for banner printing with SR4090/SR4110/SR4100. Jam190 occurs when printing 1259.95 - 1259.98 mm paper.

Before installing FIT217014:

- The following prerequisite(s) must be installed in the order specified before installing **FIT217014.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT217014.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT217014.exe** patch:
 - FIT217012.exe
 - FIT215199.exe
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Reissued: 17-Jul-14Model: **CH-C1 Color Controller E-42B**

Date: 07-Jul-14

No.: RD728014a

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT217014.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT217014**.

Reissued: 17-Jul-14**Model: CH-C1 Color Controller E-42B****Date: 07-Jul-14****No.: RD728014a**

Make sure that the Fiery printer controller reaches Idle.

1. Execute **FIT217014.exe** and follow the instructions in the Fiery Patch Downloader.
2. Notes about the Fiery Patch Downloader
3. Logon must be admin. This is fixed and cannot be modified.
4. Password is the Fiery administrator login password.
5. Hostname can be the IP address or the Fiery server name.
6. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
7. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
8. Wait until the Fiery controller reaches Idle and print the Configuration page.
9. If the controller does not eventually reach Idle, please manually start the Fiery service.
10. Verify that the System Updates Log section contains the patch number **FIT217014**.

Model: CH-C1 Pro Color Controller E-42B		Date: 10-Sep-14	No.: RD728015
Subject: Patch (FIT218645.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT218645” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT218645.exe	<ul style="list-style-type: none"> The B/W counter falsely counts up blank data printed from the Interposer Tray.

Before installing FIT218645:

- The following prerequisite(s) must be installed in the order specified before installing **FIT218645.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT218645.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT218645.exe** patch:
 - FIT217014.exe**
 - FIT217012.exe**
 - FIT215199.exe**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT218645.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT218645**.

Model: CH-C1 Pro Color Controller E-42B		Date: 10-Sep-14	No.: RD728016
Subject: Patch (FIT218217.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT218217” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT218217.exe	<ul style="list-style-type: none"> Output is blank, if printed in some custom sizes.

Before installing FIT218217:

- The following prerequisite(s) must be installed in the order specified before installing **FIT218217.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT218217.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT218217.exe** patch:
 - FIT218645.exe**
 - FIT217014.exe**
 - FIT215199.exe**
 - FIT217012.exe**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT218217.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT218217**.

Model: CH-C1 Pro Color Controller E-42B		Date: 10-Sep-14	No.: RD728017
Subject: Patch (FIT219446.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT219446” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT219446.exe	<ul style="list-style-type: none"> Character corruption caused by bug in the Adobe PDF to PS converter.

Before installing FIT219446:

- The following prerequisite(s) must be installed in the order specified before installing **FIT219446.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
 - FIT212362.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT219446.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT219446.exe** patch:
 - None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT219446.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the System Updates Log section contains the patch number **FIT219446**.

Model: CH-C1 Pro Color Controller E-42B		Date: 10-Sep-14	No.: RD728018
Subject: Patch (FIT220177.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT220177” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT220177.exe	<ul style="list-style-type: none"> Part of printer driver setting may not work correctly when the job is later edited by Impose.

Before installing FIT220177:

- The following prerequisite(s) must be installed in the order specified before installing **FIT220177.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT220177.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT220177.exe** patch:
 - None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT220177.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT220177**.

Model: CH-C1 Pro Color Controller E-42B		Date: 10-Sep-14	No.: RD728019
Subject: Patch (FIT220924.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT220924” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT220924.exe	<ul style="list-style-type: none"> Command WorkStation displays some Dutch strings on a German E-42B controller. If the Command WorkStation language is set to Italian, options do not appear in Job Properties.

Before installing FIT220924:

- The following prerequisite(s) must be installed in the order specified before installing **FIT220924.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT220924.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT220924.exe** patch:
 - None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT220924.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the System Updates Log section contains the patch number FIT220924.

Model: CH-C1 Pro Color Controller E-42B		Date: 10-Sep-14	No.: RD728020
Subject: Patch (FIT220720.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT220720” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT220720.exe	<ul style="list-style-type: none"> If a merged job containing odd number pages is submitted, printer stalls and status remains Printing.

Before installing FIT220720:

- The following prerequisite(s) must be installed in the order specified before installing **FIT220720.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do NOT install any of the following patch(es) after installing the **FIT220720.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT220720.exe** patch:
 - FIT218217.exe**
 - FIT218645.exe**
 - FIT217014.exe**
 - FIT215199.exe**
 - FIT217012.exe**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT220720.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT220720**.

Model: CH-C1 Pro Color Controller E-42B		Date: 10-Sep-14	No.: RD728021
Subject: Patch (FIT221551.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting <input type="checkbox"/> Mechanical <input type="checkbox"/> Paper path <input type="checkbox"/> Product Safety	<input type="checkbox"/> Part information <input type="checkbox"/> Electrical <input type="checkbox"/> Transmit/receive <input checked="" type="checkbox"/> Other ()	<input type="checkbox"/> Action required <input type="checkbox"/> Service manual revision <input type="checkbox"/> Retrofit information

This RTB has been issued to announce the release notes on the patch “FIT221551” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT221551.exe	<ul style="list-style-type: none"> Pages cannot be rotated to the portrait orientation when printing imposed jobs from Mac.

Before installing FIT221551:

- The following prerequisite(s) must be installed in the order specified before installing **FIT221551.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT221551.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT221551.exe** patch:
 - FIT220177.exe**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT221551.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT221551**.

Model: CH-C1 Pro Color Controller E-42B		Date: 06-Nov-14	No.: RD728022
Subject: Patch (FIT100226044.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 3rd PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT100226044” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT100226044.exe	<ul style="list-style-type: none"> ● Tray Alignment buttons on Command WorkStation are greyed out, if the Bypass tray is selected on the engine operation panel.

Before installing FIT100226044:

- Known issues listed below, read before installing **FIT100226044.exe** patch:
 - Cannot execute tray alignment for bypass tray for long edge feed paper when Bypass Tray Priority is set to Driver Command.
To execute tray alignment on long edge feed paper set Bypass Tray Priority to Panel Setting (Engine Panel-> Fiery-> Setup-> Jobs-> Engine Handling-> Bypass Tray Priority: Panel Setting)
- The following prerequisite(s) must be installed in the order specified before installing **FIT100226044.exe** is applied:
 - **1-1KPCFP.exe** (Composite Patch 03)
 - **FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - **FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT100226044.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT100226044.exe** patch:
 - **None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT100226044.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT100226044**.

Model: CH-C1 Pro Color Controller E-42B		Date: 06-Nov-14	No.: RD728023
Subject: Patch (FIT100226049.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 3rd PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT100226049” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT100226049.exe	<ul style="list-style-type: none"> ● Print position shifts on some pages, if the image shift and mixed media options are specified in the Fiery driver.

Before installing FIT100226049:

- Known issues listed below, read before installing **FIT100226049.exe** patch:
 - **None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT100226049.exe** is applied:
 - **1-1KPCFP.exe** (Composite Patch 03)
 - **FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - **FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT100226049.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT100226049.exe** patch:
 - **None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT100226049.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT100226049**.

Model: CH-C1 Pro Color Controller E-42B		Date: 06-Nov-14	No.: RD728024
Subject: Patch (FIT100526548.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 3rd PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT100526548” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT100526548.exe	<ul style="list-style-type: none"> ● The job is printed in color even if color mode is specified to Grayscale, if CMYK option is specified to Full (Source GCR) and APPE is enabled.

Before installing FIT100526548:

- Known issues listed below, read before installing **FIT100526548.exe** patch:
 - **None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT100526548.exe** is applied:
 - **1-1KPCFP.exe** (Composite Patch 03)
 - **FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - **FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT100526548.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT100526548.exe** patch:
 - **None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT100526548.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT100526548**.

Model: CH-C1 Pro Color Controller E-42B		Date: 12-Dec-14	No.: RD728025
Subject: Patch (FIT100709130.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 3rd PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT100709130” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT100709130.exe	<ul style="list-style-type: none"> ● If paper runs out on the Plockmatic Cover Feeder 5010e, printing does not resume even after refilling paper.

Before installing FIT100709130:

- Known issues listed below, read before installing **FIT100709130.exe** patch:
 - **None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT100709130.exe** is applied:
 - **1-1KPCFP.exe** (Composite Patch 03)
 - **FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - **FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT100709130.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT100709130.exe** patch:
 - **FIT220720.exe**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT100709130.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT100709130**.

Model: CH-C1 Pro Color Controller E-42B		Date: 16-Feb-15	No.: RD728026
Subject: Patch (FIT222966.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 3rd PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT222966” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT222966.exe	● Fiery Patch to address OpenSSL security update to v.0.9.8za.

Before installing FIT222966:

- Known issues listed below, read before installing **FIT222966.exe** patch:
 - **None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT222966.exe** is applied:
 - **1-1KPCFP.exe** (Composite Patch 03)
 - **FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - **FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT222966.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT222966.exe** patch:
 - **None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT222966.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT222966**.

Model: CH-C1 Pro Color Controller E-42B		Date: 16-Feb-15	No.: RD728027
Subject: Patch (FIT100775022.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 3rd PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT100775022” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT100775022.exe	<ul style="list-style-type: none"> ● Printing does not start and results in SC911, if the job is sent while a scanning operation is in process.

Before installing FIT100775022:

- Known issues listed below, read before installing **FIT100775022.exe** patch:
 - **None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT100775022.exe** is applied:
 - **1-1KPCFP.exe** (Composite Patch 03)
 - **FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - **FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT100775022.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT100775022.exe** patch:
 - **FIT100709130.exe**
 - **FIT220720.exe**
 - **FIT218217.exe**
 - **FIT218645.exe**
 - **FIT217014.exe**
 - **FIT215199.exe**
 - **FIT217012.exe**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT100775022.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT100775022**.

Model: CH-C1 Pro Color Controller E-42B		Date: 18-May-15	No.: RD728028
Subject: Patch (FIT217867.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT217867” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT217867.exe	● Some tabs are not printed, if tab pages are added in the Job Master.

Before installing FIT217867:

- Known issues listed below, read before installing **FIT217867.exe** patch:
 - **None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT217867.exe** is applied:
 - **1-1KPCFP.exe** (Composite Patch 03)
 - **FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - **FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT217867.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT217867.exe** patch:
 - **FIT100775022.exe**
 - **FIT100709130.exe**
 - **FIT220720.exe**
 - **FIT218217.exe**
 - **FIT218645.exe**
 - **FIT217014.exe**
 - **FIT215199.exe**
 - **FIT217012.exe**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT217867.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT217867**.

Model: CH-C1 Pro Color Controller E-42B		Date: 18-May-15	No.: RD728029
Subject: Patch (FIT100946181.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT100946181” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT100946181.exe	Printing the following job results in a paper jam without an error notification: <ul style="list-style-type: none"> ● Original: Portrait ● Feed tray: LCT ● Stapling: Two at top

Before installing FIT100946181:

1. Known issues listed below, read before installing **FIT100946181.exe** patch:
 - **None**
2. The following prerequisite(s) must be installed in the order specified before installing **FIT100946181.exe** is applied:
 - **1-1KPCFP.exe** (Composite Patch 03)
 - **FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - **FIT214829.exe**
3. Do **NOT** install any of the following patch(es) after installing the **FIT100946181.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT100946181.exe** patch:
 - **FIT217867.exe**
 - **FIT100775022.exe**
 - **FIT100709130.exe**
 - **FIT220720.exe**
 - **FIT218217.exe**
 - **FIT218645.exe**
 - **FIT217014.exe**
 - **FIT215199.exe**
 - **FIT217012.exe**
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT100946181.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT100946181**.

Model: CH-C1 Pro Color Controller E-42B		Date: 18-May-15	No.: RD728030
Subject: Patch (FIT100921763.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT100921763” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT100921763.exe	1) Range of the minimum size for custom paper is not accordingly with the specification. 2) 180 degrees rotation is not honored, if the rotation is set after the job has been RIPped.

Before installing FIT100921763:

- Known issues listed below, read before installing **FIT100921763.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT100921763.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT100921763.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT100921763.exe** patch:
 - None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT100921763.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT100921763**.

Model: CH-C1 Pro Color Controller E-42B		Date: 04-Jun-15	No.: RD728031
Subject: Patch (FIT100985100.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT100985100” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT100985100.exe	Texts are not printed to the correct location on the tab, if tab sheets run out during the job followed by a replenishment.

Before installing FIT100985100:

- Known issues listed below, read before installing **FIT100985100.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT100985100.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT100985100.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT100985100.exe** patch:
 - FIT100946181.exe**
 - FIT217867.exe**
 - FIT100775022.exe**
 - FIT100709130.exe**
 - FIT220720.exe**
 - FIT218217.exe**
 - FIT218645.exe**
 - FIT217014.exe**
 - FIT215199.exe**
 - FIT217012.exe**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT100985100.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT100985100**.

Model: CH-C1 Pro Color Controller E-42B		Date: 09-Jul-15	No.: RD728032
Subject: Patch (FIT101033143.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT101033143” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101033143.exe	If Composite overprint is enabled, crop marks are printed in the wrong color.

Before installing FIT101033143:

- Known issues listed below, read before installing **FIT101033143.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT101033143.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT101033143.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101033143.exe** patch:
 - FIT100526548.exe**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101033143.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101033143**.

Model: CH-C1 Pro Color Controller E-42B		Date: 30-Jul-15	No.:RD728033
Subject: Patch (FIT101046200.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT101046200” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101046200.exe	RIPping might be slow, if a PDF file is imported to the Process and Hold queue of the Command WorkStation.

Before installing FIT101046200:

- Known issues listed below, read before installing **FIT101046200.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT101046200.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
 - FIT212362.exe**
 - FIT219446.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT101046200.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101046200.exe** patch:
 - None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101046200.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101046200**.

Model: CH-C1 Pro Color Controller E-42B		Date: 21-Aug-2015	No.:RD728034
Subject: Patch (FIT101076612.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT101076612” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101076612.exe	Paper may be fed from the wrong tray.

Before installing FIT101076612:

- Known issues listed below, read before installing **FIT101076612.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT101076612.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT101076612.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101076612.exe** patch:
 - None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101076612.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101076612**.

Model: CH-C1 Pro Color Controller E-42B		Date: 21-Aug-2015	No.:RD728035
Subject: Patch (FIT101021912.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting <input type="checkbox"/> Mechanical <input type="checkbox"/> Paper path <input type="checkbox"/> Product Safety	<input type="checkbox"/> Part information <input type="checkbox"/> Electrical <input type="checkbox"/> Transmit/receive <input checked="" type="checkbox"/> Other ()	<input type="checkbox"/> Action required <input type="checkbox"/> Service manual revision <input type="checkbox"/> Retrofit information

This RTB has been issued to announce the release notes on the patch "FIT101021912" for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101021912.exe	Patch to upgrade PHP, OpenSSL and Apache web server to below mentioned versions: ·Apache: 2.2.29 ·OpenSSL: 0.9.8zf/ 1.0.1m ·PHP: 5.6.7

Before installing FIT101021912:

- Known issues listed below, read before installing **FIT101021912.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT101021912.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
 - FITT222966.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT101021912.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101021912.exe** patch:
 - None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101021912.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101021912**.

Model: CH-C1 Pro Color Controller E-42B		Date: 21-Aug-2015	No.:RD728036
Subject: Patch (FIT101087873.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT101087873” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101087873.exe	A patch to block Windows 10 notification and installation via Windows Updates on Fiery servers.

Before installing FIT101087873:

1. Known issues listed below, read before installing **FIT101087873.exe** patch:
 - **None**
2. The following prerequisite(s) must be installed in the order specified before installing **FIT101087873.exe** is applied:
 - **None**
3. Do NOT install any of the following patch(es) after installing the **FIT101087873.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101087873.exe** patch:
 - **None**
4. This patch is exclusive, it must be installed by itself, and the server must be rebooted or restarted once. After that, other patches can be applied to the server.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101087873.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101087873**.

Model: CH-C1 Pro Color Controller E-42B		Date: 21-Aug-2015	No.:RD728037
Subject: Patch (FIT101031039.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT101031039” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101031039.exe	Objects may be missing, if printing PDF files with the Composite overprint function disabled.

Before installing FIT101031039:

- Known issues listed below, read before installing **FIT101031039.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT101031039.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
 - FIT219446.exe**
 - FIT101046200.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT101031039.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101031039.exe** patch:
 - FIT212362.exe**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101031039.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101031039**.

Model: CH-C1 Pro Color Controller E-42B		Date: 02-Dec-15	No.:RD728038
Subject: Patch (FIT101134037.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT101134037” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101134037.exe	Image shift may not work properly with master and variable data.

Before installing FIT101134037:

1. Known issues listed below, read before installing **FIT101134037.exe** patch:
 - **None**
2. The following prerequisite(s) must be installed in the order specified before installing **FIT101134037.exe** is applied:
 - **1-1KPCFP.exe** (Composite Patch 03)
 - **FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - **FIT214829.exe**
 - **FIT100226049.exe**
3. Do **NOT** install any of the following patch(es) after installing the **FIT101134037.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101134037.exe** patch:
 - **None**
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101134037.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101134037**.

Model: CH-C1 Pro Color Controller E-42B		Date: 21-Jan-16	No.: RD728039
Subject: Patch (FIT101191255.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting <input type="checkbox"/> Mechanical <input type="checkbox"/> Paper path <input type="checkbox"/> Product Safety	<input type="checkbox"/> Part information <input type="checkbox"/> Electrical <input type="checkbox"/> Transmit/receive <input checked="" type="checkbox"/> Other ()	<input type="checkbox"/> Action required <input type="checkbox"/> Service manual revision <input type="checkbox"/> Retrofit information

This RTB has been issued to announce the release notes on the patch “FIT101191255” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101191255.exe	Dynamic Language Switching was disabled on the Fiery controller, because it is not supported on Windows 7 and later OS.

Before installing FIT101191255:

- Known issues listed below, read before installing **FIT101191255.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT101191255.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT101191255.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101191255.exe** patch:
 - None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101191255.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101191255**.

Model: CH-C1 Pro Color Controller E-42B		Date: 21-Jan-16	No.: RD728040
Subject: Patch (FIT101184681.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT101184681” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101184681.exe	Fiery icon disappears from the printer operation panel during printing.

Before installing FIT101184681:

- Known issues listed below, read before installing **FIT101184681.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT101184681.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT101184681.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101184681.exe** patch:
 - None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101184681.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101184681**.

Model: CH-C1 Pro Color Controller E-42B		Date: 21-Jan-16	No.: RD728041
Subject: Patch (FIT101204102.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT101204102” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101204102.exe	Output is not as expected, if the paper catalog is set with a profile that uses one or two colors and the Black overprint function is enabled.

Before installing FIT101204102:

- Known issues listed below, read before installing **FIT101204102.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT101204102.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
 - FIT101033143.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT101204102.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101204102.exe** patch:
 - FIT100526548.exe**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101204102.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101204102**.

Model: CH-C1 Pro Color Controller E-42B		Date: 26-Feb-16	No.: RD728042
Subject: Patch (FIT101182181.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT101182181” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101182181.exe	The version of the Control Bar printed is incorrect, if APPE is enabled.

Before installing FIT101182181:

- Known issues listed below, read before installing **FIT101182181.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT101182181.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT101182181.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101182181.exe** patch:
 - None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101182181.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101182181**.

Model: CH-C1 Pro Color Controller E-42B	Date: 05-Apr-16	No.: RD728043
--	-----------------	---------------

Subject: Patch (FIT101276304.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji
From: 1st PP Tech Service Sect., PP Tech Service Dept.		
Classification:	<input type="checkbox"/> Troubleshooting <input type="checkbox"/> Part information <input type="checkbox"/> Action required <input type="checkbox"/> Mechanical <input type="checkbox"/> Electrical <input type="checkbox"/> Service manual revision <input type="checkbox"/> Paper path <input type="checkbox"/> Transmit/receive <input type="checkbox"/> Retrofit information <input type="checkbox"/> Product Safety <input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch "FIT101276304" for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101276304.exe	The Fiery exits while processing some PDF file when APPE is ON.

Before installing FIT101276304:

- Known issues listed below, read before installing **FIT101276304.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT101276304.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
 - FIT101204102.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT101276304.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101276304.exe** patch:
 - None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101276304.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101276304**.

Model: CH-C1 Pro Color Controller E-42B		Date: 05-Apr-16	No.: RD728044
Subject: Patch (FIT101320153.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT101320153” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101320153.exe	When printed using user codes, the number of color pages printed is not logged by user.

Before installing FIT101320153:

- Known issues listed below, read before installing **FIT101320153.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT101320153.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT101320153.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101320153.exe** patch:
 - FIT100946181.exe**
 - FIT217867.exe**
 - FIT100775022.exe**
 - FIT100709130.exe**
 - FIT220720.exe**
 - FIT218217.exe**
 - FIT218645.exe**
 - FIT217014.exe**
 - FIT215199.exe**
 - FIT217012.exe**
 - FIT100985100.exe**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101320153.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101320153**.

Model: CH-C1 Pro Color Controller E-42B		Date: 02-May-16	No.: RD728045
Subject: Patch (FIT101332153.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT101332153” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101332153.exe	Image may shrink when printing a PDF file.

Before installing FIT101332153:

- Known issues listed below, read before installing **FIT101332153.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT101332153.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do NOT install any of the following patch(es) after installing the **FIT101332153.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101332153.exe** patch:
 - None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101332153.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101332153**.

Model: CH-C1 Pro Color Controller E-42B		Date: 11-Jul-16	No.: RD728046
Subject: Patch (FIT101372101.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT101372101” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101372101.exe	Time lag occurs between the modified time of Command WorkStation and Web Tools.

Before installing FIT101372101:

- Known issues listed below, read before installing **FIT101372101.exe** patch:
 - This patch requires two reboots in total to be effective.**
- The following prerequisite(s) must be installed in the order specified before installing **FIT101372101.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT101372101.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101372101.exe** patch:
 - None**
- This patch is not exclusive, it can be installed along with other patches concurrently, and one server Reboot or Restart is sufficient for all patches to take effect on the system.
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101372101.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle.
- 7 Reboot the server one more time and wait until the Fiery controller reaches Idle.
- 8 Print the Configuration page.
- 9 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 10 Verify that the **System Updates Log** section contains the patch number **FIT101372101**.

Model: CH-C1 Pro Color Controller E-42B		Date: 11-Jul-16	No.: RD728047
Subject: Patch (FIT101377544.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT101377544” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101377544.exe	Operation panel freezes, if Secure jobs are continuously printed.

Before installing FIT101377544:

- Known issues listed below, read before installing **FIT101377544.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT101377544.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT101377544.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101377544.exe** patch:
 - None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101377544.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101377544**.

Model: CH-C1 Pro Color Controller E-42B		Date: 04-Aug-16	No.: RD728048
Subject: Patch (FIT101389535.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT101389535” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101389535.exe	Background color disappears, if APPE is enabled and the job is set with Fiery Impose on large paper size such as 13x19.

Before installing FIT101389535:

- Known issues listed below, read before installing **FIT101389535.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT101389535.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
 - FIT101204102.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT101389535.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101389535.exe** patch:
 - FIT101276304.exe**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101389535.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101389535**.

Model: CH-C1 Pro Color Controller E-42B		Date: 17-Nov-16	No.: RD728049
Subject: Patch (FIT101467285.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “FIT101467285” for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101467285.exe	Unable to RIP specific PDF files (due to an Adobe core module problem).

Before installing FIT101467285:

- Known issues listed below, read before installing **FIT101467285.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT101467285.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
 - FIT100226049.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT101467285.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101467285.exe** patch:
 - None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101467285.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101467285**.

Model: CH-C1 Pro Color Controller E-42B		Date: 17-Nov-16	No.: RD728050
Subject: Patch (FIT101489275.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch "FIT101489275" for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101489275.exe	Security Patch: A patch to remove RC4 cipher from Windows cipher list

Before installing FIT101489275:

- Known issues listed below, read before installing **FIT101489275.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT101489275.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
 - FIT101021912.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT101489275.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101489275.exe** patch:
 - None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101489275.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101489275**.

Model: CH-C1 Pro Color Controller E-42B		Date: 17-Nov-16	No.: RD728051
Subject: Patch (FIT101502896.exe) release notes for Color Controller E-42B System Software Version 1.1		Prepared by: Chisato Tsuji	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch "FIT101502896" for the Color Controller E-42B **system software version 1.1**.

Patch File	Issue(s)
FIT101502896.exe	If a job in the held/printed queue is printed again by changing the shift mode of the delivery option, the new shift setting it not honored.

Before installing FIT101502896:

- Known issues listed below, read before installing **FIT101502896.exe** patch:
 - None**
- The following prerequisite(s) must be installed in the order specified before installing **FIT101502896.exe** is applied:
 - 1-1KPCFP.exe** (Composite Patch 03)
 - FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - FIT214829.exe**
 - FIT101021912.exe**
- Do **NOT** install any of the following patch(es) after installing the **FIT101502896.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101502896.exe** patch:
 - None**
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

- 1 Make sure that the Fiery printer controller reaches Idle.
- 2 Execute **FIT101502896.exe** and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
- 4 **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
- 5 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- 6 Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7 If the controller does not eventually reach Idle, please manually start the Fiery service.
- 8 Verify that the **System Updates Log** section contains the patch number **FIT101502896**.

Fiery Patch Release Notes

PAGE: 1/2

Model: Color Controller E-42B (CH-C1 Pro)	Date: April 17, 2017	Revision:
System Version: 1.1		

Patch File: FIT101370305.ps

Issue(s) address to this Patch:

- A patch to upgrade OpenSSL to 1.0.2g.

Before installing FIT101370305:

1. Known issues listed below, read before installing **FIT101370305.exe** patch:
 - **None**
2. The following prerequisite(s) must be installed in the order specified before installing **FIT101370305.exe** is applied:
 - **1-1KPCFP.exe** (Composite Patch 03)
 - **FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - **FIT214829.exe**
 - **FIT101021912.exe**
3. Do NOT install any of the following patch(es) after installing the **FIT101370305.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101370305.exe** patch:
 - **None**
4. This patch is exclusive, it must be installed by itself (no other patches should accompany this patch while installing), and the server must be rebooted or restarted once. After that, other patches can be applied to the server.

Note: If you have installed other non-exclusive patches before this patch you must reboot the server to apply those patches first.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101370305.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101370305**.

Fiery Patch Release Notes

PAGE: 1/2

Model: Color Controller E-42B (CH-C1 Pro)

Date: May 19, 2017

Revision:

System Version: 1.1

Patch File: FIT101613608.ps

Issue(s) address to this Patch:

- Color Search Pattern cannot be printed out, if User Authentication Management is enabled.

Before installing FIT101613608:

1. Known issues listed below, read before installing **FIT101613608.exe** patch:
 - **None**
2. The following prerequisite(s) must be installed in the order specified before installing **FIT101613608.exe** is applied:
 - **1-1KPCFP.exe** (Composite Patch 03)
 - **FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - **FIT214829.exe**
3. Do NOT install any of the following patch(es) after installing the **FIT101613608.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101613608.exe** patch:
 - **FIT101320153.exe**
 - **FIT100985100.exe**
 - **FIT100946181.exe**
 - **FIT217867.exe**
 - **FIT100775022.exe**
 - **FIT100709130.exe**
 - **FIT220720.exe**
 - **FIT218217.exe**
 - **FIT218645.exe**
 - **FIT217014.exe**
 - **FIT215199.exe**
 - **FIT217012.exe**
4. This patch is not exclusive, it can be installed along with other patches concurrently, and one server Reboot or Restart is sufficient for all patches to take effect on the system.
5. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
6. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101613608.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. **Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.**
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101613608**.

Fiery Patch Release Notes

PAGE: 1/2

Model: Color Controller E-42B (CH-C1 Pro) System Version: 1.1	Date: Feb. 2, 2018	Rank: C	Revision:
Patch file: <ul style="list-style-type: none">● FIT101594368.exe● uninstall_sp.exe (uninstaller)			

Issue(s) address to this Patch: <ul style="list-style-type: none">● Number of pages displayed in impose is incorrect, for example, in an Enhanced FreeForm job, the number of pages in the variable file is falsely displayed instead of the number of pages in the master file.

Uninstallation Capability	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
Uninstaller Patch File	uninstall_sp.exe

Table of Contents

- Before installing **FIT101594368.exe**
- Patch installation instructions
- About Uninstaller Patch
- Notes for uninstalling **FIT101594368.exe**
- Uninstaller Patch installation instructions

Before installing FIT101594368.exe

1. Known issues listed below, read before installing **FIT101594368.exe** patch:
 - None.
2. The following prerequisite(s) must be installed in the order specified before applying the **FIT101594368.exe** patch:
 - 1-1KPCFP.exe
 - FIT212992.exe
 - FIT214829.exe
 - FIT100226049.exe
 - FIT101134037.exe
3. Do **NOT** install any of the following patch(es) after installing the **FIT101594368.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101594368.exe** patch:
 - None.
4. This patch is not exclusive, it can be installed along with other patches concurrently, and one server Reboot or Restart is sufficient for all patches to take effect on the system.
5. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
6. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101594368.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
5. Wait until the Fiery controller reaches Idle and print the Configuration page.
6. If the controller does not eventually reach Idle, please manually start the Fiery service.
7. Verify that the System Updates Log section contains the patch number FIT101594368.

About the Uninstaller Patch

1. The uninstaller patch (**uninstall_sp.exe**) uninstalls the last patch applied to the system.
2. The uninstaller patch can only be used when the patch you intend to uninstall has the uninstallation capability.
3. The uninstaller patch uninstalls one patch at a time. Once the server reaches idle after uninstallation of the patch, the server will return to the state before the patch was first installed.
4. The uninstaller patch is exclusive and must be installed independently. Reboot the server, to install other patches.

Notes for uninstalling the FIT101594368.exe

1. This **FIT101594368.exe** patch has the uninstaller capability.

To uninstall this patch, make sure to use the uninstaller patch (**uninstall_sp.exe**) that is provided with **FIT101594368.exe** patch.

2. If **FIT101594368.exe** is not the last patch applied to the system, every patch installed after **FIT101594368.exe** must be uninstalled one by one before uninstalling **FIT101594368.exe**.
3. Important notes for uninstalling **FIT101594368.exe** patch with the uninstaller patch:
 - None

Uninstaller Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **uninstall_sp.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
5. Wait until the Fiery controller reaches Idle and print the Configuration page.
6. Verify that the System Updates Log section does NOT contain **the patch number FIT101594368**.

Fiery Patch Release Notes

Model: Color Controller E-42B (CH-C1 Pro) System Version: 1.1	Date: Jan 30, 2018	Revision:
Patch file: <ul style="list-style-type: none">● FIT101654809.exe (Security patch 001)● uninstall_sp.exe (uninstaller)		

Uninstallation Capability	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
Uninstaller Patch File	uninstall_sp.exe

Table of Contents

- Issues addressed with this release
- Before installing FIT101654809.exe
- Patch installation instructions
- About the uninstaller (uninstall_sp.exe)
- Notes for uninstalling FIT101654809.exe
- Uninstaller patch installation instruction

Issues addressed with this release

Patch ID	Description
FIT101654809	Patch to update the following components of the Fiery to the versions listed: <ul style="list-style-type: none">● PHP: 5.6.27● Apache: 2.2.31● OpenSSL: 1.0.2j

Before installing FIT101654809.exe

1. Known issues listed below, read before installing **FIT101654809.exe** patch:
 - **1-1KPCFP.exe** (Composite Patch 03)
 - **FIT212992.exe** (Composite Patch 04, which upgrades the system from Ver.1.0 to Ver.1.1)
 - **FIT214829.exe**
 - **FIT101021912.exe**
1. The following prerequisite(s) must be installed in the order specified before applying the FIT101654809.exe patch:
 - None.
2. Do **NOT** install any of the following patch(es) after installing the **FIT101654809.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101654809.exe** patch:
 - None.

3. This patch is exclusive, it must be installed by itself (no other patches should accompany this patch while installing), and the server must be rebooted or restarted once. After that, other patches can be applied to the server.

Note: If you have installed other non-exclusive patches before this patch you must reboot the server to apply those patches first.

4. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101654809.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
5. Wait until the Fiery controller reaches Idle and print the Configuration page.
6. If the controller does not eventually reach Idle, please manually start the Fiery service.
7. Verify that the System Updates Log section contains the patch number **FIT101654809**.

About the Uninstaller Patch

1. The uninstaller patch (**uninstall_sp.exe**) uninstalls the last patch applied to the system.
2. The uninstaller patch can only be used when the patch you intend to uninstall has the uninstallation capability.
3. The uninstaller patch uninstalls one patch at a time. Once the server reaches idle after uninstallation of the patch, the server will return to the state before the patch was first installed.
4. The uninstaller patch is exclusive and must be installed independently. Reboot the server, to install other patches.

Notes for uninstalling the FIT101654809.exe

This **FIT101654809.exe** patch has the uninstaller capability.

To uninstall this patch, make sure to use the uninstaller patch (**uninstall_sp.exe**) that is provided with **FIT101654809.exe** patch.

1. If **FIT101654809.exe** is not the last patch applied to the system, every patch installed after **FIT101654809.exe** must be uninstalled one by one before uninstalling **FIT101654809.exe**.
2. Important notes for uninstalling **FIT101654809.exe** patch with the uninstaller patch:
 - None

Uninstaller Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **uninstall_sp.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
5. Wait until the Fiery controller reaches Idle and print the Configuration page.
6. Verify that the System Updates Log section does NOT contain the patch number FIT101654809.

Fiery Patch Release Notes

PAGE: 1/3

Model: Color Controller E-42B (CH-C1 Pro) System Version: 1.1	Date: Feb. 2, 2018	Rank: C	Revision:
Patch file: <ul style="list-style-type: none">● FIT101696199.exe● uninstall_sp.exe (uninstaller)			

Issue(s) address to this Patch: <ul style="list-style-type: none">● Paper jam occurs in multi half-fold booklet jobs printed in duplex.● Communication between the E-42B and printer drops intermittently.
--

Uninstallation Capability	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
Uninstaller Patch File	uninstall_sp.exe

Table of Contents

- Before installing **FIT101696199.exe**
- Patch installation instructions
- About Uninstaller Patch
- Notes for uninstalling **FIT101696199.exe**
- Uninstaller Patch installation instructions

Before installing FIT101696199.exe

1. Known issues listed below, read before installing **FIT101696199.exe** patch:
 - None.
2. The following prerequisite(s) must be installed in the order specified before applying the **FIT101696199.exe** patch:
 - 1-1KPCFP.exe
 - FIT212992.exe
 - FIT214829.exe
3. Do **NOT** install any of the following patch(es) after installing the **FIT101696199.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101696199.exe** patch:
 - FIT101320153.exe
 - FIT100946181.exe
 - FIT217867.exe
 - FIT100775022.exe
 - FIT100709130.exe
 - FIT220720.exe
 - FIT218217.exe
 - FIT218645.exe
 - FIT217014.exe
 - FIT215199.exe

- FIT217012.exe
- FIT100985100.exe.

4. This patch is not exclusive, it can be installed along with other patches concurrently, and one server Reboot or Restart is sufficient for all patches to take effect on the system.
5. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
6. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101696199.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
5. Wait until the Fiery controller reaches Idle and print the Configuration page.
6. If the controller does not eventually reach Idle, please manually start the Fiery service.
7. Verify that the System Updates Log section contains the patch number FIT101696199.

About the Uninstaller Patch

1. The uninstaller patch (**uninstall_sp.exe**) uninstalls the last patch applied to the system.
2. The uninstaller patch can only be used when the patch you intend to uninstall has the uninstallation capability.
3. The uninstaller patch uninstalls one patch at a time. Once the server reaches idle after uninstallation of the patch, the server will return to the state before the patch was first installed.
4. The uninstaller patch is exclusive and must be installed independently. Reboot the server, to install other patches.

Notes for uninstalling the FIT101696199.exe

1. This **FIT101696199.exe** patch has the uninstaller capability.

To uninstall this patch, make sure to use the uninstaller patch (**uninstall_sp.exe**) that is provided with **FIT101696199.exe** patch.

2. If **FIT101696199.exe** is not the last patch applied to the system, every patch installed after **FIT101696199.exe** must be uninstalled one by one before uninstalling **FIT101696199.exe**.
3. Important notes for uninstalling **FIT101696199.exe** patch with the uninstaller patch:
 - None

Uninstaller Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **uninstall_sp.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
5. Wait until the Fiery controller reaches Idle and print the Configuration page.
6. Verify that the System Updates Log section does NOT contain **the patch number FIT101696199**.

Model: CH-C1 Pro Color Controller E-42B		Date: 20-Apr-18	No.: RD728052
Subject: New Feature Information: Fiery Updates		Prepared by: Chisato Tsuji	
From: 1st CP Business Department CP Business Center			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input checked="" type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input type="checkbox"/> Other ()	<input checked="" type="checkbox"/> Tier 2 <input type="checkbox"/> Tier 0.5

Introduction:

Fiery Updates is a new feature allowing Administrators to install patches on Fiery servers from *Command Workstation 6.x*.

Notifications of updates are displayed in the Job Center and Home screens.

Please introduce your customers of this new feature as this will be beneficial in allowing them to update their Fiery controllers on their own at the desired time (on-demand) and in reducing service visits/cost.

Note: This feature is unnecessary for customers who have the Fiery System Updates set to [Automatically download and install updates.]

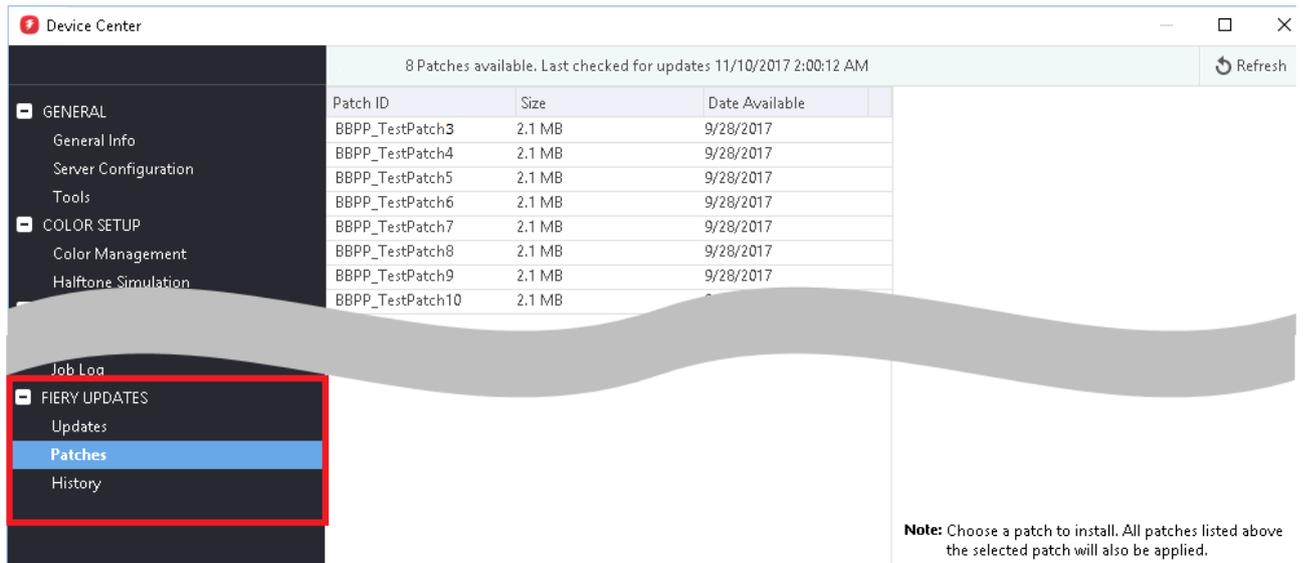


Table of contents:

1. Schedule
2. Target Models
3. About Fiery Updates
4. Merit of using Fiery Updates
5. Notes
6. Activating the Fiery Update feature.
7. "Update" Menu
8. "Patches" Menu
9. "History" Menu
10. Updates Available badges

1. Schedule

Fiery Updates will become available from May 7th, 2018 (PDST)

For upcoming models, the feature will be available from launch.

2. Target Models

FS100 or later models enabled of the System Updates feature

On the above indicated date, EFI enables the following models to have access to the Fiery updates feature through the Update server on the internet.

The feature will be available with Command WorkStation 6.x

Windows model

- Color Controller E-42/82 (Aries-VerUp)
- Color Controller E-43/83 (Andromeda-P1)
- Color Controller E-43A/83A (Leo-C1/P1)
- Color Controller E-45A/85A (Leo-C2/P2)
- Color Controller E-42B (CH-C1)
- Color Controller E-44B (CH-C2)
- Printer Controller EB-32 (BR-C1/P1)
- Printer Controller EB-34 (BR--C2/P2)

Linux model

- Color Controller E-23C (MET-C2)
- Color Controller E-24B (CH-C2)

For models that are not supported of the Fiery Updates feature, the following message will appear when attempted to open the Fiery Updates menu via Command WorkStation.



Fiery Updates is not supported for this Fiery Server model.

Model: CH-C1 Pro Color Controller E-42B	Date: 20-Apr-18	No.: RD728052
---	-----------------	---------------

3. About "Fiery Updates"

Command WorkStation Ver. 6.x includes the Fiery Updates feature for installing Fiery system software and Fiery API updates and patches.


This allows system software updates to be installed from either the Fiery controller or remote (client) computers.

Fiery API: Fiery API is an Application Programming Interface, used by many newer Fiery features to communicate with the Fiery (instead of harmony). It is already used by Fiery Go, Fiery Ticker, new black Fiery bar, and other features like Fiery updates.

Patches: Patches downloaded with Fiery Updates is no different to those downloaded with the conventional System Updates feature.

4. Merit of using the Fiery Updates

- Once this feature is enabled, while Command WorkStation is launched, updates are searched periodically and notifications of updates are displayed in the Job Center and Home screens.

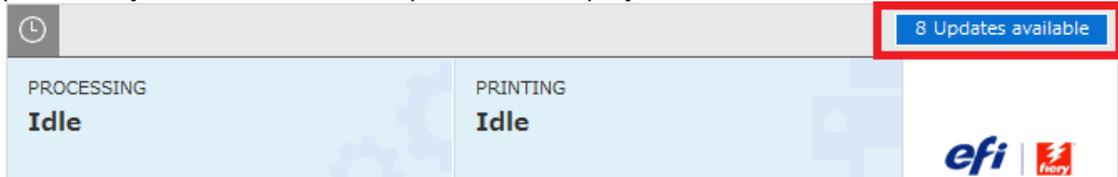


- User Friendly Interface for operation (via Command WorkStation with Administrator privileges)
- Updates and patch installation is possible from Client PC with internet connection.
- (In this case, the Fiery controller does not have to be connected to the internet.)
- Identically to System Updates, only patches that are not applied to the system appear on the list.
- Identically to System Updates, selecting a patch from the list will automatically select its pre-requisite, if any.


5. Notes

- To use this feature, System Updates must be disabled.
- The computer running Command WorkStation must:
 - Be connected to the Internet
 - Be able to communicate with Fiery controller via LAN.

[Command WorkStation on Fiery controller (Windows model only)] --- (Internet) -- [EFI Update Server]

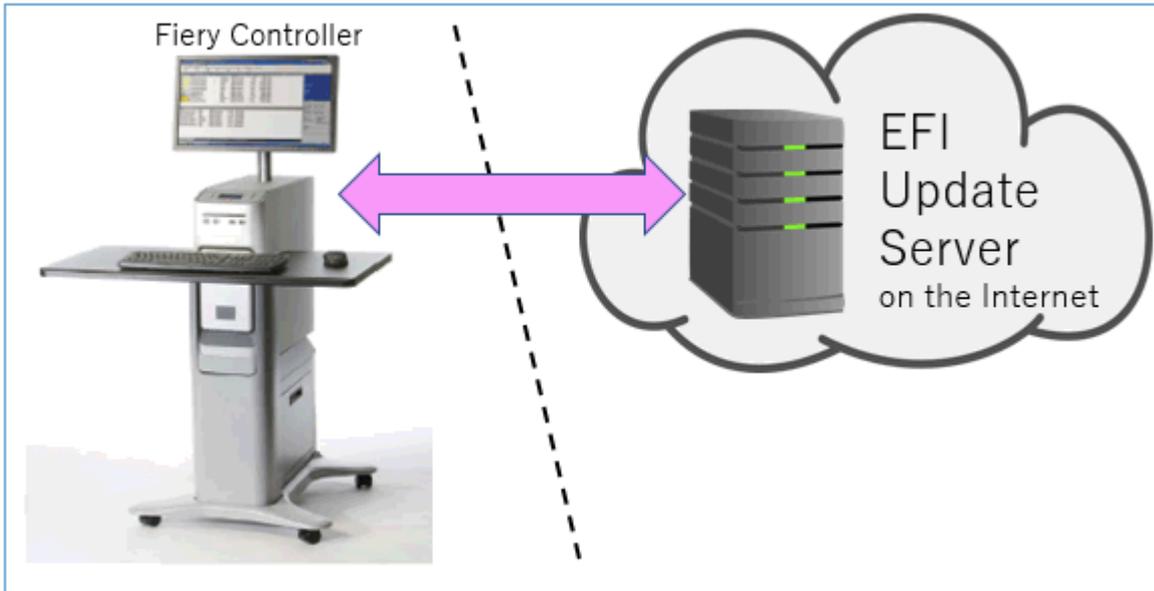


[Fiery controller (Windows or Linux model)] --(local LAN)-- [Command WorkStation on Client PC] --- (Internet) -- [EFI Update Server]

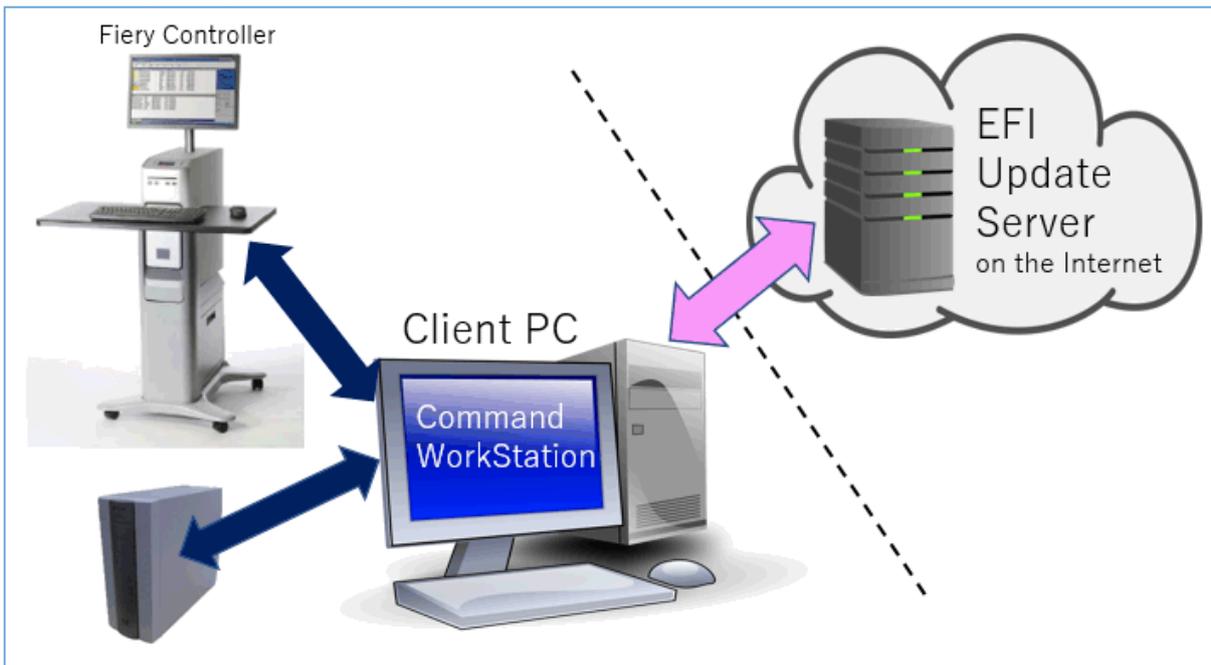


Model: CH-C1 Pro Color Controller E-42B	Date: 20-Apr-18	No.: RD728052
---	-----------------	---------------

6. Activating the Fiery Update feature

1. Right-click the Fiery controller name in the controllers column list and click **Device Center**.

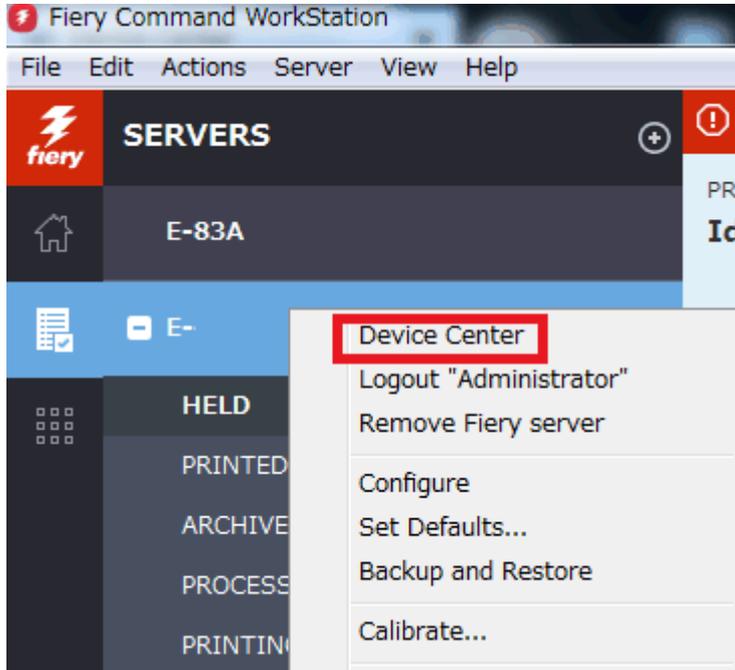


2. Select **Updates** or **Patches** under Fiery Updates

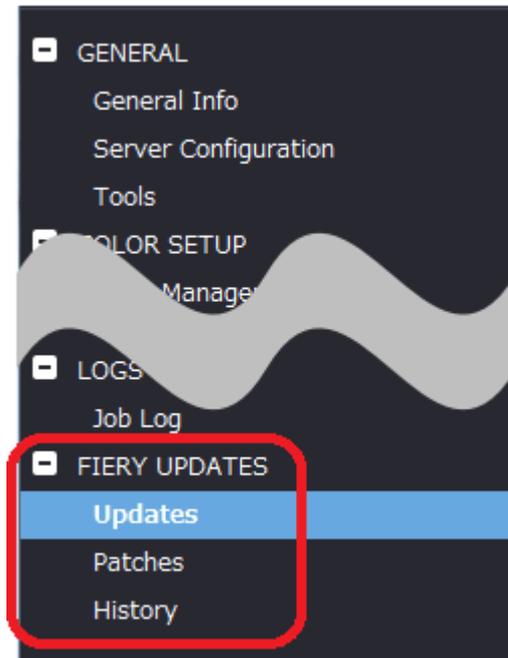


Model: CH-C1 Pro Color Controller E-42B	Date: 20-Apr-18	No.: RD728052
---	-----------------	---------------

3. On the message screen below, click Continue. This will automatically disable System Updates.

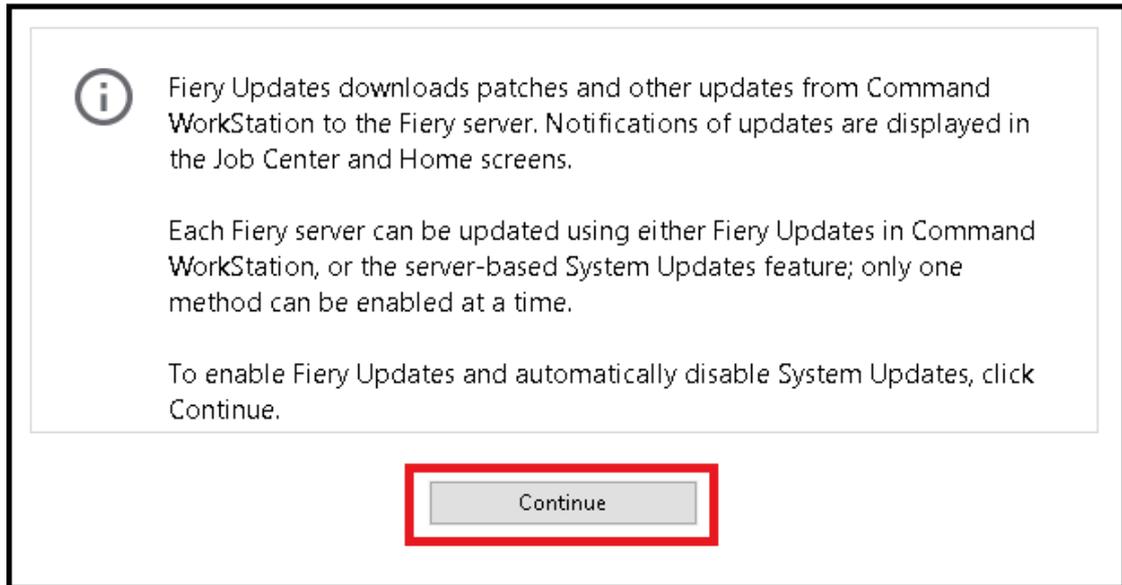


7. "Update" Menu

To view and install the available updates, click Updates under Fiery Updates, then click Update in the right pane for each update you choose to install.

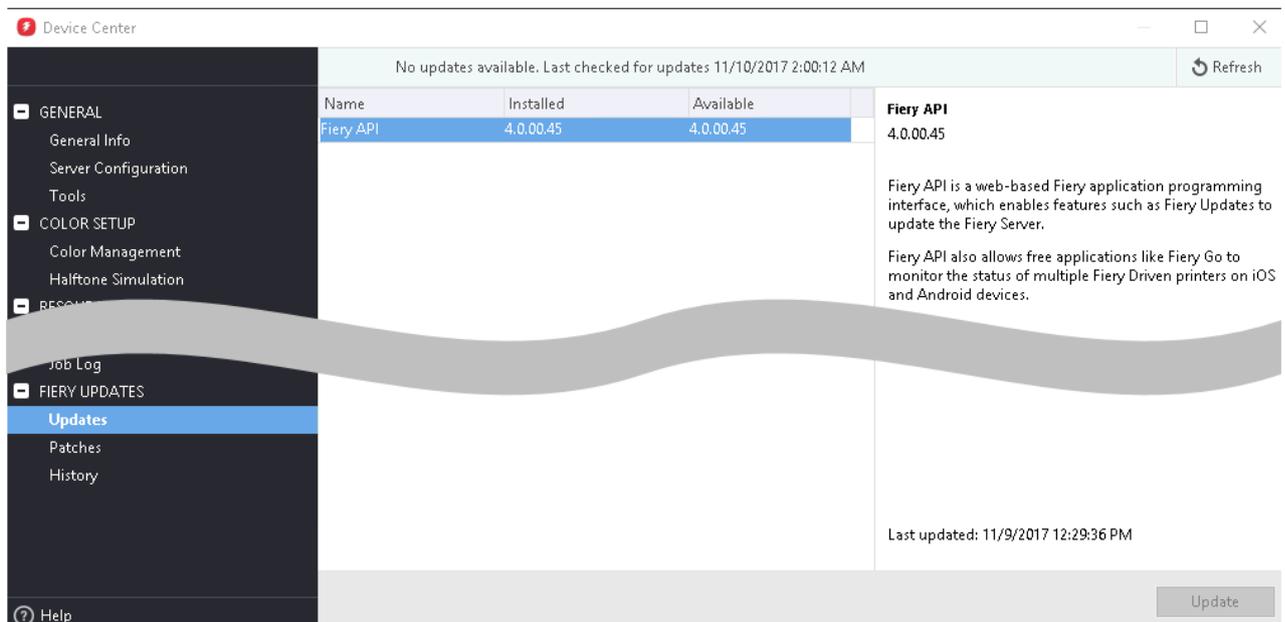


8. "Patches" Menu

1. To view the available patches, click Patches under Fiery Updates.

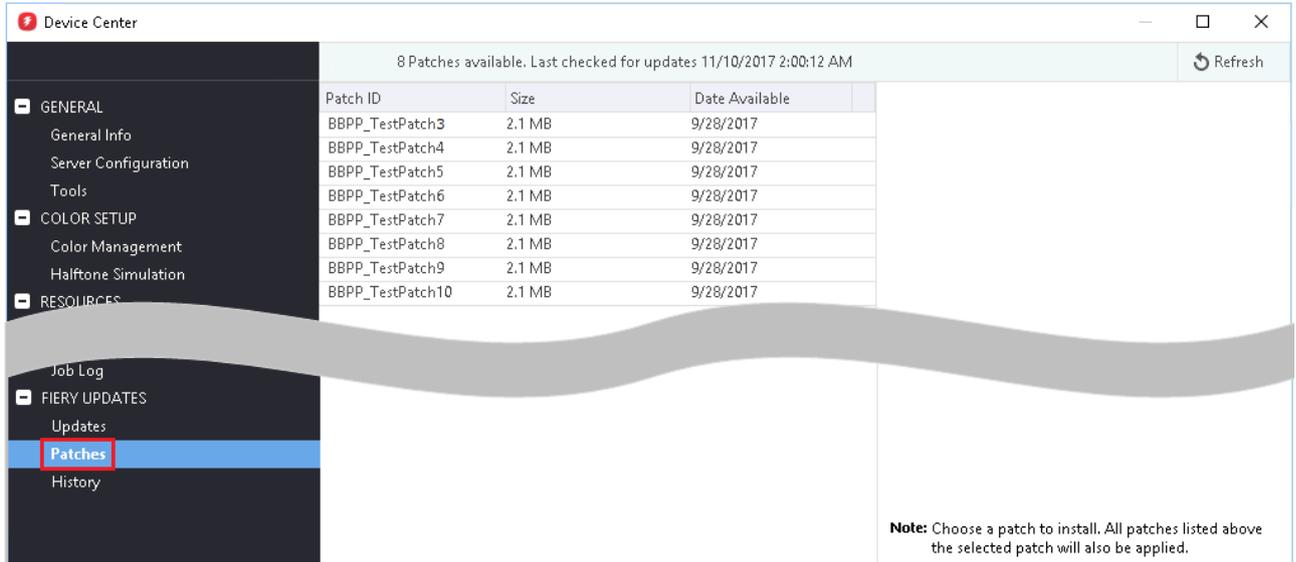


2. When you select a patch the pre-requisite patches are also automatically selected, if any. For example, selecting Patch #7 will automatically select its pre-requisite Patches #3-6. Click Update.

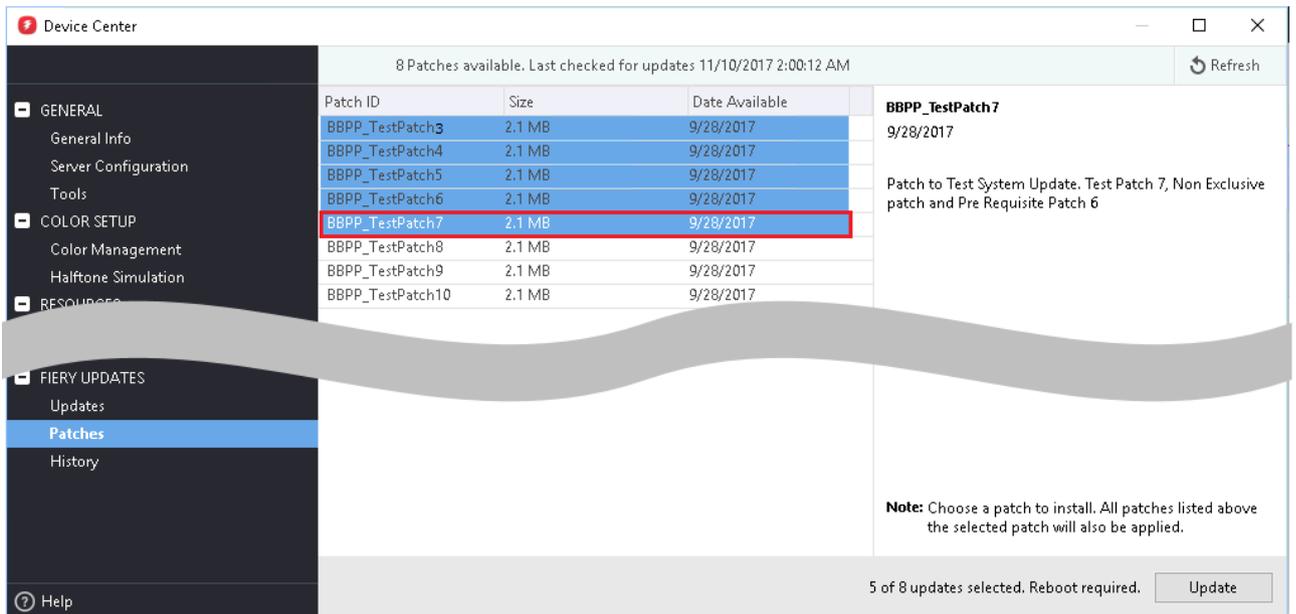


Model: CH-C1 Pro Color Controller E-42B	Date: 20-Apr-18	No.: RD728052
---	-----------------	---------------

3. Click Continue in the confirmation message screen below.

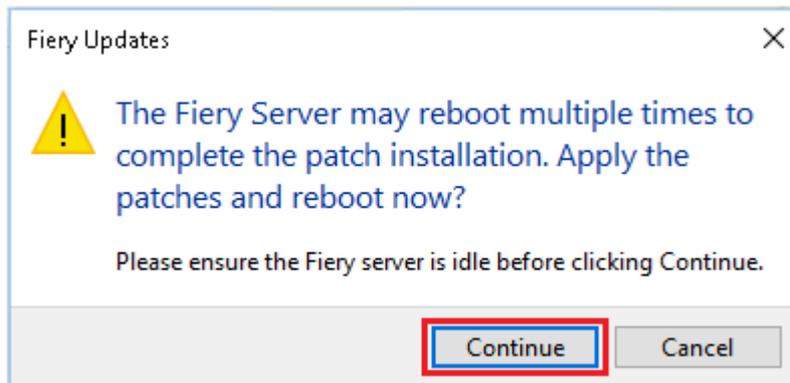


Various stages of the update process and a progress bar appear in the Disconnect screen as follows:

- Initializing
- Downloading Updates
- Transferring
- Installing

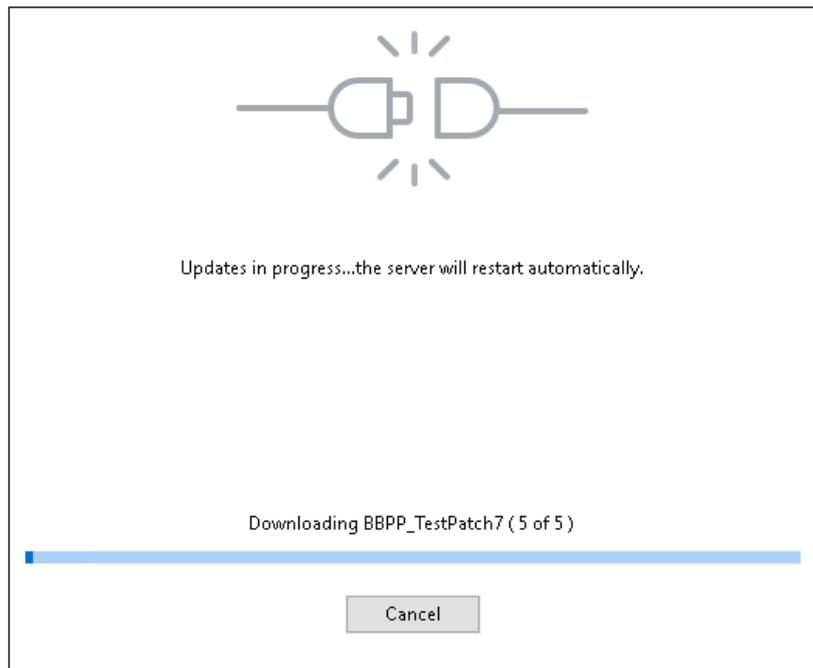

Model: CH-C1 Pro Color Controller E-42B	Date: 20-Apr-18	No.: RD728052
---	-----------------	---------------


The Fiery controller will reboot as necessary between exclusive patches.
 (If five patches are being installed, then up to five reboots may occur).

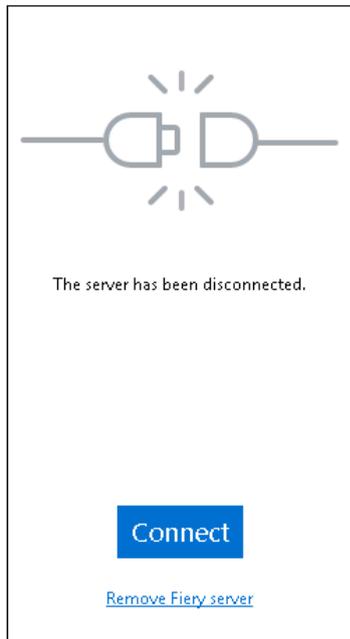

Note: After the Fiery controller reboots, Command WorkStation will not automatically reconnect. The Administrator must click Connect in order to reconnect to the Fiery controller.

9. "History" Menu

After the system reboots automatically for a number of times necessary according to the updates installed, reconnect to your Fiery controller via Command WorkStation and confirm the update history in the History menu.

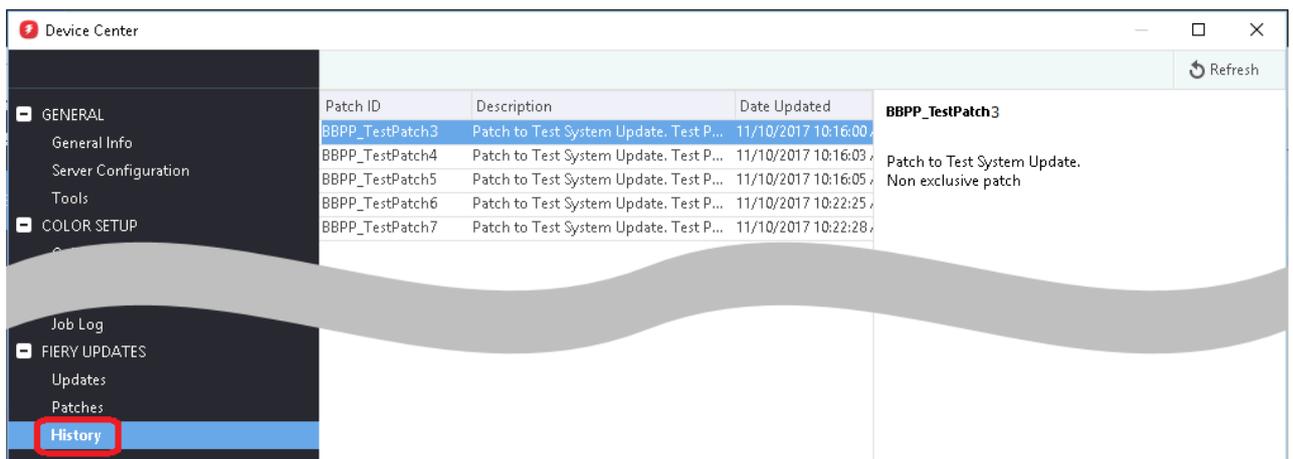

Model: CH-C1 Pro Color Controller E-42B	Date: 20-Apr-18	No.: RD728052
---	-----------------	---------------

10. Updates Available badges

When Fiery Updates is enabled for the Fiery server model and patches are available, the badges will display in the Job Center and the Home Screen. These badges include the number of patches available in the patch tab. The count does not include any Fiery API updates in the Updates tab.

The user can click on this “Updates available” badge to be taken directly to the Device Center > Fiery Updates > Patches tab.

