

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 14-Jan-11	No.: RM382001
Subject: Release note System Patch EXP01 (Composite01) for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: N. Iida	
From: PPBG Service Planning Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch EXP01 (Composite01) for AG-P1/C1-QX2.0(Color Controller E-80)

Files included in this release	
File name	File size
M3827554.exe (1-14O3IK.exe)	137 MB

Problem Solving (Measures)

Following are the key problems that have been given countermeasures.

No	Symptom Details	Remarks
1	Perfect binder: Thick1, 2 can be selected to Body Paper.	
2	When "Tray1, 2 and 7" are selected, "Coated" cannot be selected to input tray in the cover.	
3	Perfect binder :A choice of Body Paper Size becomes only A4 & LT.	
4	In consecutive Mismatch, Timer does not begin with a set point.	
5	In Gang-up print, "Thick3" and "Backed Copied" are excluded and cannot be set.	
6	BookletMaker4.0:There is the combination of Body Size and Coversine that cannot do maximum Trim when set Spine value.	
7	Perfect binder: After Process & hold, when covers are increased in Preview, Jam occurs.	
8	BookletMaker4.0: Saddle print: Thin paper is demanded when Pre-Printed is specified and no paper is in Interposer Upper/Lower Tray.	
9	Impose: Paper cannot be fed from the interposer Tray.	
10	An error occurs when try to launch CWPT after restoring Fiery settings.	
11	It is impossible to refer and edit address book.	
12	MIB acquired with Paper Tray empty state is different from specifications.	
13	Perfect binder job starts when Perfect binder inter poser tray is opened.	
14	Ring Binder: A wrong error message is displayed when print a ring bind job with the ring comb empty state.	
15	Performance with sub set staple job.	
16	After the subset staple job is printed, it stays in "Printing" state.	
17	Unexpected Watermark is printed on MacOS10.	
18	The setting of the "Scale" function does not work.	
19	Full-bleed print support on custom-size paper	

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 14-Jan-11	No.: RM382001
---	-----------------	---------------


Installation instructions

1. Execute **1-1403IK** and follow the instructions in the Fiery Patch Downloader
2. Notes about the Fiery Patch Downloader
 - a. Login must be **admin**. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password
 - c. Hostname can be either the IP address or the Fiery server name.
3. After the patch is downloaded, and when prompted by Fiery Patch Downloader, choose **Reboot**.
4. When the Fiery has come to Idle, verify the patch ID on the **System Update Log**.
5. It should contain the patch number **1-1403IK**.

Note 1: When executing **1-1403IK.exe**, if you choose **Restart later** when prompted by the Fiery Patch Downloader, please make sure you manually reboot the server for changes to take effect.


Note 2: This patch is Exclusive which means it must be installed independently and the server rebooted/restarted once. After which, other patches can be applied to the server.

- **To run this patch downloader on a Vista 32bit or 64bit client, follow the steps below:**
 - **Right-click on the “1-1403IK.exe” and select ‘Properties’**

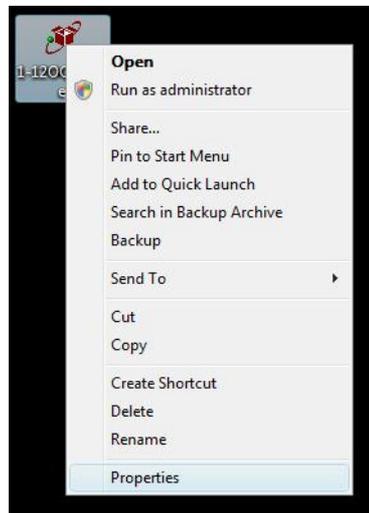

- **Select ‘Run this program in compatibility mode for: Windows XP’ and click ‘OK’**

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 14-Jan-11	No.: RM382001
--	-----------------	---------------

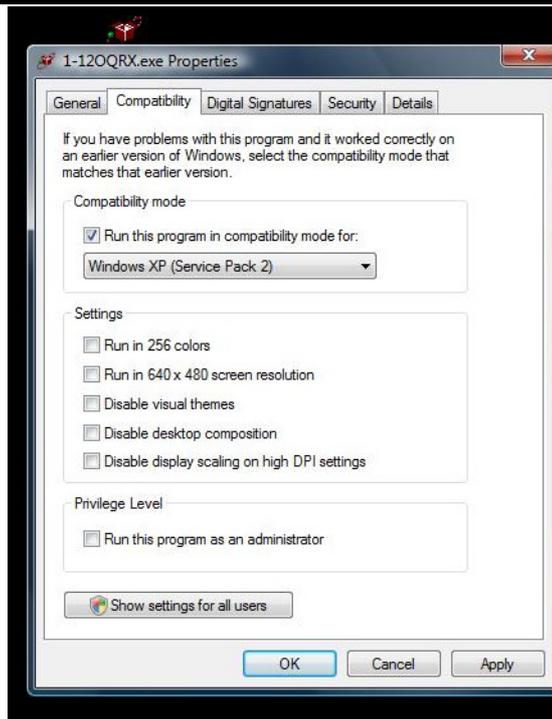

- **Double-click the program and follow the instructions to install the patch.**

Reissued:23-Jun-11

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 14-Jan-11	No.: RM382002a
--	-----------------	----------------

RTB Reissue

The items in ***bold italics*** were corrected or added.

Subject: Release note System Patch EXP02 for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: T. Satoh	
From: 1st PP Service Planning Sec., PP Service Planning			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch EXP02 for AG-P1/C1-QX2.0(Color Controller E-80)

Files included in this release	
File name	File size
M3827556.exe	52.7 MB

Problem Solving (Measures)

Following are the key problems that have been given countermeasures.

Files included in this release

Folder Name/ File Name/ File Size/ Reboot

- 1st/ 1-15EE1H.exe/ 1,546,840/ not Exclusive
- / 1-15S0PD.exe/ 2,511,080/ not Exclusive
- / 1-152Q1L.exe/ 3,439,664/ not Exclusive
- / 1-1676UH.exe/ 4,905,904/ not Exclusive
- / 1-167G12.exe/ 2,025,904/ not Exclusive
- / 1-160XXC.exe/ 3,186,376/ not Exclusive
- / 1-167G1V.exe/ 3,186,368/ not Exclusive
- / 1-16AH35.exe/ 3,191,592/ not Exclusive
- / 1-169MOC.exe/ 3,191,664/ not Exclusive (changed order)**
- / 1-16CG30.exe/ 3,179,088/ not Exclusive
- ~~/ 1-169MOC.exe/ 3,191,664/ not Exclusive~~
- / 1-16KG4Z.exe/ 10,468,400/ not Exclusive
- / 1-15S0R4.exe/ 1,612,592/ not Exclusive
- / 1-16G6QP.exe/ 1,370,928/ not Exclusive
- / 1-16KG33.exe/ 6,272,944/ not Exclusive
- / 1-16ZGY7.exe/ 3,190,616/ not Exclusive
- / 1-17WPVK.exe/ 3,182,696/ not Exclusive

Note : Important!!! Strictly follow the installation order as indicated here above.

Issue(s) addressed with this release

- 1-15EE1H.exe EFI separator page does not print multiple copies correctly.
- 1-15S0PD.exe PowerPoint2003:Striped pattern is printed on the image which stuck.
- 1-152Q1L.exe Media Size in Consumables is not correct.
- 1-1676UH.exe radiation pictures are wrong with the setting of
CompositeOverprint:ON"+ "Text/Graphics Quality:Best"+Booklet.

Reissued:23-Jun-11

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 14-Jan-11	No.: RM382002a
--	-----------------	----------------

- 1-167G12.exe A slanted line is printed on a part of the gradation.
Fiery Service crashes during any print when no domain name is present in Fiery setup
- 1-160XXC.exe During printing a subset staple job, it becomes the "Printing" state eternally.
- 1-167G1V.exe Paper in PerfectBinderBin, it does not recovery print.
- 1-16AH35.exe Scan: After removing ADF jam, the original is scanned with overlapping 1 page.
- 1-16CG30.exe When "External charge unit" and "User Authentication" were used together, Print of next job becomes possible when cancel a job even if it is assumed that there is not a card.
- 1-169M0C.exe Cannot print Alignment Page on paper except the Plain paper.
- 1-16KG4Z.exe During RIPping, Job error occurs.
- 1-15S0R4.exe Gradient is not smooth with default setting printing.
- 1-16G6QP.exe A cyan line is not printed when print it with 600DPI.
- 1-16KG33.exe Some white texts are printed with black.
- 1-16ZGY7.exe Feature request for additional staple positions
- 1-17WPVK.exe Slowdown printing to Container Stacker

Preparation before Installation

1. Please print out the configuration page. Verify the **Server Info** section. It should show the version number "2.0". And also verify the **Update Information** section. It should show "**1-14O3IK**"
2. Please install "**1-14O3IK**", if the **Update Information** section is blank. Or please install the system 2.0 again, if the version number is not 4.0 or if other patch already installed.

Note

1. You should keep to the correct installation order when installing a patch.
2. You should execute a reboot when you install an "**Exclusive**" patch.
(The patch names that you installed will be shown in the configuration after reboot.)

Installation Instructions

Patch installation instruction

- 1 Make sure the Fiery is idle.
- 2 Execute 1-xxxxxx.exe and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Login must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be either the IP address or the Fiery server name.
- 4 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Restart later (not Exclusive) then apply the next patch.
or
Reboot. (**Exclusive**)
- 5 Wait until the Fiery comes to Idle and print the configuration page.
- 6 Verify that the System Update Log section contains the patch number 1-xxxxxx.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 14-Jan-11	No.: RM382003
Subject: Release note System Patch EXP03 for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: T. Satoh	
From: PPBG Service Planning Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch EXP03 for AG-P1/C1-QX2.0(Color Controller E-80)

Files included in this release	
File name	File size
M3827557.exe	5.36 MB

Problem Solving (Measures)

Following are the key problems that have been given countermeasures.

Files included in this release

Folder Name/ File Name/ File Size/ Reboot

- 1st/ 1-17O315.exe/ 1,499,528/ not Exclusive
- 2nd/ 1-1807GJ.exe/ 1,154,480/ not Exclusive
- 3rd/ 1-18M9YD.exe/ 3,183,792/ not Exclusive

Note : Important!!! Strictly follow the installation order as indicated here above.

Issue(s) addressed with this release

- 1-17O315: Fiery feeds paper from other tray with the auto-feeding manner if the no paper tray has been specified.
- 1-1807GJ: SC990 occurs when calibration is executed on a Dutch language.
- 1-18M9YD: Fiery may stop when tray is changed if no-paper occurs.

Preparation before Installation

1. Please print out the configuration page. Verify the **Server Info** section. It should show the version number "2.0". And also verify the **Update Information** section. It should show "**1-14O3IK**"
2. Please install "**1-14O3IK**", if the **Update Information** section is blank. Or please install system 2.0 again, if the version number is not 4.0 or if other patch already installed.

Note

1. You should keep to the correct installation order when installing the patches.
2. You should execute a reboot when you install an "**Exclusive**" patch.
(The patch names that you installed will be shown in the configuration after reboot.)

Installation Instructions

Patch installation instruction

- 1 Make sure the Fiery is idle.

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 14-Jan-11	No.: RM382003
---	-----------------	---------------

- 2 Execute 1-xxxxxx.exe and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Login must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be either the IP address or the Fiery server name.
- 4 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Restart later (not Exclusive) then apply next patch.
or
Reboot. (**Exclusive**)
- 5 Wait until the Fiery comes to Idle and print the configuration page.
- 6 Verify that the System Update Log section contains the patch number 1-xxxxxx.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 05-Jul-11	No.: RM382004
Subject: Release note System Patch EXP03 for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: T. Satoh	
From: PPBG Service Planning Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch EXP04 for AG-P1/C1-QX2.0(Color Controller E-80)

Files included in this release	
File name	File size
M3827560.exe	8.76 MB

Problem Solving (Measures)

Following are the key problems that have been given countermeasures.

Files included in this release

Folder Name/ File Name/ File Size/ Reboot

- 1st/ 1-18S4WV.exe/ 1,341,432/ not Exclusive
- 2nd/ 1-191K3X.exe/ 1,706,600/ not Exclusive
- 3rd/ 1-18YMPK.exe/ 3,195,536/ not Exclusive
- 4th/ 1-190YYG.exe/ 3,184,960/ not Exclusive

Note : Important!!! Strictly follow the installation order as indicated here above.

Issue(s) addressed with this release

- 1-18S4WV: Fiery improved the ripping performance for JPEG with page rotation. (Mac10.5 Preview Application)
- 1-191K3X: Cannot export the job log over 65535..
- 1-18YMPK: Change the value of keep alive timeout.
- 1-190YYG: Print Counter with User Code Auth. and/or External Charge Unit does not increase correctly.

Preparation before Installation

1. Please print out the configuration page. Verify the **Server Info** section. It should show the version number "2.0". And also verify the **Update Information** section. It should show "**1-1403IK**"
2. Please install "**1-1403IK**", if the **Update Information** section is blank. Or please install the system 2.0 again, if the version number is not 2.0.

Note

1. You should keep to the install order when the patch is installed.
2. You should execute the reboot when you install an "**Exclusive**" patch. (The patch names that you installed will be shown in the configuration after reboot.)

Model: AG-P1/C1-QX2.0(Color Controller E-80)

Date: 05-Jul-11

No.: RM382004

Installation Instructions

Patch installation instruction

- 1 Make sure the Fiery is idle.
- 2 Execute 1-xxxxxx.exe and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Login must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be either the IP address or the Fiery server name.
- 4 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Restart later (not Exclusive) then apply the next patch.
or
Reboot. (**Exclusive**)
- 5 Wait until the Fiery comes to Idle and print the configuration page.
- 6 Verify that the System Update Log section contains the patch number 1-xxxxxx.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 05-Jul-11	No.: RM382005
Subject: Release note System Patch EXP05 for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: T. Satoh	
From: PPBG Service Planning Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch EXP05 for AG-P1/C1-QX2.0(Color Controller E-80)

Files included in this release	
File name	File size
M3827565.exe	57.3 MB

Problem Solving (Measures)

Following are the key problems that have been given countermeasures.

Files included in this release

Folder Name/ File Name/ File Size/ Reboot

- 1st/ 1-19J7BQ.exe/ 4,424,704/ not Exclusive
- 2nd/ 1-19J7B0.exe/ 1,913,592/ not Exclusive
- 3rd/ 1-19J7BZ.exe/ 3,185,992/ not Exclusive
- 4th/ 1-19J7CE.exe/ 1,512,976/ not Exclusive
- 5th/ 1-19J76R.exe/ 4,424,872/ not Exclusive
- 6th/ 1-19K4M7.exe/ 2,592,264/ not Exclusive
- 7th/ 1-19QSLI.exe/ 27,618,176/ not Exclusive
- 8th/ 1-1A9NQF.exe/ 1,235,552/ not Exclusive
- 9th/ 1-1AHNCV.exe/ 7,200,192/ not Exclusive
- 10th/ 1-1AI9RO.exe/ 8,597,640/ not Exclusive

Note : Important!!! Strictly follow the installation order as indicated here above.

Issue(s) addressed with this release

- 1-19J7BQ: SC919 and SC991 occur in printing.
- 1-19J7B0: The image behind the blank page will slip off in the top right corner.
- 1-19J7BZ: Fiery may fail to close the page.
- 1-19J7CE: The job can be printed out, but a paper is fed from Tray1 like Auto tray select.
- 1-19J76R: Scale to fit and full bleed does not mix
- 1-19K4M7: Jobs are not displayed in accordance with the order of "Date/Time" in the joblog.
- 1-19QSLI: DLC ps error when ripping job
- 1-1A9NQF: If B5 size data is imposed and printed with B4 size, Configure is printed with B5 size.
- 1-1AHNCV: Cannot print HPT correctly.
- 1-1AI9RO: If RIP is executed via other than PS drv, pattern image collapses.

Preparation before Installation

1. Please print out the configuration page. Verify the **Server Info** section. It should show the version number "2.0". And also verify the **Update Information** section. It should show "**1-1403IK**"

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 05-Jul-11	No.: RM382005
--	-----------------	---------------

2. Please install "1-1403IK", if the **Update Information** section is blank. Or please install the system 2.0 again, if the version number is not 2.0.

Note

1. You should keep to the install order when the patch is installed.
2. You should execute the reboot when you install an "**Exclusive**" patch.
(The patch names that you installed will be shown in the configuration after reboot.)

Installation Instructions

Patch installation instruction

- 1 Make sure the Fiery is idle.
- 2 Execute 1-xxxxxx.exe and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Login must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be either the IP address or the Fiery server name.
- 4 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Restart later (not Exclusive) then apply the next patch.
or
Reboot. (**Exclusive**)
- 5 Wait until the Fiery comes to Idle and print the configuration page.
- 6 Verify that the System Update Log section contains the patch number 1-xxxxxx.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 23-Nov-11	No.: RM382006
Subject: Release note System Patch EXP05 for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: T. Satoh	
From: 1st PP Tech Service Sect. PP Tech Service Dept.,			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch EXP05 for AG-P1/C1-QX2.0(Color Controller E-80)

Files included in this release	
File name	File size
M3827566.exe	31.5 MB

Problem Solving (Measures)

Following are the key problems that have been given measures.

Files included in this release

Folder Name/ File Name/ File Size/ Reboot

- 1st/ 1-1AYSJ9.exe/ 1,408,064/ not Exclusive
- 2nd/ 1-1AYSKH.exe/ 1,114,952/ not Exclusive
- 3rd/ 1-1B3O8H.exe/ 17,035,560/ not Exclusive
- 4th/ 1-1AZX6D.exe/ 1,241,832/ not Exclusive
- 5th/ 1-1B1ER6.exe/ 2,120,304/ not Exclusive
- 6th/ 1-1B58C7.exe/ 1,253,288/ not Exclusive
- 7th/ 1-1BKSBQ.exe/ 1,517,568/ not Exclusive
- 8th/ 1-1BJJVN.exe/ 1,516,992/ not Exclusive
- 9th/ 1-1BRJZX.exe/ 1,518,296/ not Exclusive
- 10th/ 1-1CA20N.exe/ 5,099,048/ not Exclusive

Note : Important!!! Strictly follow the installation order as indicated here above.

Issue(s) addressed with this release

- 1-1AYSJ9: When 2 at center of the staple has been requested, Fiery show PS error (Rangecheck Error).
- 1-1AYSKH: When PS-File is printed by Virtual Printer, a sheet is not fed from a correct tray.
- 1-1B3O8H: Importing PDF files through CWS.
- 1-1AZX6D: RGB image with Pure Black prints incorrectly
- 1-1B1ER6: By specific data, "Scale to Fit" is not applied.
- 1-1B58C7: CWS5:PS data are classified as PCL
- 1-1BKSBQ: Impose page rotation problem
- 1-1BJJVN: Impose:Scaling is not applied even if the template which set "Scale" is used.
- 1-1BRJZX: Connection with Fiery and printer run out.
- 1-1CA20N: Compose does not launch from PDF files.

Preparation before Installation

1. Please print out the configuration page. Verify the **Server Info** section. It should show the version number "2.0". And also verify the **Update Information** section. It should show the "1-1403IK"
2. Please install the "1-1403IK", if the **Update Information** section is blank. Or please install the system 2.0 again, if the version number is not 2.0.

Model: **AG-P1/C1-QX2.0(Color Controller E-80)**

Date: 23-Nov-11

No.: RM382006

Note

1. You should keep to install order when the patch will be installed.
2. You should execute the reboot when you install the patch of "**Exclusive**".
(The patch names that you installed will be shown in the configuration after reboot.)

Installation Instructions

Patch installation instruction

- 1 Make sure the Fiery is idle.
- 2 Execute 1-**xxxxxx**.exe and follow the instructions in the Fiery Patch Downloader.
- 3 Notes about the Fiery Patch Downloader
 - a. Login must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be either the IP address or the Fiery server name.
- 4 After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Restart later (not Exclusive) then apply next patch.
or
Reboot. (**Exclusive**)
- 5 Wait until the Fiery comes to Idle and print the configuration page.
- 6 Verify that the System Update Log section contains the patch number 1-**xxxxxx**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 14-Dec-11	No.: RM382007
Subject: Release note for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: T. Satoh	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the release note for AG-P1/C1-QX2.0(Color Controller E-80)

Files included in this release	
File name	File size
M3827567.exe	192 KB

Problem Solving (Measures)

System/Web update did not function since 10 October 2011 for Fiery servers that run on either Windows XPe SP2 or XPe SP3.

Steps to reproduce

NA

Prerequisite(s)

Installation instructions

Installation on FACI systems:

1. Execute 1-1CO771.exe and follow the instructions
2. Fiery must be rebooted in order for changes to take effect.

Installation on non-FACI systems:

1. Enable remote desktop on the server.
2. With a Windows XP client, using remote desktop to the Fiery server
3. Execute 1-1CO771.exe and follow the instructions
4. Fiery must be rebooted in order for changes to take effect.

Known Issues

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 02-Mar-12	No.: RM382008
Subject: Release note System Patch EXP07 for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: T. Satoh	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch EXP07 for AG-P1/C1-QX2.0(Color Controller E-80)

Files included in this release	
File name	File size
M3827568 .exe	149MB

Problem Solving (Measures)

Following are the key problems that have been given measures.

Files included in this release

Folder Name/ File Name/ File Size/ Reboot

- 1st/ 1-1BQC8E.exe/ 125,980,168/ not Exclusive
- 2nd/ 1-1BQAK6.exe/ 3,201,536/ not Exclusive
- 3rd/ 1-1BVLUA.exe/ 8,126,064/ not Exclusive
- 4th/ 1-1BQ9RY.exe/ 2,429,856/ not Exclusive
- 5th/ 1-1C4JEI.exe/ 7,202,680/ not Exclusive
- 6th/ 1-1BTCHO.exe/ 9,629,976/ Exclusive

Note: Important!!! Strictly follow the installation order as indicated here above.

Issue(s) addressed with this release

- 1-1BQC8E: If CMYK Source is set to None in Virtual Printer's settings, a conflict message is displayed when the driver's properties are opened.
- 1-1BQAK6: After recovery from a Paper End condition when SEF jobs are being printed, LEF paper is requested.
- 1-1BVLUA: The MIB value is not correctly updated when printing certain jobs via raw port 9101.
- 1-1BQ9RY: A 2 at Left staple job cannot be printed on short edge feed paper where a cover from Inserter is added.
- 1-1C4JEI: No duplex printing with PCL5 data with later version of Fiery Controller.
- 1-1BTCHO: The controller crashes when Preflight is executed repeatedly.

Preparation before Installation

1. Please print out the configuration page. Verify the **Server Info** section. It should show the version number "2.0". And also verify the **Update Information** section. It should show the "1-14O3IK"
2. Please install the "1-14O3IK", if the **Update Information** section is blank. Or please install the system 2.0 again, if the version number is not "2.0" or if other patch already installed.

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 02-Mar-12	No.: RM382008
---	-----------------	---------------

Note

1. You should keep to install order when the patch will be installed.
2. You should execute the reboot when you install the patch of "Exclusive".
(The patch names that you installed will be shown in the configuration after reboot.)
3. You should execute the reboot when you installed all patches.

Installation Instructions

1. Please refer to the each release note.
Please care each patch may need preparation patch(s).
2. Please print configuration page and verify the patch name after reboot.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 13-June-12	No.: RM382009
Subject: Release note System Patch EXP08 for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Takahiro Satoh	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch EXP08 for AG-P1/C1-QX2.0(Color Controller E-80).

Patch File	Issue(s)
1-1E2AVE.exe	- Font size changes during a print job when printing particular PCL files.

Before installing 1-1E2AVE. exe:

1. Known issues listed below, read before installing **1-1E2AVE.exe** patch:
 - None.
2. The prerequisites listed below must be installed in the order specified before the **1-1E2AVE.exe** patch is applied:
 - 1-14O3IK.exe
 - 1-19QSLI.exe
 - 1-1B3O8H.exe
3. Do NOT install any of the following patch(es) after installing the **1-1E2AVE.exe** patch. If you must install any of the patch(es) below, do so before installing the **1-1E2AVE.exe** patch:
 - 1-1AHNCV.exe
 - 1-1C4JEL.exe
4. This patch is not exclusive. It may be installed along with other patches. One server Reboot is sufficient for all patches to take effect on the system.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **1-1E2AVE.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 13-June-12	No.: RM382009
---	------------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. Verify that the System Updates Log section contains the patch number **1-1E2AVE**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 13-June-12	No.: RM382010
Subject: Release note System Patch EXP09 for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Takahiro Satoh	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch EXP09 for AG-P1/C1-QX2.0(Color Controller E-80).

Patch File	Issue(s)
1-1E2Y15.exe	- An error message appears when printing a particular file with Mixed Media.

Before installing 1-1E2Y15. exe:

1. This patch is not exclusive. It may be applied to the server along with other patches. One server reboot is sufficient for all patches to take effect on the system.
2. The prerequisites listed below must be installed in the order specified before the **1-1E2Y15.exe** patch is applied:
 - 1-14O3IK.exe
 - 1-191K3X.exe
 - 1-19QSLI.exe
 - 1-1B3O8H.exe
 - 1-1B1ER6.exe
 - 1-1BVLUA.exe
 - 1-1BQ9RY.exe
3. If any known issues listed below, read before installing **1-1E2Y15.exe** patch:
 - None.
4. Do NOT install any of the following patches after installing the **1-1E2Y15.exe** patch. If you are required to install any of the patches below, do so before installing the **1-1E2Y15.exe** patch:
 - None.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure the Fiery controller is Idle.
2. Execute **1-1E2Y15.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 13-June-12	No.: RM382010
---	------------------	---------------

- c. Hostname can be either the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch file is done processing, when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose Restart/Reboot later, make sure you manually reboot the server for changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. Verify that the System Updates Log section contains the patch number **1-1E2Y15**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 13-June-12	No.: RM382011
Subject: Release note System Patch EXP10 for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Takahiro Satoh	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch EXP10 for AG-P1/C1-QX2.0(Color Controller E-80).

Patch File	Issue(s)
1-1E8FZN.exe	-When printing using the direct queue [port 9101], the next job is not transmitted until the current job is printed out.

Before installing 1-1E8FZN. exe:

1. This patch is not exclusive. It may be applied to the server along with other patches. One server reboot is sufficient for all patches to take effect on the system.
2. The prerequisites listed below must be installed in the order specified before the **1-1E8FZN.exe** patch is applied:
 - 1-14O3IK.exe
 - 1-19QSLI.exe
 - 1-1B3O8H.exe
3. If any known issues listed below, read before installing **1-1E8FZN.exe** patch:
 - None.
4. Do NOT install any of the following patches after installing the **1-1E8FZN.exe** patch. If you are required to install any of the patches below, do so before installing the **1-1E8FZN.exe** patch:
 - 1-1AHNCV.exe
 - 1-1C4JEL.exe
 - 1-1E2AVE.exe
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure the Fiery controller is Idle.
2. Execute **1-1E8FZN.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be either the IP address or the Fiery server name.

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 13-June-12	No.: RM382011
---	------------------	---------------

4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch file is done processing, when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose Restart/Reboot later, make sure you manually reboot the server for changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. Verify that the System Updates Log section contains the patch number **1-1E8FZN**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 20-Jul-12	No.: RM382012
Subject: Release note System Patch EXP11 for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Takahiro Satoh	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch EXP11 for AG-P1/C1-QX2.0(Color Controller E-80).

Patch File	Issue(s)
1-1F1WQC.exe	- CMYK Simulation Profile setting is not honored when Properties of shared Printer driver is launched after setting up a virtual printer.

Before installing 1-1F1WQC.exe:

1. Known issues listed below, read before installing **1-1F1WQC.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **1-1F1WQC.exe** patch is installed:
 - 1-14O3IK.exe
3. Do NOT install any of the following patch(es) after installing the **1-1F1WQC.exe** patch. If you must install any of the patch(es) below, do so before installing the **1-1F1WQC.exe** patch:
 - None.
4. This patch is not exclusive. It may be installed along with other patches. One server Reboot is sufficient for all patches to take effect on the system.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **1-1F1WQC.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
6. Wait until the Fiery controller reaches Idle and print the Configuration page.

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 20-Jul-12	No.: RM382012
---	-----------------	---------------

7. Verify that the System Updates Log section contains the patch number **1-1F1WQC**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 20-Jul-12	No.: RM382013
Subject: Release note System Patch EXP12 for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Hiroshi Wada	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch EXP12 for AG-P1/C1-QX2.0(Color Controller E-80).

Patch File	Issue(s)
1-1F1X8G.exe	- A character with a specific font is printed incorrectly for a particular file.

Before installing 1-1F1X8G. exe:

1. Known issues listed below, read before installing **1-1F1X8G.exe** patch:
 - None.
2. The prerequisites listed below must be installed in the order specified before the **1-1F1X8G.exe** patch is applied:
 - 1-14O3IK.exe
 - 1-19QSLI.exe
 - 1-1B3O8H.exe
3. Do NOT install any of the following patch(es) after installing the **1-1F1X8G.exe** patch. If you must install any of the patch(es) below, do so before installing the **1-1F1X8G.exe** patch:
 - 1-19J7BQ.exe
 - 1-19J76R.exe
4. This patch is not exclusive. It may be installed along with other patches. One server Reboot is sufficient for all patches to take effect on the system.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **1-1F1X8G.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 20-Jul-12	No.: RM382013
---	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. Verify that the System Updates Log section contains the patch number **1-1F1X8G**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 05-Sep-13	No.: RM382014
Subject: Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Hiroshi Wada	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80).

Patch File	Issue(s)
1-1GHW66.exe	- Printer Counter behavior is incorrect, when a job is printed from Document Server.

Before installing 1-1GHW66.exe:

1. Known issues listed below, read before installing **1-1GHW66.exe** patch:
 - None.
2. The prerequisites listed below must be installed in the order specified before the **1-1GHW66.exe** patch is applied:
 - 1-14O3IK.exe
3. Do NOT install any of the following patch(es) after installing the **1-1GHW66.exe** patch. If you must install any of the patch(es) below, do so before installing the **1-1GHW66.exe** patch:
 - 1-18M9YD.exe
 - 1-18YMPK.exe
 - 1-190YYG.exe
 - 1-19J7BZ.exe
 - 1-1BQAK6.exe
4. This patch is not exclusive. It may be installed along with other patches. One server Reboot is sufficient for all patches to take effect on the system.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **1-1GHW66.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 05-Sep-13	No.: RM382014
---	-----------------	---------------

4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. Verify that the System Updates Log section contains the patch number **1-1GHW66**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 05-Sep-13	No.: RM382015
Subject: Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Hiroshi Wada	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80).

Patch File	Issue(s)
1-1HU4Q8.exe	- A patch to support Web Configure on Mac OS 10.8.

Before installing 1-1HU4Q8.exe:

1. Known issues listed below, read before installing **1-1HU4Q8.exe** patch:
 - None.
2. The prerequisites listed below must be installed in the order specified before the **1-1HU4Q8.exe** patch is applied:
 - 1-14O3IK.exe
3. Do NOT install any of the following patch(es) after installing the **1-1HU4Q8.exe** patch. If you must install any of the patch(es) below, do so before installing the **1-1HU4Q8.exe** patch:
 - None.
4. This patch is not exclusive. It may be installed along with other patches. One server Reboot is sufficient for all patches to take effect on the system.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **1-1HU4Q8.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. Verify that the System Updates Log section contains the patch number **1-1HU4Q8**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 05-Sep-13	No.: RM382016
Subject: Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Hiroshi Wada	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80).

Patch File	Issue(s)
1-1I84XQ.exe	- Unable to disable IPv6 option.

Before installing 1-1I84XQ.exe:

1. Known issues listed below, read before installing **1-1I84XQ.exe** patch:
 - None.
2. The prerequisites listed below must be installed in the order specified before the **1-1I84XQ.exe** patch is applied:
 - 1-14O3IK.exe
3. Do NOT install any of the following patch(es) after installing the **1-1I84XQ.exe** patch. If you must install any of the patch(es) below, do so before installing the **1-1I84XQ.exe** patch:
 - None.
4. This patch is not exclusive. It may be installed along with other patches. One server Reboot is sufficient for all patches to take effect on the system.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **1-1I84XQ.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. Verify that the System Updates Log section contains the patch number **1-1I84XQ**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 05-Sep-13	No.: RM382017
Subject: Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Hiroshi Wada	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80).

Patch File	Issue(s)
1-1I1DED.exe	- Input Tray setting is not honored while printing with a virtual printer.

Before installing 1-1I1DED.exe:

1. Known issues listed below, read before installing **1-1I1DED.exe** patch:
 - None.
2. The prerequisites listed below must be installed in the order specified before the **1-1I1DED.exe** patch is applied:
 - 1-14O3IK.exe
 - 1-191K3X.exe
 - 1-19QSLI.exe
 - 1-1B3O8H.exe
 - 1-1B1ER6.exe
 - 1-1BVLUA.exe
 - 1-1BQ9RY.exe
3. Do NOT install any of the following patch(es) after installing the **1-1I1DED.exe** patch. If you must install any of the patch(es) below, do so before installing the **1-1I1DED.exe** patch:
 - 1-17O315.exe
 - 1-1AYSKH.exe
 - 1-1DID4N.exe
4. This patch is not exclusive. It may be installed along with other patches. One server Reboot is sufficient for all patches to take effect on the system.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **1-1I1DED.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 05-Sep-13	No.: RM382017
---	-----------------	---------------

- b. Password is the Fiery administrator login password.
- c. Hostname can be the IP address or the Fiery server name.
- 4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
- 5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
- 6. Wait until the Fiery controller reaches Idle and print the Configuration page.
- 7. Verify that the System Updates Log section contains the patch number **1-1I1DED**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 05-Sep-13	No.: RM382018
Subject: Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Hiroshi Wada	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80).

Patch File	Issue(s)
1-1J018J.exe	- Garbled data occurs with Impose settings for a particular job.

Before installing 1-1J018J.exe:

1. Known issues listed below, read before installing **1-1J018J.exe** patch:
 - None.
2. The prerequisites listed below must be installed in the order specified before the **1-1J018J.exe** patch is applied:
 - 1-14O3IK.exe
 - 1-1676UH.exe
 - 1-16KG4Z.exe
 - 1-16KG33.exe
 - 1-19QSLI.exe
 - 1-1B3O8H.exe
3. Do NOT install any of the following patch(es) after installing the **1-1J018J.exe** patch. If you must install any of the patch(es) below, do so before installing the **1-1J018J.exe** patch:
 - 1-19J76R.exe
 - 1-1AI9RO.exe
 - 1-1F1X8G.exe
4. This patch is not exclusive. It may be installed along with other patches. One server Reboot is sufficient for all patches to take effect on the system.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **1-1J018J.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 05-Sep-13	No.: RM382018
---	-----------------	---------------

- c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. Verify that the System Updates Log section contains the patch number **1-1J018J**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 18-Sep-13	No.: RM382019
Subject: Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Hiroshi Wada	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80).

Patch File	Issue(s)
1-1JHCG8.exe	- A Compatibility patch to support Web Configure on Internet Explorer 10.

Before installing 1-1JHCG8.exe:

1. Known issues listed below, read before installing **1-1JHCG8.exe** patch:
 - None.
2. The prerequisites listed below must be installed in the order specified before the **1-1JHCG8.exe** patch is applied:
 - None.
3. Do NOT install any of the following patch(es) after installing the **1-1JHCG8.exe** patch. If you must install any of the patch(es) below, do so before installing the **1-1JHCG8.exe** patch:
 - None.
4. This patch is not exclusive. It may be installed along with other patches. One server Reboot is sufficient for all patches to take effect on the system.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **1-1JHCG8.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
6. Wait until the Fiery controller reaches Idle and print the Configuration page.

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 18-Sep-13	No.: RM382019
---	-----------------	---------------

7. Verify that the System Updates Log section contains the patch number **1-1JHCG8**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 04-Oct-13	No.: RM382020
Subject: Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Y. Okano	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch for AG-P1/C1-QX2.0 (Color Controller E-80).

Patch File	Issue(s)
1-1JYFC3.exe	- Image alignment is incorrect for a specific VDP job when printed with duplex setting.

Before installing 1-1JYFC3.exe:

1. Known issues listed below, read before installing **1-1JYFC3.exe** patch:
 - None.
2. The prerequisites listed below must be installed in the order specified before the **1-1JYFC3.exe** patch is applied:
 - 1-14O3IK.exe
3. Do NOT install any of the following patch(es) after installing the **1-1JYFC3.exe** patch. If you must install any of the patch(es) below, do so before installing the **1-1JYFC3.exe** patch:
 - None.
4. This patch is not exclusive. It may be installed along with other patches. One server Reboot is sufficient for all patches to take effect on the system.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **1-1JYFC3.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
6. Wait until the Fiery controller reaches Idle and print the Configuration page.

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 04-Oct-13	No.: RM382020
---	-----------------	---------------

7. Verify that the System Updates Log section contains the patch number **1-1JYFC3**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 15-Nov-13	No.: RM382021
Subject: Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: M. Yoshikawa	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch for AG-P1/C1-QX2.0 (Color Controller E-80).

Patch File	Issue(s)
1-1KPSMA.exe	- Validity period of the SSL authentication certificate was extended due to its expiration.

Before installing 1-1KPSMA.exe:

1. Known issues listed below, read before installing **1-1KPSMA.exe** patch:
 - None.
2. The prerequisites listed below must be installed in the order specified before the **1-1KPSMA.exe** patch is applied:
 - 1-14O3IK.exe
 - 1-1JHCG8.exe
3. Do NOT install any of the following patch(es) after installing the **1-1KPSMA.exe** patch. If you must install any of the patch(es) below, do so before installing the **1-1KPSMA.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **1-1KPSMA.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 15-Nov-13	No.: RM382021
---	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If, after multiple patches are manually installed, the Fiery does not reach Idle after approximately five minutes, please manually start the Fiery service by right-clicking on the Fiery bar and selecting Restart Fiery.
8. Verify that the System Updates Log section contains the patch number **1-1KPSMA**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 15-Nov-13	No.: RM382022
Subject: Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: M. Yoshikawa	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch for AG-P1/C1-QX2.0 (Color Controller E-80).

Patch File	Issue(s)
FIT109349.exe	- Images might not be printed correctly due to the incorrect imageable area dimensions in PPD.

Before installing FIT109349.exe:

1. Known issues listed below, read before installing **FIT109349.exe** patch:
 - None.
2. The prerequisites listed below must be installed in the order specified before the **FIT109349.exe** patch is applied:
 - 1-14O3IK.exe
 - 1-1JHCG8.exe
3. Do NOT install any of the following patch(es) after installing the **FIT109349.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT109349.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT109349.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 15-Nov-13	No.: RM382022
---	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If, after multiple patches are manually installed, the Fiery does not reach Idle after approximately five minutes, please manually start the Fiery service by right-clicking on the Fiery bar and selecting Restart Fiery.
8. Verify that the System Updates Log section contains the patch number **FIT109349**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 03-Sep-14	No.: RM382023
Subject: Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Hiroshi Wada	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch for AG-P1/C1-QX2.0 (Color Controller E-80).

Patch File	Issue(s)
FIT204548.exe	- Configure application does not active from WebTools, if Java 1.7u51 is installed on the Windows OS or Mac OS.

Before installing FIT204548.exe:

1. Please refer to the patch Addendum for additional information regarding this release.
2. Known issues listed below, read before installing **FIT204548.exe** patch:
 - None.
3. The prerequisites listed below must be installed in the order specified before the **FIT204548.exe** patch is applied:
 - 1-14O3IK.exe
4. Do NOT install any of the following patch(es) after installing the **FIT204548.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT204548.exe** patch:
 - 1-1HU4Q8.exe
 - 1-1JHCG8.exe
 - 1-1KPSMA.exe
5. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
6. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT204548.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 03-Sep-14	No.: RM382023
---	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If, after multiple patches are manually installed, the Fiery does not reach Idle after approximately five minutes, please manually start the Fiery service by right-clicking on the Fiery bar and selecting Restart Fiery.
8. Verify that the System Updates Log section contains the patch number **FIT204548**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 03-Sep-14	No.: RM382023
---	-----------------	---------------

Fiery Patch Addendum

This patch will make the Fiery compatible with Java Runtime Environment (JRE) 1.7u51 and above versions installed in client machine. After applying patch to the Fiery Servers, Fiery Configure application for Fiery Servers can be launched from Microsoft Windows and Apple Inc. Macintosh OSX client machine as well.


Known Limitations:

- After installing/updating the JRE 1.7u51 on Macintosh OSX client machine, sometimes Safari browser does not recognize newly installed Java due to this user may unable to launch Configure application from Safari browser. To resolve this problem, please try the below mentioned options:
 - Reboot the Macintosh OSX client machine manually, after installing/updating the JRE 1.7u51.
 - Enable the Java Web contents from Safari browser Preferences -> Security tab. Please see the below Screenshot - 1.




(Screenshot - 1)

- Enable the Java from System Preferences -> Java Control Panel -> Security tab. Please see the below Screenshot - 2.

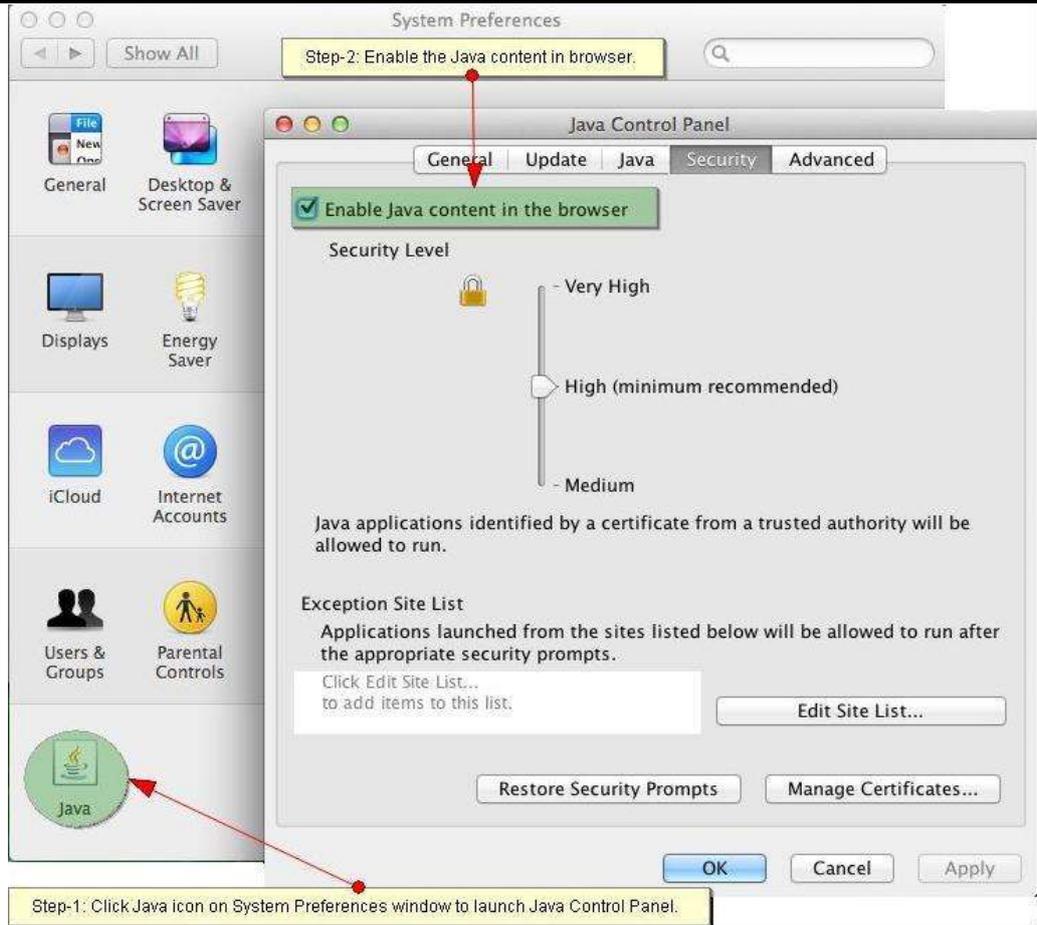

(Screenshot - 2)

- If Safari 5.x browser does not recognize Java 7, please update the Safari 5.x to Safari 6.x version. Or use Firefox browser to launch Configure application.
- To avoid security vulnerability, Apple has added restriction on Safari browser for signed Java applet to access local directories. Backup/Restore functionality of Configure requires access to local directory to read/write file. To remove the above restriction please do the following steps:
 1. Launch Preferences window from Safari and open the Security tab.
 2. Click on “Manage Website Settings...” button.
 3. Select “Java” from left hand side applications list.
 4. Select “Run in Unsafe Mode” from drop down for a particular Fiery.
 5. Click “Trust” button on pop-up window for confirmation.

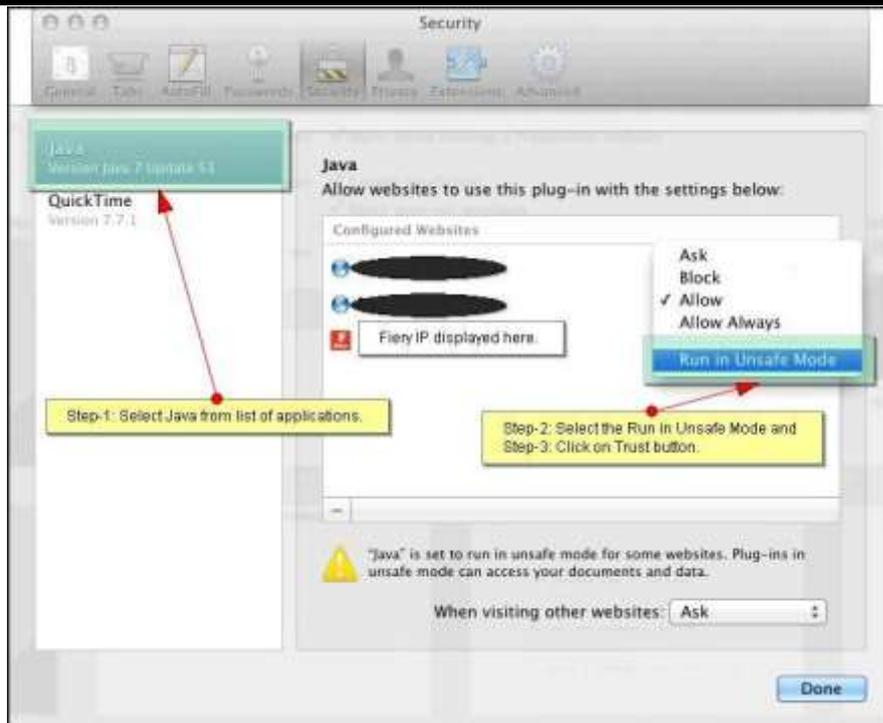

(Screenshot - 3)

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 10-Jun-15	No.: RM382024
Subject: Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Miyuki Yoshikawa	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch for AG-P1/C1-QX2.0 (Color Controller E-80).

Patch File	Issue(s)
FIT100556477.exe	12-digit patch IDs are truncated on the server configuration page.

Before installing FIT100556477.exe:

- Known issues listed below, read before installing **FIT100556477.exe** patch:
 - None.
- The following prerequisites must be installed in the order specified before the **FIT100556477.exe** patch is applied:
 - 1-14O3IK.exe
- Do NOT install any of the following patch(es) after installing the **FIT100556477.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT100556477.exe** patch:
 - None
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

- Make sure that the Fiery printer controller reaches Idle.
- Execute **FIT100556477.exe** and follow the instructions in the Fiery Patch Downloader.
- Notes about the Fiery Patch Downloader
 - Logon must be admin. This is fixed and cannot be modified.
 - Password is the Fiery administrator login password.
 - Hostname can be the IP address or the Fiery server name.
- Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
- After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- Wait until the Fiery controller reaches Idle and print the Configuration page.
- If the controller does not eventually reach Idle, please manually start the Fiery service.
- Verify that the System Updates Log section contains the patch number **FIT100556477**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 10-Jun-15	No.: RM382025
Subject: Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Miyuki Yoshikawa	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch for AG-P1/C1-QX2.0 (Color Controller E-80).

Patch File	Issue(s)
FIT100541576.exe	PDF file imported to Command WorkStation might result in error while RIPping.

Before installing FIT100541576.exe:

- Known issues listed below, read before installing **FIT100541576.exe** patch:
 - None.
- The following prerequisites must be installed in the order specified before the **FIT100541576.exe** patch is applied:
 - 1-14O3IK.exe
 - 1-1676UH.exe
 - 1-16KG4Z.exe
 - 1-16KG33.exe
 - 1-19QSLI.exe
 - 1-1B3O8H.exe
 - 1-1J018J.exe
 - FIT100556477.exe
- Do NOT install any of the following patch(es) after installing the **FIT100541576.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT100541576.exe** patch:
 - 1-1AI9RO.exe
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

- Make sure that the Fiery printer controller reaches Idle.
- Execute **FIT100541576.exe** and follow the instructions in the Fiery Patch Downloader.
- Notes about the Fiery Patch Downloader
 - Logon must be admin. This is fixed and cannot be modified.
 - Password is the Fiery administrator login password.
 - Hostname can be the IP address or the Fiery server name.

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 10-Jun-15	No.: RM382025
---	-----------------	---------------

4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the System Updates Log section contains the patch number **FIT100541576**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 21-Aug-15	No.: RM382026
Subject: Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Miyuki Yoshikawa	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch for AG-P1/C1-QX2.0 (Color Controller E-80).

Patch File	Issue(s)
FIT101045437.exe	If Composite overprint is enabled, crop marks are printed in the wrong color.

Before installing FIT101045437.exe:

1. Known issues listed below, read before installing **FIT101045437.exe** patch:
 - None.
2. The following prerequisite(s) must be installed in the order specified before applying the **FIT101045437.exe** patch:
 - 1-14O3IK.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101045437.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101045437.exe** patch:
 - None.
4. This patch is not exclusive, it can be installed along with other patches concurrently, and one server Reboot or Restart is sufficient for all patches to take effect on the system.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101045437.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
5. Wait until the Fiery controller reaches Idle and print the Configuration page.
6. If the controller does not eventually reach Idle, please manually start the Fiery service.
7. Verify that the System Updates Log section contains the patch number **FIT101045437**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 17--15	No.: RM382027
Subject: Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Miyuki Yoshikawa	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch for AG-P1/C1-QX2.0 (Color Controller E-80).

Patch File	Issue(s)
FIT101063085.exe	Certificate Update for XPe. This is required for system updates to download new updates.

Before installing FIT101063085.exe

- Known issues listed below, read before installing **FIT101063085.exe** patch:
 - When this patch is not applied, after September 20th, 2015, the Fiery controller is no longer able to receive automatic system updates from EFI.
 - For the above reason, if the system software has been re-installed, make sure to apply this patch manually BEFORE running the automatic system updates.
- The following prerequisites must be installed in the order specified before the **FIT101063085.exe** patch is installed:
 - None.
- Do NOT install the following patch after installing the **FIT101063085.exe** patch.
 - 1-1CO771.exe
Note: The 1-1CO771.exe is no longer distributed.

Patch installation on FACL system instructions

- Execute **FIT101063085.exe** and follow the instructions.
- Fiery must be rebooted in order for changes to take effect.

Patch installation on non-FACL system instructions

- Enable remote desktop on the server.
- With a Windows XP client, using remote desktop to the Fiery controller.
- Execute **FIT101063085.exe** and follow the instructions.
- Fiery must be rebooted in order for changes to take effect.
- Wait until the Fiery controller reaches Idle and print the Configuration page.
- If the controller does not eventually reach Idle, please manually start the Fiery service.
- Verify that the System Updates Log section contains the patch number **FIT101063085**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 29-Jun-16	No.: RM382028
Subject: Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Miyuki Yoshikawa	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch for AG-P1/C1-QX2.0 (Color Controller E-80).

Patch File	Issue(s)
FIT101145629.exe	- Files scanned using the Scan to SMB feature on a Windows XP Server based Fiery controller cannot be saved in Mac OSX 10.10 shared folder.

Before installing FIT101145629.exe:

- Known issues listed below, read before installing **FIT101145629.exe** patch:
 - None.
- The following prerequisite(s) must be installed in the order specified before applying the **FIT101145629.exe** patch:
 - 1-14O3IK.exe
 - FIT100556477.exe
- Do **NOT** install any of the following patch(es) after installing the **FIT101145629.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101145629.exe** patch:
 - None.
- This patch is not exclusive, it can be installed along with other patches concurrently, and one server Reboot or Restart is sufficient for all patches to take effect on the system.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

- Make sure that the Fiery printer controller reaches Idle.
- Execute **FIT101145629.exe** and follow the instructions in the Fiery Patch Downloader.
- Notes about the Fiery Patch Downloader
 - Logon must be admin. This is fixed and cannot be modified.
 - Password is the Fiery administrator login password.
 - Hostname can be the IP address or the Fiery server name.
- After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- Wait until the Fiery controller reaches Idle and print the Configuration page.
- If the controller does not eventually reach Idle, please manually start the Fiery service.
- Verify that the System Updates Log section contains the patch number **FIT101145629**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 25-Oct-16	No.: RM382029
Subject: Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Miyuki Yoshikawa	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch for AG-P1/C1-QX2.0 (Color Controller E-80).

Patch File	Issue(s)
FIT101446053.exe	- OpenSSL security was updated for Windows-based Fiery controller.

Before installing FIT101446053.exe:

- Known issues listed below, read before installing **FIT101446053.exe** patch:
 - None.
- The following prerequisite(s) must be installed in the order specified before applying the **FIT101446053.exe** patch:
 - 1-14O3IK.exe
 - 1-1JHCG8.exe
 - 1-1KPSMA.exe
 - FIT204548.exe
- Do **NOT** install any of the following patch(es) after installing the **FIT101446053.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101446053.exe** patch:
 - None.
- This patch is exclusive, it must be installed by itself, and the server must be rebooted or restarted once. After that, other patches can be applied to the server.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

- Make sure that the Fiery printer controller reaches Idle.
- Execute **FIT101446053.exe** and follow the instructions in the Fiery Patch Downloader.
- Notes about the Fiery Patch Downloader
 - Logon must be admin. This is fixed and cannot be modified.
 - Password is the Fiery administrator login password.
 - Hostname can be the IP address or the Fiery server name.
- After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
- Wait until the Fiery controller reaches Idle and print the Configuration page.
- If the controller does not eventually reach Idle, please manually start the Fiery service.
- Verify that the System Updates Log section contains the patch number **FIT101446053**.

Model: AG-P1/C1-QX2.0(Color Controller E-80)		Date: 25-Oct-16	No.: RM382030
Subject: Release note System Patch for AG-P1/C1-QX2.0(Color Controller E-80)		Prepared by: Miyuki Yoshikawa	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB is the Release note System Patch for AG-P1/C1-QX2.0 (Color Controller E-80).

Patch File	Issue(s)
FIT101167175.exe	- Patch to upgrade PHP, Apache and OpenSSL v5.4.41, v2.2.29 and v0.98zf respectively. <ul style="list-style-type: none"> • PHP : 5.3.29 → 5.4.41 • Apache : 2.2.29 → 2.2.29 • OpenSSL : 0.9.8zb → 0.9.8zf

Before installing FIT101167175.exe:

1. Known issues listed below, read before installing **FIT101167175.exe** patch:
 - None.
2. The following prerequisite(s) must be installed in the order specified before applying the **FIT101167175.exe** patch:
 - 1-14O3IK.exe
 - 1-1JHCG8.exe
 - 1-1KPSMA.exe
 - FIT204548.exe
 - FIT101446053.exe
3. Do **NOT** install any of the following patch(es) after installing the **FIT101167175.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101167175.exe** patch:
 - None.
4. This patch is exclusive, it must be installed by itself, and the server must be rebooted or restarted once. After that, other patches can be applied to the server.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101167175.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.

Model: AG-P1/C1-QX2.0(Color Controller E-80)	Date: 25-Oct-16	No.: RM382030
---	-----------------	---------------

5. Wait until the Fiery controller reaches Idle and print the Configuration page.
6. If the controller does not eventually reach Idle, please manually start the Fiery service.
7. Verify that the System Updates Log section contains the patch number **FIT101167175**.