

Model: Br-C1 EFI(EB-32)		Date: 27-Feb-14	No.: RD726001
Subject: Composite Patch (FIT203760) release note for System Software Version 1.0 for Br-C1 EFI(EB-32)		Prepared by: Hiroshi Wada	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release note for **PLP (Post Launching Patch)** for System Software Version 1.0 for **Br-C1 EFI (EB-32)**.

Table of contents:

- **About this Post Launching Patch**
- **Issues addressed with the PLP**
- **Preparation**
- **Patch installation instructions.**

About this Post Launching Patch

Files included in this release	
File name	File size
FIT203760.exe	12.0 MB

Product name

Pro 8100S/8110S/8120S EB-32 Ver.1.0

Notes:

- There are **no** prerequisites for installing the **PLP (FIT203760)**.
- If you wish to **reinstall the system**, install the patches as follows:
System software Ver1.0 + **PLP**

Issues addressed with the PLP

This **PLP** addresses the following defects not necessarily in the order approved:

Patch ID	Short Description
FIT200900	The error message of the blank is displayed when choose "Continue" when invalid RingBind setting.
FIT200902	Printing with booklet staple when Booklet staples end, even if I select [Continue], printing is not resumed.
FIT200904	Printing is started in the state that continues displaying empty error popup when set a staples after BookletStaple empty occur.
FIT200914	When prints in "Face up - reverse order", the image of the 2nd sheet and later turns upside down.
FIT201242	"Glue empty" message for the second job pops-up only in CWS and not on LCD.

Preparation

1. Known issues listed below, read before installing **FIT203760.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT203760.exe** patch is installed:
 - None.
3. Do **NOT** install any of the following patch(es) after installing the **FIT203760.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT203760.exe** patch:
 - None.
4. This patch is not exclusive, it can be installed along with other patches concurrently, and one server Reboot or Restart is sufficient for all patches to take effect on the system.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT203760.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)*
6. Wait until the Fiery controller reaches Idle, print the Configuration page.
7. Verify that the **System Updates Log** section contains the patch number **FIT203760**

Model: Baron-C1 EFI(EB-32)		Date: 23-May-14	No.: RD726002
Subject: Patch (FIT205071) release note for System Software Version 1.0 for Baron-C1 EFI(EB-32)		Prepared by: Hiroshi Wada	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT205071**” applied to the Baron-C1 EFI (EB-32) system software version 1.0.

Patch File	Issue(s)
FIT205071.exe	- Image Enhance is shown in CWS Device Center while is not applicable in job properties.

Before installing FIT205071.exe

1. Known issues listed below, read before installing **FIT205071.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT205071.exe** patch is installed:
 - None.
3. Do NOT install any of the following patch(es) after installing the **FIT205071.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT205071.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT205071.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1 EFI(EB-32)	Date: 23-May-14	No.: RD726002
-----------------------------------	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT205071**.

Model: Baron-C1 EFI(EB-32)		Date: 23-May-14	No.: RD726003
Subject: Patch (FIT203762) release note for System Software Version 1.0 for Baron-C1 EFI(EB-32)		Prepared by: Hiroshi Wada	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT203762**” applied to the Baron-C1 EFI (EB-32) system software version 1.0.

Patch File	Issue(s)
FIT203762.exe	- Image Shift does not work correctly when cover page is added.

Before installing FIT203762.exe

1. Known issues listed below, read before installing **FIT203762.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT203762.exe** patch is installed:
 - None.
3. Do NOT install any of the following patch(es) after installing the **FIT203762.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT203762.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT203762.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1 EFI(EB-32)	Date: 23-May-14	No.: RD726003
-----------------------------------	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (*If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.*)
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT203762**.

Model: Baron-C1 EFI(EB-32)		Date: 23-May-14	No.: RD726004
Subject: Patch (FIT205073) release note for System Software Version 1.0 for Baron-C1 EFI(EB-32)		Prepared by: Hiroshi Wada	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT205073**” applied to the Baron-C1 EFI (EB-32) system software version 1.0.

Patch File	Issue(s)
FIT205073.exe	- Cannot print 16K and 8K mixture data with Half Z-fold(Large paper only).

Before installing FIT205073.exe

1. Known issues listed below, read before installing **FIT205073.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT205073.exe** patch is installed:
 - FIT203760.exe
3. Do NOT install any of the following patch(es) after installing the **FIT205073.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT205073.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT205073.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1 EFI(EB-32)	Date: 23-May-14	No.: RD726004
-----------------------------------	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT205073**.

Model: Baron-C1 EFI(EB-32)		Date: 23-May-14	No.: RD726005
Subject: Patch (FIT204571) release note for System Software Version 1.0 for Baron-C1 EFI(EB-32)		Prepared by: Hiroshi Wada	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT204571**” applied to the Baron-C1 EFI (EB-32) system software version 1.0.

Patch File	Issue(s)
FIT204571.exe	- Patch to address incompatibility issue between the Configure application and JRE 1.7u51.

Before installing FIT204571.exe

1. Please refer to the patch Addendum for additional information regarding this release.
2. Known issues listed below, read before installing **FIT204571.exe** patch:
 - None.
3. The following prerequisites must be installed in the order specified before the **FIT204571.exe** patch is installed:
 - None.
4. Do NOT install any of the following patch(es) after installing the **FIT204571.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT204571.exe** patch:
 - None.
5. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
6. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT204571.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1 EFI(EB-32)	Date: 23-May-14	No.: RD726005
-----------------------------------	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (*If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.*)
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT204571**.

Model: Baron-C1 EFI(EB-32)	Date: 23-May-14	No.: RD726005
-----------------------------------	-----------------	---------------

Fiery Patch Addendum

This patch will make the Fiery compatible with Java Runtime Environment (JRE) 1.7u51 and above versions installed in client machine. After applying patch to the Fiery Servers, Fiery Configure application for Fiery Servers can be launched from Microsoft Windows and Apple Inc. Macintosh OSX client machine as well.


Known Limitations:

- After installing/updating the JRE 1.7u51 on Macintosh OSX client machine, sometimes Safari browser does not recognize newly installed Java due to this user may unable to launch Configure application from Safari browser. To resolve this problem, please try the below mentioned options:
 - Reboot the Macintosh OSX client machine manually, after installing/updating the JRE 1.7u51.
 - Enable the Java Web contents from Safari browser Preferences -> Security tab. Please see the below Screenshot - 1.



(Screenshot - 1)


- Enable the Java from System Preferences -> Java Control Panel -> Security tab. Please see the below Screenshot - 2.

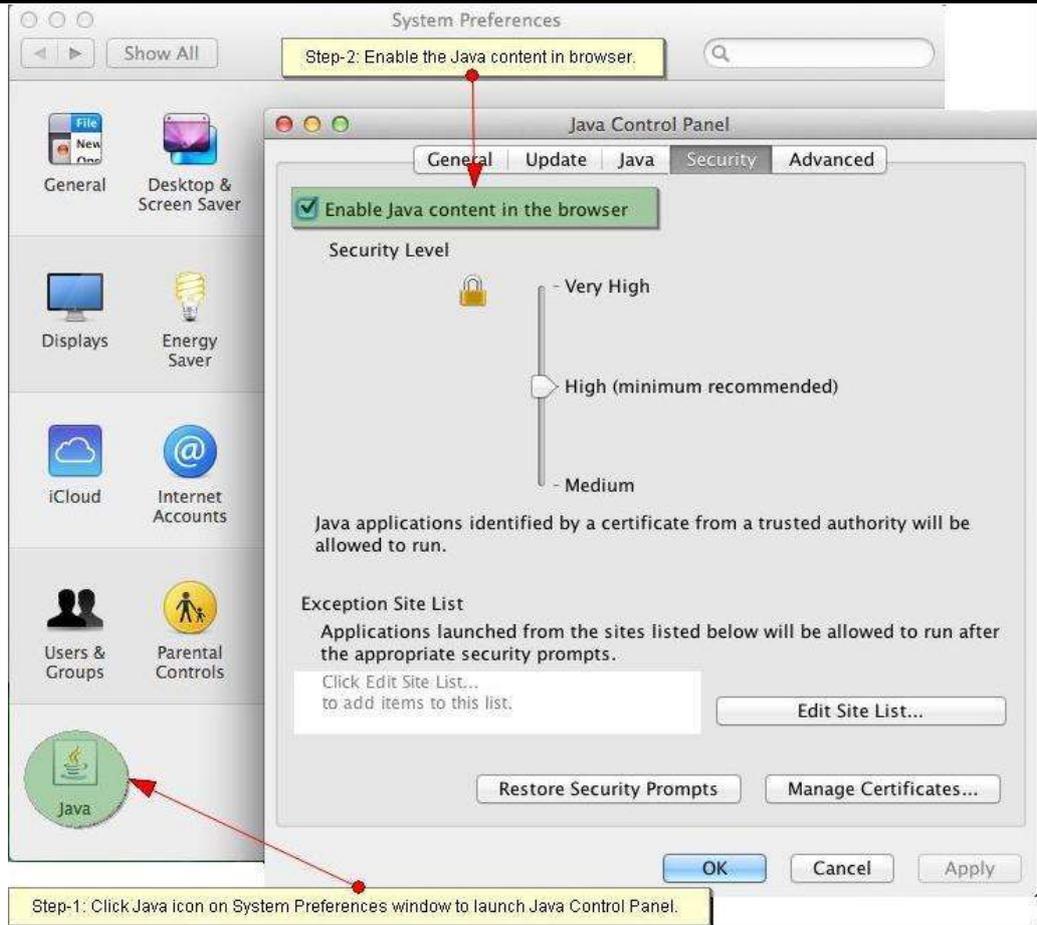

(Screenshot - 2)

- If Safari 5.x browser does not recognize Java 7, please update the Safari 5.x to Safari 6.x version. Or use Firefox browser to launch Configure application.
- To avoid security vulnerability, Apple has added restriction on Safari browser for signed Java applet to access local directories. Backup/Restore functionality of Configure requires access to local directory to read/write file. To remove the above restriction please do the following steps:
 1. Launch Preferences window from Safari and open the Security tab.
 2. Click on “Manage Website Settings...” button.
 3. Select “Java” from left hand side applications list.
 4. Select “Run in Unsafe Mode” from drop down for a particular Fiery.
 5. Click “Trust” button on pop-up window for confirmation.

Model: Baron-C1 EFI(EB-32)	Date: 23-May-14	No.: RD726005
-----------------------------------	-----------------	---------------

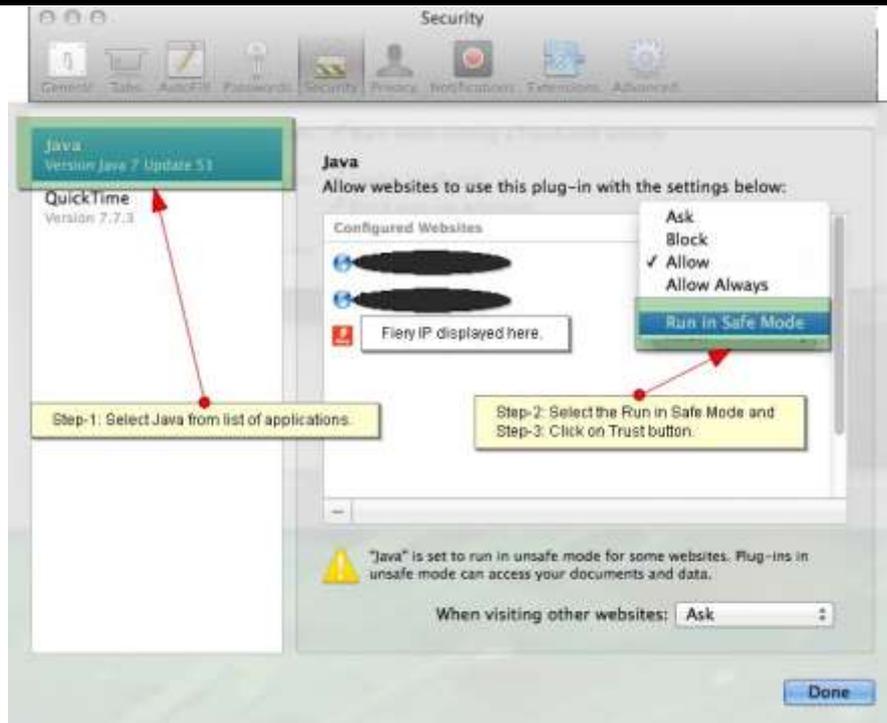

(Screenshot - 3)

Model: Baron-C1 EFI(EB-32)		Date: 26-Jun-14	No.: RD726006
Subject: Patch (FIT214949) release note for System Software Version 1.0 for Baron-C1 EFI(EB-32)		Prepared by: Hiroshi Wada	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT214949**” applied to the Baron-C1 EFI (EB-32) system software version 1.0.

Patch File	Issue(s)
FIT214949.exe	- The following problems pertaining to iOS-7 devices were fixed: 1. Jobs cannot be printed from an iOS-7 device with authentication enabled. 2. RIP error occurs while processing web pages.

Before installing FIT214949.exe

1. Known issues listed below, read before installing **FIT214949.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT214949.exe** patch is installed:
 - FIT203760.exe
3. Do NOT install any of the following patch(es) after installing the **FIT214949.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT214949.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT214949.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.

Model: Baron-C1 EFI(EB-32)	Date: 26-Jun-14	No.: RD726006
-----------------------------------	-----------------	---------------

4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT214949**.

Model: Baron-C1 EFI(EB-32)		Date: 08-Jul-14	No.: RD726007
Subject: Patch (FIT205650) release note for System Software Version 1.0 for Baron-C1 EFI(EB-32)		Prepared by: Hiroshi Wada	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT205650**” applied to the Baron-C1 EFI (EB-32) system software version 1.0.

Patch File	Issue(s)
FIT205650.exe	- If the paper size specified for the job does not match with the size specified on the Plockmatic BK5010 Booklet Finisher and "Paper Size Auto [OK]" is pressed on the Plockmatic operation panel, pages within the job is duplicated depending on the timing when the OK button is pressed.

Before installing FIT205650.exe

1. Known issues listed below, read before installing **FIT205650.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT205650.exe** patch is installed:
 - FIT203760.exe
3. Do NOT install any of the following patch(es) after installing the **FIT205650.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT205650.exe** patch:
 - FIT205073.exe
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT205650.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.

Model: Baron-C1 EFI(EB-32)	Date: 08-Jul-14	No.: RD726007
-----------------------------------	-----------------	---------------

4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT205650**.

Model: Baron-C1 EFI(EB-32)		Date: 29-Aug-14	No.: RD726008
Subject: Patch (FIT218687) release note for System Software Version 1.0 for Baron-C1 EFI(EB-32)		Prepared by: Hiroshi Wada	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT218687**” applied to the Baron-C1 EFI (EB-32) system software version 1.0.

Patch File	Issue(s)
FIT218687.exe	- Print position shifts as a result of faulty image centering process with PS files.

Before installing FIT218687.exe

1. Known issues listed below, read before installing **FIT218687.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT218687.exe** patch is installed:
 - FIT203760.exe
3. Do NOT install any of the following patch(es) after installing the **FIT218687.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT218687.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT218687.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1 EFI(EB-32)	Date: 29-Aug-14	No.: RD726008
-----------------------------------	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT218687**.

Model: Baron-C1 EFI(EB-32)		Date: 27-Jan-15	No.: RD726009
Subject: Patch (FIT100563219) release note for System Software Version 1.0 for Baron-C1 EFI(EB-32)		Prepared by: Y.Okano	
From: 3rd PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT100563219**” applied to the Baron-C1 EFI (EB-32) system software version 1.0.

Patch File	Issue(s)
FIT100563219.exe	- The first page of a punched job is printed upside down, if specified face up in reverse order, regardless of simplex/duplex.

Before installing FIT100563219.exe

- Known issues listed below, read before installing **FIT100563219.exe** patch:
 - None.
- The following prerequisites must be installed in the order specified before the **FIT100563219.exe** patch is installed:
 - FIT203760.exe
- Do NOT install any of the following patch(es) after installing the **FIT100563219.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT100563219.exe** patch:
 - FIT205073.exe
 - FIT205650.exe
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

- Make sure that the Fiery printer controller reaches Idle.
- Execute **FIT100563219.exe** and follow the instructions in the Fiery Patch Downloader.
- Notes about the Fiery Patch Downloader
 - Logon must be admin. This is fixed and cannot be modified.
 - Password is the Fiery administrator login password.
 - Hostname can be the IP address or the Fiery server name.
- Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1 EFI(EB-32)	Date: 27-Jan-15	No.: RD726009
-----------------------------------	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT100563219**.

Model: Baron-C1 EFI(EB-32)		Date: 27-Jan-15	No.: RD726010
Subject: Patch (FIT100703756) release note for System Software Version 1.0 for Baron-C1 EFI(EB-32)		Prepared by: Y.Okano	
From: 3rd PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT100703756**” applied to the Baron-C1 EFI (EB-32) system software version 1.0.

Patch File	Issue(s)
FIT100703756.exe	- Booklet jobs are trimmed even if trim settings are not specified.

Before installing FIT100703756.exe

1. Known issues listed below, read before installing **FIT100703756.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT100703756.exe** patch is installed:
 - FIT203760.exe
3. Do NOT install any of the following patch(es) after installing the **FIT100703756.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT100703756.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT100703756.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1 EFI(EB-32)	Date: 27-Jan-15	No.: RD726010
-----------------------------------	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT100703756**.

Model: Baron-C1 EFI(EB-32)		Date: 27-Jan-15	No.: RD726011
Subject: Patch (FIT100717271) release note for System Software Version 1.0 for Baron-C1 EFI(EB-32)		Prepared by: Y.Okano	
From: 3rd PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT100717271**” applied to the Baron-C1 EFI (EB-32) system software version 1.0.

Patch File	Issue(s)
FIT100717271.exe	- Fiery controller loses connection with the engine and fails to print the first job after the engine restarts with the weekly timer setting.

Before installing FIT100717271.exe

1. Known issues listed below, read before installing **FIT100717271.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT100717271.exe** patch is installed:
 - FIT203760.exe
3. Do NOT install any of the following patch(es) after installing the **FIT100717271.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT100717271.exe** patch:
 - FIT205073.exe
 - FIT205650.exe
 - FIT100563219.exe
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT100717271.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.

Model: Baron-C1 EFI(EB-32)	Date: 27-Jan-15	No.: RD726011
-----------------------------------	-----------------	---------------

4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT100717271**.

Model: Baron-C1 EFI(EB-32)		Date: 27-Jan-15	No.: RD726012
Subject: Patch (FIT222966) release note for System Software Version 1.0 for Baron-C1 EFI(EB-32)		Prepared by: Y.Okano	
From: 3rd PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT222966**” applied to the Baron-C1 EFI (EB-32) system software version 1.0.

Patch File	Issue(s)
FIT222966.exe	- OpenSSL security was updated for Windows-based Fiery controller.

Before installing FIT222966.exe

1. Known issues listed below, read before installing **FIT222966.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT222966.exe** patch is installed:
 - 1-1EYSCX.exe (E-41A v1.2 Japanese, E-41A v1.2 EFIGSD only)
 - 1-1IA0FZ.exe (E-41A v1.2 Japanese, E-41A v1.2 EFIGSD only)
 - 1-1F428Z.exe (E-41A v1.2 Simplified Chinese only)
 - 1-19Z4WM.exe (E-41 Japanese, E-41 EFIGSD, E-81 EFIGSD only)
 - 1-1DPQMC.exe (E-41 Japanese, E-41 EFIGSD, E-81 EFIGSD only)
 - 1-1IA0FH.exe (E-41 Japanese, E-41 EFIGSD, E-81 EFIGSD only)
 - 1-1JI829.exe (E-42 Japanese, E-42 EFIGSD, E-82 EFIGSD only)
 - 1-1JNLLA.exe (E-42 Japanese, E-42 EFIGSD, E-82 EFIGSD only)
 - 1-1KPCFP.exe (E-42B EFIGSD v1.1 only)
 - FIT212992.exe (E-42B EFIGSD v1.1 only)
 - FIT214829.exe (E-42B EFIGSD v1.1 only)
 - FIT203760.exe (EB-32 Japanese v1.0, EB-32 EFIGSDSc v1.0 only)
3. Do NOT install any of the following patch(es) after installing the **FIT222966.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT222966.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.

Model: Baron-C1 EFI(EB-32)	Date: 27-Jan-15	No.: RD726012
-----------------------------------	-----------------	---------------

5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT222966.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT222966**.

Model: Baron-C1 EFI(EB-32)		Date: 11-Mar-15	No.: RD726013
Subject: Patch (FIT100704410) release note for System Software Version 1.0 for Baron-C1 EFI(EB-32)		Prepared by: Y.Okano	
From: 3rd PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT100704410**” applied to the Br-C1 EFI (EB-32) system software version 1.0.

Patch File	Issue(s)
FIT100704410.exe	- Memory leaks when printing heavy jobs.

Before installing FIT100704410.exe

1. Known issues listed below, read before installing **FIT100704410.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT100704410.exe** patch is installed:
 - FIT203760.exe
3. Do NOT install any of the following patch(es) after installing the **FIT100704410.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT100704410.exe** patch:
 - FIT205073.exe
 - FIT205650.exe
 - FIT100563219.exe
 - FIT100717271.exe
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT100704410.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.

Model: Baron-C1 EFI(EB-32)	Date: 11-Mar-15	No.: RD726013
-----------------------------------	-----------------	---------------

- c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT100704410**.

Model: Baron-C1 EFI(EB-32)		Date: 11-Mar-15	No.: RD726014
Subject: Patch (FIT100869700) release note for System Software Version 1.0 for Baron-C1 EFI(EB-32)		Prepared by: Y.Okano	
From: 3rd PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT100869700**” applied to the Br-C1 EFI (EB-32) system software version 1.0.

Patch File	Issue(s)
FIT100869700.exe	- Print position on tab sheet shifts when the tray runs out of paper.

Before installing FIT100869700.exe

1. Known issues listed below, read before installing **FIT100869700.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT100869700.exe** patch is installed:
 - FIT203760.exe
 - FIT100704410.exe
3. Do NOT install any of the following patch(es) after installing the **FIT100869700.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT100869700.exe** patch:
 - FIT205073.exe
 - FIT205650.exe
 - FIT100563219.exe
 - FIT100717271.exe
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT100869700.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.

Model: Baron-C1 EFI(EB-32)	Date: 11-Mar-15	No.: RD726014
-----------------------------------	-----------------	---------------

- b. Password is the Fiery administrator login password.
- c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT100869700**.

Model: Baron-C1/P1 EFI (EB-32)		Date: 08-Apr-15	No.: RD726015
Subject: Release note for System Software Version 2.0 for Baron-C1/P1 EFI (EB-32)		Prepared by: Y.Okano	
From: 1st PP Tech Service Sec., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB announces the release notes for “**D7266646**” (DVD image file of the Baron-C1/P1 EFI (EB-32) System software version 2.0).

File	Description
D7266646.exe	- DVD image file of Baron-C1/P1 EFI (EB-32) System software version 2.0

Prerequisites

- Download and unzip **D7266646.exe** file. This will generate “sinatra2.0RDSc_031815_202248.iso”. Burn this iso file to a DVD.
 - The following DVDs are required for installing the System software:
 - Windows OS Disk1 (*1)
 - Windows OS Disk2 (*1)
 - User software (*2)
- *1: Download Disk1/Disk2 image files from the EFI web site linked below:
<http://w3.efi.com/dm/events/OS-updates-1e>
- *2: Download User software image file from the Ricoh firmware download site.

Notes

- See service manual for the System software installation procedure.

Important

- Installing version 2.0 on a system running on version 1.0 will initialize the settings and delete all data. Make sure to backup data and settings of version 1.0 in advance.

Model: Baron-C1/P1 EFI (EB-32)		Date: 08-Apr-15	No.: RD726016
Subject: Release note for User Software Version 2.0 for Baron-C1/P1 EFI (EB-32)		Prepared by: Y.Okano	
From: 1st PP Tech Service Sec., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB announces the release notes for “**D7266636**” (DVD image file of the Baron-C1/P1 EFI (EB-32) User software version 2.0).

File	Description
D7266636.exe	- DVD image file of Baron-C1/P1 EFI (EB-32) User software version 2.0

Prerequisites

- Download and unzip **D7266636.exe** file. This will generate “sinatra2.0RDSc_031715_105602.iso”. Burn this iso file to a DVD.
 - The following DVDs are required for installing the User software:
 - System software (*1)
 - Windows OS Disk1 (*2)
 - Windows OS Disk2 (*2)
- *1: Download System software image file from the Ricoh firmware download site.
 *2: Download Disk1/Disk2 image files from the EFI web site linked below:
<http://w3.efi.com/dm/events/OS-updates-1e>

Notes

- See service manual for the User software installation procedure.

Important

- Installing version 2.0 on a system running on version 1.0 will initialize the settings and delete all data. Make sure to backup data and settings of version 1.0 in advance.

Model: Baron-C1/P1 EFI 2.0(EB-32)		Date: 22-May-15	No.: RD726017
Subject: Patch (FIT101025137) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: 1st PP Tech Service Sect., PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101025137**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101025137.exe	<ul style="list-style-type: none"> - Booklet jobs are trimmed even if trim settings are not specified. - Fixed network error of OS (Windows7). - Fixed the freeze of MA operation of the printer and scanner. - Reflected the PC setting of v1.0.

Before installing FIT101025137.exe

1. Known issues listed below, read before installing **FIT101025137.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101025137.exe** patch is installed:
 - None.
3. Do NOT install any of the following patch(es) after installing the **FIT101025137.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101025137.exe** patch:
 - None.
4. This patch is exclusive, it must be installed by itself, and the server must be rebooted or restarted once. After that, other patches can be applied to the server.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101025137.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1/P1 EFI 2.0(EB-32)	Date: 22-May-15	No.: RD726017
--	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (*If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.*)
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101025137**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date:27-Jul-15	No.: RD726018
Subject: Patch (FIT101039015) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101039015**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101039015.exe	- Error occurs while processing a PDF job, if APPE is enabled.

Before installing FIT101039015.exe

1. Known issues listed below, read before installing **FIT101039015.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101039015.exe** patch is installed:
 - FIT101025137.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101039015.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101039015.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101039015.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date:27-Jul-15	No.: RD726018
--	----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101039015**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date:27-Jul-15	No.: RD726019
Subject: Patch (FIT101045386) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101045386**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101045386.exe	<ul style="list-style-type: none"> - Image is not printed as expected, if APPE is enabled. - Image is not printed as expected, if APPE is enabled and the job is imposed. - Fiery service aborts, if ripped with the image enhancement option enabled.

Before installing FIT101045386.exe

1. Known issues listed below, read before installing **FIT101045386.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101045386.exe** patch is installed:
 - FIT101025137.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101045386.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101045386.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101045386.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date:27-Jul-15	No.: RD726019
--	----------------	---------------

4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101045386**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date:27-Jul-15	No.: RD726020
Subject: Patch (FIT101077886) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101077886**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101077886.exe	- Image is rotated 180 degrees, if specified either face-up printing with APPE enabled or face-up and mixed media printing defined of a cover page.

Before installing FIT101077886.exe

1. Known issues listed below, read before installing **FIT101077886.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101077886.exe** patch is installed:
 - FIT101025137.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101077886.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101077886.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101077886.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date:27-Jul-15	No.: RD726020
--	----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101077886**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 03-Aug-15	No.: RD726021
Subject: Patch (FIT101058667) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101058667**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101058667.exe	- The maximum number of sheets stackable on the output tray is not calculated correctly according to paper thickness, if the "Ring bind: Punch only" option is specified.

Before installing FIT101058667.exe

1. Known issues listed below, read before installing **FIT101058667.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101058667.exe** patch is installed:
 - FIT101025137.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101058667.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101058667.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101058667.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 03-Aug-15	No.: RD726021
--	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101058667**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 03-Aug-15	No.: RD726022
Subject: Patch (FIT101085326) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101085326**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101085326.exe	- The same page is printed twice after recovering from a no paper in tray status, if the system configuration consists of the Plockmatic finisher.

Before installing FIT101085326.exe

- Known issues listed below, read before installing **FIT101085326.exe** patch:
 - None.
- The following prerequisites must be installed in the order specified before the **FIT101085326.exe** patch is installed:
 - FIT101025137.exe
- Do NOT install any of the following patch(es) after installing the **FIT101085326.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101085326.exe** patch:
 - None.
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

- Make sure that the Fiery printer controller reaches Idle.
- Execute **FIT101085326.exe** and follow the instructions in the Fiery Patch Downloader.
- Notes about the Fiery Patch Downloader
 - Logon must be admin. This is fixed and cannot be modified.
 - Password is the Fiery administrator login password.
 - Hostname can be the IP address or the Fiery server name.
- Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 03-Aug-15	No.: RD726022
--	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101085326**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 03-Aug-15	No.: RD726023
Subject: Patch (FIT101087873) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101087873**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101087873.exe	- A patch to block Windows 10 notification and installation via Windows Updates on Fiery servers.

Before installing FIT101087873.exe

1. Known issues listed below, read before installing **FIT101087873.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101087873.exe** patch is installed:
 - None.
3. Do NOT install any of the following patch(es) after installing the **FIT101087873.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101087873.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101087873.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 03-Aug-15	No.: RD726023
--	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101087873**.

Reissued: 21-Aug-15

Model: Baron-C1 EFI(EB-32)	Date: 04-Aug-15	No.: RD726024a
-----------------------------------	-----------------	----------------

RTB Reissue

The items in *red bold italics* were corrected.

Subject: Patch (FIT101087873) release note for System Software Version 1.0 for Baron-C1 EFI(EB-32)		Prepared by: Y.Okano	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101087873**” applied to the Baron-C1 EFI (EB-32) system software version 1.0.

Patch File	Issue(s)
FIT101087873.exe	- A patch to block Windows 10 notification and installation via Windows Updates on Fiery servers.

Before installing FIT101087873.exe

1. Known issues listed below, read before installing **FIT101087873.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101087873.exe** patch is installed:
 - None.
3. Do NOT install any of the following patch(es) after installing the **FIT101087873.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101087873.exe** patch:
 - None.
4. ***This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch. This patch is exclusive, it must be installed by itself, and the server must be rebooted or restarted once. After that, other patches can be applied to the server.***
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101087873.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.

Reissued: 21-Aug-15Model: **Baron-C1 EFI(EB-32)**

Date: 04-Aug-15

No.: RD726024a

- c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101087873**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 07-Aug-15	No.: RD726025
Subject: Patch (FIT101056018) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101056018**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101056018.exe	- Patch to upgrade PHP, Apache and OpenSSL v5.6.7, v2.2.29 and v1.0.1m respectively. <ul style="list-style-type: none"> • PHP: 5.3.15 --> 5.6.7 • Apache: 2.2.22 --> 2.2.29 • OpenSSL: 0.9.8za --> 1.0.1m

Before installing FIT101056018.exe

1. Known issues listed below, read before installing **FIT101056018.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101056018.exe** patch is installed:
 - FIT101015201.exe (E-43, E-83 only)
 - FIT100868801.exe (E-43A, E-83A only)
 - FIT101025137.exe (EB-32 only)
3. Do NOT install any of the following patch(es) after installing the **FIT101056018.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101056018.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101056018.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 07-Aug-15	No.: RD726025
--	-----------------	---------------

- b. Password is the Fiery administrator login password.
- c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101056018**.

Model: Baron-C1 EFI(EB-32)		Date:20-Aug-2015	No.: RD726026
Subject: Patch (FIT101021912) release note for System Software Version 1.0 for Baron-C1 EFI(EB-32)		Prepared by: Y.Okano	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101021912**” applied to the Baron-C1 EFI (EB-32) system software version 1.0.

Patch File	Issue(s)
FIT101021912.exe	- Patch to upgrade PHP, Apache and OpenSSL v5.6.7, v2.2.29 and v1.0.1m respectively. <ul style="list-style-type: none"> • PHP: 5.3.15 --> 5.6.7 • Apache: 2.2.22 --> 2.2.29 • OpenSSL: 0.9.8za --> 1.0.1m

Before installing FIT101021912.exe

1. Known issues listed below, read before installing **FIT101021912.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101021912.exe** patch is installed:
 - FIT203760.exe
 - FIT222966.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101021912.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101021912.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101021912.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.

Model: Baron-C1 EFI(EB-32)	Date:20-Aug-2015	No.: RD726026
-----------------------------------	------------------	---------------

- c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101021912**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date:10-Sep-15	No.: RD726027
Subject: Patch (FIT101114065) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101114065**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101114065.exe	- When recovering from a tray empty status in a system configured with RPIP Interface Box Type S3 and Duplo finisher, printing resumes from the first page of the job.

Before installing FIT101114065.exe

1. Known issues listed below, read before installing **FIT101114065.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101114065.exe** patch is installed:
 - FIT101025137.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101114065.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101114065.exe** patch:
 - FIT101077886.exe
 - FIT101058667.exe
 - FIT101085326.exe
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101114065.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date:10-Sep-15	No.: RD726027
--	----------------	---------------

4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101114065**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date:14-Sep-15	No.: RD726028
Subject: Patch (FIT101104764) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101104764**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101104764.exe	- Solid fills, ruled lines, and gradients in PDF files may not be RIPped correctly.

Before installing FIT101104764.exe

1. Known issues listed below, read before installing **FIT101104764.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101104764.exe** patch is installed:
 - FIT101025137.exe
 - FIT101045386.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101104764.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101104764.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101104764.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date:14-Sep-15	No.: RD726028
--	----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101104764**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 01-Oct-15	No.: RD726029
Subject: Patch (FIT101101406) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101101406**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101101406.exe	- The correct paper type does not appear in job properties, if specifying glossy or matted.

Before installing FIT101101406.exe

1. Known issues listed below, read before installing **FIT101101406.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101101406.exe** patch is installed:
 - FIT101025137.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101101406.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101101406.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101101406.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 01-Oct-15	No.: RD726029
--	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101101406**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 02-Dec-15	No.: RD726030
Subject: Patch (FIT101191075) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101191075**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101191075.exe	- Page sequence is incorrect, if a page range is selected in a mixplex job.

Before installing FIT101191075.exe

1. Known issues listed below, read before installing **FIT101191075.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101191075.exe** patch is installed:
 - FIT101025137.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101191075.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101191075.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101191075.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 02-Dec-15	No.: RD726030
--	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101191075**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 18-Dec-15	No.: RD726031
Subject: Patch (FIT101143883) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101143883**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101143883.exe	- Cannot staple the maximum allowable number of sheets even if specified so in the SP.

Before installing FIT101143883.exe

1. Known issues listed below, read before installing **FIT101143883.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101143883.exe** patch is installed:
 - FIT101025137.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101143883.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101143883.exe** patch:
 - FIT101077886.exe
 - FIT101058667.exe
 - FIT101085326.exe
 - FIT101114065.exe
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101143883.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 18-Dec-15	No.: RD726031
--	-----------------	---------------

- c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101143883**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 13-Jan-16	No.: RD726032
Subject: Patch (FIT101191255) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101191255**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101191255.exe	- Dynamic Language Switching was disabled on the Fiery controller, because it is not supported on Windows 7 and later OS.

Before installing FIT101191255.exe

1. Known issues listed below, read before installing **FIT101191255.exe** patch:
 - English will be listed in WebTool language dropdown along with server language. If Server language is Roman, English will list twice.
2. The following prerequisites must be installed in the order specified before the **FIT101191255.exe** patch is installed:
 - None.
3. Do NOT install any of the following patch(es) after installing the **FIT101191255.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101191255.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101191255.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 13-Jan-16	No.: RD726032
--	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101191255**.

Model: Baron-C1 EFI(EB-32)		Date: 24-Feb-16	No.: RD726033
Subject: Patch (FIT101191255) release note for System Software Version 1.0 for Baron-C1 EFI(EB-32)		Prepared by: Y.Okano	
From: PP Solution Support Sec. PP Tech Service Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101191255**” applied to the Baron-C1 EFI (EB-32) system software version 1.0.

Patch File	Issue(s)
FIT101191255.exe	- Dynamic Language Switching was disabled on the Fiery controller, because it is not supported on Windows 7 and later OS.

Before installing FIT101191255.exe

- Known issues listed below, read before installing **FIT101191255.exe** patch:
 - English will be listed in WebTool language dropdown along with server language. If Server language is Roman, English will list twice.
- The following prerequisites must be installed in the order specified before the **FIT101191255.exe** patch is installed:
 - FIT203760.exe
- Do NOT install any of the following patch(es) after installing the **FIT101191255.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101191255.exe** patch:
 - None.
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

- Make sure that the Fiery printer controller reaches Idle.
- Execute **FIT101191255.exe** and follow the instructions in the Fiery Patch Downloader.
- Notes about the Fiery Patch Downloader
 - Logon must be admin. This is fixed and cannot be modified.
 - Password is the Fiery administrator login password.
 - Hostname can be the IP address or the Fiery server name.
- Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1 EFI(EB-32)	Date: 24-Feb-16	No.: RD726033
-----------------------------------	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101191255**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 15-Mar-16	No.: RD726034
Subject: Patch (FIT101143883) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: 1st Tech. Support Sec. Service Support Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101143883**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101143883.exe	- Cannot staple the maximum allowable number of sheets even if specified so in the SP.

Before installing FIT101143883.exe

1. Known issues listed below, read before installing **FIT101143883.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101143883.exe** patch is installed:
 - FIT101025137.exe
 - FIT101138129.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101143883.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101143883.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101143883.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 15-Mar-16	No.: RD726034
--	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101143883**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 15-Mar-16	No.: RD726035
Subject: Patch (FIT101191255) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: 1st Tech. Support Sec. Service Support Dept.			
Classification:	<input type="checkbox"/> Troubleshooting <input type="checkbox"/> Part information <input type="checkbox"/> Action required <input type="checkbox"/> Mechanical <input type="checkbox"/> Electrical <input type="checkbox"/> Service manual revision <input type="checkbox"/> Paper path <input type="checkbox"/> Transmit/receive <input type="checkbox"/> Retrofit information <input type="checkbox"/> Product Safety <input checked="" type="checkbox"/> Other ()		

This RTB has been issued to announce the release notes on the patch “**FIT101191255**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101191255.exe	- Dynamic Language Switching was disabled on the Fiery controller, because it is not supported on Windows 7 and later OS.

Before installing FIT101191255.exe

1. Known issues listed below, read before installing **FIT101191255.exe** patch:
 - English will be listed in WebTool language dropdown along with server language. If Server language is Roman, English will list twice.
2. The following prerequisites must be installed in the order specified before the **FIT101191255.exe** patch is installed:
 - FIT101025137.exe
 - FIT101138129.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101191255.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101191255.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101191255.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 15-Mar-16	No.: RD726035
--	-----------------	---------------

4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101191255**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 15-Mar-16	No.: RD726036
Subject: Patch (FIT101147947) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: 1st Tech. Support Sec. Service Support Dept.			
Classification:	<input type="checkbox"/> Troubleshooting <input type="checkbox"/> Part information <input type="checkbox"/> Action required <input type="checkbox"/> Mechanical <input type="checkbox"/> Electrical <input type="checkbox"/> Service manual revision <input type="checkbox"/> Paper path <input type="checkbox"/> Transmit/receive <input type="checkbox"/> Retrofit information <input type="checkbox"/> Product Safety <input checked="" type="checkbox"/> Other ()		

This RTB has been issued to announce the release notes on the patch “**FIT101147947**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101147947.exe	- Incorrect paper type is shown in job properties, if "recycled + coated" is specified as the paper type in paper catalog.

Before installing FIT101147947.exe

1. Known issues listed below, read before installing **FIT101147947.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101147947.exe** patch is installed:
 - FIT101025137.exe
 - FIT101138129.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101147947.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101147947.exe** patch:
 - None.
4. This patch is exclusive, it must be installed by itself, and the server must be rebooted or restarted once. After that, other patches can be applied to the server.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101147947.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 15-Mar-16	No.: RD726036
--	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101147947**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 15-Mar-16	No.: RD726037
Subject: Patch (FIT101263942) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: 1st Tech. Support Sec. Service Support Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101263942**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101263942.exe	- RIPPING a PDF file with APPE enabled may cause Command WorkStation to lose connection with the engine.

Before installing FIT101263942.exe

1. Known issues listed below, read before installing **FIT101263942.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101263942.exe** patch is installed:
 - FIT101025137.exe
 - FIT101138129.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101263942.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101263942.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101263942.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 15-Mar-16	No.: RD726037
--	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (*If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.*)
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101263942**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 15-Mar-16	No.: RD726038
Subject: Patch (FIT101288284) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: 1st Tech. Support Sec. Service Support Dept.			
Classification:	<input type="checkbox"/> Troubleshooting <input type="checkbox"/> Part information <input type="checkbox"/> Action required <input type="checkbox"/> Mechanical <input type="checkbox"/> Electrical <input type="checkbox"/> Service manual revision <input type="checkbox"/> Paper path <input type="checkbox"/> Transmit/receive <input type="checkbox"/> Retrofit information <input type="checkbox"/> Product Safety <input checked="" type="checkbox"/> Other ()		

This RTB has been issued to announce the release notes on the patch “**FIT101288284**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101288284.exe	- If RPIP Interface Box Type S3 is connected, printing does not resume even if paper is loaded on the tray after a paper-end detection.

Before installing FIT101288284.exe

1. Known issues listed below, read before installing **FIT101288284.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101288284.exe** patch is installed:
 - FIT101025137.exe
 - FIT101138129.exe
 - FIT101147947.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101288284.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101288284.exe** patch:
 - FIT101143883.exe
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101288284.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 15-Mar-16	No.: RD726038
--	-----------------	---------------

4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101288284**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date:23-Mar-16	No.:RD726039
Subject: Composite Patch02 (FIT101138129) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: M.Yoshikawa	
From: 1st Tech. Support Sec. Service Support Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes for Composite Patch02 (FIT101138129) applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

File name	File size
D7267662.exe	161 MB

Important Notes on Composite Patch 02 [FIT101138129]

- Composite02 contains 11 patches released after Composite Patch 01 [FIT101025137].
- Patches contained in Composite02 applied separately do not have to be removed from EB-32 when installing Composite02.
- The final configuration will be as follows:
 System software Version 2.0 + Composite01
 + Misc. patches released after Composite01
 + **Composite02**
- If you wish to reinstall the system, install the patches as follows:
 System software Version 2.0 + Composite01
 + **Composite02**

Issues addressed with Composite Patch 02 [FIT101138129]

Patch ID	Short Descriptions
FIT101039015	Error occurs while processing a PDF job, if APPE is enabled.
FIT101045386	- Image is not printed as expected, if APPE is enabled. - Image is not printed as expected, if APPE is enabled and the job is imposed. - Fiery service aborts, if RIPped with the image enhancement option enabled.
FIT101077886	Image is rotated 180 degrees, if specified either face-up printing with APPE enabled or face-up and mixed media printing defined of a cover page.
FIT101058667	The maximum number of sheets stackable on the output tray is not calculated correctly according to paper thickness, if the "Ring bind: Punch only" option is specified.
FIT101085326	The same page is printed twice after recovering from a no paper in tray status, if the system configuration consists of the Plockmatic finisher.
FIT101087873	A patch to block Windows 10 notification and installation via Windows Updates on Fiery servers.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date:23-Mar-16	No.:RD726039
FIT101056018	Patch to upgrade PHP, Apache and OpenSSL v5.6.7, v2.2.29 and v1.0.1m respectively. - PHP: 5.3.15 --> 5.6.7 - Apache: 2.2.22 --> 2.2.29 - OpenSSL: 0.9.8za --> 1.0.1m		
FIT101114065	When recovering from a tray empty status in a system configured with CANAL and Duplo finisher, printing resumes from the first page of the job.		
FIT101104764	Solid fills, ruled lines, and gradients in PDF files may not be RIPped correctly.		
FIT101101406	The correct paper type does not appear in job properties, if specifying glossy or matted.		
FIT101191075	Page sequence is incorrect, if a page range is selected in a mixplex job.		

Before installing FIT101138129.exe

1. Known issues listed below, read before installing **FIT101138129.exe** patch:
 - None.
2. The following prerequisite(s) must be installed in the order specified before applying the **FIT101138129.exe** patch:
 - FIT101025137.exe(Composite patch 01)
3. Do **NOT** install any of the following patch(es) after installing the **FIT101138129.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101138129.exe** patch:
 - None.
4. This patch is exclusive, it must be installed by itself, and the server must be rebooted or restarted once. After that, other patches can be applied to the server.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101138129.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
5. Wait until the Fiery controller reaches Idle and print the Configuration page.
6. If the controller does not eventually reach Idle, please manually start the Fiery service.
7. Verify that the System Updates Log section contains the patch number **FIT101138129**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 23-Jun-16	No.: RD726040
Subject: Patch (FIT101311862) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: 1st Tech. Support Sec. Service Support Dept.			
Classification:	<input type="checkbox"/> Troubleshooting <input type="checkbox"/> Mechanical <input type="checkbox"/> Paper path <input type="checkbox"/> Product Safety	<input type="checkbox"/> Part information <input type="checkbox"/> Electrical <input type="checkbox"/> Transmit/receive <input checked="" type="checkbox"/> Other ()	<input type="checkbox"/> Action required <input type="checkbox"/> Service manual revision <input type="checkbox"/> Retrofit information

This RTB has been issued to announce the release notes on the patch “**FIT101311862**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101311862.exe	- A blank page is falsely inserted, if a PS file generated by the EB-32 printer driver is imported to Command WorkStation and printed with a print range specified.

Before installing FIT101311862.exe

1. Known issues listed below, read before installing **FIT101311862.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101311862.exe** patch is installed:
 - FIT101025137.exe
 - FIT101138129.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101311862.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101311862.exe** patch:
 - None.
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101311862.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 23-Jun-16	No.: RD726040
--	-----------------	---------------

4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101311862**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 23-Jun-16	No.: RD726041
Subject: Patch (FIT101339552) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: 1st Tech. Support Sec. Service Support Dept.			
Classification:	<input type="checkbox"/> Troubleshooting <input type="checkbox"/> Part information <input type="checkbox"/> Action required <input type="checkbox"/> Mechanical <input type="checkbox"/> Electrical <input type="checkbox"/> Service manual revision <input type="checkbox"/> Paper path <input type="checkbox"/> Transmit/receive <input type="checkbox"/> Retrofit information <input type="checkbox"/> Product Safety <input checked="" type="checkbox"/> Other ()		

This RTB has been issued to announce the release notes on the patch “**FIT101339552**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101339552.exe	- Stacking quality of the High Capacity Stacker is poor with custom paper sizes.

Before installing FIT101339552.exe

- Known issues listed below, read before installing **FIT101339552.exe** patch:
 - None.
- The following prerequisites must be installed in the order specified before the **FIT101339552.exe** patch is installed:
 - FIT101025137.exe
 - FIT101138129.exe
 - FIT101147947.exe
- Do **NOT** install any of the following patch(es) after installing the **FIT101339552.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101339552.exe** patch:
 - FIT101143883.exe
 - FIT101288284.exe
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

- Make sure that the Fiery printer controller reaches Idle.
- Execute **FIT101339552.exe** and follow the instructions in the Fiery Patch Downloader.
- Notes about the Fiery Patch Downloader
 - Logon must be admin. This is fixed and cannot be modified.
 - Password is the Fiery administrator login password.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 23-Jun-16	No.: RD726041
--	-----------------	---------------

- c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101339552**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 26-Aug-16	No.: RD726042
Subject: Patch (FIT101417825) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: 1st Tech. Support Sec. Service Support Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101417825**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101417825.exe	- EB-32 may hang up when "process and hold" is selected for a PCL file in the hold queue.

Before installing FIT101417825.exe

1. Known issues listed below, read before installing **FIT101417825.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101417825.exe** patch is installed:
 - FIT101025137.exe
 - FIT101138129.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101417825.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101417825.exe** patch:
 - None
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101417825.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 26-Aug-16	No.: RD726042
--	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101417825**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 26-Aug-16	No.: RD726043
Subject: Patch (FIT101374593) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: 1st Tech. Support Sec. Service Support Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101374593**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101374593.exe	- Printing does not resume after recovering from a tray empty status or a paper jam.

Before installing FIT101374593.exe

1. Known issues listed below, read before installing **FIT101374593.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101374593.exe** patch is installed:
 - FIT101025137.exe
 - FIT101138129.exe
 - FIT101147947.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101374593.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101374593.exe** patch:
 - FIT101143883.exe
 - FIT101288284.exe
 - FIT101339552.exe
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101374593.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 26-Aug-16	No.: RD726043
--	-----------------	---------------

- b. Password is the Fiery administrator login password.
- c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101374593**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 29-Nov-16	No.: RD726044
Subject: Patch (FIT101441834) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: 1st Tech. Support Sec. Service Support Dept.			
Classification:	<input type="checkbox"/> Troubleshooting <input type="checkbox"/> Part information <input type="checkbox"/> Action required <input type="checkbox"/> Mechanical <input type="checkbox"/> Electrical <input type="checkbox"/> Service manual revision <input type="checkbox"/> Paper path <input type="checkbox"/> Transmit/receive <input type="checkbox"/> Retrofit information <input type="checkbox"/> Product Safety <input checked="" type="checkbox"/> Other ()		

This RTB has been issued to announce the release notes on the patch “**FIT101441834**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101441834.exe	- Paper is not fed from the assigned tray, if the job applies Impose and Mixed Media settings with slip sheet insertion.

Before installing FIT101441834.exe

1. Known issues listed below, read before installing **FIT101441834.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101441834.exe** patch is installed:
 - FIT101025137.exe
 - FIT101138129.exe
 - FIT101147947.exe
3. Do **NOT** install any of the following patch(es) after installing the **FIT101441834.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101441834.exe** patch:
 - FIT101374593.exe
 - FIT101143883.exe
 - FIT101288284.exe
 - FIT101339552.exe
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101441834.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 29-Nov-16	No.: RD726044
--	-----------------	---------------

- a. Logon must be admin. This is fixed and cannot be modified.
- b. Password is the Fiery administrator login password.
- c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101441834**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 29-Nov-16	No.: RD726045
Subject: Patch (FIT101501273) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: 1st Tech. Support Sec. Service Support Dept.			
Classification:	<input type="checkbox"/> Troubleshooting <input type="checkbox"/> Part information <input type="checkbox"/> Action required <input type="checkbox"/> Mechanical <input type="checkbox"/> Electrical <input type="checkbox"/> Service manual revision <input type="checkbox"/> Paper path <input type="checkbox"/> Transmit/receive <input type="checkbox"/> Retrofit information <input type="checkbox"/> Product Safety <input checked="" type="checkbox"/> Other ()		

This RTB has been issued to announce the release notes on the patch “**FIT101501273**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101501273.exe	- Plockmatic paper jam does not recover when paper jam occurs while printing a particular job.

Before installing FIT101501273.exe

- Known issues listed below, read before installing **FIT101501273.exe** patch:
 - None.
- The following prerequisites must be installed in the order specified before the **FIT101501273.exe** patch is installed:
 - FIT101025137.exe
 - FIT101138129.exe
 - FIT101147947.exe
- Do NOT install any of the following patch(es) after installing the **FIT101501273.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101501273.exe** patch:
 - FIT101441834.exe
 - FIT101374593.exe
 - FIT101339552.exe
 - FIT101288284.exe
 - FIT101143883.exe
- This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
- In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

- Make sure that the Fiery printer controller reaches Idle.
- Execute **FIT101501273.exe** and follow the instructions in the Fiery Patch Downloader.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 29-Nov-16	No.: RD726045
--	-----------------	---------------

3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101501273**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 22-Feb-17	No.: RD726046
Subject: Patch (FIT101504048) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: 1st Tech. Support Sec. Service Support Dept.			
Classification:	<input type="checkbox"/> Troubleshooting <input type="checkbox"/> Part information <input type="checkbox"/> Action required <input type="checkbox"/> Mechanical <input type="checkbox"/> Electrical <input type="checkbox"/> Service manual revision <input type="checkbox"/> Paper path <input type="checkbox"/> Transmit/receive <input type="checkbox"/> Retrofit information <input type="checkbox"/> Product Safety <input checked="" type="checkbox"/> Other ()		

This RTB has been issued to announce the release notes on the patch “**FIT101504048**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101504048.exe	- Paper mismatch occurs with specific settings.

Before installing FIT101504048.exe

1. Known issues listed below, read before installing **FIT101504048.exe** patch:
 - None.
2. The following prerequisites must be installed in the order specified before the **FIT101504048.exe** patch is installed:
 - FIT101025137.exe
 - FIT101138129.exe
 - FIT101147947.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101504048.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101504048.exe** patch:
 - FIT101501273.exe
 - FIT101441834.exe
 - FIT101374593.exe
 - FIT101339552.exe
 - FIT101288284.exe
4. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101504048.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 22-Feb-17	No.: RD726046
--	-----------------	---------------

- a. Logon must be admin. This is fixed and cannot be modified.
- b. Password is the Fiery administrator login password.
- c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.
5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101504048**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 28-Feb-17	No.: RD726047
Subject: Patch (FIT101257880) release note for System Software Version 2.0 for Baron-C1/P1 EFI(EB-32)		Prepared by: Y.Okano	
From: 1st Tech. Support Sec. Service Support Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other ()	

This RTB has been issued to announce the release notes on the patch “**FIT101257880**” applied to the Baron-C1/P1 EFI (EB-32) system software version 2.0.

Patch File	Issue(s)
FIT101257880.exe	- Job does not get printed. - SC919 or engine communication loss.

Before installing FIT101257880.exe

1. Known issues listed below, read before installing **FIT101257880.exe** patch:
 - None.
2. The following prerequisite(s) must be installed in the order specified before the **FIT101257880.exe** patch:
 - FIT101025137.exe
 - FIT101138129.exe
3. Do NOT install any of the following patch(es) after installing the **FIT101257880.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101257880.exe** patch:
 - None.
4. This patch is not exclusive, it can be installed along with other patches concurrently, and one server Reboot or Restart is sufficient for all patches to take effect on the system.
5. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101257880.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. Before rebooting the system, to ensure that the patch file is completely processed, please wait up to 60 seconds until the file is done processing.

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 28-Feb-17	No.: RD726047
--	-----------------	---------------

5. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. *(If you choose to Restart later, make sure you manually reboot the server for the changes to take effect.)*
6. Wait until the Fiery controller reaches Idle and print the Configuration page.
7. If the controller does not eventually reach Idle, please manually start the Fiery service.
8. Verify that the **System Updates Log** section contains the patch number **FIT101257880**.

Fiery Patch Release Notes

PAGE: 1/2

Model: Printer Controller E-32B (BR-C1.1)

Date: June 9, 2017

Revision:

System Version: 2.0

Patch File: FIT101560594.exe

Issue(s) address to this Patch:

- Duplex setting is not honored for 316mm x 234mm LEF custom paper selected from the paper catalog.

Before installing FIT101560594:

1. Known issues listed below, read before installing **FIT101560594.exe** patch:
 - **None**
2. The following prerequisite(s) must be installed in the order specified before installing **FIT101560594.exe** is applied:
 - **FIT101025137.exe**
 - **FIT101138129.exe**
3. Do NOT install any of the following patch(es) after installing the **FIT101560594.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101560594.exe** patch:
 - **None**
4. This patch is not exclusive, it can be installed along with other patches concurrently, and one server Reboot or Restart is sufficient for all patches to take effect on the system.
5. This patch is not exclusive if installed manually. One server Reboot is sufficient for all patches to take effect on the system. System Updates may require an exclusive install if this patch becomes a prerequisite for a future patch.
6. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch Installation Instructions:

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101560594.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
5. Wait until the Fiery controller reaches Idle and print the Configuration page.
6. If the controller does not eventually reach Idle, please manually start the Fiery service.
7. Verify that the **System Updates Log** section contains the patch number **FIT101560594**.

Fiery Patch Release Notes

Model: Printer_Contrller EB-32 (BR-C1) System Version: 2.0	Date: July 4, 2017	Revision:
Patch file: <ul style="list-style-type: none">● Printer_Controller_EB-32_SP2.exe (Service Pack 02)● uninstall_sp.exe (uninstaller)		

Table of Contents

- Issues addressed with this release
- Patch configuration
- Before installing Printer_Controller_EB-32_SP2.exe (Service Pack 02)
- Patch installation instructions
- About Service Pack 02
- About the uninstaller (uninstall_sp.exe)
- Notes for uninstalling Service Pack 02
- Uninstaller patch installation instruction

Issues addressed with this release

Service Pack 02 contains the following fixes:

Patch ID	Description
FIT101143883	<ul style="list-style-type: none">● Cannot staple the maximum allowable number of sheets even if specified so in the SP.
FIT101191255	<ul style="list-style-type: none">● Dynamic Language Switching was disabled on the Fiery controller, because it is not supported on Windows 7 and later OS.
FIT101147947	<ul style="list-style-type: none">● Incorrect paper type is shown in job properties, If "recycled + coated" is specified as the paper type in paper catalog.
FIT101263942	<ul style="list-style-type: none">● RIPPING a PDF file with APPE enabled may cause Command WorkStation to lose connection with the engine.
FIT101288284	<ul style="list-style-type: none">● If CANAL is connected, printing does not resume even if paper is loaded on the tray after a paper-end detection.
FIT101311862	<ul style="list-style-type: none">● A Blank page is added when a job is printed through Driver after selecting age range.
FIT101339552	<ul style="list-style-type: none">● Job stacking does not honor when printed with mix paper size.
FIT101417825	<ul style="list-style-type: none">● Fiery services hang up when Process and Hold a particular PCL file.
FIT101374593	<ul style="list-style-type: none">● Printing does not resume after recovering from a tray empty status or a paper jam.
FIT101441834	<ul style="list-style-type: none">● The paper does not feed from the specified tray when Mixed Media and imposition sets for the job.
FIT101501273	<ul style="list-style-type: none">● Plockmatic paper jam does not recover when paper jam occurs while printing a particular job.
FIT101504048	<ul style="list-style-type: none">● Paper mismatch occurs with specific settings.
FIT101257880	<ul style="list-style-type: none">● Job does not get printed.● SC919 or engine communication loss.
FIT101560594	<ul style="list-style-type: none">● Duplex setting is not honored for 316mm x 234mm LEF custom paper selected from the paper catalog.
–	<ul style="list-style-type: none">● The body of a booklet remains in the finisher, if the job had been cancelled after a cover jam.

Patch configuration

- Configuration after installing **Color_Controller_EB-32_SP2.exe** (Service Pack 02):
 - System Software Version 2.00
 - + Misc. patches released before Composite Patch 01
 - + Composite Patch 01 (FIT101025137)
 - + Misc. patches released after Composite Patch 01
 - + Composite Patch 02 (.FIT101138129)
 - + Misc. patches released after Composite Patch 02
 - + **Service Pack 02**

- If you wish to reinstall the system, install the patches as follows:
 - System Software Version 2.0
 - + Composite Patch 01 (FIT101025137)
 - + Composite Patch 02 (FIT101138129)
 - + **Service Pack 02**

Before installing Printer_Controller_EB-32_SP2.exe

- Known issues listed below, read before installing **Printer_Controller_EB-32_SP2.exe** patch:
 - None.
 - The following prerequisite(s) must be installed in the order specified before applying the **Printer_Controller_EB-32_SP2.exe** patch:
 - FIT101025137.exe (Composite Patch 01)
 - FIT101138129.exe (Composite Patch 02)
 - Do **NOT** install any of the following patch(es) after installing the **Printer_Controller_EB-32_SP2.exe** patch. If you must install any of the patch(es) below, do so before installing the **Printer_Controller_EB-32_SP2.exe** patch:
 - None.
4. This patch is exclusive, it must be installed by itself (no other patches should accompany this patch while installing), and the server must be rebooted or restarted once. After that, other patches can be applied to the server.
- Note: If you have installed other non-exclusive patches before this patch you must reboot the server to apply those patches first.
5. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **Printer_Controller_EB-32_SP2.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
5. Wait until the Fiery controller reaches Idle and print the Configuration page.
6. If the controller does not eventually reach Idle, please manually start the Fiery service.
7. Verify that the **System Updates Log** section lists the patch number **SP2_FIT101678347**.

About Service Pack 02

The service pack installer package is distributed as an EXE file, and is named **Printer_Controller_EB-32_SP2.exe**. When the service pack is installed on the controller, you can observe the below mentioned changes to confirm the service pack patch effectiveness:

- Latest version of the service pack will be listed in WebTools, Engine LCD panel, General tab of Command WorkStation & Fiery Configuration Page.

The service pack features are as follows.

- Uninstaller:
 - Uninstaller reverts back the changes made by the service pack. Uninstaller works by uninstalling the last installed service pack on the Fiery server.
 - The uninstaller would check the backup binaries and replace them. After the reboot the server would be back in the pre service pack state.
 - Uninstaller can be run multiple times to uninstall multiple service pack patches, one patch at a time.
- Prerequisite checking:
 - Service packs will run pre-requisite checks upon patch installation to ensure all dependent service packs/patches are installed.
 - Service pack installation will only succeed if pre-requisite patches are installed on server, otherwise the installation will fail.
- Versioning:
 - Service pack has versioning system where incremental version of each service pack would list on server
 - On LCD for example SP1, SP2, SP3 etc.
 - On Configuration page → System Update log section → SP1_FIT100000, SP2_FIT20000

The Version information will appear as follows after installing Service Pack 02.

Version	: 2.0_SP2
---------	-----------

About the Uninstaller Patch

1. The uninstaller patch (**uninstall_sp.exe**) uninstalls the last patch applied to the system.
2. The uninstaller patch can only be used when the patch you intend to uninstall has the uninstallation capability.
3. The uninstaller patch uninstalls one patch at a time. Once the server reaches idle after uninstallation of the patch, the server will return to the state before the patch was first installed.
4. The uninstaller patch is exclusive and must be installed independently. Reboot the server, to install other patches.

Notes for uninstalling the **Printer_Controller_EB-32_SP2.exe**

1. This **Printer_Controller_EB-32_SP2.exe** patch has the uninstaller capability.

To uninstall this patch, make sure to use the uninstaller patch (**uninstall_sp.exe**) that is provided with **Printer_Controller_EB-32_SP2.exe** patch.

2. If **Printer_Controller_EB-32_SP2.exe** is not the last patch applied to the system, every patch installed after **Printer_Controller_EB-32_SP2.exe** must be uninstalled one by one before uninstalling **Printer_Controller_EB-32_SP2.exe**.
3. Important notes for uninstalling **Printer_Controller_EB-32_SP2.exe** patch with the uninstaller patch:
 - None

Uninstaller Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **uninstall_sp.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
5. Wait until the Fiery controller reaches Idle and print the Configuration page.
6. Verify that the System Updates Log section does NOT contain the patch number **SP2_FIT101678347**.

Model: Baron-C1/P1 EFI v2.0 (EB-32)		Date: 20-Apr-18	No.: RD726048
Subject: New Feature Information: Fiery Updates		Prepared by: Chisato Tsuji	
From: 1st CP Business Department CP Business Center			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input checked="" type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input type="checkbox"/> Other ()	<input checked="" type="checkbox"/> Tier 2 <input type="checkbox"/> Tier 0.5

Introduction:

Fiery Updates is a new feature allowing Administrators to install patches on Fiery servers from *Command Workstation 6.x*.

Notifications of updates are displayed in the Job Center and Home screens.

Please introduce your customers of this new feature as this will be beneficial in allowing them to update their Fiery controllers on their own at the desired time (on-demand) and in reducing service visits/cost.

Note: This feature is unnecessary for customers who have the Fiery System Updates set to [Automatically download and install updates.]

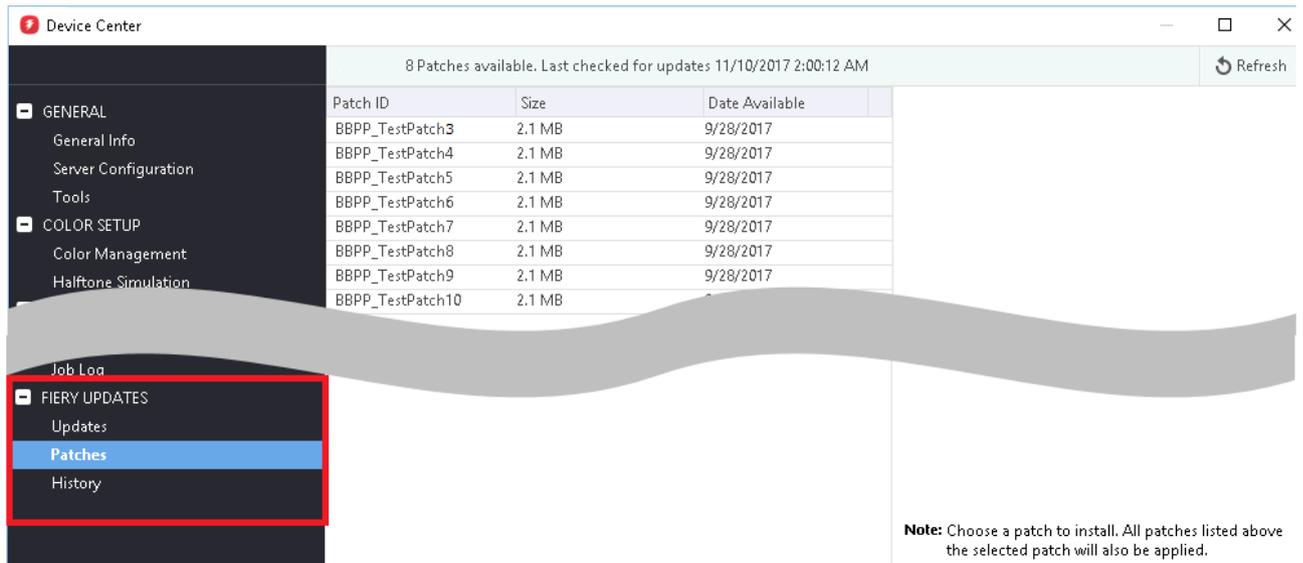


Table of contents:

1. Schedule
2. Target Models
3. About Fiery Updates
4. Merit of using Fiery Updates
5. Notes
6. Activating the Fiery Update feature.
7. "Update" Menu
8. "Patches" Menu
9. "History" Menu
10. Updates Available badges

1. Schedule

Fiery Updates will become available from May 7th, 2018 (PDST)

For upcoming models, the feature will be available from launch.

2. Target Models

FS100 or later models enabled of the System Updates feature

On the above indicated date, EFI enables the following models to have access to the Fiery updates feature through the Update server on the internet.

The feature will be available with Command WorkStation 6.x

Windows model

- Color Controller E-42/82 (Aries-VerUp)
- Color Controller E-43/83 (Andromeda-P1)
- Color Controller E-43A/83A (Leo-C1/P1)
- Color Controller E-45A/85A (Leo-C2/P2)
- Color Controller E-42B (CH-C1)
- Color Controller E-44B (CH-C2)
- Printer Controller EB-32 (BR-C1/P1)
- Printer Controller EB-34 (BR--C2/P2)

Linux model

- Color Controller E-23C (MET-C2)
- Color Controller E-24B (CH-C2)

For models that are not supported of the Fiery Updates feature, the following message will appear when attempted to open the Fiery Updates menu via Command WorkStation.



Fiery Updates is not supported for this Fiery Server model.

Model:Baron-C1/P1 EFI v2.0 (EB-32)	Date: 20-Apr-18	No.: RD726048
------------------------------------	-----------------	---------------

3. About "Fiery Updates"


Command WorkStation Ver. 6.x includes the Fiery Updates feature for installing Fiery system software and Fiery API updates and patches. This allows system software updates to be installed from either the Fiery controller or remote (client) computers.

Fiery API: Fiery API is an Application Programming Interface, used by many newer Fiery features to communicate with the Fiery (instead of harmony). It is already used by Fiery Go, Fiery Ticker, new black Fiery bar, and other features like Fiery updates.

Patches: Patches downloaded with Fiery Updates is no different to those downloaded with the conventional System Updates feature.

4. Merit of using the Fiery Updates

- Once this feature is enabled, while Command WorkStation is launched, updates are searched periodically and notifications of updates are displayed in the Job Center and Home screens.

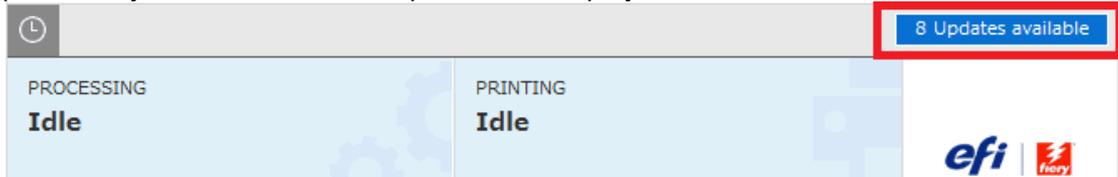


- User Friendly Interface for operation (via Command WorkStation with Administrator privileges)
- Updates and patch installation is possible from Client PC with internet connection.
- (In this case, the Fiery controller does not have to be connected to the internet.)
- Identically to System Updates, only patches that are not applied to the system appear on the list.
- Identically to System Updates, selecting a patch from the list will automatically select its pre-requisite, if any.

Model:Baron-C1/P1 EFI v2.0 (EB-32)	Date: 20-Apr-18	No.: RD726048
------------------------------------	-----------------	---------------


5. Notes

- To use this feature, System Updates must be disabled.
- The computer running Command WorkStation must:
 - Be connected to the Internet
 - Be able to communicate with Fiery controller via LAN.

[Command WorkStation on Fiery controller (Windows model only)] --- (Internet) -- [EFI Update Server]

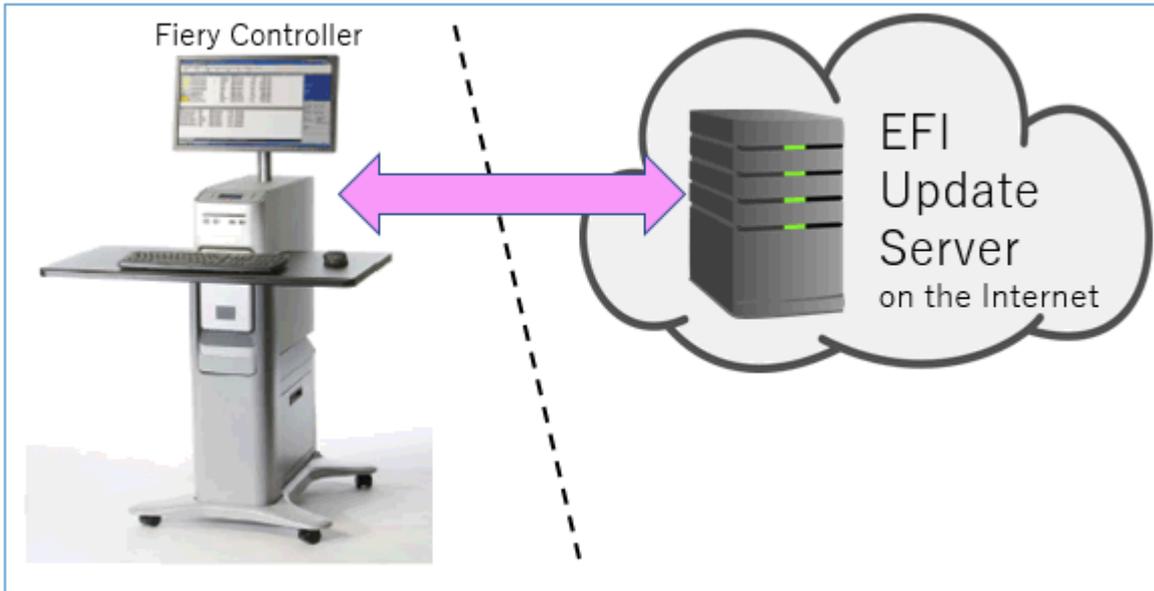


[Fiery controller (Windows or Linux model)] --(local LAN)-- [Command WorkStation on Client PC] --- (Internet) -- [EFI Update Server]

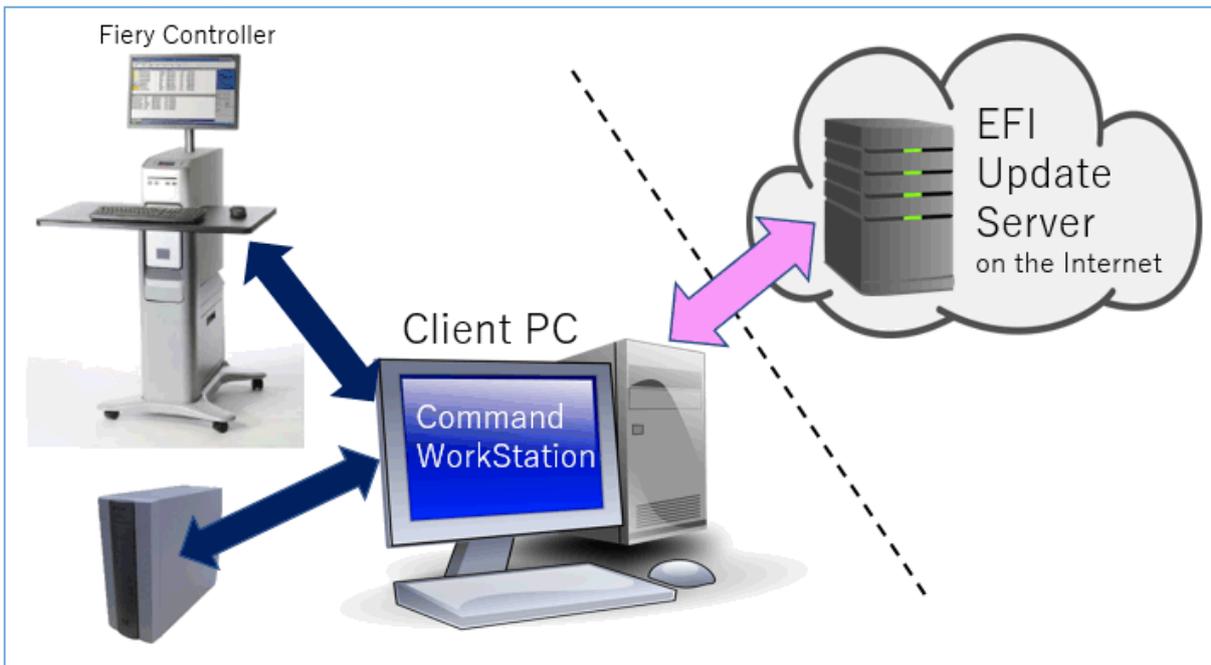


6. Activating the Fiery Update feature

1. Right-click the Fiery controller name in the controllers column list and click **Device Center**.

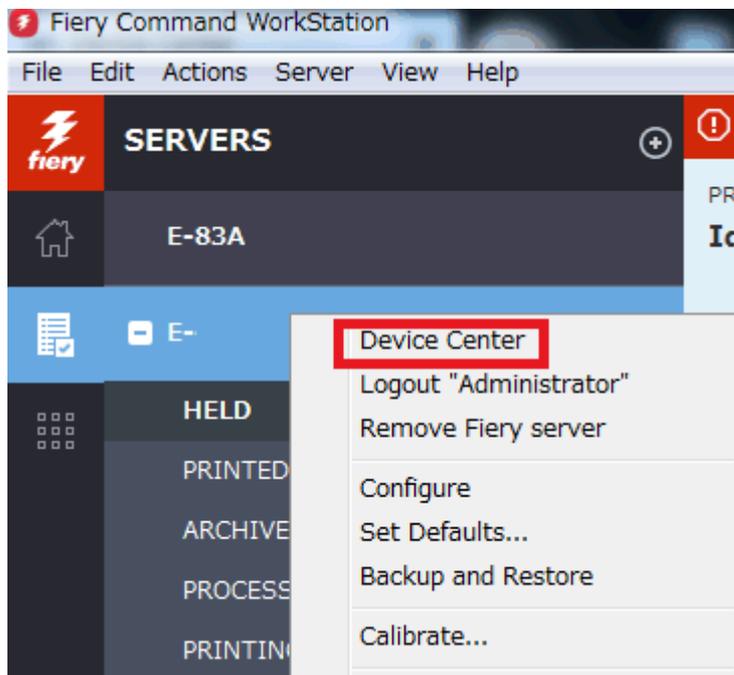


2. Select **Updates** or **Patches** under Fiery Updates

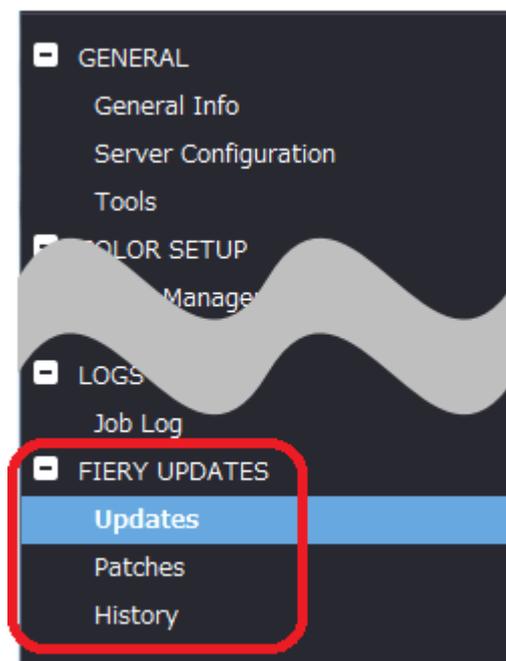


Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 20-Apr-18	No.: RD726048
--	-----------------	---------------

3. On the message screen below, click Continue. This will automatically disable System Updates.

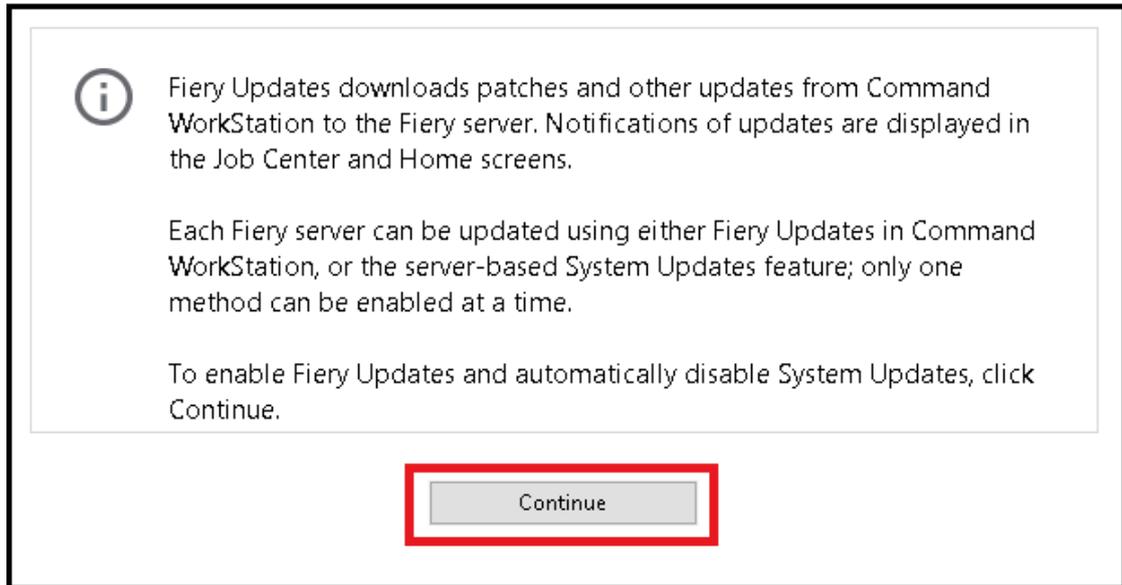


7. "Update" Menu

To view and install the available updates, click Updates under Fiery Updates, then click Update in the right pane for each update you choose to install.

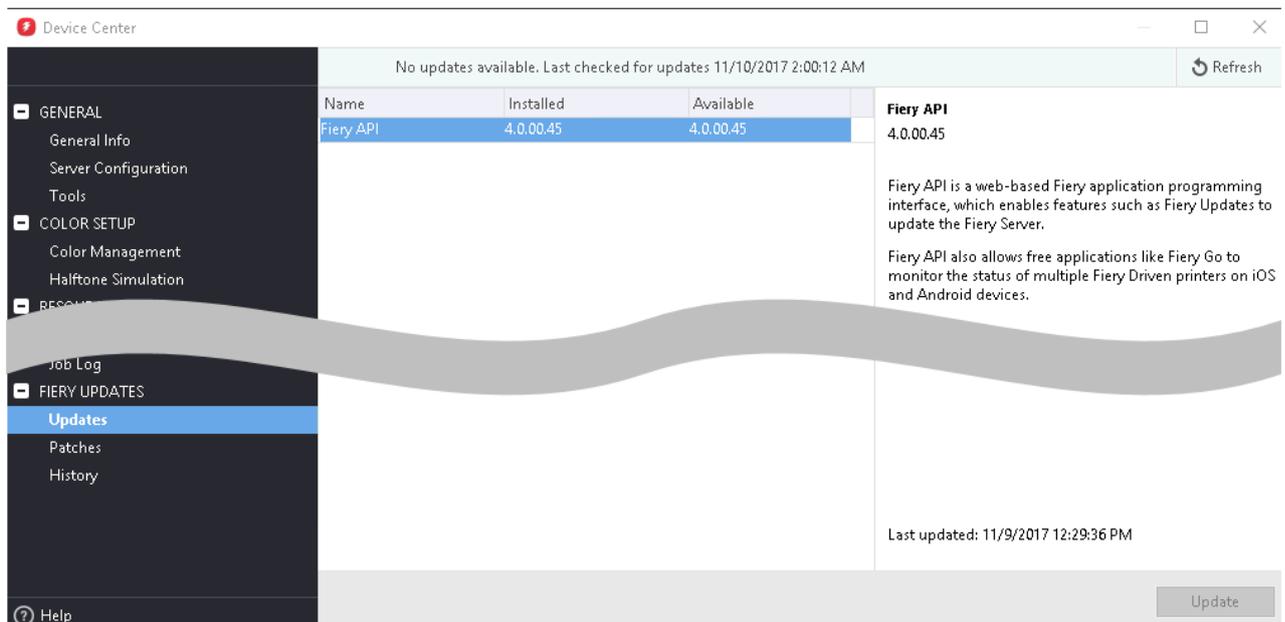


8. "Patches" Menu


1. To view the available patches, click Patches under Fiery Updates.

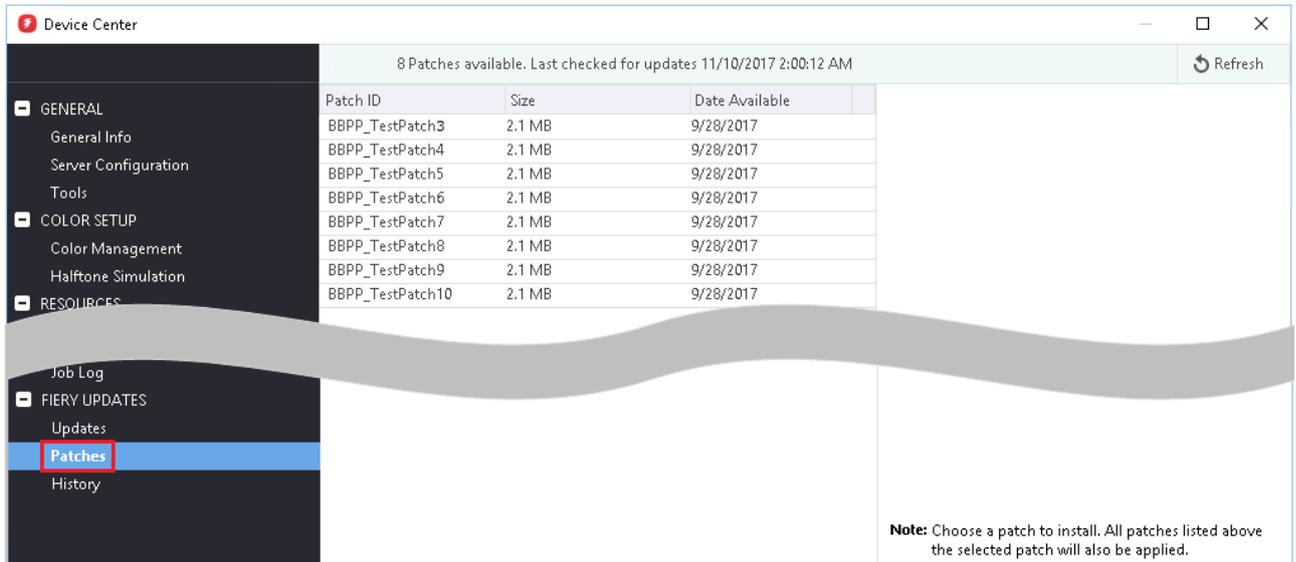

2. When you select a patch the pre-requisite patches are also automatically selected, if any. For example, selecting Patch #7 will automatically select its pre-requisite Patches #3-6. Click Update.

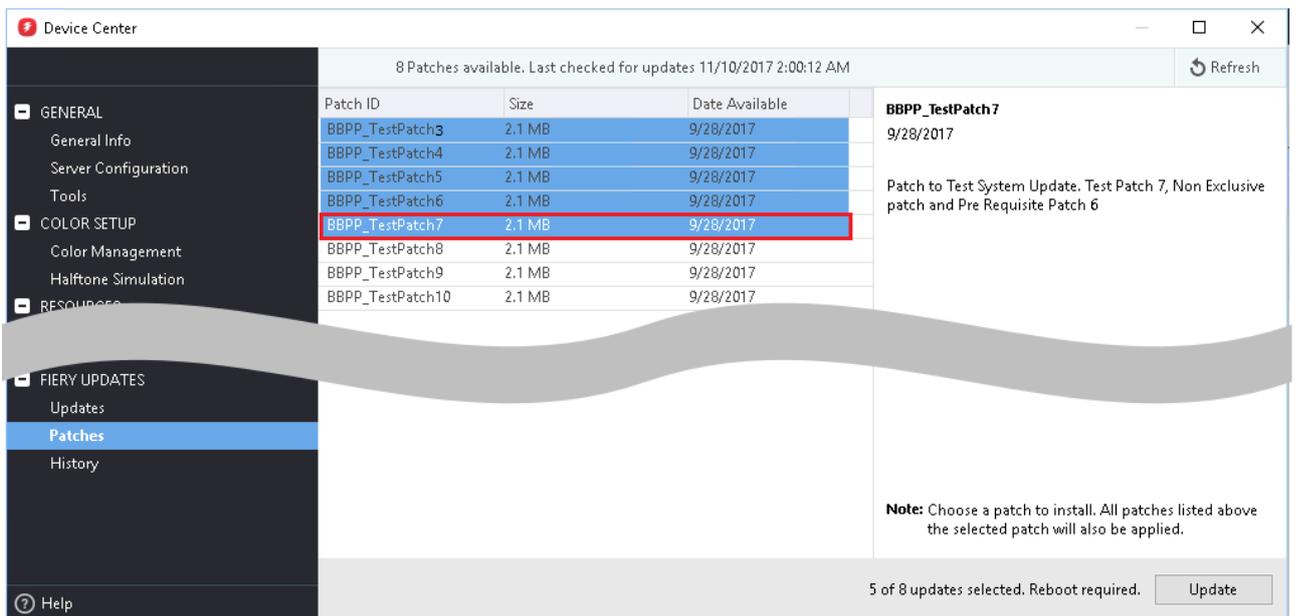


3. Click Continue in the confirmation message screen below.

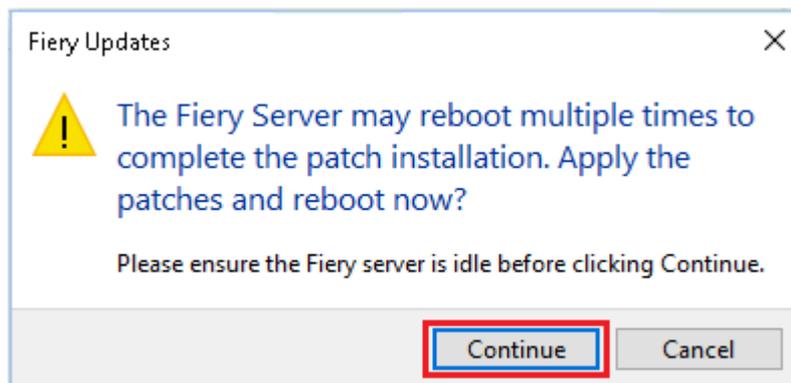


Various stages of the update process and a progress bar appear in the Disconnect screen as follows:

- Initializing
- Downloading Updates
- Transferring
- Installing

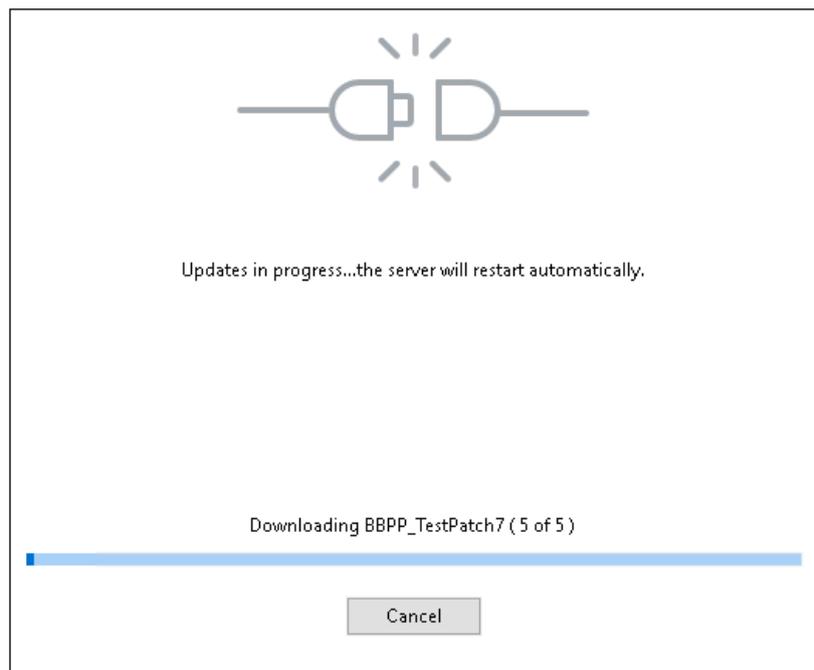

Model: Baron-C1/P1 EFI v2.0 (EB-32)	Date: 20-Apr-18	No.: RD726048
--	-----------------	---------------


The Fiery controller will reboot as necessary between exclusive patches.
(If five patches are being installed, then up to five reboots may occur).

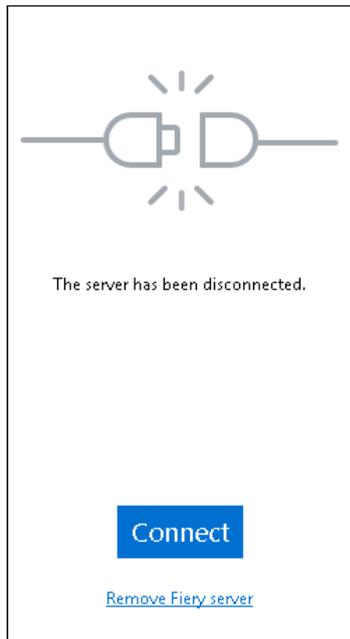

Note: After the Fiery controller reboots, Command WorkStation will not automatically reconnect. The Administrator must click Connect in order to reconnect to the Fiery controller.

9. "History" Menu

After the system reboots automatically for a number of times necessary according to the updates installed, reconnect to your Fiery controller via Command WorkStation and confirm the update history in the History menu.

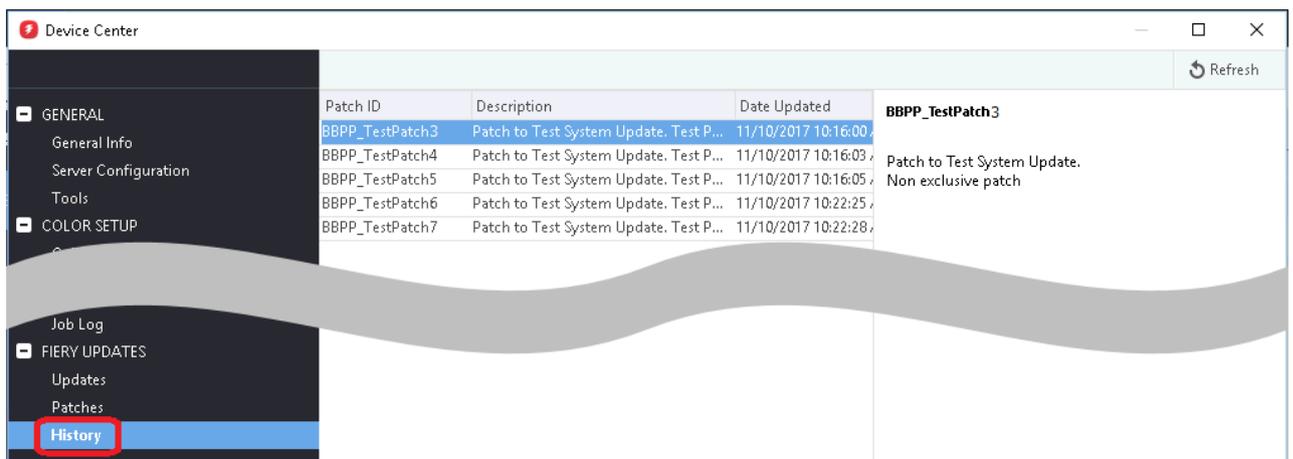


Model:Baron-C1/P1 EFI v2.0 (EB-32)	Date: 20-Apr-18	No.: RD726048
------------------------------------	-----------------	---------------

10. Updates Available badges

When Fiery Updates is enabled for the Fiery server model and patches are available, the badges will display in the Job Center and the Home Screen. These badges include the number of patches available in the patch tab. The count does not include any Fiery API updates in the Updates tab.

The user can click on this “Updates available” badge to be taken directly to the Device Center > Fiery Updates > Patches tab.

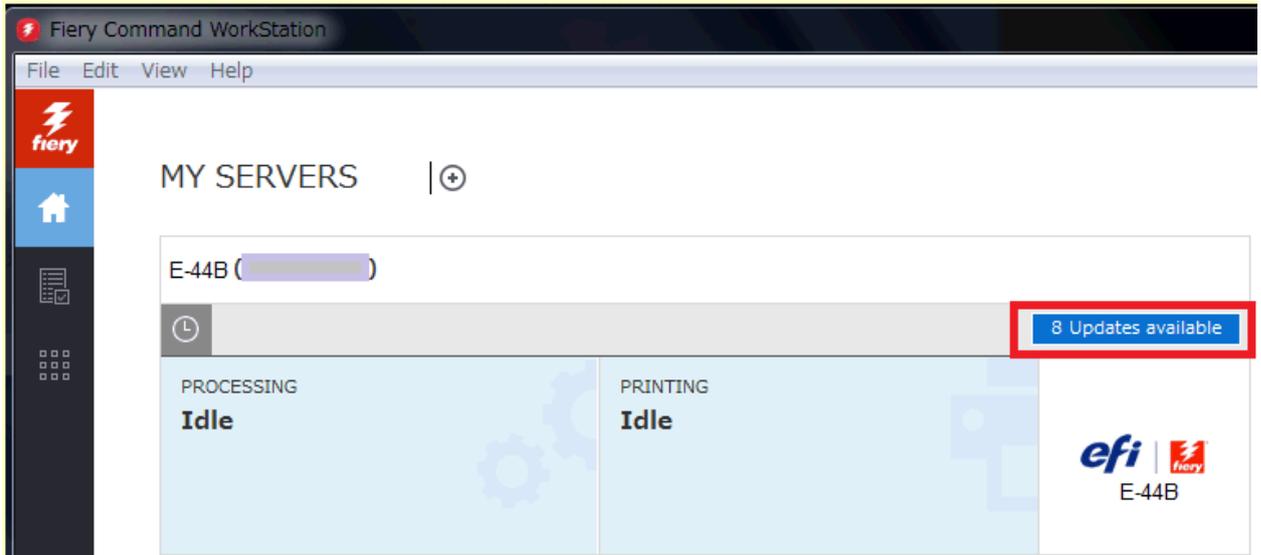

Fiery Patch Release Notes

Model: Printer Controller EB-32 (Baron-C1/P1)	Date: August 20, 2019	Rank: C	Revision:
System Version: 2.0			
Patch file: <ul style="list-style-type: none">● FIT101815771.exe (Security patch 002)● uninstall_sp.exe (uninstaller)			

Uninstallation Capability	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
Uninstaller Patch File	uninstall_sp.exe

Table of Contents

- Issues addressed with this release
- Before installing **FIT101815771.exe**
- Patch installation instructions
- About the uninstaller (**uninstall_sp.exe**)
- Notes for uninstalling **FIT101815771.exe**
- Uninstaller patch installation instruction

Issues addressed with this release

Patch ID	Description
FIT101815771	Patch to update the following components of the Fiery to the versions listed: <ul style="list-style-type: none">- Apache: 2.2.34- PHP: 5.6.33- OpenSSL: 1.0.2n

Before installing FIT101815771.exe

1. **IMPORTANT:** It is recommended to perform OS update or install MS update KB4103720 and superseding updates. Failing to do this may result in losing Remote Desktop Access to the Fiery until the Microsoft patches are installed.
2. Known issues listed below, read before installing **FIT101815771.exe** patch:
 - None.
3. The following prerequisite(s) must be installed in the order specified before applying the **FIT101815771.exe** patch:
 - FIT101138129.exe
 - FIT101654798.exe
4. Do **NOT** install any of the following patch(es) after installing the **FIT101815771.exe** patch. If you must install any of the patch(es) below, do so before installing the **FIT101815771.exe** patch:
 - FIT101654798.exe
5. This patch is exclusive, it must be installed by itself (no other patches should accompany this patch while installing), and the server must be rebooted or restarted once. After that, other patches can be applied to the server.

Note: If you have installed other non-exclusive patches before this patch you must reboot the server to apply those patches first.

6. In the case where the customer needs to install a patch which was previously skipped in the patch order, it is necessary to reinstall the system.

Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **FIT101815771.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot.
5. Wait until the Fiery controller reaches Idle and print the Configuration page.
6. If the controller does not eventually reach Idle, please manually start the Fiery service.
7. Verify that the System Updates Log section contains the patch number **FIT101815771**.

About the Uninstaller Patch

1. The uninstaller patch (**uninstall_sp.exe**) uninstalls the last patch applied to the system.
2. The uninstaller patch can only be used when the patch you intend to uninstall has the uninstallation capability.
3. The uninstaller patch uninstalls one patch at a time. Once the server reaches idle after uninstallation of the patch, the server will return to the state before the patch was first installed.
4. The uninstaller patch is exclusive and must be installed independently. Reboot the server, to install other patches.

Notes for uninstalling the FIT101815771.exe

This **FIT101815771.exe** patch has the uninstaller capability.

To uninstall this patch, make sure to use the uninstaller patch (**uninstall_sp.exe**) that is provided with **FIT101815771.exe** patch.

1. If **FIT101815771.exe** is not the last patch applied to the system, every patch installed after **FIT101815771.exe** must be uninstalled one by one before uninstalling **FIT101815771.exe**.
2. Important notes for uninstalling **FIT101815771.exe** patch with the uninstaller patch:
 - None

Uninstaller Patch installation instructions

1. Make sure that the Fiery printer controller reaches Idle.
2. Execute **uninstall_sp.exe** and follow the instructions in the Fiery Patch Downloader.
3. Notes about the Fiery Patch Downloader
 - a. Logon must be admin. This is fixed and cannot be modified.
 - b. Password is the Fiery administrator login password.
 - c. Hostname can be the IP address or the Fiery server name.
4. After the patch is downloaded, and when prompted by the Fiery Patch Downloader, choose Reboot. (If you choose to Restart later, make sure you manually reboot the server for the changes to take effect)
5. Wait until the Fiery controller reaches Idle and print the Configuration page.
6. Verify that the System Updates Log section does NOT contain the patch number **FIT101815771**.