

=====  
**\*\*\* Basic Information \*\*\***  
=====

[Create date] 2019/03/12

-----  
[Program Name] GWFCU3.8-3(WW)

-----  
[Version] 08.00.00

-----  
[PCB No.]

-----  
[Interchangeability] X / O

-----  
[Other Firmware Requirements] None

-----  
[PCB Requirements] None

-----  
[Software category] Normal Release

-----  
[Release category] Normal Release

-----  
[Program category] Firmware

-----  
Exported to(language) GEN(all)

[Firmware No.] D7025580H

[File Information]

File Name       D7025580H.fwu

File Type       Module for Service

Size            3.94 MB ( 4129296 byte )

[File Information]

File Name       D7025580H.rfu

File Type       Module for Remote Upgrade

Size            3.95 MB ( 4137216 byte )

[Availability of RFU] Yes

-----  
[Production reflection] 2019/02  
-----

=====  
**\*\*\* Note \*\*\***  
=====

[Note]

=====  
**\*\*\* Important Notes \*\*\***  
=====

[Important Notes]

=====  
**\*\*\* Modification History \*\*\***  
=====

=====  
[Modifications made:]

Rank C

Symptom corrected:

- Communication error (code: 00-20/22) occurs, if the device is run on V.17 modulation and receives a fax containing many pages.
- Message "FAX jobs will be full soon" may appear after continuously using the Remote FAX.  
If continuously used in this condition, message "FAX jobs are full" appears and Remote FAX function becomes disabled.
- If [Store and Print] is enabled and a document is deleted from GlobalScan, the FAX function becomes inoperable.
- When the Capture function for sending FAX is enabled, (SP5836-001 and SP5836-004 set to '1') the received FAX document cannot be printed correctly if the machine power is turned OFF while capturing the data.

-----  
[Modification history]

-----  
Version 07.00.00

Support for ErP Lot 6 compliance.

-----  
Version 06.00.00

Symptom corrected:

If an error, for example, 14-30 occurs while sending folders, the machine may not recover from the error nor report the error.

-----  
Version 05.00.00

Symptom Corrected:

1. When documents received by fax are delivered as files to a PC using the ScanRouter delivery software, some files are printed instead of delivered to the PC.

If SP5-191 is set to 1 and SP1-111-001 bit1 is set to 0, the following symptoms may occur:

2. The machine reboots and displays SC899.
3. FAX does not activate when the machine recovers from the Energy Saver mode. 5 minutes after the recovery, SC899 occurs.

-----  
Version 04.00.00

Symptom corrected:

The display for the number of jobs (remaining) that can be sent is not reduced after a Direct Transmission job is completed, and no Direct Transmission, Memory Transmission, or Memory Reception jobs can be performed.

-----

Version 03.00.00

Symptom corrected:

SC899 occurs after the machine recovers from Energy Saver Mode

-----  
Version 02.00.00

Symptom corrected:

- Stored FAX reception documents cannot be accessed from WIM after the machine recovers from Energy Saver mode.
- SC866 may occur after the machine recovers from Energy Saver mode.

-----  
Version 01.00.00

1st Mass production

=====  
**\*\*\* Basic Information \*\*\***  
=====

[Create date] 2019/03/12

-----  
[Program Name] GWFCU3.8-3(WW)

-----  
[Version] 08.00.00

-----  
[PCB No.]

-----  
[Interchangeability] X / O

-----  
[Other Firmware Requirements] None

-----  
[PCB Requirements] None

-----  
[Software category] Normal Release

-----  
[Release category] Normal Release

-----  
[Program category] Firmware

-----  
Exported to(language) GEN(all)

[Firmware No.] D7025580H

[File Information]

File Name       D7025580H.fwu

File Type       Module for Service

Size            3.94 MB ( 4129296 byte )

[File Information]

File Name       D7025580H.rfu

File Type       Module for Remote Upgrade

Size            3.95 MB ( 4137216 byte )

[Availability of RFU] Yes

-----  
[Production reflection] 2019/02  
-----

=====  
**\*\*\* Note \*\*\***  
=====

[Note]

=====  
**\*\*\* Important Notes \*\*\***  
=====

[Important Notes]

=====  
**\*\*\* Modification History \*\*\***  
=====

=====  
[Modifications made:]

Rank C

Symptom corrected:

- Communication error (code: 00-20/22) occurs, if the device is run on V.17 modulation and receives a fax containing many pages.
- Message "FAX jobs will be full soon" may appear after continuously using the Remote FAX.  
If continuously used in this condition, message "FAX jobs are full" appears and Remote FAX function becomes disabled.
- If [Store and Print] is enabled and a document is deleted from GlobalScan, the FAX function becomes inoperable.
- When the Capture function for sending FAX is enabled, (SP5836-001 and SP5836-004 set to '1') the received FAX document cannot be printed correctly if the machine power is turned OFF while capturing the data.

-----  
[Modification history]

-----  
Version 07.00.00

Support for ErP Lot 6 compliance.

-----  
Version 06.00.00

Symptom corrected:

If an error, for example, 14-30 occurs while sending folders, the machine may not recover from the error nor report the error.

-----  
Version 05.00.00

Symptom Corrected:

1. When documents received by fax are delivered as files to a PC using the ScanRouter delivery software, some files are printed instead of delivered to the PC.

If SP5-191 is set to 1 and SP1-111-001 bit1 is set to 0, the following symptoms may occur:

2. The machine reboots and displays SC899.
3. FAX does not activate when the machine recovers from the Energy Saver mode. 5 minutes after the recovery, SC899 occurs.

-----  
Version 04.00.00

Symptom corrected:

The display for the number of jobs (remaining) that can be sent is not reduced after a Direct Transmission job is completed, and no Direct Transmission, Memory Transmission, or Memory Reception jobs can be performed.

-----

Version 03.00.00

Symptom corrected:

SC899 occurs after the machine recovers from Energy Saver Mode

-----  
Version 02.00.00

Symptom corrected:

- Stored FAX reception documents cannot be accessed from WIM after the machine recovers from Energy Saver mode.
- SC866 may occur after the machine recovers from Energy Saver mode.

-----  
Version 01.00.00

1st Mass production

\*\*\* Basic Information \*\*\*

[Create date] 2020/05/26

[Program Name] GWFCU3.8-3(WW)

[Version] 09.00.00

[PCB No.]

[Interchangeability] X / O

[Other Firmware Requirements] None

[PCB Requirements] None

[Software category] Normal Release

[Release category] Normal Release

[Program category] Firmware

Exported to(language) GEN(all)

[Firmware No.] D7025580J

[File Information]

File Name D7025580J.fwu

File Type Module for Service

Size 3.94 MB ( 4129296 byte )

[File Information]

File Name D7025580J.rfu

File Type Module for Remote Upgrade

Size 3.95 MB ( 4137216 byte )

[Availability of RFU] Yes

[Production reflection] 2020/05

\*\*\* Note \*\*\*

[Note]

\*\*\* Important Notes \*\*\*

[Important Notes]

\*\*\* Modification History \*\*\*

=====  
[Modifications made:]

Rank C

Symptom corrected:

- A faxed document will be lost under the following conditions:.

1. The fax reception setting is set to receive directly (default setting).
2. A fax is sent while receiving a fax.
3. The main power is cut while receiving a fax and no pages can be printed.  
(For example, due to a power failure, momentary disconnection, unplugging, or FCU malfunction. This does not happen with a normal shutdown.)

-----  
[Modification history]

-----  
Version 08.00.00

Rank C

Symptom corrected:

- Communication error (code: 00-20/22) occurs, if the device is run on V.17 modulation and receives a fax containing many pages.
- Message "FAX jobs will be full soon" may appear after continuously using the Remote FAX.  
If continuously used in this condition, message "FAX jobs are full" appears and Remote FAX function becomes disabled.
- If [Store and Print] is enabled and a document is deleted from GlobalScan, the FAX function becomes inoperable.
- When the Capture function for sending FAX is enabled, (SP5836-001 and SP5836-004 set to '1') the received FAX document cannot be printed correctly if the machine power is turned OFF while capturing the data.

-----  
Version 07.00.00

Support for ErP Lot 6 compliance.

-----  
Version 06.00.00

Symptom corrected:

If an error, for example, 14-30 occurs while sending folders, the machine may not recover from the error nor report the error.

-----  
Version 05.00.00

Symptom Corrected:

1. When documents received by fax are delivered as files to a PC using the ScanRouter delivery software, some files are printed instead of delivered to the PC.

If SP5-191 is set to 1 and SP1-111-001 bit1 is set to 0, the following symptoms may occur:

2. The machine reboots and displays SC899.



3. FAX does not activate when the machine recovers from the Energy Saver mode. 5 minutes after the recovery, SC899 occurs.

-----  
Version 04.00.00

Symptom corrected:

The display for the number of jobs (remaining) that can be sent is not reduced after a Direct Transmission job is completed, and no Direct Transmission, Memory Transmission, or Memory Reception jobs can be performed.

-----  
Version 03.00.00

Symptom corrected:

SC899 occurs after the machine recovers from Energy Saver Mode

-----  
Version 02.00.00

Symptom corrected:

- Stored FAX reception documents cannot be accessed from WIM after the machine recovers from Energy Saver mode.
- SC866 may occur after the machine recovers from Energy Saver mode.

-----  
Version 01.00.00

1st Mass production