Technical Bulletin

PAGE: 1/1

Model: Kir-C		Dat	ite: 06-Jun-01		No.: RB040005	
Subject: ROM History (Kir-C1 Printer Option)			Prepared by: M. Mano			
From: Technical Services Dept., GTS Division						
Classification:	Troubleshooting	Part info	ormat	tion	Action	n required
	Mechanical	Electrica	al		Servic	e manual revision
	Paper path	🗌 Transmi	it/rec	eive	⊠ Retrof	fit information
	Other ()					

Firmware history for the Kir-C1 Printer Option.

B4055280	Version	C.SUM	Production
А	1.00	5E8C	1st Mass Prod.
В	1.02	43B1	May Prod. '01

Symptom Corrected	Suffix
PCL5e font download cannot be performed.	В
While the copier is in standby mode with the printer on-line, the printer is taken off-line after entering and then exiting Printer Settings using the User Tools Key.	В

Technical Bulletin

PAGE: 1/1

Model: Kir-C		Dat	te: 12-Jul-0	1	No.: RB040009	
Subject: ROM History (Kir-C1 Printer Option)			Prepared by: M. Mano		Mano	
From: Technical Services Dept., GTS Division						
Classification:	Troubleshooting	Part info	orma	tion	Action	n required
	Mechanical	Electrica	al		Servic	ce manual revision
	Paper path	🗌 Transmi	it/rec	eive	Retrof	fit information
	Other ()					

Firmware history for the Kir-C1 Printer Option

B4055280	Version	C.SUM	Production
А	1.00	5E8C	1st Mass Prod.
В	1.02	43B1	May Prod. '01
С	1.04	8997	July Prod. '01

Symptom Corrected	Suffix
PCL5e Font Download cannot be performed.	В
While the copier is in standby mode with the printer on-line, the	В
printer is taken off-line after entering and then exiting Printer	
Settings using the User Tools Key.	
After a decimal number is entered in [Font Pitch] from	С
[Printer Features]-[Job Control]-[PCL Menu], the digits to the	
right of the decimal point may be displayed differently on the	
LCD.	
When printing out w/a cover page from a Mac client, text	С
characters appear larger if the resolution has been set to	
300dpi in [Printer Features]-[Job Control]-[Print Quality].	
When both Frame Border and Rotate are enabled, the frame	С
border does not appear.	

Technical Bulletin

Reissued: 27-Sep-01

Model: Kir-C

Date: 12-Jul-01

No.: RB040009a

RTB Correction

Subject: ROM History (Kir-C1 Printer Option)		Prepared by: K. Miura		
From: Technical	Services Dept., GTS Division			
Classification:	Troubleshooting	Part information	tion	Action required
	Mechanical	Electrical		Service manual revision
	Paper path	Transmit/rec	eive	Retrofit information
	Other ()			

Firmware history for the Kir-C1 Printer Option.

General

B4055280	Version	C.SUM	Production
А	1.00	5E8C	1st Mass Prod.
В	1.02	43B1	May Prod. '01
С	1.04	8997	July Prod. '01
B4055285	1.00	A6C9	October Prod. '01

Chinese/Taiwanese

B4055286	Version	C.SUM	Production
No suffix	1.00	D370	1st Mass Prod.

Symptom Corrected	General	CHN/TWN
PCL5e Font Download cannot be performed.	B4055280B	_
While the copier is in standby mode with the printer on-line, the printer is taken off-line after entering and then exiting Printer Settings using the User Tools Key.	В	-
After a decimal number is entered in [Font Pitch] from [Printer Features]-[Job Control]-[PCL Menu], the digits to the right of the decimal point may be displayed differently on the LCD.	С	-
When printing out w/a cover page from a Mac client, text characters appear larger if the resolution has been set to 300dpi in [Printer Features]-[Job Control]-[Print Quality].	С	-
When both the frame border and Rotate are enabled, the frame border does not appear.	С	-
Start of mass production for China and Taiwan models.	_	B4055286
Start of mass production for duplex model.	B4055285	_

Technical Bulletin

Reissued: 22-Oct-01

Model: Kir-C

Date: 12-Jul-01

No.: RB040009b

RTB Correction

Subject: ROM History (Kir-C1 Printer Option)			Prepared by: M. Kitajima		
From: Technical	Services Dept., GTS Division				
Classification:	Troubleshooting	Part information	tion	Action required	
	Mechanical	Electrical		Service manual revision	
	Paper path	Transmit/rec	eive	Retrofit information	
	Other ()				

Firmware history for the Kir-C1 Printer Option.

General

B4055280	Version	C.SUM	Production
А	1.00	5E8C	1st Mass Prod.
В	1.02	43B1	May Prod. '01
С	1.04	8997	July Prod. '01
B4055285	1.00	A6C9	October Prod. '01

Chinese/Taiwanese

B4055286	Version	C.SUM	Production
No suffix	1.00	D370	1st Mass Prod.

	Symptoms Corrected (new information only)	General	CHN/TWN
1. 2.	Start of mass production for the duplex model. Rotate Collation mode is enabled under the following conditions:	B4055285	-
	 a. The optional memory is installed. b. Auto Tray Select is selected from the printer driver. c. The same size (A4, Letter, or B5) is loaded in the paper trays in the opposite orientation (LEF/SEF). 		
3.	Tray Lock can now be used for multiple trays.		
4.	Sub Paper Size mode (A4/LT overwrite) has been added to UP mode.		
5.	The bypass tray now supports both LEF and SEF feed.		
6.	Spelling errors in the Czech display language have been corrected (e.g. Configuration Page, Menu List, etc.).		

Technical Bulletin

PAGE: 1/1

Model: Kir-C			Dat	Date: 26-Oct-01		No.: RB040017
Subject: ROM History (Kir-C1 Printer Option PS2)				Prepared by: M. Mano		
From: Technical :	Services Dept., GTS Division					
Classification:	Troubleshooting	Part info	orma	tion	Action	n required
	Mechanical	Electric	al		Servic	ce manual revision
	Paper path	🗌 Transm	it/rec	eive	Retro	fit information
	Other ()					

Firmware history for the Kir-C1 Printer Option PS2

B4315280	Version	C.SUM	Production
В	1.01	F384	1st Mass Prod.
С	1.02	AD6E	September Prod. '01
D	1.03	CAF9	October Prod. '01

Symptoms Corrected	Suffix
The printer does not work when printing from the PS driver	D
and Tray 1 has been set to a custom size in User Tools $ ightarrow$	
System Settings.	
If the memory full condition occurs when printing from the	D
PS driver with Rotate Collate, the image is printed out	
upside-down after the condition is cleared.	
With PS 300dpi printing from a Mac application, the font	С
comes out enlarged on the cover page.	
Incorrect resolution values appear in the Get Info pull-down	С
menu on Mac operating systems.	
When printing from Dazel using the PS driver (SEF feed), a	С
Load Tray error happens and the file cannot be printed out.	
After printing out the PS Font List, a paper jam occurs while	С
printing out the Configuration Page. Following this, the PS	
Font list cannot be printed out even after jam recovery.	

Technical Bulletin

Reissued: 04-Decv-01

Model: Kir-C

Date: 26-Oct-01

No.: RB040017a

RTB Correction

The items in bold italics have been corrected or added.

Subject: ROM History (Kir-C1 Printer Option PS2)		Prepared by: K. Ugaeri		
From: Technical	Services Dept., GTS Division			
Classification:	Troubleshooting	Part informat	tion	Action required
	Mechanical	Electrical		Service manual revision
	Paper path	Transmit/rec	eive	Retrofit information
	Other ()			

Firmware history for the Kir-C1 Printer Option PS2.

B4315280	Version	C.SUM	Production
В	1.01	F384	1st Mass Prod.
С	1.02	AD6E	No Production
D	1.03	CAF9	September Prod. '01
E	1.04	F31E	December Prod.'01

Symptom Corrected	Suffix
When PS2 firmware ver.1.02 or 1.03 is used on the old Kir-C1 controllers	E
ver.1.00/1.02/1.04, "processing" is displayed on the LCD panel and PS printing is	
not possible.	
*For the old Kir-C1 controller ver.1.00, 1.02 or 1.04, use this PS2 version (=1.04 suffix E), or version 1.01 (suffix B).	
- PS2 Firmware Version -	
- Controller Firmware -	
Ver.1.01	
Ver.1.03	
Ver.1.04	
Old Kir-C1 Controller	
Ver.1.00, 1.02 or 1.04	
OK	
NG	
ΟΚ	
New Kir-C1 Controller	
Ver.Vd.1.00	
NG	
OK	
ΟΚ	
Stella series Controller	
NG	
ОК	
OK	

Technical Bulletin

Reissued: 04-Decv-01

Model: Kir-C Date: 26-Oct-01 No.: RB0400					
The printer does not work when printing from the PS driver and Tray 1 has been set to a custom size with User Tools \rightarrow System Settings.					
If the memory full condition occurs when printing from t the image is printed out upside-down after the condition		e Collate,	D		
The PS font list comes out reduced, and is printed	out continuously until	paper	С		
end. This symptom occurs with new Kir-C Controller firmware vd.1.00 (which incl. duplex function) and all Stella series controllers.					
With PS 300dpi printing from a Mac application, the font comes out enlarged on the cover page.					
Incorrect resolution values appear in the Get Info pull-down menu on Mac operating systems.					
When printing from Dazel using the PS driver (SEF feed), a Load Tray error occurs and the file cannot be printed out.					
After printing out the PS Font List, a paper jam occurs Configuration Page. Following this, the PS Font list car jam recovery.		n after	С		

Technical Bulletin

PAGE: 1/1

Model: Kir-C		Dat	Date: 17-Dec-01		No.: RB040019	
Subject: Printer Controller Change for Duplex Model				Prepared	d by: ĸ. N	<i>l</i> iura
From: Technical	Services Dept., GTS Division					
Classification:	Troubleshooting	Part info	ormat	tion	Action	n required
	Mechanical	Electrica	al		Servic	e manual revision
	Paper path	🗌 Transm	it/rec	eive	Retrof	fit information
	Other ()					

From October 2001 production, printer controller product codes have corresponded to the duplex model of the K-C1. For this reason, the product codes have been changed as follows:

NEW
B405-50
B405-54
B405-55
B405-57
B405-62
B405-64
B405-66
B405-67

The new printer controllers have all the functions of the older ones. In addition, the marketing group has not sold the old controllers since the launch of the duplex model K-C1. From now on we will issue MBs only for the new printer controllers. The differences between old and new are as follows:

Description	Old P/N	New P/N
Controller Board	B4055170	B4055175
Operation Manual	B4058607	B4058857

We will also issue an MB concerning the above information.

Technical Bulletin

Reissued: 12-Mar-02

Model: Kir-C

RIGOH

Date: 12-Jul-01

No.: RB040009c

RTR	Correction

The	itomo	10	hald	Haliaa	have	h ~ ~ ~	corrected	~ ~	addad	
INP	nems	ILL	1)()(1)	nancs	nave	neen	COLLECIED	()[added	
1110	1001110		0010	nunoo	110.00	00011	001100100	0	aaaoa.	

Subject: ROM History (Kir-C1 Printer Option)			Prepared by: M. Kitajima		
From: Technical	Services Dept., GTS Division				
Classification:	Troubleshooting	Part information	tion	Action required	
	Mechanical	Electrical		Service manual revision	
	Paper path	Transmit/rec	eive	Retrofit information	
	Other ()				

Firmware history for the Kir-C1 Printer Option.

General

B4055280	Version	C.SUM	Production
А	1.00	5E8C	1st Mass Prod.
В	1.02	43B1	May Prod. '01
С	1.04	8997	July Prod. '01
B4055285	1.00	A6C9	October Prod. '01
B4055285A	1.05	37C4	December Prod. '01

Chinese/Taiwanese

B4055286	Version	C.SUM	Production
No suffix	1.00	D370	1st Mass Prod.

B4055287	Version	C.SUM	Production
No suffix	3.00	B97A	1st Mass Prod.

RIGOH Reissued: 12-Mar-02

Technical Bulle	etin
-----------------	------

Model: Kir-C

Date: 12-Jul-01

No.: RB040009c

	General	CHN/TWN	Russian
Symptom Corrected			Russian
PCL5e Font Download cannot be performed.	B4055280B	_	_
While the copier is in standby mode with the printer on-line,	В	-	_
the printer is taken off-line after entering and then exiting			
Printer Settings using the User Tools Key.			
After a decimal number is entered in [Font Pitch] from [Printer	С	-	_
Features]-[Job Control]-[PCL Menu], the digits to the right of			
the decimal point may be displayed differently on the LCD.			
When printing out w/a cover page from a Mac client, text	С	_	_
characters appear larger if the resolution has been set to			
300dpi in [Printer Features]-[Job Control]-[Print Quality].			
When both frame border and Rotate are enabled, the frame	С	-	_
border does not appear.			
Start of mass production for China and Taiwan models.	_	B4055286	_
1. Start of mass production for duplex models.	B4055285	-	_
2. Rotate Collation mode is enabled under the following			
conditions:			
a. The optional memory is installed.			
b. Auto Tray Select is selected from the printer driver.			
c. The same size (A4, Letter, or B5) is loaded in the paper			
trays in the opposite orientation (LEF/SEF).			
3. Tray Lock can now be used for multiple trays.			
4. Sub Paper Size mode (A4/LT overwrite) has been added			
to UP mode.			
5. The bypass tray now supports both LEF and SEF feed.			
6. Spelling errors in the Czech display language have been			
corrected (e.g. Configuration Page, Menu List, etc.).			
1. The face side is not printed completely when a no paper	B4055285A	_	_
feed jam occurs in the duplex print mode.			
2. The printer controller hangs up when a PS job is			
attempted without installing the PS option.			
Start of mass production for the Russia model.	_	_	B4055287

Technical Bulletin

Reissued: 27-Mar-02

Model: Kir-C

RIGOH

No.: RB040009d Date: 12-Jul-01

RTB (Correc	tion
-------	--------	------

The items in bold italics have been corrected or added.

Subject: ROM History (Kir-C1 Printer Option)			Prepared by: M. Kitajima		
From: Technical	Services Dept., GTS Division				
Classification:	Troubleshooting	Part information	tion	Action required	
	Mechanical	Electrical		Service manual revision	
	Paper path	Transmit/rec	eive	Retrofit information	
	Other ()				

Firmware history for the Kir-C1 Printer Option.

General

B4055280	Version	C.SUM	Production
А	1.00	5E8C	1st Mass Prod.
В	1.02	43B1	May Prod. '01
С	1.04	8997	July Prod. '01
B4055285	1.00	A6C9	October Prod. '01
B4055285A	1.05	37C4	December Prod. '01
B4055285B	1.20	59D3	April Prod. '02

Chinese/Taiwanese

B4055286	Version	C.SUM	Production
No suffix	1.00	D370	1st Mass Prod.

B4055287	Version	C.SUM	Production
No suffix	3.00	B97A	1st Mass Prod.

	Symptom Corrected	General	CHN/TWN	Russian
1.	Rotate collation is enabled when using Kir-C1b or Kir-	B4055285B	-	_
	C1c.			
2.	Corrects the print when using AS400.			
3.	Supports the Euro symbol.			

Technical Bulletin

Reissued: 4-Jul-02

Date: 12-Jul-01

No.: RB040009e

RTB Correction

Model: Kir-C

Subject: ROM H	story (Kir-C1 Printer Option)		Prepared	by: M. Mano
From: Technical	Services sec. Service Planning	g Dept.		
Classification:	Troubleshooting Mechanical Paper path	Part informat		 Action required Service manual revision Retrofit information
	Other ()			

Firmware history for the Kir-C1 Printer Option.

General

B4055280	Version	C.SUM	Production
А	1.00	5E8C	1st Mass Prod.
В	1.02	43B1	May Prod. '01
С	1.04	8997	July Prod. '01
B4055285	1.00	A6C9	October Prod. '01
B4055285A	1.05	37C4	December Prod. '01
B4055285B	1.20	59D3	April Prod. '02

Chinese/Taiwanese

B4055286	Version	C.SUM	Production
No suffix	1.00	D370	1st Mass Prod.
А	1.10	F633	July Prod. '02

B4055287	Version	C.SUM	Production
No suffix	3.00	B97A	1st Mass Prod.

Symptom Corrected	General	CHN/TWN	Russian
When printing out with PCL6, some characters in the Chinese font Fzshuti/yaoti appear rough (smudged).	-	B4055286A	-
Chinese font Fzshull/yaoli appear fough (shuuyeu).			

Technical Bulletin

Reissued: 19-Jul-02

Date: 12-Jul-01

No.: RB040009f

RTB Correction

Model: Kir-C

The items in bold italics have been corrected or added.

Subject: ROM H	story (Kir-C1 Printer Option)		Prepared	by: M. Mano
From: Technical	Services sec. Service Planning	g Dept.		
Classification:	Troubleshooting Mechanical Paper path	Part informat		 Action required Service manual revision Retrofit information
	Other ()			

Firmware history for the Kir-C1 Printer Option.

General

B4055280	Version	C.SUM	Production
Α	1.00	5E8C	1st Mass Prod.
В	1.02	43B1	May Prod. '01
С	1.04	8997	July Prod. '01
B4055285	1.00	A6C9	October Prod. '01
B4055285A	1.05	37C4	December Prod. '01
B4055285B	1.20	59D3	April Prod. '02
B4055285C	1.30	A488	August Prod. '02

Chinese/Taiwanese

B4055286	Version	C.SUM	Production
No suffix	1.00	D370	1st Mass Prod.
А	1.10	F633	July Prod. '02

B4055287	Version	C.SUM	Production
No suffix	3.00	B97A	1st Mass Prod.

Symptom Corrected	General	CHN/TWN	Russian
Panel settings reset to the defaults when the main switch is turned Off/On.	B4055285C	-	-

Technical Bulletin

Reissued: 13-Feb-03

Date: 12-Jul-01

No.: RB040009g

RTB Correction

Model: Kir-C

The items in bold italics have been corrected or added.	
Subject: ROM History (Kir-C1 Printer Option)	Prepared by: M. Mano

Services Sec. Service Planning	j Dept.	
Troubleshooting	Part information	Action required
Mechanical	Electrical	Service manual revision
Paper path	Transmit/receive	Retrofit information
Other ()		
	Troubleshooting Mechanical Paper path	Mechanical Electrical Paper path Transmit/receive

We hereby inform you of the firmware history for the Kir-C1 Printer Option.

(General)

B4055280	Version	C.SUM	Production
А	1.00	5E8C	1st Mass Prod.
В	1.02	43B1	May Prod. '01
С	1.04	8997	July Prod. '01
B4055285	1.00	A6C9	October Prod. '01
B4055285A	1.05	37C4	December Prod. '01
B4055285B	1.20	59D3	April Prod. '02
B4055285C	1.30	A488	August Prod. '02
B4055285D	1.40	FE53	March Prod. '03

(Chinese/Taiwanese)

B4055286	Version	C.SUM	Production
No suffix	1.00	D370	1st Mass Prod.
A	1.10	F633	July Prod. '02

(Russian)

B4055287	Version	C.SUM	Production
No suffix	3.00	B97A	1st Mass Prod.

RIGOR Reissued: 13-Feb-03

PAGE: 2/2

Model: Kir-C

Date: 12-Jul-01

No.: RB040009g

Symptom Corrected	General	CHN/TWN	Russian
PCL5e Font Download cannot be performed.	B4055280B	_	
While the copier is in standby mode with the printer on-line,	В		
the printer is taken off-line after entering and then exiting		_	-
Printer Settings using the User Tools Key.			
After a decimal number is entered in [Font Pitch] from [Printer	С		
Features]-[Job Control]-[PCL Menu], the digits to the right of	_	_	-
the decimal point may be displayed differently on the LCD.			
When printing out w/a cover page from a Mac client, text	С		
characters appear larger if the resolution has been set to		_	-
300dpi in [Printer Features]-[Job Control]-[Print Quality].			
When both the frame border and Rotate are enabled, the	С	_	_
frame border does not appear.			
Start of mass production for China and Taiwan models.	_	B4055286	_
1. Start of mass production for duplex model.	B4055285	_	_
2. Rotate Collation mode is enabled under the following			
conditions:			
a. The optional memory is installed.			
 b. Auto Tray Select is selected from the printer driver. 			
c. The same size (A4, Letter, or B5) is loaded in the paper			
trays in the opposite orientation (LEF/SEF).			
3. Tray Lock can now be used for multiple trays.			
4. Sub Paper Size mode (A4/LT overwrite) has been added			
to UP mode.			
5. The bypass tray now supports both LEF and SEF feed.			
6. Spelling errors in the Czech display language have been			
corrected (e.g. Configuration Page, Menu List, etc.).	B4055285A		
1. The face side is not printed completely when no paper	B4055265A	-	-
feed jam occurs in the duplex print mode.			
 The printer controller hangs up when the PS job is operated without installing PS option. 			
Start of mass production for Russia model.			B4055287
1. Rotate collation is enabled when using Kir-C1b or Kir-C1c.	– B4055285B		
 Corrects the print when using AS400. 	210002002	-	-
3. Supports the Euro symbol.			
When printing out with a PCL6, some characters in the		B4055286A	
Chinese font Fzshuti/yaoti appear rough (smudged).	_		_
Panel settings reset to default when the main switch is turned	B4055285C		
Off/On.		_	—
1. Cannot print from the Sercom print server.	B4055285D	-	-
2. ListPrint doesn't count as "others" in the User Code			
column of User Management Tools (SmartNetMonitor			
for Admin).			
3. "Processing" is not displayed if ListPrint is			
performed in the User Tools while there are print jobs			
stacked in the Windows spooler.			
4. A memory overflow may occur when deleting a print			
job from the Windows spooler.			
	1	1	

Technical Bulletin

Reissued: 26-Apr-04

Date: 12-Jul-01

No.: RB040009h

RTB Correction

Model: Kir-C

The items in bold italics have been corrected or added.	

Subject: ROM History (Kir-C1 Printer Option)			Prepared by: M. Ishihara		
From: Technical Services Sec. Service Planning Dept.					
Classification:	Troubleshooting Hechanical Paper path Other ()	Part informat		 Action required Service manual revision Retrofit information 	

We hereby inform you of the firmware history for the Kir-C1 Printer Option.

(General)

B4055280	Version	C.SUM	Production	
A	1.00	5E8C	1st Mass Prod.	
В	1.02	43B1	May Prod. '01	
С	1.04	8997	July Prod. '01	
B4055285	1.00	A6C9	October Prod. '01	
B4055285A	1.05	37C4	December Prod. '01	
B4055285B	1.20	59D3	April Prod. '02	
B4055285C	1.30	A488	August Prod. '02	
B4055285D	1.40	FE53	March Prod. '03	
B4055285D	1.43	4E3A	For service use only	

(Chinese/Taiwanese)

B4055286	Version	C.SUM	Production
No suffix	1.00	D370	1st Mass Prod.
A	1.10	F633	July Prod. '02

(Russian)

B4055287	Version	C.SUM	Production
No suffix	3.00	B97A	1st Mass Prod.

Reissued: 26-Apr-04

Model: Kir-C

Date: 12-Jul-01

No.: RB040009h

	Symptom Corrected	General	CHN/TWN	Russian
PC	_5e Font Download cannot be performed.	B4055280B		
	ile the copier is in standby mode with the printer on-line,	В		
	printer is taken off-line after entering and then exiting			_
	iter Settings using the User Tools Key.			
	er a decimal number is entered in [Font Pitch] from [Printer	С		
	tures]-[Job Control]-[PCL Menu], the digits to the right of		—	—
	decimal point may be displayed differently on the LCD.			
	en printing out w/a cover page from a Mac client, text	С		
	racters appear larger if the resolution has been set to		_	_
	dpi in [Printer Features]-[Job Control]-[Print Quality].			
	en both the frame border and Rotate are enabled, the	С		
	ne border does not appear.		_	_
	rt of mass production for China and Taiwan models.		B4055286	
1.	Start of mass production for duplex model.	B4055285		
2.	Rotate Collation mode is enabled under the following		—	—
	conditions:			
	a. The optional memory is installed.			
	b. Auto Tray Select is selected from the printer driver.			
	c. The same size (A4, Letter, or B5) is loaded in the paper			
	trays in the opposite orientation (LEF/SEF).			
3.	Tray Lock can now be used for multiple trays.			
4.	Sub Paper Size mode (A4/LT overwrite) has been added			
	to UP mode.			
5.	The bypass tray now supports both LEF and SEF feed.			
6.	Spelling errors in the Czech display language have been			
	corrected (e.g. Configuration Page, Menu List, etc.).			
1.	The face side is not printed completely when no paper	B4055285A	_	_
	feed jam occurs in the duplex print mode.			
2.	The printer controller hangs up when the PS job is			
	operated without installing PS option.			
	rt of mass production for Russia model.	_		B4055287
1.	Rotate collation is enabled when using Kir-C1b or Kir-C1c.	B4055285B	_	_
2.	Corrects the print when using AS400.			
3.	Supports the Euro symbol.			
	en printing out with a PCL6, some characters in the	_	B4055286A	_
	nese font Fzshuti/yaoti appear rough (smudged).			
	el settings reset to default when the main switch is turned	B4055285C	_	_
Off/	On.			
1.	Cannot print from the Sercom print server.	B4055285D	-	-
2.	ListPrint doesn't count as "others" in the User Code			
	column of User Management Tools (SmartNetMonitor for			
	Admin).			
3.	"Processing" is not displayed if ListPrint is performed in			
	User Tools while there are print jobs stacked in the			
1.	Windows spooler.			
4.	A memory overflow may occur when deleting a print job			
L	from the Windows spooler.			



Technical Bulletin

Reissued: 26-Apr-04

Model: Kir-C		Date: 12-Jul-01		No.: RE	No.: RB040009h	
	Symptom Corrected		General	CHN/TWN	Russian	
1. 2.	SC692 may occur when printing from the SHE p server. Some PCL text is not printed out correctly on th second page.		B4055285D (Ver1.43)	-	-	