Technical Bulletin

PAGE: 1/1

Model: PB3030 (PR-C1 2-paper tray unit)			Dat	:e: 20-Sep	-07	No.: RD331001				
Subject: Friction	Subject: Friction pad					Prepared by: M. Ishihara				
From: 1st Tech. S										
Classification:	 Troubleshooting Mechanical Paper path Product Safety 	Part info Electric Transm	al		Servic	n required ce manual revision fit information				

Symptom


Dog ears may occur when the paper is fed from the optional 2-tray paper unit. **Note:** This only occurs on some of the Affected Units listed below.

Cause

Part of the friction pad peels off the pad bracket.

Action

Do the following when you install the optional 2-tray paper unit on the Parisian-C1: Press the friction pad firmly with your thumb, and while doing so, slide your thumb across the length of the pad. Do this three or four times.

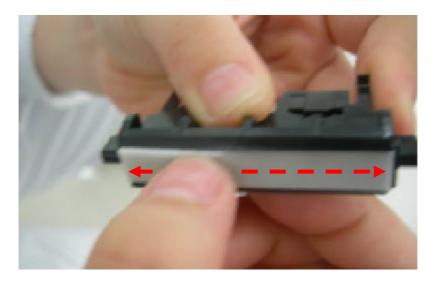

Affected Units

This symptom may	This symptom may occur on the following units:									
Code (Destination)	Machine serial Numbers (units)	Production Month/Year								
D331-01 (Generic)	M3970600001 - 00582 (582)	June/2007								
	M3970700001 – 00417 (417)	July/2007								
	M3970800001 - 00033 (33)	August/2007								
D331-02 (infotec)	9J10670001 - 0060 (60)	June/2007								
	9J10770001 – 0040 (40)	July/2007								
D331-21 (China,Ric	c) M3970600583 – 00652 (70)	June/2007								
	M3970700418 - 00457 (40)	July/2007								


Technical Bulletin

PAGE: 1/1

Model: PB3030	(PR-C1 2-paper tray unit)	ay unit) D			-09	No.: RD331002		
Subject: Spacer:	Supporter: Right			Prepared by: M. Ishihara				
From: 1st Tech. 8	Support Sec. Service Support I	Dept.						
Classification:	Troubleshooting	🛛 Part informat		tion	Action	n required		
	Mechanical	Electric	al		Servic	ce manual revision		
	Paper path	Transmit/rec		ceive 🗌 Retro		fit information		
	Product Safety	Other ()				

Old P/N	New P/N	Description	Q'ty	Int	Page	Index	Note
-	D3311092	Spacer: Supporter: Right	0-1	-	3	35	New

Change/Reason: This part was missing in the parts catalog of the Paper Feed Unit PB3030 (D331).

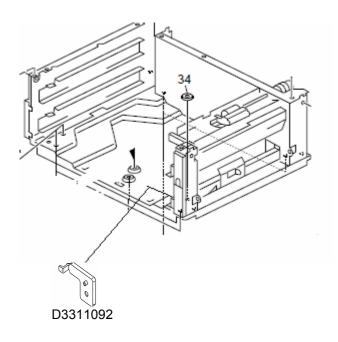

Technical Bulletin

PAGE: 1/1


Model: PB3030 (PR-C1 2-paper tray unit) Date			te: 29-Jun-09		No.: RD331003				
Subject: Tension	Subject: Tension Spring: Paper Feed: 2				Prepared by: M. Ishihara				
From: 1st Tech. 8	Support Sec. Service Support	Dept.							
Classification:	☐ Troubleshooting	🛛 Part informati		tion	Action	n required			
	Mechanical	Electric	al	Servic		ce manual revision			
	Paper path	Transmit/rec		it/receive 🗌 🛙		fit information			
	Product Safety	Other ()					

Old P/N	New P/N	Description	Q'ty	Int	Page	Index	Note
-	D3312774	Tension Spring: Paper	1	-	9	2	New
		Feed: 2					

Change: The spring was added as a service part.

Reason: To minimize non-feed paper jams that can occur when feeding "Yes Color 100g" paper.

4.Electrical Section 1 (D331)

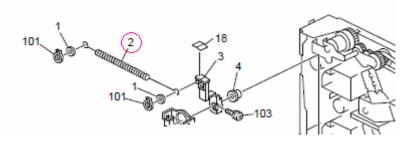


Technical Bulletin

PAGE: 1/1

Model: PB3030 (PR-C1 2-paper tray unit) Dat			e: 29-Jun-()9	No.: RD331004		
Subject: Guide: F	Paper Tray			Prepared by: M. Ishihara			
From: 1st Tech. S	Support Sec. Service Support [Dept.					
Classification:	Troubleshooting	🛛 Part informat		tion	Action	n required	
	Mechanical	Electric	al		Servic	ce manual revision	
	Paper path	Transmit/rec		t/receive		fit information	
	Product Safety	Other ()			

Old P/N	New P/N	Description	Q'ty	Int	Page	Index	Note
-	D3311059	Guide: Paper Tray	0-1	-	3	36	New

Change: A guide was added to the area shown below. **Reason:** To minimize the sound that occurs when the paper tray is pulled out or pushed in.

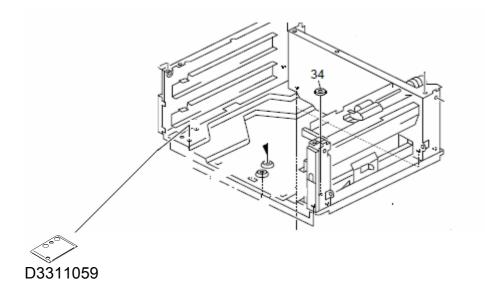

Technical Bulletin


PAGE: 1/1

Model: PB3030	Model: PB3030 (PR-C1 2-paper tray unit) Date			e: 16-Jul-(09	No.: RD331005		
Subject: Caster				Prepared by: M. Ishihara				
From: 1st Tech. 8	Support Sec. Service Support I	Dept.						
Classification:	Troubleshooting	Part info	ormat	ation 🗌 Act		n required		
	Mechanical	Electric	al		Servic	ce manual revision		
	Paper path	Transmit/rec		mit/receive		fit information		
	Product Safety	Other ()				

Old P/N	New P/N	Description	Q'ty	Int	Page	Index	Note
AH012037	D3511121	Caster	4-4	X/X	3	16	
B8001103	A5071096	Philips Screw – M5x6	8-8	X/X	3	17	

Change: The thickness of the caster holder has been made thicker than the old one. **Reason:** Vendor change

Note: Those parts are interchangeable as a set.

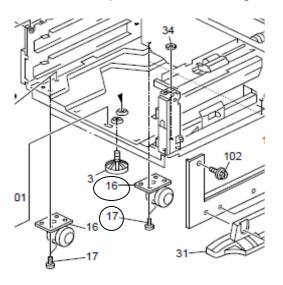


Technical Bulletin

PAGE: 1/1

Model: PB3030 (Model: PB3030 (PR-C1 2-paper tray unit) D			e: 02-Mar	-10	No.: RD331006	
Subject: Paper T	ray: Lower Position: BALI-D: A	Ass'y		Prepared by: M. Ishihara			
From: 2nd Overseas Tech Support Sec., 2nd PQM Dept.							
Classification:	Troubleshooting	Part inf	ormation		Action	n required	
	🗌 Mechanical	Electric	al		Service manual revision		
	Paper path	Transmit/rec		Transmit/receive		fit information	
	Product Safety	Other ()			

Old P/N	New P/N	Description	Q'ty	Int	Page	Index	Note
-	D3312531	Paper Tray: Lower Position: BALI-D: Ass'y	0-1	-	5	*	
-	D4252532	Paper Tray: GUAM-C: Ass'y	0-1	-	5	*	

Change / **Reason:** These assembly parts are now available as service parts. **Note:** D3312531 is for the lower tray and D4252532 is for the upper one.

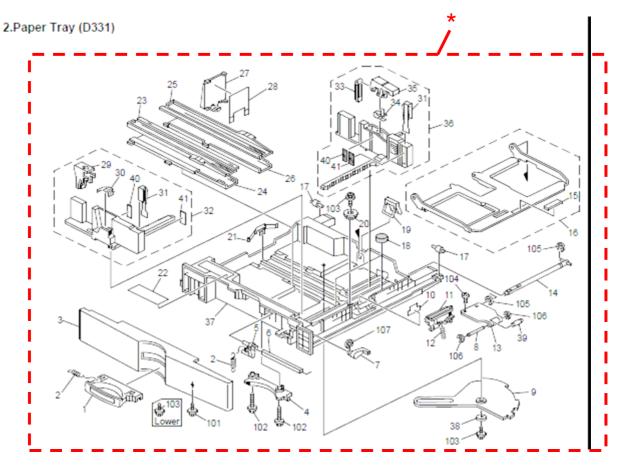

Technical Bulletin


PAGE: 1/1

Model: PB3030 (PR-C1 Paper Feed Unit) Date					-10	No.: RD331007			
Subject: Spacer: Adhesion					Prepared by: M. Ishihara				
From: 2nd Overseas Tech Support Sec., 2nd PQM Dept.									
Classification:	assification: Troubleshooting X Part in			tion Action required					
	Mechanical	Electric	al		Servic	ce manual revision			
	Paper path Transmi			eive	eive Retrofit information				
□ Product Safety □ Other			_)					

Old P/N	New P/N	Description	Q'ty	Int	Page	Index	Note
A8602559		Cushion Guide Plate	2-0	-	7	4	
-	D4252558	Spacer: Adhesion	0-1	-	7	25	New index

Change: 2 cushions were assembled and became the spacer (D4252558) as shown in the figure below. The spacer is affixed on the upper tray only. **Reason:** To unify the part with other models.

New Index: 25 #D4252558 (Spacer: Adhesion)

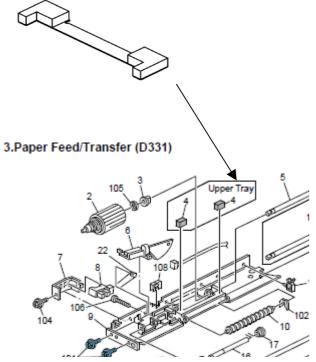

Technical Bulletin

PAGE: 1/1


Model: PR-C1 Paper Feed Unit(PB3030) Date					-10	No.: RD331008		
Subject: Parts Catalog Correction (push switch)					Prepared by: M.Saiki			
From: 2nd Overseas Tech Support Sec., 2nd PQM Dept.								
Classification:	ssification: Troubleshooting X Part in			tion Action require		n required		
	🗌 Mechanical	Electrical			Service manual revision			
	Paper path Transmit			eive	Retrof	fit information		
	Product Safety Other ()	Tier 2			

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	G0205626	PUSH SWITCH			11	33	

Change: An index for the illustration is added.

Reason: The part information was not available.

See the following diagram for the part location.

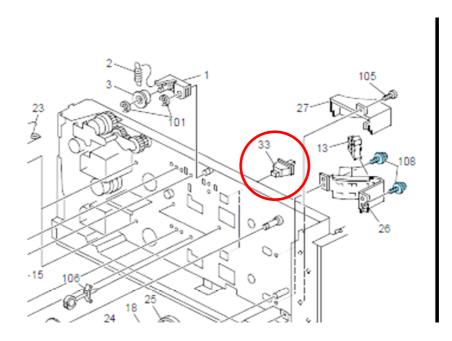

Technical Bulletin

PAGE: 1/1

Model: PR-C1 Paper Feed Unit(PB3030) Date					-10	No.: RD331009		
Subject: Guide: Paper Size Sensor: Side Fence					Prepared by: M. Ishihara			
From: 2nd Overseas Tech Support Sec., 2nd PQM Dept.								
Classification:	Troubleshooting Zert i					Action required		
	Mechanical Electrical		vice manual revision					
	Paper path Transmit			eive	fit information			
	Product Safety Other ()	Tier 2			

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
-	D3312796	Guide: Paper Size Sensor: Side	0-2	-	7, 11	26, 34	New
		Fence					Index

Change: A Mylar with double-sided tape was added to the photo-interrupter.

Reason: To attach the photo-interrupter to the sensor bracket more tightly.

Note: The Mylar is attached to the photo-interrupter (P/N AW020173, index #14 on pages 7 and 11).

Technical Bulletin

PAGE: 1/1

Model: PR-0	Model: PR-C1 Paper Feed Unit(PB3030)Date: 0						-Dec-1	1	No.:	RD3310	10
Subject: Par Cover	Cover							by: M	.Saiki		
From: 2nd Tech Service Sect., MFP/P Tech Service Dept.											
Classification: Troubleshooting Part inform Mechanical Electrical Paper path Transmit/ro Product Safety Other (al nit/rec			Ser	ofit infor	nual revis	ion
Old part number		ew part umber	De	escription			Q'ty	Int	Page	Index	Note
AW020141	AW	/020198	PHOTOINTER	PHOTOINTERRUPTOR:LG2A14			2-2	X/X	11	13	#
D3312752 D3312753 COVER:SENSOR:PA SENSOR		OR:PAPER S	IZE		3-3	X/X	11	27	#		

X/O as a set

Change/Reason: The paper size sensor has been redesigned due to a vendor change, and the sensor cover also has been modified to support the new sensor shape.