
Technical Bulletin

Model: SR3020 Date			e: 21-Oct-	09	No.: RB804001	
Subject: Parts catalog correction				Prepare	d by: M.	Kumagai
From: 1st Tech. Support Sec. Service Support Dept.						
Classification:	Troubleshooting	□ Part info	orma	ition Action requi		n required
		☐ Electric	al		Service	ce manual revision
	☐ Paper path	☐ Transmit/red		eive	☐ Retrofit information	
	☐ Product Safety	\square Other ()	☐ Tier 2	

Change/Reason: The illustration on pg. 24 was corrected as follows (the dashed line for index #13 was separated into two sections).

Pg. 24

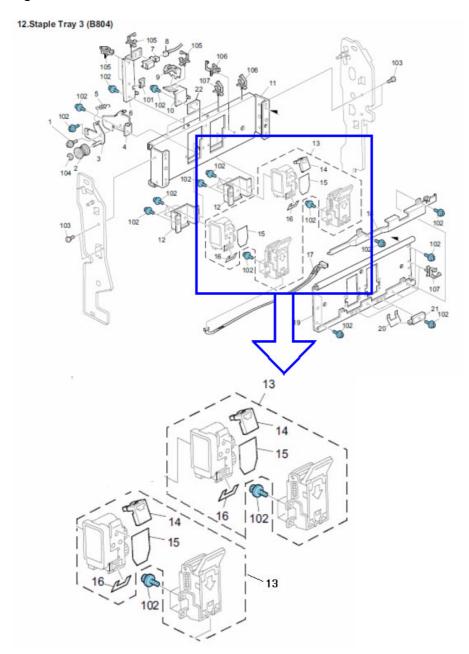

Technical Bulletin

PAGE: 1/2

Model: AP-C1 Finisher SR3020/3030 Dat			e: 31-Mar	-10	No.: RB804002	
Subject: Parts information				Prepared by: M. Kumagai		
From: 1st Overseas Tech Support Sec., 1st PQM Dept.						
Classification:	☐ Troubleshooting	⊠ Part info	orma	tion Action		required
	☐ Mechanical	☐ Electric	al		Service	e manual revision
	☐ Paper path ☐ Transmit/red		eive	☐ Retrof	fit information	
	☐ Product Safety	Other ()	☐ Tier 2	

11. Staple Tray 2 (B804/B805)

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
B7004180	D3734180	Stapler Tray	1-1	X/X	23	17	X/O as
B7004167	D3734167	Stay: Lower: Positioning	1-1	X/X	29 (B804)	7	a set
		Sensor			25 (B805)		
-	04543006Q	Tapping Screw - M3x6	7-8	-	23	101	


Change: A tapping screw was added for attaching the stapler tray to the lower stay

positioning sensor, and screw holes were added as shown below.

Reason: To further improve structural reliability.

Stapler Tray (Pg.23 Index#17)

11.Staple Tray 2 (B804)

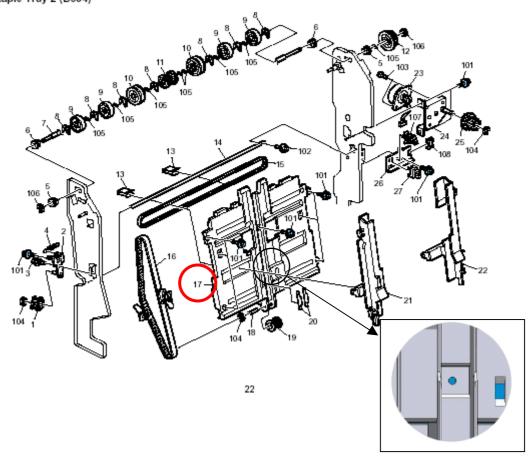



PAGE: 2/2

Model: AP-C1 Finisher SR3020/3030 Date: 31-Mar-10 No.: RB804002

Stay: Lower: Positioning Sensor (Pg.29(B804) Index#7)

14.Staple Tray 5 (B804)

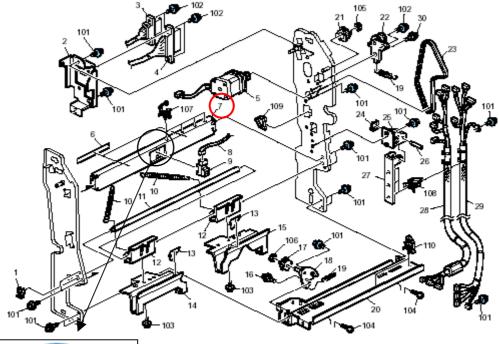

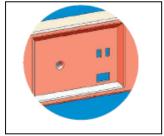

28

Technical Bulletin

PAGE: 1/1

Model: AP-C1 Finisher SR3020/SR3030 Date			e: 25-May	-10	No.: RB804003		
Subject: Parts information					Prepared by: M. Kumagai		
From: 1st Overseas Tech Support Sec., 1st PQM Dept.							
Classification:	Troubleshooting	□ Part info	orma	tion	Action required		
		☐ Electric	al		☐ Service	ce manual revision	
	☐ Paper path ☐ Transmit/red		it/rec	eive	☐ Retrof	fit information	
	☐ Product Safety	Other ()	☐ Tier 2		


Change: A spacer was added to the shaft of the stapler bracket.

Reason: To improve the reliability of staple positioning.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B7004320	D3734320	BRACKET:STAPLER:SLI DE:ASS'Y	1	X/O	31	16	
	08077092	SPACER - 10.5/16	1		31	114*	

*New Index

15.Staple Tray 6 (B804)

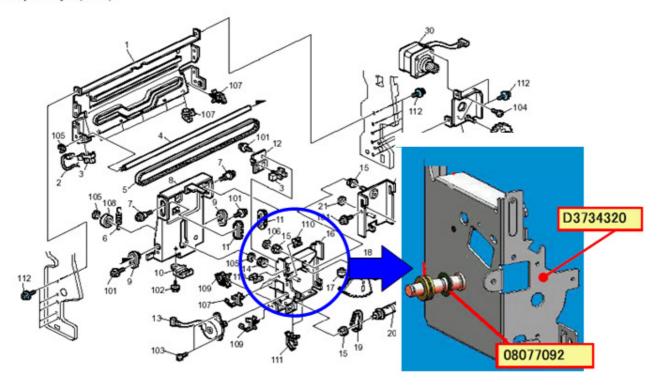

Technical Bulletin

PAGE: 1/1

Model: AP-C1 Fi	AP-C1 Finisher SR3020/SR3030 Dat			te: 22-Sept-10		No.: RB804004
Subject: Parts catalog correction			Prepared	d by: M.K	(umagai	
From: 1st Overseas Tech Support Sec., 1st PQM Dept.						
Classification:	Troubleshooting	□ Part info	ormat	tion	Action	required
	☐ Mechanical	☐ Electric	al		Service	e manual revision
	☐ Paper path ☐ Transmit/red		it/rec	eive	Retrof	fit information
	☐ Product Safety	\square Other ()	☐ Tier 2	

Change/Reason: The following parts were changed to apply to the new Model AT/AP-C2.5

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
		GUIDE PLATE:PAPER EXIT SUB-		X/O			Set A
B7003705	B8043705	UNIT:PAPER CRIMP	1	As a Set	49	16	
		HARNESS:CONNECTING:PAPER					
B7005407	B8045457	EXIT SUB-UNIT	1		49	17	
B8045310	B8045410	HARNESS:STEPPER MOTOR	1	X/O	47	4	Set B
				As a Set	39	3	
					43	17	
B4685991	B4685991	HARNESS BRACKET	4 -> 3		45	10	
		BRACKET:DCSOL:GATE					
B7002515	B8042515	PAWL:STAPLE	1		41	1	
B7003500	B8043510	STAY:UNIFORM:ASS'Y	1	X/O	15	27	Set C
		HARNESS:SURFACE OF PAPER		As a Set			
B7005304	B8045404	SENSOR	1		15	31	

Technical Bulletin


PAGE: 1/6

Model: General			Dat	Date: 11-Jan-11		No.: RGene042
Subject: RoHS Compliance Issue (Stapler)				Prepared by: T. Nihei		
From: 1st Overseas Tech Support Sec., 1st PQM Dept.						
Classification:	Troubleshooting	☐ Part info	ormat	tion		required
	☐ Mechanical	☐ Electric	al		☐ Service	e manual revision
	☐ Paper path	☐ Transm	it/rec	eive	☐ Retrof	it information
	☐ Product Safety	\square Other ()	☐ Tier 2	

NOTE: This bulletin is for NA, EU, and China regions only.

SYMPTOM

Some parts of the stapler unit (black resin parts shown below) contained PBDE material in excess of the limits set by the RoHS Directive.

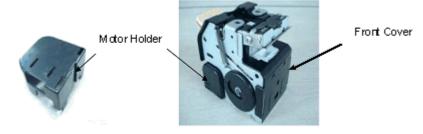

CAUSE

The vendor of these parts used irregular materials during the manufacturing process. Production period: June to September 2010 (refer to the S/N table below)

SOLUTION

Production line

The vendor of these parts will ensure that only approved materials are used on their production lines.

Applied from:

EU / NA / AP

	S/N
SR790(B40850)	J1008104158~
SR3000(B79317)	L4408100558~
SR3050(D37217)	M7808103426 \sim
SR3020(B80457)	L9508100626~
SR3030(B80557)	L9608101420~
SR4010(D37417)	M8508103010 \sim
SR4020(D37317)	M8408100550 \sim
SR4030(D37457)	M8508102853 \sim

Technical Bulletin

PAGE: 2/6

Model: General	Date: 11-Jan-11	No.: RGene042
----------------	-----------------	---------------

SR4040(D37357)	M8408100365 \sim
SR3010(B79257)	TBA
C2550(D42917)	TBA

China

	S/N
SR790(B40821)	J1008207477~
SR3000(B79317N)	L4408280001~
SR3050(D37217N)	M7808280001~
SR3020(B80457N)	L9508180015∼
SR3030(B80557N)	L9608380001~
SR970(B70121)	K6208300001~
SR4030(D37461)	M8408100563~
SR4040(D37361)	M8508104280~

In the field (Action to be taken)

Replace the stapler unit.

-Affected finishers-

The serial numbers of the affected finishers are listed at the end of this RTB.

Important: Stapler units on some of these affected finishers have already been replaced with the normal ones. If there is a **red dot** on the stapler unit's label (see the photo below), you **do not need to replace** these units.





PAGE: 3/6

Model: General Date: 11-Jan-11 No.: RGene042

-Replacement parts-

New stapler units have been made available for replacement.


Replace the affected stapler units with the following part numbers for the intended models

Finisher	Stapler unit P/N
SR790	B408 9910
SR3000	B793 9901
SR3050	D372 9901
SR3020*(see note2)	B805 9901
SR3030	
SR4020*(see note2)	
SR4030	
SR4040*(see note2)	
SR3010	B792 9901
Internal Finisher Type C2550	D429 9910

Note:

- 1. These parts contain staplers and Mylars but not cartridges.
- 2. Stapler units for corner stapling on the affected finishers with the parts that were registered specifically for this issue (also listed below). So, this issue does not apply to booklet stapler units (B7007852), so you do not need to replace these.

The affected stapler unit is shown in the illustration below (Index #24):

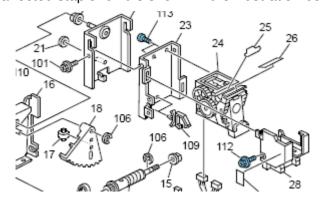

Replacement procedure

Please refer to each product's Service Manual.



PAGE: 4/6

Model: General Date: 11-Jan-11 No.: RGene042

Service parts

Part numbers will not change, RoHS compliance parts were shipped from Sep.24, 2010 production, from lot number 240910.

Note: "24": day, "09": month, "10": year.

Affected finishers and supported MFPs

	Produ	RICOH	Nashuatec	Gestetner	SAVIN	LANIER
	ct Code		Rex-Rotary			
	Oode					
SR790	D084	Aficio MP 2851	MP 2851	MP 2851	9228	MP 2851 LD528
	D085	Aficio MP 3351	MP3351	MP3351	9233	MP3351 LD533
	D027	Aficio MP C4000	MP C4000	MP C4000	C4040	MP C4000
	D029	Aficio MP C5000	MP C5000	MP C5000	C5050	LD540c
						MO C5000 LD550c
	D023	Aficio MP C2800	MP C2800	MP C2800	C2828	MP C2800
	D025	Aficio MP C3300	MP C3300	MP C3300	C3333	LD528c
						MP C3300 LD533c
SR3050	D084	Aficio MP 2851	MP 2851	MP 2851	9228	MP 2851 LD528
	D085	Aficio MP 3351	MP3351	MP3351	9233	MP3351 LD533
	D023	Aficio MP C2800	MP C2800	MP C2800	C2828	MP C2800
	D025	Aficio MP C3300	MP C3300	MP C3300	C3333	LD528c
						MP C3300 LD533c
SR3000	D084	Aficio MP 2851	MP 2851	MP 2851	9228	MP 2851 LD528
	D085	Aficio MP 3351	MP3351	MP3351	9233	MP3351 LD533
	D023	Aficio MP C2800	MP C2800	MP C2800	C2828	MP C2800
	D025	Aficio MP C3300	MP C3300	MP C3300	C3333	LD528c
						MP C3300 LD533c
	D027	Aficio MP C4000	MP C4000	MP C4000	C4040	MP C4000
	D029	Aficio MP C5000	MP C5000	MP C5000	C5050	LD540c
						MO C5000 LD550c
SR3020	D027	Aficio MP C4000	MP C4000	MP C4000	C4040	MP C4000
SR3030	D029	Aficio MP C5000	MP C5000	MP C5000	C5050	LD540c
						MO C5000 LD550c
	G188	Aficio SP C820DN	SP C820DN	SP C820 DN	CLP340D	SP C820DN
	G189	Aficio SP C821DN	SP C821DN	C8140nD	CLP350D	LP540c
				DP C821DN C8150nD		SP C821DN LP550c
	D091	Aficio MP 4001	MP 4001	MP 4001	9240	MP 4001 LD140
	D092	Aficio MP 5001	MP 5001	MP 5001	9250	MP 5001 LD150

PAGE: 5/6

Model:	General			Date: 1	1-Jan-11	No.: RGene042
	G179	Aficio SP 8200DN	SP 8200DN	SP 8200DN	MLP150DN	LP150dn SP 8200DN
SR4010 SR4020	D014 D015 D078 D079	Aficio MP C6000 Aficio MP C7500 Pro C550EX Pro C700EX	MP C6000 MP C7500	MP C6000 MP C7500 Pro C550EX Pro C700EX	C6055 C7570 Pro C550EX Pro C700EX	MP C6000 LD260c MP C7500 LD275c Pro C550EX Pro C700EX
SR4030 SR4040	D062 D063 D065 D066	Aficio MP 6001 Aficio MP 7001 Aficio MP 8001 Aficio MP 9001	MP 6001 MP 7001 MP 8001 MP 9001	MP 6001 MP 7001 MP 8001 MP 9001	9060 9070 9080 9090	MP 6001 LD360 MP 7001 LD370 MP 8001 LD380 MP 9001 LD390
	D081 D082	Aficio MP C6501SP Aficio MP C7501SP	MP C6501SP MP C7501SP	MP C6501SP MP C7501SP	C9065 C9075	MP C7501SP LD365C MP C7501SP LD375C
SR3010	D010 D043	Aficio MP 2500 Aficio MP 2580 Aficio MP 2500LN	MP 2500	MP 2500 DSm625 MP2580	7025	MP2500 LD125
C2550	D037 D038	Aficio MP C2030 Aficio MP C2050	MP C2030 MP C2050	MP C2030 MP C2050	C9020L C9020	MP C2030 LD520cl MP C2050 LD520c

S/N of affected finishers

The following are the finishers affected by this issue.

EU

	From		То
SR790(B40850)	J1007805822	~	J1008104157
SR3000(B79317)	L4407800852	~	L4408100553
SR3050(D37217)	M7807802655	~	M7808103425
SR3020(B80457)	L9507801005	~	L9508100625
SR3030(B80557)	L9607801524	~	L9608101419
SR4020(D37317)	M8408000001	~	M8408000010
SR4030(D37457)	M8507802256	~	M8508102852
SR4040(D37357)	M8407900028	~	M8408100364
SR3010(B79257)	L4309000001	~	L4309200385
C2550(D42917)	V2908900643	~	V2909300382



PAGE: 6/6

Model: General Date: 11-Jan-11 No.: RGene042

NA

	From		То
SR790(B40850)	J1007805700	~	J1008102757
SR3000(B79317)	L4407800851	~	L4408100557
SR3050(D37217)	M7807802578	~	M7808102405
SR3020(B80457)	L9507801000	~	L9508100452
SR3030(B80557)	L9607801298	~	L9608101121
SR4010(D37417)	M8507904285	~	M8508003009
SR4020(D37317)	M8407800559	~	M8408100549
SR4030(D37457)	M8507802257	~	M8508102765
SR4040(D37357)	M8407800482	~	M8408100304
SR3010(B79257)	L4309000001	~	L4309200385
C2550(D42917)	V2908900643	~	V2909300382

China (MIF only)

	From		То
SR790(B40821)	J1007807229	~	J1008106806
SR3000(B79317N)	L4407880001	~	L4408080011
SR3050(D37217N)	M7807880001	~	M7808180003
SR3020(B80457N)	L9507880001	~	L9508180014
SR3030(B80557N)	L9608180001	~	L9608180004
SR970(B70121)	K6207800001		
SR4030(D37461)	M8507802874	2	M8508104279
SR4040(D37361)	M8407800565	~	M8408100562

☐ Product Safety

Technical Bulletin

Model: AP-C1 Finisher SR3020/SR3030 Dat			ite: 21-Feb-11	No.: RB804005		
Subject: Parts catalog correction				Prepared by: M.Kumagai		
From: 1st Overseas Tech Support Sec., 1st PQM Dept.						
Classification:	Troubleshooting	□ Part inform □ P	mat	tion	required	
	☐ Mechanical	☐ Electrical		☐ Service	e manual revision	
	☐ Paper path	☐ Transmit/	rece	eive	t information	

☐ Tier 2


)

PAGE: 1/1

Change/Reason: A new decal was added to improve product safety

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
		DECAL:CAUTION:PROOF					
	B8047813	TRAY:PAPER EXIT SUB-UNIT	1				

Other (

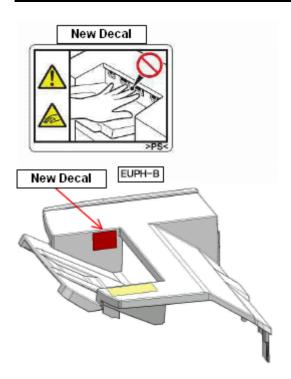

Technical Bulletin

PAGE: 1/1

Model: SR3020 Da			Dat	te: 15-Jun-11		No.: RB804006
Subject: Parts catalog correction			Prepared	d by: н. т	Гатакі	
From: 1st Overseas Tech Support Sec., 1st PQM Dept.						
Classification:	Troubleshooting	□ Part info	orma	tion	Action	required
	☐ Mechanical	☐ Electrication	al		Service	ce manual revision
	☐ Paper path	☐ Transmit/rec		eive	☐ Retrof	fit information
	☐ Product Safety	Other ()	☐ Tier 2	

Change/Reason: The following parts were shown incorrectly.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B7005340	B7005430	HARNESS - STAPLE	1		47	6	
B7005430	B7005340	HARNESS - STAPLER TRAY UNIT	1		47	12	

Technical Bulletin

PAGE: 1/2

Model: SR3020/SR3030			Dat	Date: 11-Nov-11		No.: RB804007		
Subject: CPU and firmware Change Notification				Prepared	d by: T.H	irakawa		
From: 1st Tech Service Sect., MFP/P Tech Service Dept.								
Classification:	☐ Troubleshooting	□ Part info	☐ Part information☐ Electrical		Action required			
	☐ Mechanical	☐ Electric			☐ Service manual revisi			
	☐ Paper path	☐ Transmit/rec		☐ Transmit/receive		eive	☐ Retrofit information	
	☐ Product Safety	Other ()				

Important Information About Finisher PCB Replacement

Background

Due to the March 11 earthquake and tsunami disaster in the Tohoku region of Japan, many production facilities in the area suffered extensive damage. This has caused an interruption in the supply of electrical parts for PCBs used on Ricoh products. To continue machine production, a different type of CPU had to be used on PCBs, beginning from July production.

Service parts changes

- 1) As a result, a modified version of the Finisher firmware is preloaded on boards that use the new CPU. This change is shown in the first line in the table below.

 Note:
 - There is **no difference** in machine function or performance. This is why the interchangeability of boards with the old and new CPUs is O/O.
 - However, the compatibility of the old/new PCB and old/new firmware is as follows:

		Firmware	
		Old:	New:
PCB	Old:	Supported	NOT supported (see Important Notes below)
	New:	NOT supported (see Important Notes below)	Supported

2) The board containing the old CPU (and old firmware) is still available to order, under a new part number. This is shown in the second line in the table below.

Note: This is because some machines in the field still require the old firmware version (e.g. customized machines, locally tested/approved machines).

Old Part Number	New Part Number	Description	I/C
B8045516	B8045100	PCB:MAIN CONTROL:ASS'Y	O/O
-	B8045517	PCB:MAIN CONTROL:ASS'Y	

Cut-in S/N:

B80457: L9518000571~ B80557: L9618000664~



PAGE: 2/2

Model: SR3020/SR3030 Date: 11-Nov-11 No.: RB804007

Important Notes

Make sure to keep the following in mind:

- Do not install the old firmware (v. 01.100:27 and older) on the new Finisher board. This is because the old firmware cannot be used on the new board, and the new firmware (v. v.90.020:02; The new version starts with a "9") cannot be used on the old board. If you install the old firmware on the new engine board by mistake, the new engine board will become unusable, and you will have to replace it. For this reason, the new firmware will not be released to the field.
- The release note for the old firmware (v. 01.100:27) will be revised to include the above note (#1). Firmware older than v. 01.100:27 will be eliminated from the firmware release DB.
- If you replace the Finisher board on a machine that still requires the old firmware version, as mentioned above, please order the board using P/N B8045517.