

Reissued: 06-Jan-17
Model: Finisher_SR4110
Date: 20-May-13
No.: RD707001g
RTB Reissue

The items in ***bold italics*** have been corrected or added.

Subject: Firmware Release Note: Finisher_SR4110		Prepared by: K.Hamada	
From: 1st Tech Service Sect., MFP/Printer Tech Service Dept			
Classification:	<input type="checkbox"/> Troubleshooting <input type="checkbox"/> Mechanical <input type="checkbox"/> Paper path <input type="checkbox"/> Product Safety	<input type="checkbox"/> Part information <input type="checkbox"/> Electrical <input type="checkbox"/> Transmit/receive <input checked="" type="checkbox"/> Other (Firmware)	<input type="checkbox"/> Action required <input type="checkbox"/> Service manual revision <input type="checkbox"/> Retrofit information <input checked="" type="checkbox"/> Tier 2

This RTB has been issued to announce the firmware release information for the **Finisher_SR4110**.

Version	Program No.	Effective Date	Availability of RFU
<i>01.240:05</i>	<i>D7075300J</i>	<i>January 2017 production</i>	<i>Not available</i>
01.230:04	D7075300H	October 2016 production	Not available
01.210:04	D7075300G	August 2016 production	Not available
01.140:04	D7075300F	December 2015 production	Not available
01.120:04	D7075300E	May 2014 production	Not available
01.110:04	D7075300D	November 2013 production	Not available
01.080:04	D7075300C	July 2013 production	Not available
01.050:03	D7075300B	1st Mass production	Not available

Note: Definition of Availability of RFU via @Remote
"Available" The firmware can be updated via RFU or SD card.

"Not available": The firmware can only be updated via SD card.

Version	Modified Points or Symptom Corrected
<i>01.240:05</i>	<i>Support of the following system configuration: Mainframe, SR4110 and PBM350/500.</i>
01.230:04	Support of the following system configuration: Mainframe, SR4110 and StreamPunch Ultra MP
01.210:04	<ul style="list-style-type: none"> - Sheets are not stapled in duplex booklet jobs that contain solid images. - The LED does not light even if the tray up/down switch is pressed.
01.140:04	Specification Change: <ul style="list-style-type: none"> - Supported the Mexican legal paper (Oficio). Error Correction: <ul style="list-style-type: none"> - Machine stalls, if the paper is left inside the staple tray when the machine power is turned ON and then the paper is removed from the tray before the finisher completes the initialization process. - The finisher attempts to staple even if the staple cartridge is empty, when the following condition is met: <ul style="list-style-type: none"> * A staple job is run after recovering from the energy saver mode and then the system enters the energy saver mode again, and this flow is repeated for more than 20 times.

Reissued: 06-Jan-17

Model: Finisher_SR4110		Date: 20-May-13	No.: RD707001g
Version	Modified Points or Symptom Corrected		
01.120:04	Symptom Corrected: Only one sheet (A4/B5/LT LEF) is stapled when the original is scanned from the exposure glass.		
01.110:04	Symptom Corrected: Inaccurate jogging performance of the shift tray is poor when using a paper whose length is longer than 459mm like SRA3 paper.		
01.080:04	Symptom Corrected: Paper jam occurs when plockmatic is installed.		
01.050:03	1st Mass production		