

Reissued: 13-Apr-17

Model: MT-C5/MT-C6 Finisher SR4080	Date: 17-May -12	No.: RD610001c
------------------------------------	------------------	----------------

RTB Reissue

The items in bold italics have been corrected or added.

Subject: Firmware Release Note: MT-C5/MT-C6 Finisher SR4080		Prepared by: K. Moriizumi	
From: 1st Tech Service Sect., MFP/Printer Tech Service Dept			
Classification:	<input type="checkbox"/> Troubleshooting <input type="checkbox"/> Mechanical <input type="checkbox"/> Paper path <input type="checkbox"/> Product Safety	<input type="checkbox"/> Part information <input type="checkbox"/> Electrical <input type="checkbox"/> Transmit/receive <input checked="" type="checkbox"/> Other (Firmware)	<input type="checkbox"/> Action required <input type="checkbox"/> Service manual revision <input type="checkbox"/> Retrofit information <input checked="" type="checkbox"/> Tier 2

This RTB has been issued to announce the firmware release information for the **MT-C5/MT-C6 Finisher SR4080**.

Version	Program No.	Effective Date	Availability of RFU
02.520:04	D6105300F	May 2017 production	Not Available
02.510:04	D6105300E	May 2016 production	Not Available
02.030 :04	D6105300D	December 2015 production	Not Available
01.040:02	D6105300C	1st Mass production	Not Available

Note: Definition of Availability of RFU via @Remote
"Available" The firmware can be updated via RFU or SD card.

"Not available": The firmware can only be updated via SD card.

Version	Modified Points or Symptom Corrected
02.520:04	Symptom corrected: - The following jams occur, because the entrance sensor of the Finisher false detects paper even when there is no paper: J201 for MP 6503/7503/9003, J151 for MP 6002/7502/9002
02.510:04	Symptom corrected: - Error is not alerted even if the staple cartridge is empty, if a staple job is requested while the machine is in energy saver mode. Other changes: - New "Stream Punch Unit" supported.
02.030:04	Other changes: MP 6503SP/7503SP/9003SP has been supported.
01.040:02	1st Mass production

Model: SR4080		Date: 2-May-17	No.: RD610002
Subject: Jam201 / 151		Prepared by: K. Yamamoto	
From: 1st Overseas Tech Support Sec., 1st PQM Dept.			
Classification:	<input checked="" type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input type="checkbox"/> Other ()	<input checked="" type="checkbox"/> Tier 2

SYMPTOM

The following jams occur:

Jam 201 (MP 6503/7503/9003)

Jam 151 (MP 6002/7502/9002)

CAUSE

A bug with the SR4080 firmware ver. 2.51:04 causes the finisher's entrance sensor to falsely detect paper when there is none.

SOLUTION

Update the SR4080 firmware to a newer version.