8		11	_
		, ,	

PAGE: 1/1

Model: Model Sh-P1 PFU option Da			Da	te: 24-Feb-12		No.: RM386001		
Subject: Part catalog correction					Prepared by: T.Hirai			
From: 3rd Tech Service Sect., MFP/P Tech Service Dept.								
Classification:	Troubleshooting	□ Part info	rma	tion	☐ Action	required		
	☐ Mechanical	☐ Electrical			☐ Service	e manual revision		
	☐ Paper path	☐ Transmit/rece		☐ Transmit/receiv		eive	☐ Retrofi	t information
	☐ Product Safety	Other ()	☐ Tier 2			

Change/Reason: The following part number and index number was changed.

Incorrect part number	Correct part number	Description	Q'ty	Page	Index	Note
G0523103	M0522830	Paper Feed Roller: Ass'y	1	7	17	-

Technical Bulletin

PAGE: 1/2

Model: Model Sh-P1 (PFU)			Date: 08-May-1	12	No.: RM386002
Subject: Check	Prepai	red by: T.Hirai			
(Tray side fenc					
From: 3rd Tech S					
Classification:	Troubleshooting	☐ Part info	rmation	Action	required
	☐ Mechanical	☐ Electrica	al [] Service	e manual revision
	☐ Paper path	Transmi	t/receive	Retrofi	it information
	☐ Product Safety	Other () [Tier 2	

Symptom

- 1. Side fences are detached
- 2. Paper end sensor is detached.

Cause

- During transportation.
 Removed side fences when removing orange tapes at installation.
- 2. Orange tape pushed and detached the paper end sensor.

Action

1. Please confirm whether side fences are detached or not at installation. Even if fences were not detached, be careful to remove the orange tape. Please refer to the procedure as follows.

Procedure

1) Hold the side fence and remove the orange tapes one by one.



2)Please confirm that the side fences are moving smoothly.





Date: 08-May-12 No.: RM386002

PAGE: 2/2


Model: Model Sh-P1 (PFU)

2. Please confirm whether the paper end sensor is detached or not. If the paper end sensor is detached, please reattach the paper end sensor as follows.

Confirmation procedure

Confirm whether you can see the paper end sensor or not.

Correct position of sensor (can see) Incorrect position of sensor (cannot see)

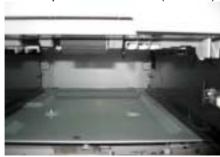



Reattaching procedure

If the paper end sensor is in an incorrect position (cannot see), please reattach as follows.


1. Remove the upper cover of the PFU. 2. Remove 1 screw.






3. Set the paper end sensor in the correct position.

Correct

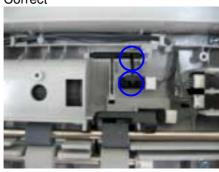



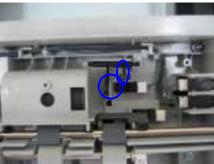

For mass production

We have changed as follows so as not to produce these problems.

- -Deleted the orange tape on side fences.
- -Set the side fences wider as A4 size.

Technical **B**ulletin

PAGE: 1/1

Model: SH-P1 PFU Option Dat			:e: 21-Jan-	13	No.: RM386003	
Subject: Parts Catalog Correction (Friction Pad)			Prepared	d by: T. N	lihei	
From: 3rd Tech S	Service Sect., MFP/P Tech Ser	vice Dept.				
Classification:	Troubleshooting	⊠ Part info	ormat	tion	Action	required
		☐ Electric	cal [☐ Service	ce manual revision
	☐ Paper path	☐ Transmit/rec		eive	☐ Retrof	fit information
ļ	☐ Product Safety	Other ()	☐ Tier 2	

Please apply the following change to your Parts Catalogs.

Incorrect	Correct	Description	Q'ty	Int	Page	Index	Note
part number	part number						
M0522610	G0963066	Friction Pad Adhesion			5	7	

Technical Bulletin

PAGE: 1/2

Reissued: 21-Nov-13

Model: Sh-P1 PFU Option	Date: 15-Mar-13	No.: RM386004a

RTB Reissue

The items in **bold/italics** were added or revised.


Subject: Breakage of Stoppers for Tray Extension				ed by: T. Nihei
From: 3rd Tech Service Sect., MFP/P Tech Service Dept.				
Classification:		☐ Part information	n	Action required
	☐ Mechanical	☐ Electrical		☐ Service manual revision
	☐ Paper path	☐ Transmit/recei	ve	☐ Retrofit information
	☐ Product Safety	☐ Other ()		⊠ Tier 2

SYMPTOM

A paper feed jam or non-feed occurs when feeding the paper from a mainframe paper tray.

CAUSE

The stopper breaks and the tray extension extends out too far, causing the end fence to retract.

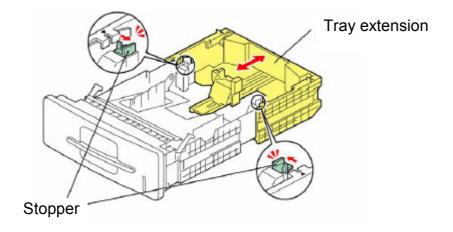

SOLUTION

Production line:

The shape of the stopper was changed, and four screw holes were added so that the extension tray can be fixed in place for LT/A4 and LG paper sizes.

Part number	Description	Q'ty	Int	Page	Index	Note
04523008N	TAPPING SCREW - M3X8	4	-	ı	-	

In the field:

- If the user always uses the same paper size, fasten the extension tray in place with screws.
- For all other users, fix the extension in place for LG sized paper.

Technical Bulletin

PAGE: 2/2

Reissued: 21-Nov-13

Model: Sh-P1 PFU Option	Date: 15-Mar-13	No.: RM386004a
-------------------------	-----------------	----------------


Important: If there is no available screw hole in the user's tray, replace the tray with the following new part (which contains the required screw holes).

Note: This new part can also be used on the HC model.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
M3752550	M3752555	PAPER TRAY:ASS'Y	1-1	X/O	5	*	

Important notes:

- The new screw holes are for LT/A4 and LG paper sizes. If the user always uses the same paper size, fix the extension tray in place at the corresponding position. If the user does not always use the same paper size, fix the extension in place for LG sized paper.
- Insert the screws from the outside face of the tray. For each paper size, there are two screw holes, as shown.
- Be careful not to over-tighten the screws.

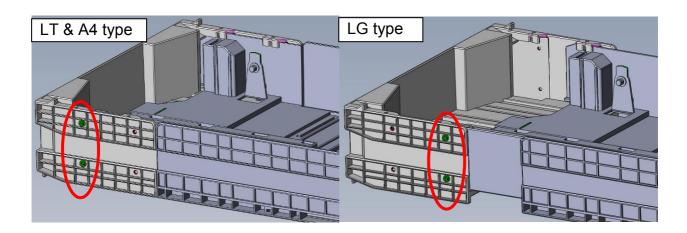

Cut-in S/N

The modification described above was applied to the production line from the following production serial numbers:

M386-17	T0322100001~
M389-17	T1222100001~

☐ Product Safety

☐ Paper path

Technical Bulletin

Model: Sh-P1 PFU Option			Date	e: 19-Apr-13	No.: RM386005
Subject: Parts C	atalog Correction (P/N for Pape		Prepared by: T.	Nihei	
From: 3rd Tech S	Service Sect., MFP/P Tech Ser	vice Dept.			
Classification:	Troubleshooting	□ Part infor	mati	ion	on required
	☐ Mechanical	☐ Electrical	l	☐ Serv	ice manual revision

☐ Tier 2

☐ Retrofit information


PAGE: 1/1

Part Number	Description	Q'ty	Int	Page	Index	Note
M3752550	PAPER TRAY:ASS'Y	1	-	5	*	

Other (

☐ Transmit/receive

Change/ Reason: This part number was missing from the parts catalog.

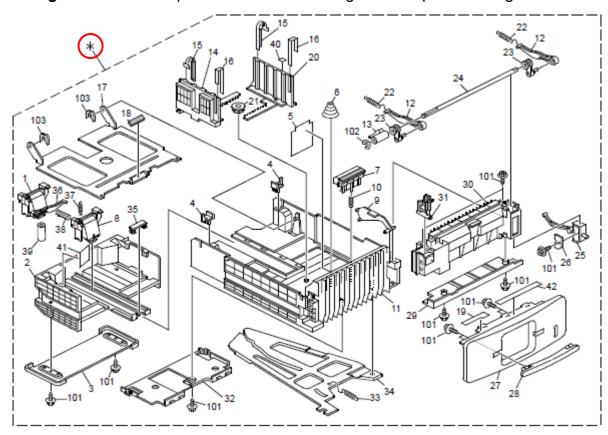



PAGE: 1/2

Reissued:06-Mar-14

Model: Sh-P1 PFU Option	Date: 29-Oct-13	No.: RM386006b
-------------------------	-----------------	----------------

RTB Reissue

The items in **bold italics** have been corrected.

Subject: End Fence Spacer				Prepared by: T. Nihei		
From: 3rd Tech S	ervice Sect., MFP/P Tech Sei	rvice Dept.				
Classification:		☐ Part informa	tion	Action required		
	☐ Mechanical	Electrical		☐ Service manual revision		
	☐ Paper path	☐ Transmit/rec	eive	☐ Retrofit information		
	☐ Product Safety	Other ()	☐ Tier 2		

NOTE: The SOLUTION in this RTB is effective for reducing paper feed jams and non-feed jams.

SYMPTOM

A paper feed jam or non-feed occurs when feeding the paper from optional paper trays.

CAUSE

End fence is not set correctly.

SOLUTION

Production line

- **A.** A spacer was added behind the end fence.
- **B.** An instructional leaflet for users was inserted in the paper tray.
- **C.** The end fence is fixed in the LT position before shipment from the factory. (The side fences are fixed in the A4 position.)
- D. A spacer with reinforced double-sided tape was added (P/N: M0212570).

In the field

Attach the following parts (P/N: M0212570) behind the end fence, as shown, <u>using double-sided tape.</u>




PAGE: 2/2


Reissued:06-Mar-14

Model: Sh-P1 PFU Option Date: 29-Oct-13 No.: RM386006b

A4/Legal

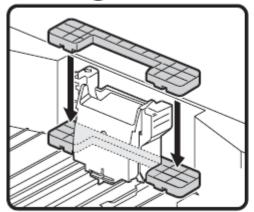

Letter

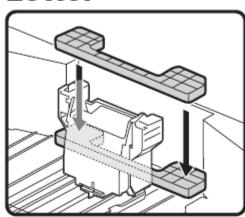

Cut-in Serial Numbers

The cut-in serial numbers for each modification are as follows.

A: Spacer added

B: Instructional leaflet for users added

C. End fence fixed in LT position

D. Spacer with reinforced double-sided tape added

	Α	B + C	D
M386-17	T0331900001 ~	T0332000781 ~	TBA
M389-17	T1231900001 ~	T1232000001 ~	TBA

Technical Bulletin

Date: 17-Dec-13	No.: RM386007
Prepared by: T. I	Nihei

PAGE: 1/1


Model: Sh-P1 Pl	-U Option	Da	ite: 17-Dec	-13	No.: RM386007
Subject: Parts C	atalog Correction (End Fence	Prepared by: T. Nihei			
From: 3rd Tech S	Service Sect., MFP/P Tech Ser	vice Dept.			
Classification:	Troubleshooting	□ Part informa	tion Action required		required
	☐ Mechanical	☐ Electrical		☐ Service	e manual revision
	☐ Paper path	☐ Transmit/re	ceive	☐ Retrof	fit information
	☐ Product Safety	Other ()	☐ Tier 2	

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	M0212564	END FENCE:SPACER	0-1	-	5	43	

Change: A spacer was added.

Reason: To make sure that the operator sets the end fence in the correct position.

2.Paper Feed Unit 2 (M386/M389)

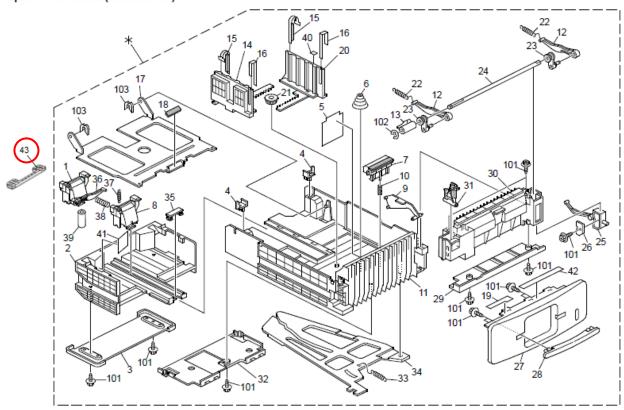

Technical Bulletin


P	ΑG	E	: 1	/-
				,

Model: Sh-P Option bank Date			ate: 18-Dec-14		No.: RM386008	
Subject: Parts Catalog Correction				Prepared by: T.Hirai		
From: 3rd Tech S	Service Sect., MFP/P Tech Ser	vice Dept.				
Classification:	☐ Troubleshooting ☐ Mechanical ☐ Paper path ☐ Product Safety	☐ Part informat☐ Electrical☐ Transmit/rec☐ Other (Service	n required be manual revision fit information

Change/Reason: The following part number and index number were changed.

Old part	New part	Description	Q'ty	Int	Page	Index
number	number					
M0212659	M0522670	TRAY BOTTOM PLATE	1	_	5	17

2.Paper Feed Unit 2 (M386/M389)

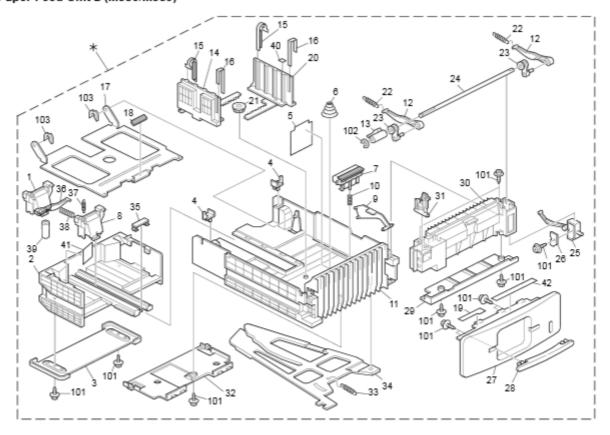

Technical Bulletin

PAGE: 1/1

Model: Sh-P1 PFU option Date			te: 14-May	<i>י</i> -15	No.: RM386009	
Subject: Parts Callever	atalog Correction for Decal for p	paper thickn	ess	Prepared	by: T. Ta	achibana
From: 1st Tech S	Service Sect., MFP/P Tech Serv	/ice Dept.				
Classification:	☐ Troubleshooting ☐ Mechanical ☐ Paper path ☐ Product Safety	Part info Electrica Transmir	al		Service	required e manual revision it information

Change: The decal for the paper thickness lever was deleted.

Reason: This lever has been set to 'Thick mode' to prevent non-feed jams from occurring.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
M3752695	-	DECAL:PAPER TRAY:LEVER	1-0	X/O	5	19	

K	П

PAGE: 1/1


Model: Sh-P1 PFU Date					15	No.: RM386010
Subject: Parts Ca Unit)	atalog Correction (Housing for F		Prepared	d by: T. T	achibana	
From: 1st Tech S						
Classification:	Mechanical	⊠ Part info ☐ Electrica ☐ Transm ☐ Other (al		Servic	required e manual revision it information

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
Hamber	M3752556	HOUSING:PAPER FEED UNIT:UPPER	1	-	7	24	Add

Change: The following part was newly added as a service part.

Reason: To meet requests received from the field.

3.Paper Feed Unit 3 (M386/M389)

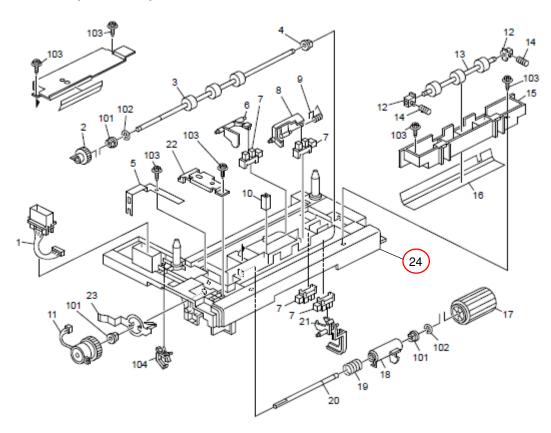


Technical Bulletin

RICOH	l ech	nnical B ulle	PAGE: 1/1	
Model: Sh-P1 PFU Option		Da	te: 17-Dec-15	No.: RM386011
Subject: Parts C harness)	atalog Correction (Conne	ctor of Engine board	Prepared by: T.	Tachibana
From: 1st Tech S	Service Sect., MFP/P Tech	n Service Dept.		
Classification:	☐ Troubleshooting ☐ Mechanical ☐ Paper path ☐ Product Safety	☐ Part informa☐ Electrical☐ Transmit/rec☐ Other (☐ Serv	on required ice manual revision ofit information

Change/Reason: This part number was missing from the parts catalog.

Part number	Description	Q'ty	Int	Page	Index	Note
11029811	CONNECTOR:1-1612256-4	1	-	7	25	

3.Paper Feed Unit 3 (M386/M389)

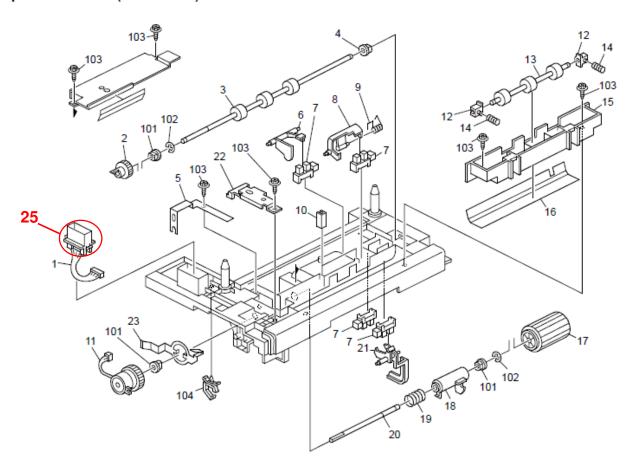

Technical Bulletin

PAGE: 1/1

Model: Sh-P1 PFU Option Date			te: 21-Aug	-18	No.: RM386012	
Subject: Parts Catalog Correction: Housing Bracket & Stay Guide				Prepared	d by: T. T	achibana
From: 1st Tech Service Sect., MFP/P Tech Service Dept.						
Classification:	☐ Troubleshooting ☐ Mechanical ☐ Paper path ☐ Product Safety	☐ Part info ☐ Electrica ☐ Transmi	al		Service	required e manual revision it information

Change: These parts are newly added.

Reason: To meet requests received from the field.

Part number	Description	Q'ty	Int	Page	Index	Note
M3752559	BRACKET:HOUSING:FEED:HELENA	1		7	26	
M3752562	GUIDE:STAY:FEED:HELENA	1		7	27	

3.Paper Feed Unit 3 (M386/M389)

