

=====
*** Basic Information ***
=====

[Create date] 2018/02/14

[Program Name] System

[Version] 1.09

[PCB No.]

[Interchangeability] X / O

[Other Firmware Requirements] None

[PCB Requirements] None

[Software category] Normal Release

[Release category] Normal Release

[Program category] Firmware

Exported to(language) GEN(all)

[Firmware No.] M0805830H

[File Information]

File Name M0805830H.fwu

File Type Module for Service

Size 13.32 MB (13971996 byte)

[File Information]

File Name M0805830H.rfu

File Type Module for Remote Upgrade

Size 13.33 MB (13979904 byte)

[Availability of RFU] Yes

[Production reflection] 2018/02

=====
*** Note ***
=====

[Note]

=====
*** Important Notes ***
=====

[Important Notes]

=====
*** Modification History ***
=====

[Modifications made:]

Rank C

Symptom corrected:

- @remote communication with Cumin may be disconnected

[Modification history]

Version 1.08

Symptom corrected:

The alert indicator lights red and the machine continues to beep even though "Ready" is displayed on the control panel.

Version 1.05

Symptom corrected:

SC688 occurs during a duplex letterhead print job.

Version 1.04

Symptom corrected:

1. The "Auto E-Mail Notification" and "On-demand E-mail Notification" menus disappear from the WIM screen under the following conditions:
 - "E-mail Notification Account" inside WIM is turned ON
 - After this, the printer main power is turned OFF/ON
2. SC899 occurs when the user selects "Startup Settings" inside WIM.
3. The heap and stack sizes for SDK applications appear at their default values on the SMC, even after these settings are changed.

Version 1.03

Symptoms corrected:

1. Toner End is mistakenly detected/displayed.
2. If a jam occurs during a duplex job, the page printed out right before the jam may be printed out again when the job resumes.
3. SC899 occurs under the following conditions, and can only be cleared by turning the power OFF/ON.
 - A very large-volume job is performed, and the machine stalls and displays "Printing..."
 - A jam and paper size error both occur with the same job
 - A tray loading error occurs, and then a feed jam occurs on the tray from which the paper is fed after that

Version 1.02

Symptom corrected:

If a supply alert unrelated to paper (e.g. related to toner, fusing unit, etc.) is triggered nine or more times while the machine main power is ON, an @Remote notification of this alert is not sent.

Version 1.01

1st Mass production