

=====
*** Basic Information ***
=====

[Create date] 2018/01/09

[Program Name] System

[Version] 2.03

[PCB No.]

[Interchangeability] X / O

[Other Firmware Requirements] None

[PCB Requirements] None

[Software category] Normal Release

[Release category] Normal Release

[Program category] Firmware

Exported to(language) GEN(all)

[Firmware No.] M0215840F

[File Information]

File Name M0215840F.fwu

File Type Module for Service

Size 13.92 MB (14599912 byte)

[File Information]

File Name M0215840F.rfu

File Type Module for Remote Upgrade

Size 13.93 MB (14606592 byte)

[Availability of RFU] Yes

[Production reflection] 2017/12

=====
*** Note ***
=====

[Note]

=====
*** Important Notes ***
=====

[Important Notes]

=====
*** Modification History ***
=====

[Modifications made:]

Rank C

Symptom corrected:

- @remote communication with Cumin may be disconnected.

[Modification history]

Version 2.02

Symptom corrected:

1. After the date/time setting is changed, the machine mistakenly detects an access attack, resulting in delayed response during authentication.
2. Administrators can login via WIM even after the account has been locked out.
3. Although the "Logout Using Card" function of Card Authentication Package v2 is turned on, the user cannot log out when he or she swipes the card.

Other changes:

A new SP mode was newly added for compliance of the Blue Angel regulations.

SP5-305-101 (Auto Off Set - Limit Set)

0: OFF

1: ON (Default)

Note. Please be sure to update the following firmware in order to apply all the change for the Blue Angel:

Printer v2.02 (M0215841B) or later

Web support v1.02 (M0215836B) or later

Version 2.01

Symptom corrected:

SC899 may occur when the user selects "StartupSetting" in Web Image Monitor.

Version 2.00

Other changes:

A protection program was added to ensure that the correct Engine firmware is selected for the correct Engine board when updating the firmware.

Note: See RTB #RM020013.

Version 1.02
1st Mass production