

Reissued: 16-Dec-14

Model: Altair-PJ1	Date: 22-Jan-13	No.: RY027001j
-------------------	-----------------	----------------

RTB Reissue

The items in bold italics have been corrected or added.

Subject: Firmware Release Note: SYSTEM:WXGA:ALT-1		Prepared by: T. Takahashi	
From: NA Support Sect, Solution Support Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input checked="" type="checkbox"/> Other (Firmware)	<input checked="" type="checkbox"/> Tier 2

This RTB has been issued to announce the firmware release information for the **SYSTEM:WXGA:ALT-1**.

- **Note:** This firmware correspond to Y027/Y029

Version	Program No.	Effective Date	Availability of RFU
10142205-1017-1019	Y0275956N	December 2014 production	Not available
10132205-1017-1019	Y0275956M	July 2014 production	Not available
10122205-1017-1019	Y0275956L	June 2014 production	Not available
10122205-1017-1018	Y0275956K	February 2014 production	Not available
10112205-1016-1017	Y0275956J	January 2014 production	Not available
10102205-1016-1017	Y0275956H	January 2014 production	Not available
10102205-1015-1016	Y0275956G	November 2013 production	Not available
10092205-1014-1015	Y0275956F	September 2013 production	Not available
10082204-1013-1014	Y0275956E	June 2013 production	Not available
10042203-1012-1012	Y0275956C	February 2013 production	Not available
10032202-1011-1010	Y0275956	Initial release	Not available

Note: Definition of Availability of RFU via @Remote

"Available": The firmware can be updated via RFU or SD card.

"Not available": The firmware can only be updated via SD card.

Version	Modified Points or Symptom Corrected
10142205-1017-1019	1) Additional Model Information: N/A 2) Specification Changes: N/A 3) Error Corrections: - Automatic startup error when HDMI is connected.
10132205-1017-1019	Changes: 1) New hardware support: None 2) Specification changes: None 3) Fixes: - The display might be abnormal when the input is changed from "video" to "Network PC". - When the device is turned on, some previously set operations

Reissued: 16-Dec-14

Model: Altair-PJ1		Date: 22-Jan-13	No.: RY027001j
Version	Modified Points or Symptom Corrected		
	might not be applied.		
10122205-1017-1019	Changes: 1) New additional hardware: none 2) Specification changes: none 3) Fixes - If the device is turned on or in an energy-saving state for a long time, some operations might not be applied.		
10122205-1017-1018	1) Additional Model Information N/A 2) Specification Change N/A 3) Error Correction Improved the Interactive function.		
10112205-1016-1017	1) Additional Model Information N/A 2) Specification Change Improved picture quality when projecting over a network or from a USB drive. 3) Error Correction N/A		
10102205-1016-1017	1) Additional Model Information N/A 2) Specification Changes - Added the Quick Signage function. 3) Error Corrections - When projecting content from a USB drive, a black image is displayed for one second when Auto Demo starts. - System failure may occur when content is projected via DLNA and then switched to USB drive, and a thumbnail might appear and be inoperative. - A waiting screen appears when switching content that is being projected via DLNA.		

Reissued: 16-Dec-14

Model: Altair-PJ1		Date: 22-Jan-13	No.: RY027001j
Version	Modified Points or Symptom Corrected		
10102205-1015-1016	Error corrections: <ul style="list-style-type: none"> - A network error occurs when the input signal is changed while a slideshow with a display effect is on. - A projection might not be able to restart after ad-hoc projection starts and ends. - QuickProjection fails to search for projectors when it is connected to a specific wireless LAN network. - Wireless LAN easy setup fails when a space is included in the SSID of the wireless LAN network. - Wireless LAN access connection while in Infrastructure mode fails to connect to a network that has multiple networks using the same SSID. - An error message appears during DMR projection. 		
10092205-1014-1015	Change specifications: <ul style="list-style-type: none"> - Supports still images via DLNA. - Supports Web Image Monitor. 		
10082204-1013-1014	Symptom corrected: <ol style="list-style-type: none"> 1. Improved the touch response of the remote controller. 2. A network board error occurs, which can only be cleared by rebooting the projector (removing/reinserting the power cord). Other changes: <ol style="list-style-type: none"> 1. Added support for Crestron. 2. Added support for AMX. 3. Added support for UPnP. 4. The aspect ratio doesn't change when using UPnP. 		
10042203-1012-1012	Fixed: <p>If WPA-PSK or WPA2-PSK is set to 27 characters or more and the user changes from Infrastructure mode to Adhoc mode, then a "Please wait" dialog appears and the system might become unresponsive. When the projector is restarted, the projected image is blacked out.</p>		
10032202-1011-1010	Initial release		

Reissued: 16-Dec-14

Model: Altair-PJ1	Date: 22-May-13	No.: RY027002f
-------------------	-----------------	----------------

RTB Reissue

The items in bold italics have been corrected or added.

Subject: Firmware Release Note: MAIN:WXGA:ALT-1		Prepared by: T. Takahashi	
From: NA Support Sect, Solution Support Dept.			
Classification:	<input type="checkbox"/> Troubleshooting <input type="checkbox"/> Mechanical <input type="checkbox"/> Paper path <input type="checkbox"/> Product Safety	<input type="checkbox"/> Part information <input type="checkbox"/> Electrical <input type="checkbox"/> Transmit/receive <input checked="" type="checkbox"/> Other (Firmware)	<input type="checkbox"/> Action required <input type="checkbox"/> Service manual revision <input type="checkbox"/> Retrofit information <input checked="" type="checkbox"/> Tier 2

This RTB has been issued to announce the firmware release information for the **MAIN:WXGA:ALT-1**.

Note: This firmware correspond to Y027/Y029

Version	Program No.	Effective Date	Availability of RFU
1014220500	Y0265951P	December 2014 production	Not available
1013220500	Y0265951N	July 2014 production	Not available
1012220500	Y0265951M	February 2014 production	Not available
1011220500	Y0265951L	January 2014 production	Not available
1010220500	Y0265951K	November 2013 production	Not available
1009220500	Y0265951J	September 2013 production	Not available
1008220400	Y0265951H	June 2013 production	Not available

Note: Definition of Availability of RFU via @Remote
"Available": The firmware can be updated via RFU or SD card.

"Not available": The firmware can only be updated via SD card.

Version	Modified Points or Symptom Corrected
1014220500	1) Additional Model Information: N/A 2) Specification Changes: N/A 3) Error Corrections: - Automatic startup error when HDMI is connected.
1013220500	Changes: 1) New hardware support: None 2) Specification changes: None 3) Fixes: - The display might be abnormal when the input is changed from "video" to "Network PC". - When the device is turned on, some previously set operations might not be applied.

Reissued: 16-Dec-14

Model: Altair-PJ1		Date: 22-May-13	No.: RY027002f
Version	Modified Points or Symptom Corrected		
1012220500	1) Additional Model Information N/A 2) Specification Change N/A 3) Error Correction Improved the Interactive function.		
1011220500	1) Additional Model Information N/A 2) Specification Change Improved picture quality when projecting over a network or from a USB drive. 3) Error Correction N/A		
1010220500	Additional Model Information N/A Specification Changes N/A Error Corrections Abnormal display of DMR projection. The projector does not start up correctly after updating the firmware through @Remote when the device is powered off.		
1009220500	Additional Model Information N/A Specification Changes Adjustments made to the subcontrast. Change made to the default of the power off timer when there is no input signal. Error Corrections Unable to connect to the network when an error regarding the lamp not lighting up occurs at startup. Frequent "Please wait" messages appear while in "Interactive ready (Point blank)" mode. Input signal issue when an iPad is connected.		
1008220400	Other changes: Improved the touch response of the remote controller. Added support for Crestron. The aspect ratio doesn't change when using UPnP.		