Technical Bulletin

PAGE: 1/1

Model: ARDF (DF3060)	Date: 12-Sep-11	No.: RD578001
----------------------	-----------------	---------------

Subject: Firmwar	re Release Note: ARDF (DF30	Prepared by: T. Nihei		
From: 1st Overseas Tech Support Sec., 1st PQM Dept.				
Classification:	Troubleshooting	☐ Part informat	tion	Action required
	☐ Mechanical	☐ Electrical		☐ Service manual revision
	☐ Paper path	☐ Transmit/receive		☐ Retrofit information
	☐ Product Safety	Other (Firmv	vare)	☐ Tier 2

This RTB has been issued to announce the firmware release information for the ARDF (DF3060).

Version	Program No.	Effective Date	Availability of RFU
01.000:01	D5785300B	1st Mass production	Available

Note: Definition of Availability of RFU via @Remote

[&]quot;Available" The firmware can be updated via RFU or SD card. "Not available": The firmware can only be updated via SD card.

Version	Modified Points or Symptom Corrected
01.000:01	1st Mass production

Technical Bulletin

PAGE: 1/1

Model: ARDF (DF3060) Date				e: 17-Feb	-12	No.: RD578002		
Subject: Parts Catalog Correction (Decal)					d by: T. N	lihei		
From: 2nd Tech Service Sect., MFP/P Tech Service Dept.								
Classification:	Troubleshooting	□ Part info	Part information		Action required			
	☐ Mechanical	☐ Electric	al		☐ Service manual revis			
	☐ Paper path	☐ Transmi		eive	☐ Retrof	fit information		
	☐ Product Safety	Other ()	☐ Tier 2			

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
D5786011	D5786012	DECAL:MISFEED REMOVAL	1-1	X/X	5	1	Set
					17	4	as
D5786061	D5786062	DECAL::ORIGINAL:MANY	1-1	X/X	5	43	X/O
		LANGUAGES			17	3	

Change: The illustrations on these decals were changed.

Reason: To further increase usability.


Technical Bulletin

PAGE: 1/4

Model: ARDF (DF3060) Date				e: 29-Mar-	12	No.: RD578003		
Subject: A small bend or tear on the original				Prepared by: T. Nihei				
From: 2nd Tech Service Sect., MFP/P Tech Service Dept.								
Classification:		☐ Part info	orma	tion	Action	required		
	☐ Mechanical	☐ Electric	cal		Service	e manual revision		
	☐ Paper path	☐ Transmit/rec		ceive Re		fit information		
	☐ Product Safety	\square Other ()	⊠ Tier 2			


SYMPTOM

A small bend or tear may form on the leading edge of the original when using the ARDF.

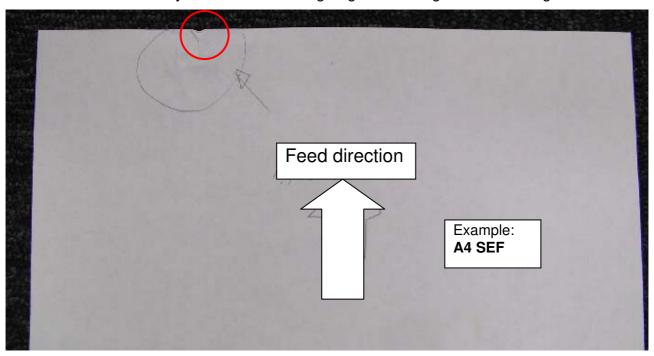

CAUSE

One of the holes in the ARDF base frame (see the photograph in Step 4 below) has a small burr, and the leading edge of the original may catch on this burr.

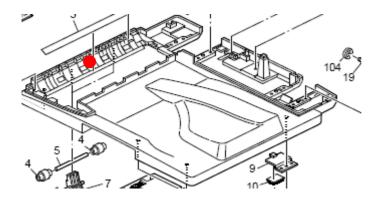

PAGE: 2/4


Model: ARDF (DF3060) Date: 29-Mar-12 No.: RD578003

SOLUTION

Remove the burr.

Procedure:


1. Open the left cover [A] and the original tray [B], and then remove the rear cover [C] (screw x1, hook x6).

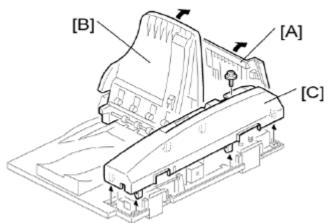

2. Remove the front cover [A] (screw x1).



3. Remove the left cover [A] (screw x2).

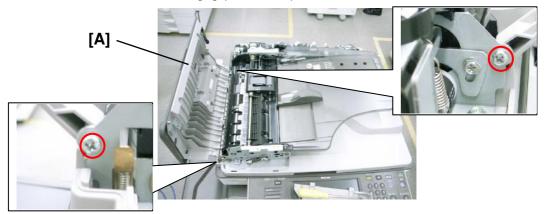



Technical Bulletin


PAGE: 3/4

Model: ARDF (DF3060) Date: 29-Mar-12 No.: RD578003

4. Remove the original turn guide plate (hook x1).



Note: After you remove the guide plate, you will see the eight holes circled in the photograph below (looking from the left side of the machine). The hole with the burr is the 4th from the right, circled in red below.

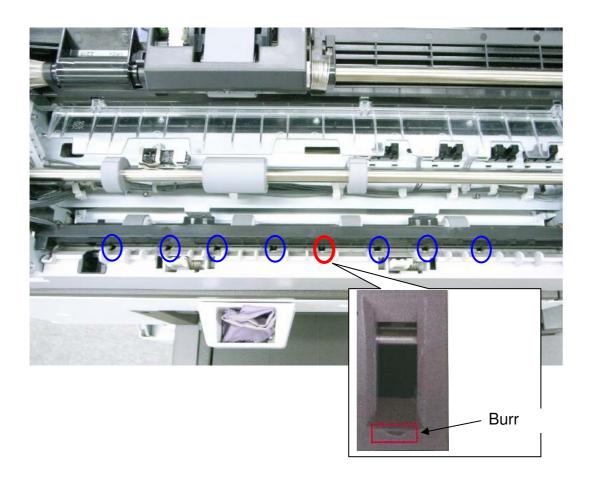



Technical Bulletin

PAGE: 4/4

Model: ARDF (DF3060) Date: 29-Mar-12 No.: RD578003

5. Insert a sheet of paper between the ARDF base frame and the entrance guide plate, as shown in the photograph below.



- 6. Remove the burr.
- 7. Reattach all the parts that you removed in the steps above.
- 8. Open the ARDF and clean the ARDF exposure glass.


Note: This is because some of the shavings from the burr may have dropped onto the exposure glass when you removed the burr in Step 6.

Model: ARDF (DF3060)				e: 21-Dec	-12	No.: RD578004		
Subject: Parts Catalog Correction for Tape for Platen Sheet				Prepared	d by: T. N	lihei		
From: 2nd Tech Service Sect., MFP/P Tech Service Dept.								
Classification:	Troubleshooting	□ Part info	ormat	tion	Action	required		
		☐ Electric	al	☐ Serv		e manual revision		
	☐ Paper path	Transm	smit/receive		☐ Retrof	fit information		
	☐ Product Safety	Other ()	☐ Tier 2			

Part number	Description		Int	Page	Index	Note
B3514322	TAPE - PLATEN SHEET	3	ı	15	10	

Change/Reason: The illustration was corrected.

- The Velcro (TAPE – PLATEN SHEET) is not included in the Pressure Plate Assembly service part (Index 8).

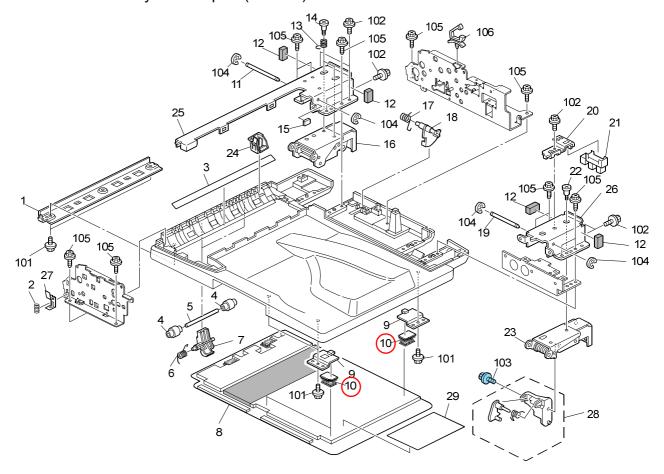

Technical Bulletin

PAGE: 1/1

Model: ARDF(DF3060) Date					15	No.: RD578005	
Subject: Parts information(ADF GRIP)					d by: A.IsI	hida	
From: 2nd Tech Service Sect., MFP/P Tech Service Dept.							
Classification:	☐ Troubleshooting☐ Mechanical☐ Paper path☐ Product Safety	Part informat Electrical Transmit/rec				required e manual revision it information	

Change: The following assembly was added.

Reason: To increase the adhesive strength between the handgrip and DF base.

Note: The handgrip can be damaged when the DF is opened/closed repeatedly.

Model	Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
LHOTSE-D	-	D5781991	GRIP:PROTECT:ASS'Y	0-1	-	3	27	

Important: Attach the grip to the base using double-sided tape.

