
This machine has labels for \triangle WARNING and \triangle CAUTION at the positions shown below. For safety, please follow the instructions and handle the machine as indicated.



When replacing the Fusing Unit, turn the main power switch off and wait at least 30 minutes before proceeding with the replacement.

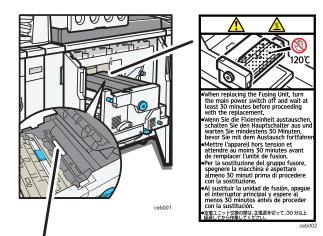

190°C

ceb003

The inside of the machine could be very hot. Do not touch the parts which a label is put on. Otherwise, an injury might occur.

