

Model: Martini-C1		Date: 17-Oct-02	No.: MB064001
Modified Article: Parts Catalog Correction		Prepared by: K. Miura	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Please correct your Parts Catalogs as follows:


Page 19

Description change:

Part number	Old description	New description	Index	Note
B0651406	Operation Panel Ass'y - LT	Operation Panel Ass'y - A4 (EU)	1	
B0651404	Operation Panel Ass'y - A4	Operation Panel Ass'y - LT	1	
B0651416	Operation Panel Ass'y - A4 (CHN9	Operation Panel Ass'y - A4 (CHN)	1	

Page 64

Illustration change:

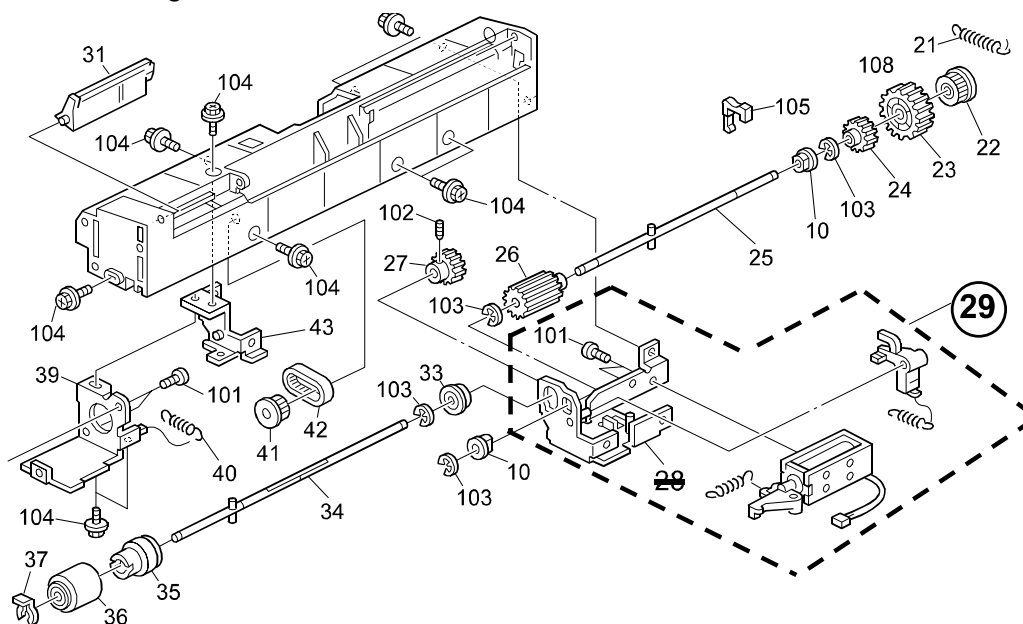

Page 65

Deletion:

Part number	Description	Index	Note
B0656328	Reverse Bracket	28	

Model: Martini-C1	Date: 17-Oct-02	No.: MB064001
-------------------	-----------------	---------------


Page 125

Part number change:

Old part number	New part number	Description	Index	Note
04513006B	03603006B	Screw - M3X6	109	


Part number addition, index change (only in 3 places circled below):

Part number	Description	Old index	New index	Note
03603008B	Screw - M3X8	101	113	

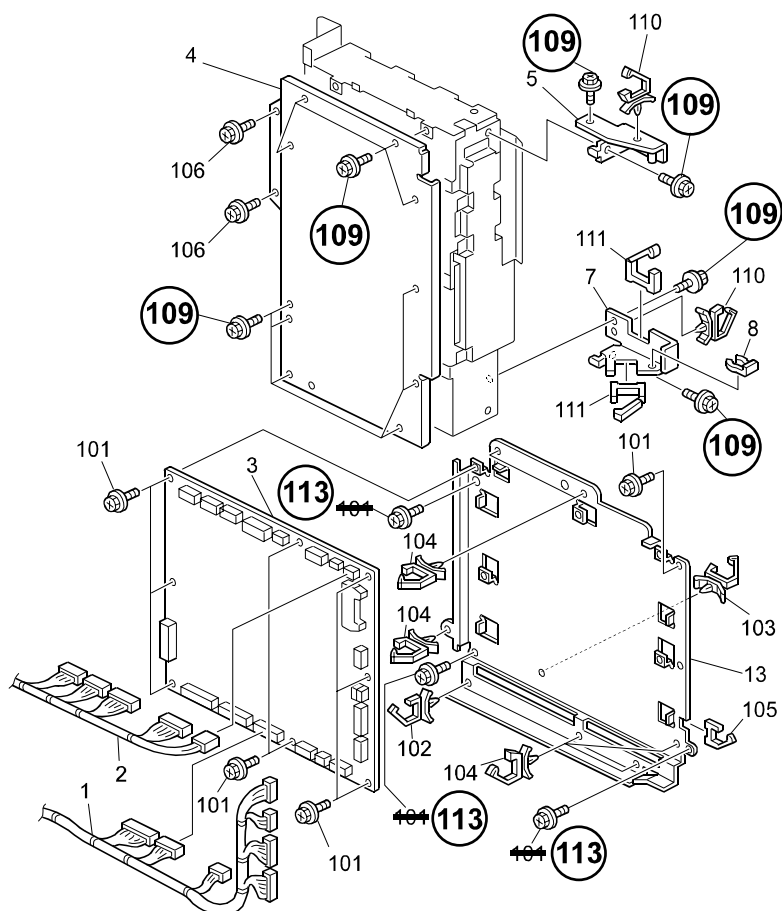

Page 126


Illustration change:

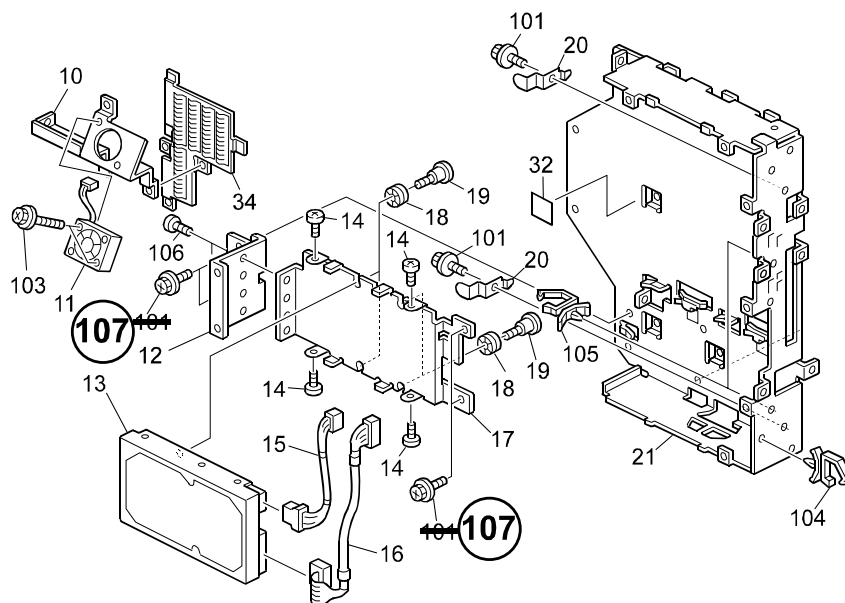

Model: Martini-C1		Date: 29-Oct-02	No.: MB064002
Modified Article: ADF Unit		Prepared by: K. Miura	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Please add the following part to your Parts Catalog:

New part number	Description	Q'ty	Page	Index	Note
B0657001	ADF Unit	1	21	12	

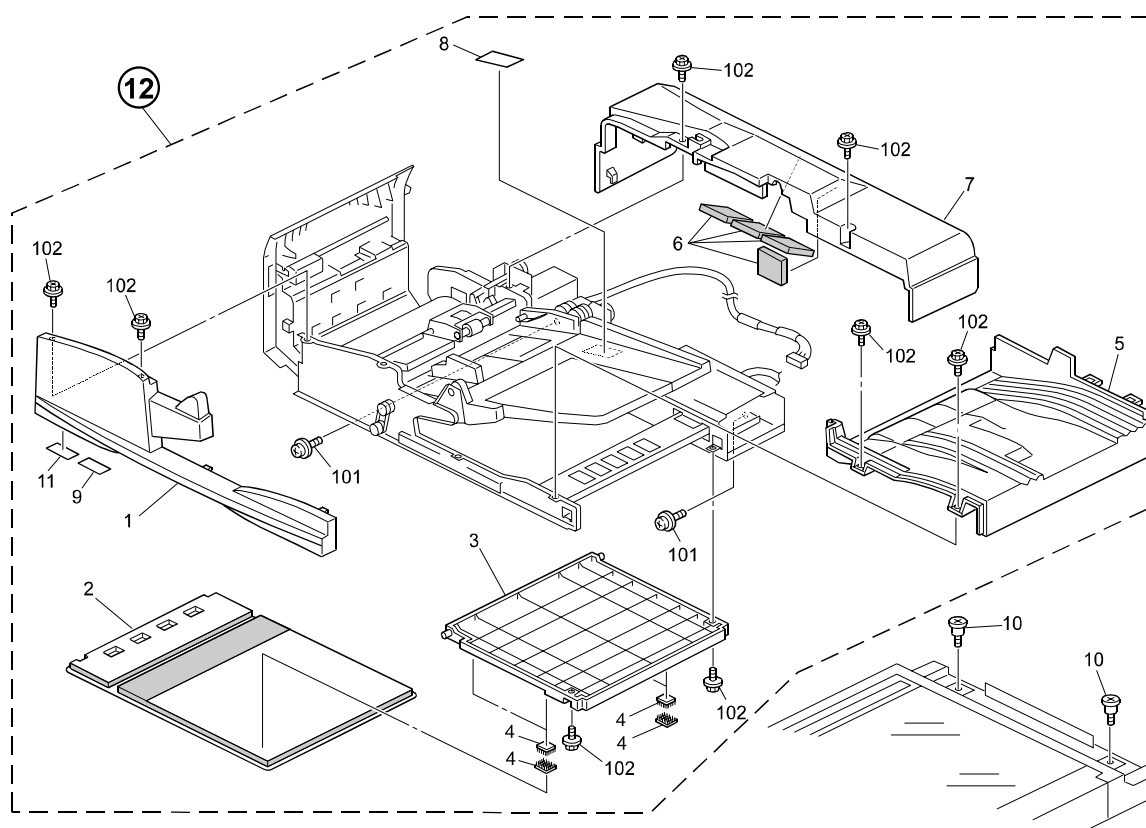

Reissued: 22-Nov-02

Model: Martini-C1	Date: 21-Nov-02	No.: MB064003a
-------------------	-----------------	----------------

MB Correction

The items in bold italics have been corrected or added.

Modified Article: Parts Catalog Correction		Prepared by: K. Miura	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☒ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☐ Other	


Please correct your Parts Catalogs as follows.

Index correction:

Index #33 in the lower half of the illustration below should be corrected to #44.

Note: Index #33 in the upper half of the illustration is correct, and should be left as is.


Part number	Description	Old Index	New Index	Page	Q'ty	Note
B0653633	Transport Screw	33 (Lower)	44	123	1	

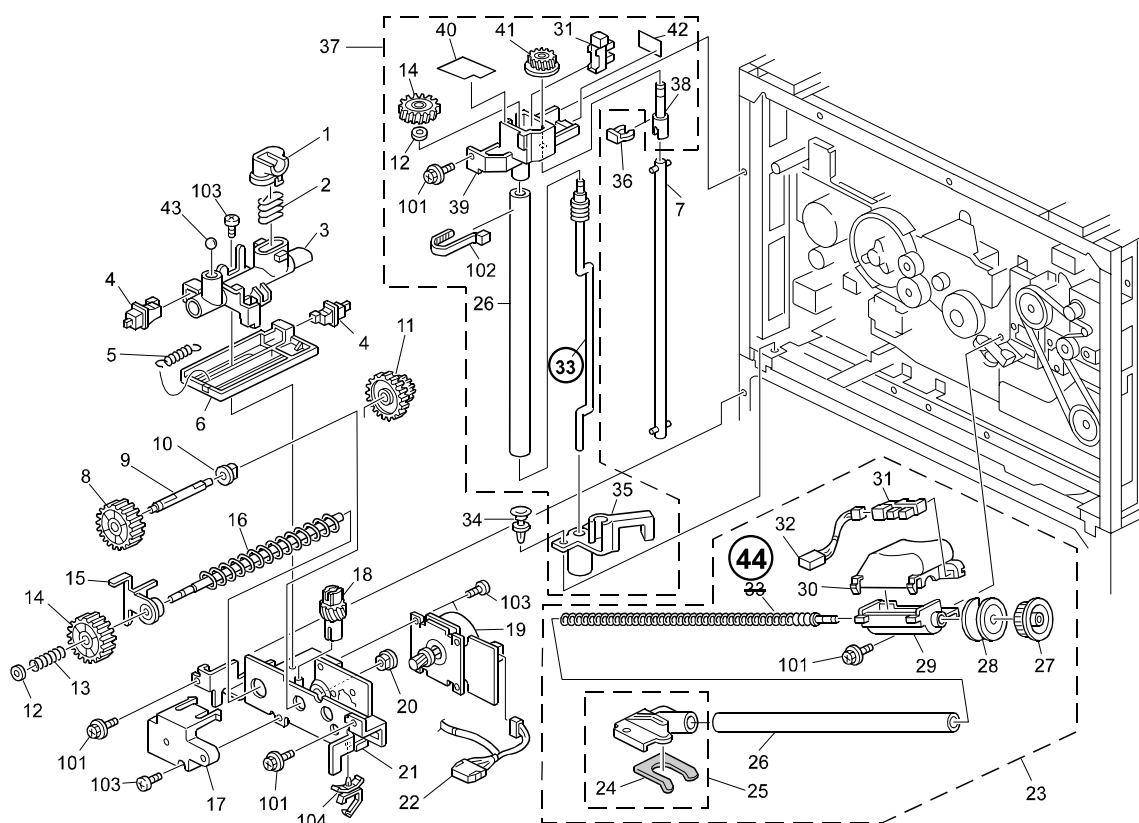

Model: Martini-C1		Date: 22-Nov-02	No.: MB064004
Modified Article: NVRAM		Prepared by: K. Miura	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

The description of the NVRAM has been changed as follows:


Part number	Old description	New description	Q'ty	Page	Index	Note
B0649099	Total Counter	NVRAM - Minus Counter	1	127	33	

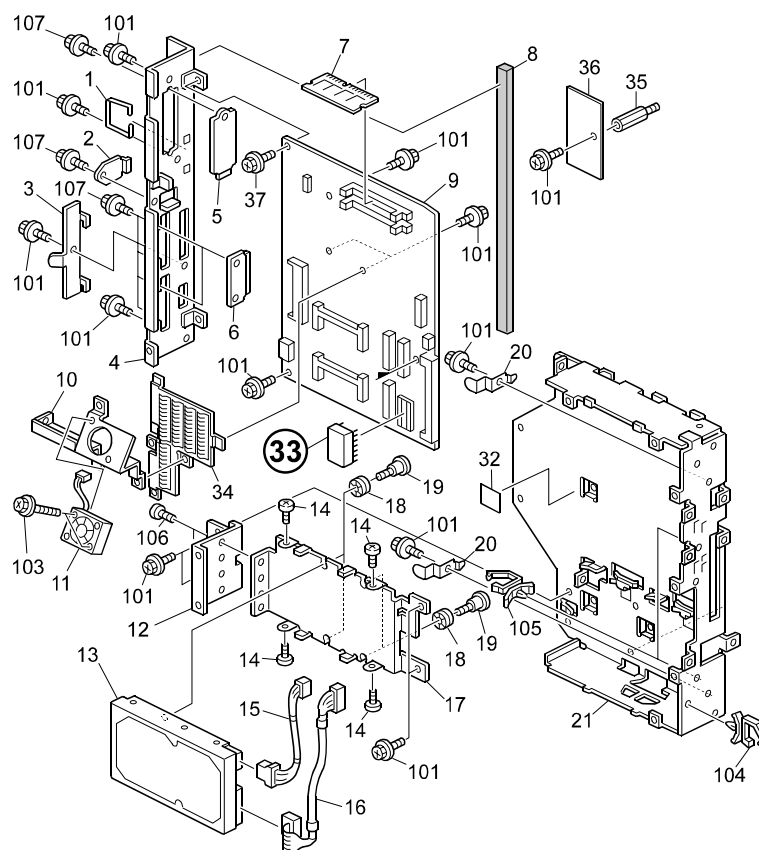

Model: Martini-C1		Date: 28-Nov-02	No.: MB064005
Modified Article: Pick-off Pawl		Prepared by: K. Miura	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Other	☐ To meet standards ()

As the edge of the Pick-off Pawl can be damaged during transport, causing paper jams in the PCU section, a protective plastic covering has been added to this area.


Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AD025023	AD025024	Pick-off Pawl	2	O/O	89	4	

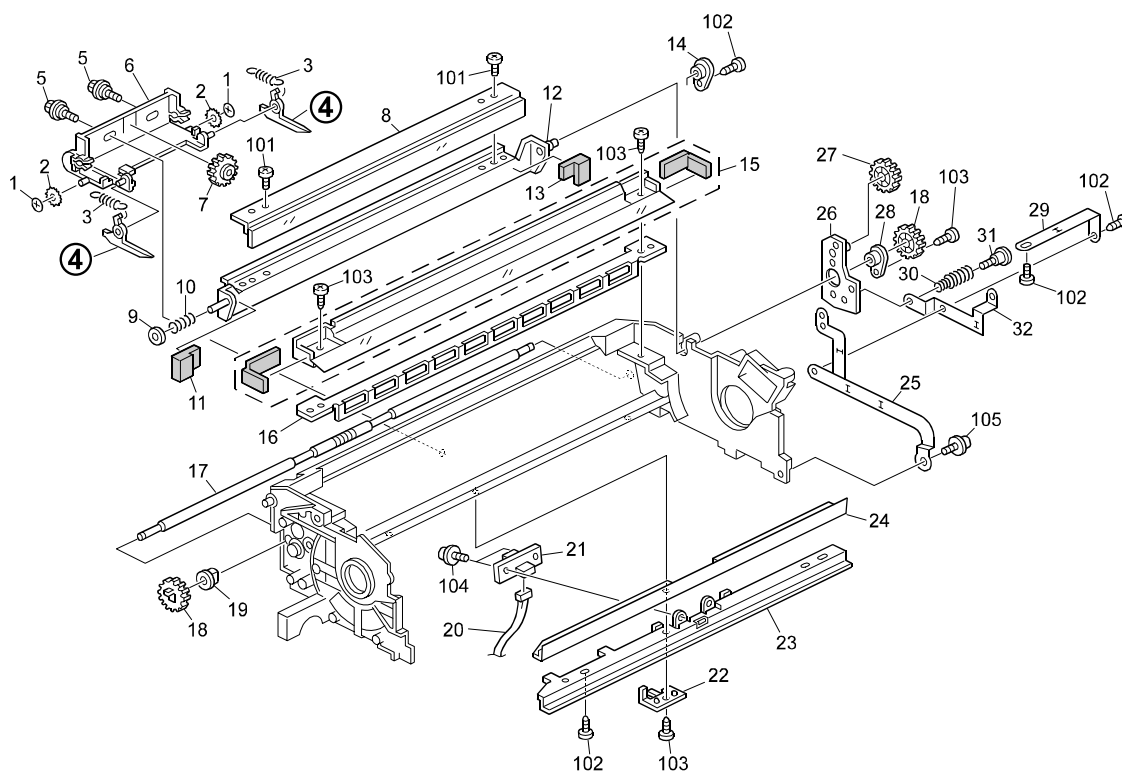

Model: Martini-C1		Date: 28-Nov-02	No.: MB064006
Modified Article: Spacer - M6		Prepared by: K. Miura	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction ☒ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()


The part shown below has been standardized in all places used in the PCU.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AA132024	AA132208	Spacer - M6	2 -> 0		85	17	
		Spacer - M6	1 -> 3	O/O	85	29	

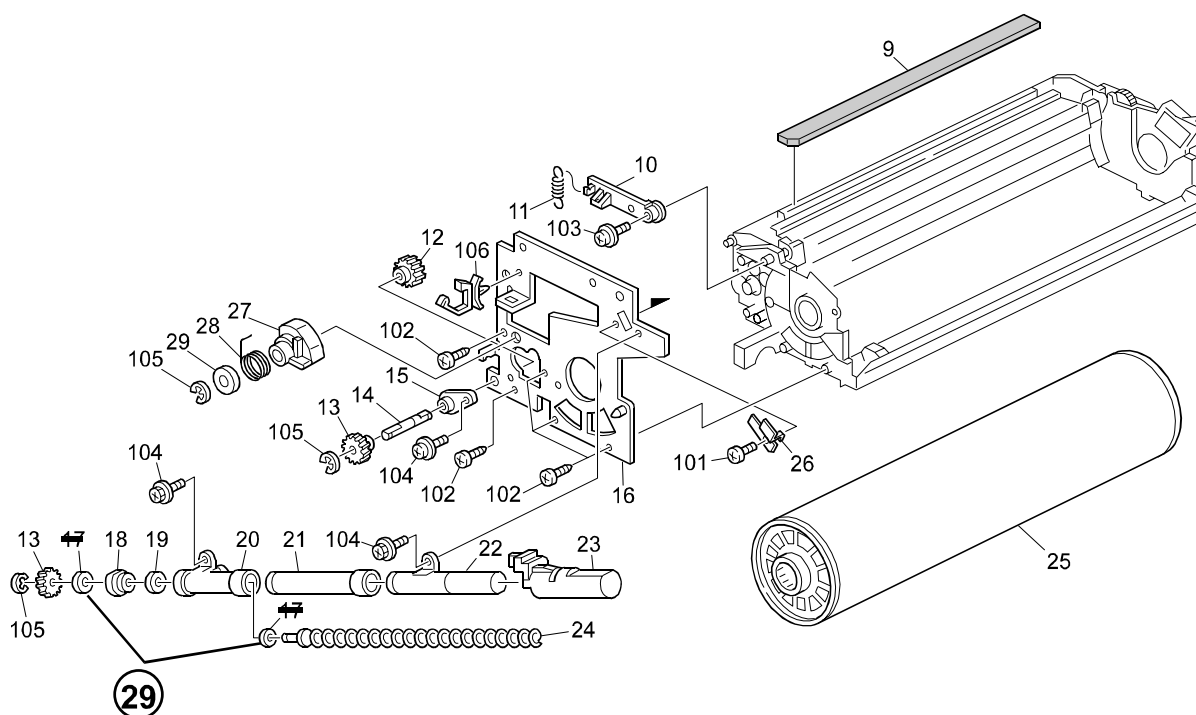

Model: Martini-C1	Date: 28-Nov-02	No.: MB064006
-------------------	-----------------	---------------

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AA132024	AA132208	Spacer - M6	1				
		Spacer - M6	1	O/O	89	9	

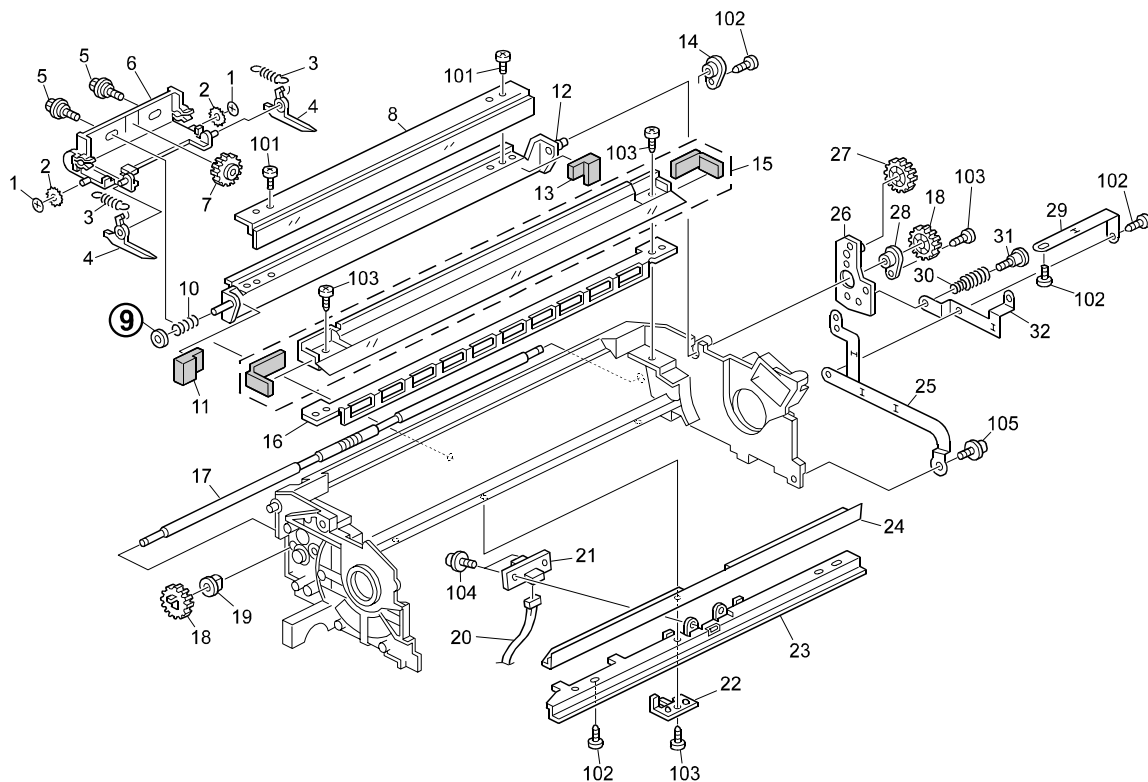

Reissued: 4-Dec-02

Model: Martini-C1	Date: 28-Nov-02	No.: MB064007a
-------------------	-----------------	----------------

Serial Number Update

The Serial Number information has been update.

Modified Article: DIMM Connector for Controller Board		Prepared by: K. Miura	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The following has been changed to ensure that the DIMM connector pins are not bent when the DIMM is installed.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
11028566		Connector SX1B-72S-0.635SH			171	108	
	11029349	Connector - DIMM		X/O	171	108	

Reissued: 4-Dec-02

Model: Martini-C1	Date: 28-Nov-02	No.: MB064007a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4221000001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282090001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10820051
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4220900001
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4220800210
Ricoh Aficio 1060	220/50,60	China	B064-69	J42208xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4321000001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292080041
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20820041
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4320800298
Ricoh Aficio 1075	220/60	Korea	B065-28	J4321100223
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4320800245
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4321000473

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4225700231
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4325700399

Reissued: 10-Jan-03

Model: Martini-C1	Date: 2-Dec-02	No.: MB064008a
-------------------	----------------	----------------


Serial Number Update

The Serial Number information has been updated.

Modified Article: Development Filter Plate		Prepared by: K. Miura	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The following part has been added to further ensure that toner does not leak out of the development unit.

Part number	Description	Q'ty	Page	Index	Note
B0653108	Filter Plate	1	79	19	

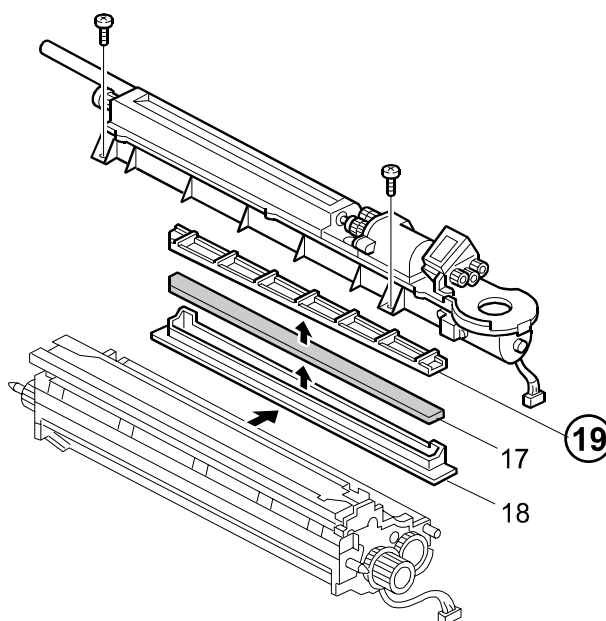

Reissued: 10-Jan-03

Model: Martini-C1	Date: 2-Dec-02	No.: MB064008a
-------------------	----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4220800001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282080001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10820009
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4220900001
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4220800151
Ricoh Aficio 1060	220/50,60	China	B064-69	J42208xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4320800001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292080001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20820001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4320800176
Ricoh Aficio 1075	220/60	Korea	B065-28	J43212xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4320800181
Ricoh Aficio 1075	220/50, 60	China	B065-69	J43212xxxxx


[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4225700571
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4325700710

Model: Martini-C1		Date: 2-Dec-02	No.: MB064009
Modified Article: Lower PCU Assembly		Prepared by: K.Miura	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The following part has been registered:

Part number	Description	Q'ty	Page	Index	Note
B0652263	PCU Lower A'ssy	1	85	32	

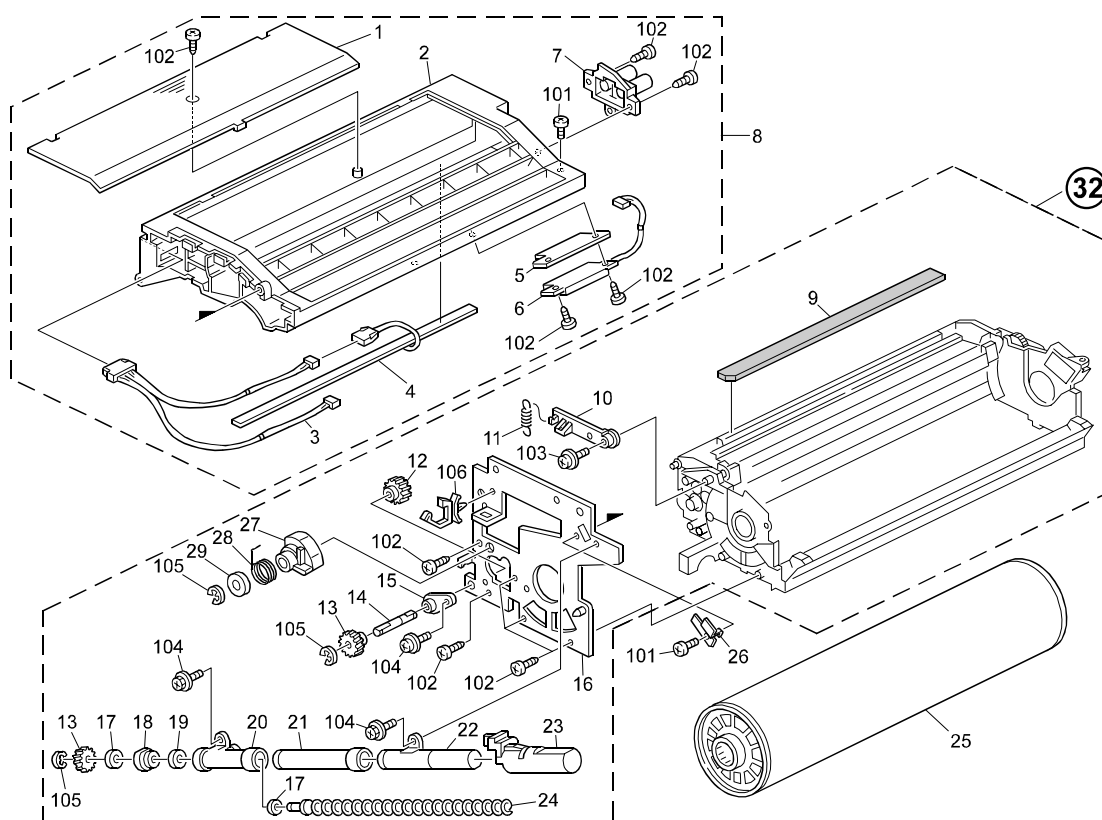

Reissued: 10-Jan-03

Model: Martini-C1	Date: 4-Dec-02	No.: MB064010a
-------------------	----------------	----------------

Serial Number Update

The Serial Number information has been updated.


Modified Article: Misfeed Removal Decal		Prepared by: K. Miura	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Other	☐ To meet standards ()

To ensure that operators do not bend the pick-up roller back too far when removing jammed originals, which can prevent the roller from returning to its default position, the instructions on the following decals have been changed.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B4774351	B4774352	Decal - Misfeed Removal	1	X/X	27 175	9 34	
B4774361	B4774362	Decal - Misfeed Removal - Exit	1	X/X	21 175	11 35	

Note: These parts must be replaced together as a set.

<Page 27>

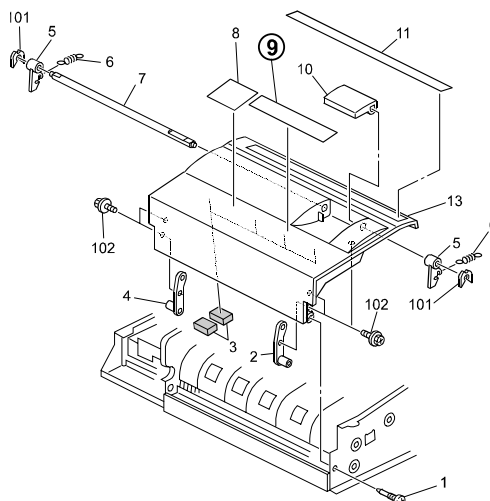


<Page 175>




Reissued: 10-Jan-03

Model: Martini-C1	Date: 4-Dec-02	No.: MB064010a
-------------------	----------------	----------------

<Page 21>

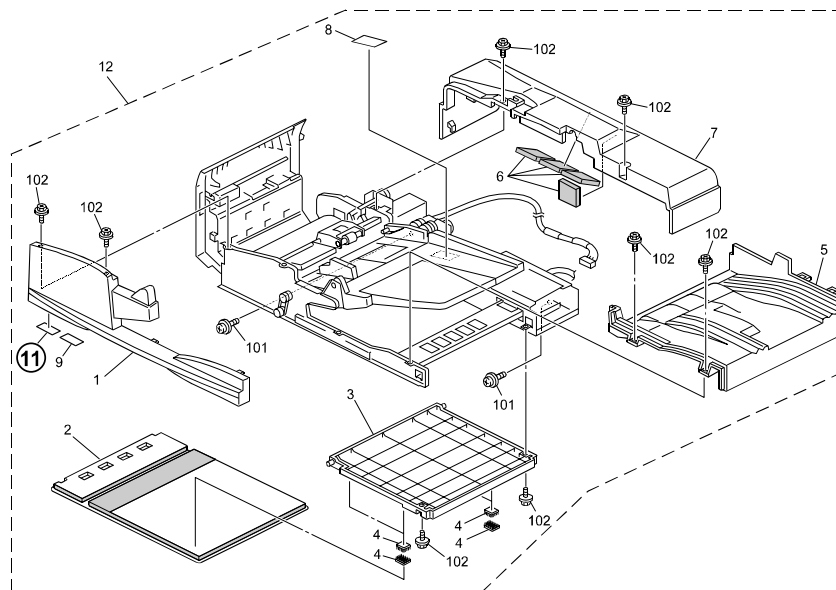

<Page 175>

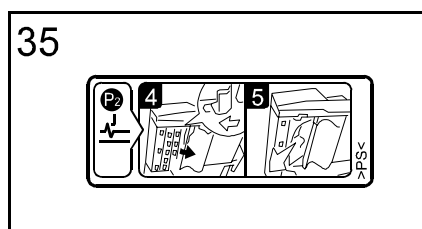

Reissued: 10-Jan-03

Model: Martini-C1	Date: 4-Dec-02	No.: MB064010a
-------------------	----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4220800001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282080001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10820001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4220700250
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4220700942
Ricoh Aficio 1060	220/50,60	China	B064-69	J42208xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4320800001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292080001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20820001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4320700201
Ricoh Aficio 1075	220/60	Korea	B065-28	J43212xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4320700479
Ricoh Aficio 1075	220/50, 60	China	B065-69	J43212xxxxx

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4225600518
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4325600292


Reissued: 5-Mar-03

Model: Martini-C1

Date: 5-Dec-02

No.: MB064011a

<Page 123>

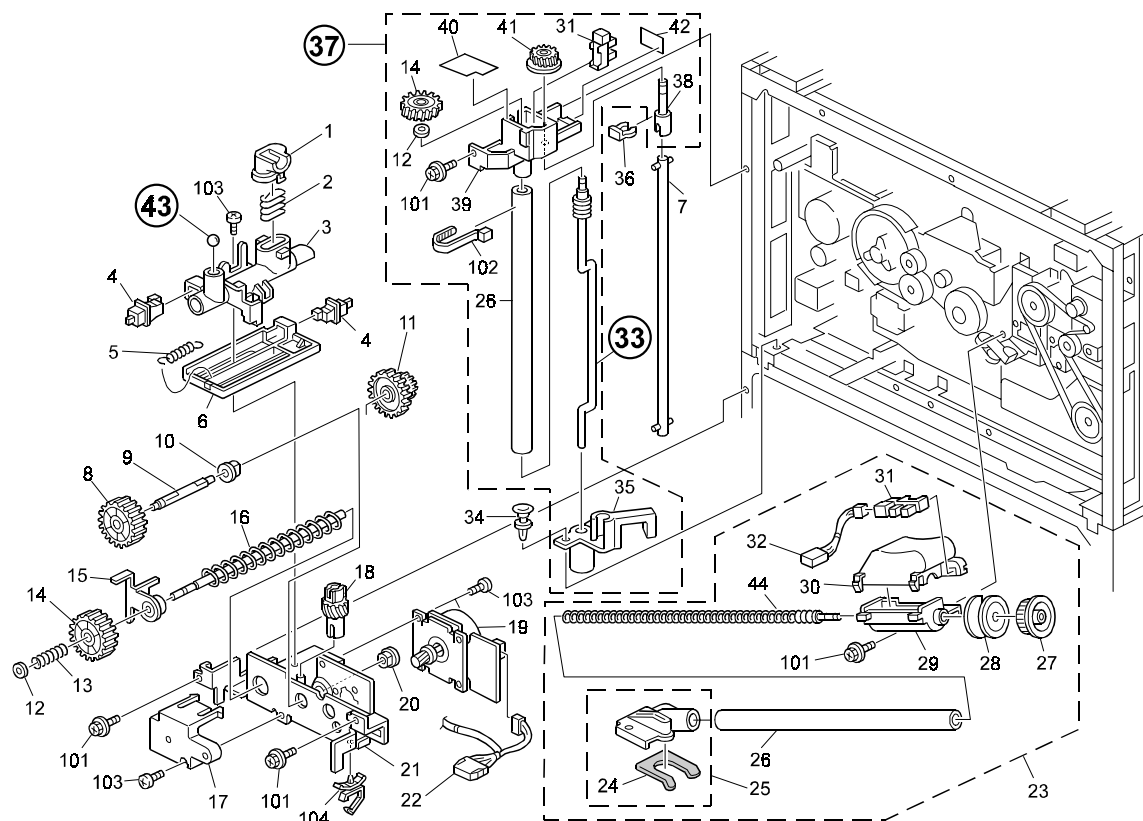

Reissued: 5-Mar-03

Model: Martini-C1	Date: 5-Dec-02	No.: MB064011a
-------------------	----------------	----------------

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4221000001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282090001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10820051
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4220900001
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4220800210
Ricoh Aficio 1060	220/50,60	China	B064-69	J42208xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4321000001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292080041
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20820041
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4320800293
Ricoh Aficio 1075	220/60	Korea	B065-28	J4321100223
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4320800225
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4321000473

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4235100103
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4335100001

Reissued: 10-Jan-03

Model: Martini-C1	Date: 6-Dec-02	No.: MB064012a
-------------------	----------------	----------------

Serial Number Update


The Serial Number information has been updated

Modified Article: Toner Supply Decal		Prepared by: K.Miura	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☒ Other	

To further ensure that the toner bottle is set correctly, the decal shown below has been added.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	B0653342	Decal - Toner Supply	1		75 175	41 45	


<Page 75 Index 41>

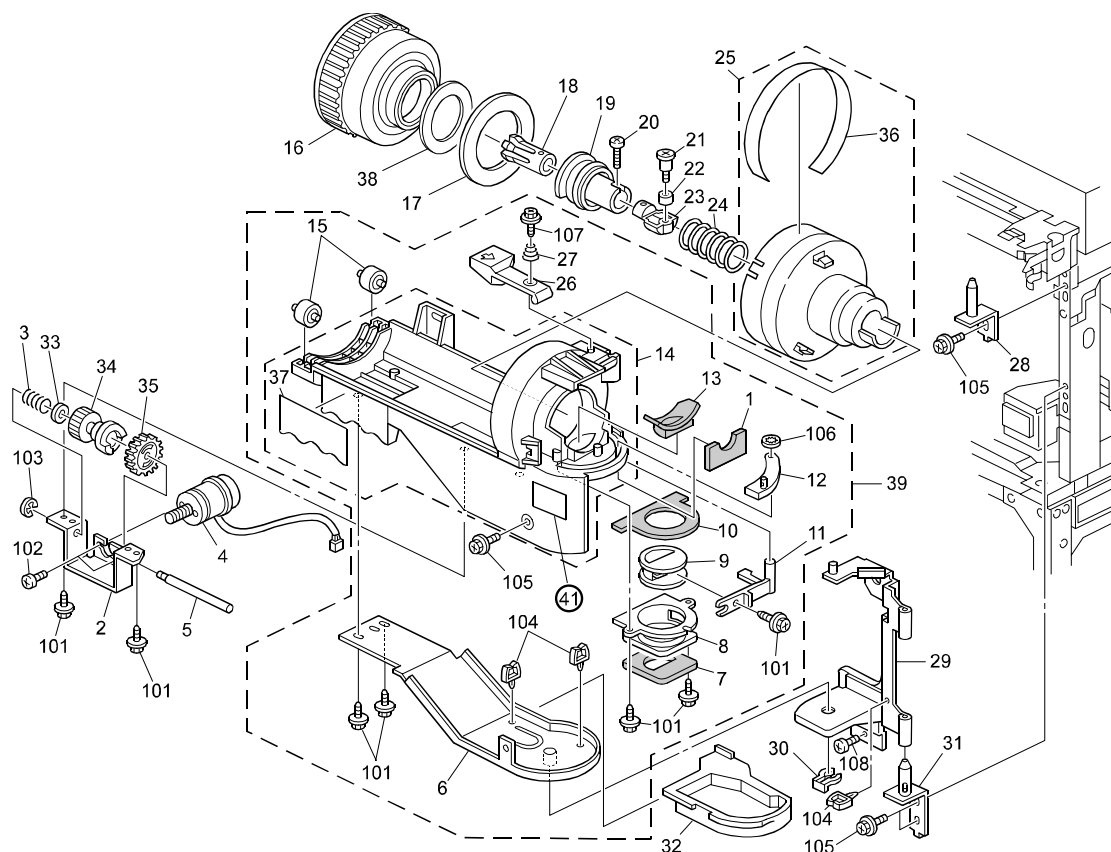

Reissued: 10-Jan-03

Model: Martini-C1	Date: 6-Dec-02	No.: MB064012a
-------------------	----------------	----------------

<Page 174 Index 45>

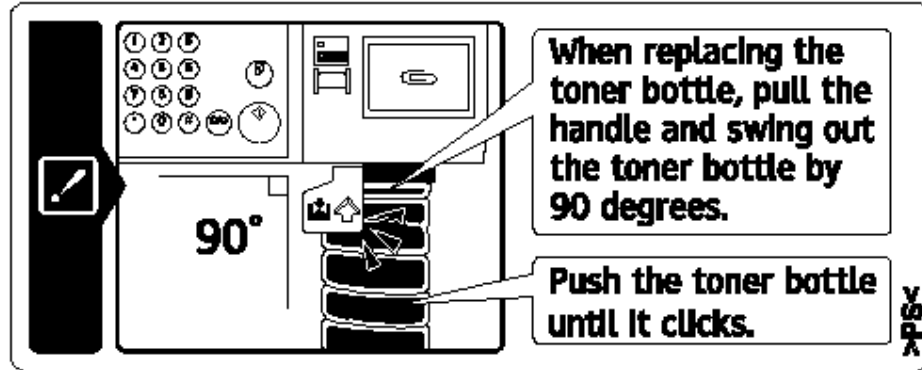
[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J42212xxxxx
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4221000001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282090001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10820001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4220900001
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4220900079
Ricoh Aficio 1060	220/50,60	China	B064-69	J42212xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J43212xxxxx
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4321000001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292090001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P21020001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4320900001
Ricoh Aficio 1075	220/60	Korea	B065-28	J43212xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4320900115
Ricoh Aficio 1075	220/50, 60	China	B065-69	J43212xxxxx

Reissued: 10-Jan-03

Model: Martini-C1	Date: 6-Dec-02	No.: MB064012a
-------------------	----------------	----------------

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4225600234
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4325600292

Reissued: 10-Jan-03

Model: Martini-C1	Date: 6-Dec-02	No.: MB064013a
-------------------	----------------	----------------


Serial Number Update

The Serial Number information has been updated.

Modified Article: Tapping Screw		Prepared by: K. Miura	
From: Technical Service Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☒ Other	

The Tapping Screw has been changed to ensure the screw head does not contact the paper tray holder base.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
04504008B		Tapping Screw - 4X8			59	106	
	B0656579	Tapping Screw - M4X8	1	X/O	59	39	

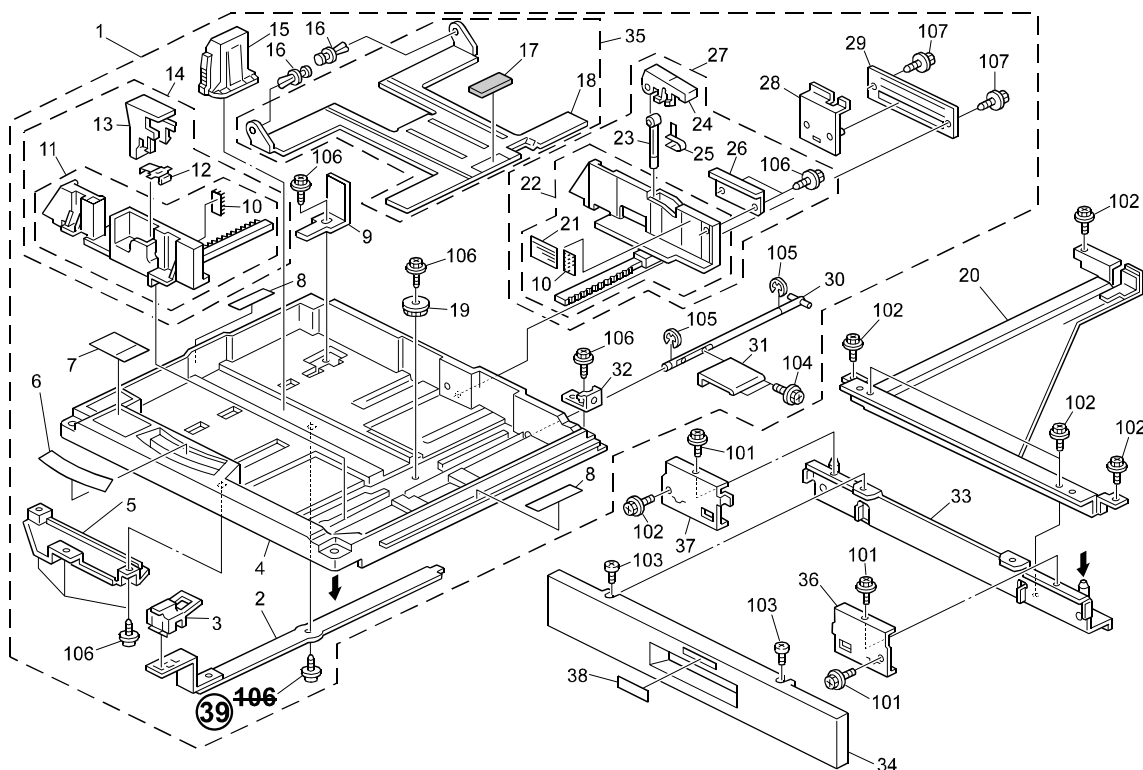

Reissued: 10-Jan-03

Model: Martini-C1	Date: 6-Dec-02	No.: MB064013a
-------------------	----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4220700001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282070001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10720001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4220700176
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4220700942
Ricoh Aficio 1060	220/50,60	China	B064-69	J42207xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4320700001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292070001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20720001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4320700201
Ricoh Aficio 1075	220/60	Korea	B065-28	J4321100223
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4320700479
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4321000473

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4225901112
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4325900839

Reissued: 10-Jan-03

Model: Martini-C1	Date: 17-Dec-02	No.: MB064014a
-------------------	-----------------	----------------

Serial Number Update


The Serial Number information has been updated.

Modified Article: CIS Inverter Bracket and CIS		Prepared by: K. Miura	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The following have been changed to ensure that SC18x does not occur.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B4773931	B4773933	CIS Inverter Bracket	1	X/X	33	6	
B4775820	B4775830	Contact Image Sensor	1	X/X	33	14	

Note: These parts must be replaced together as a set.

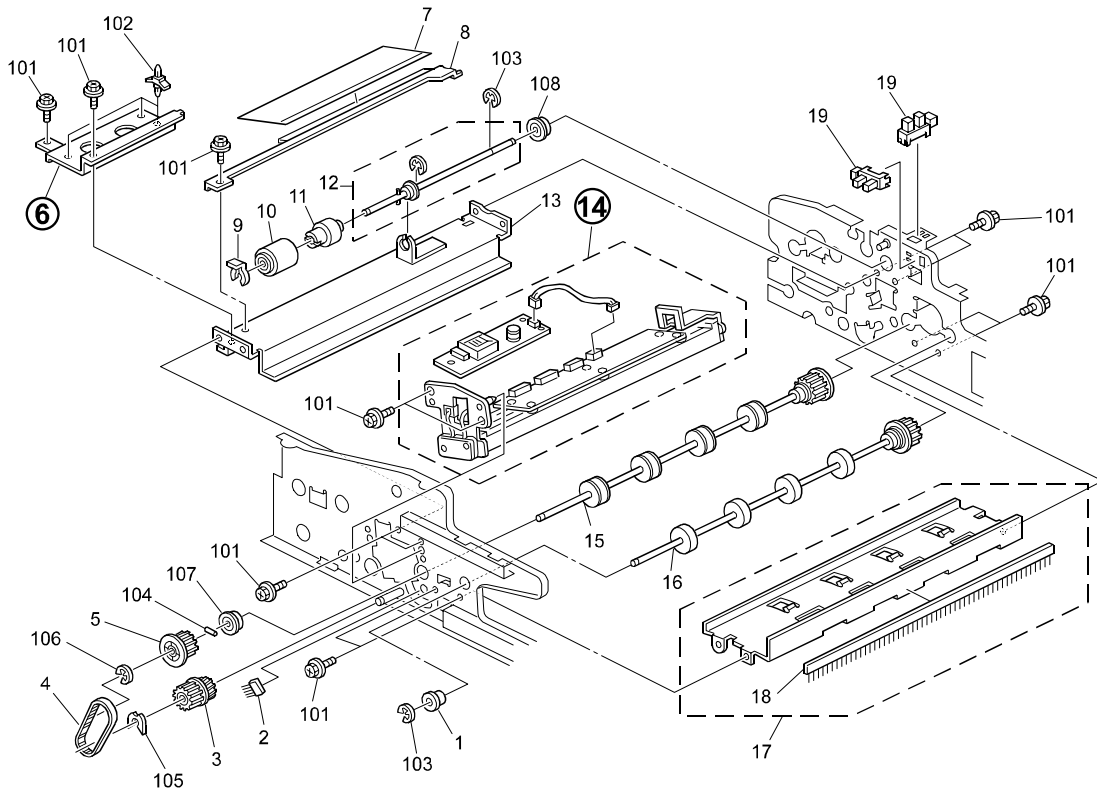

Reissued: 10-Jan-03

Model: Martini-C1	Date: 17-Dec-02	No.: MB064014a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4221000001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282090001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P11120001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4220900001
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4220800210
Ricoh Aficio 1060	220/50,60	China	B064-69	J42209xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4331000001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292080041
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20820064
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4320800293
Ricoh Aficio 1075	220/60	Korea	B065-28	J43212xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4320800507
Ricoh Aficio 1075	220/50, 60	China	B065-69	J43212xxxxx

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4225700456
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4325700651

Reissued: 10-Jan-03

Model: Martini-C1	Date: 17-Dec-02	No.: MB064015a
-------------------	-----------------	----------------


Serial Number Update

The Serial Number information has been updated.

Modified Article: ADF Main Control Board		Prepared by: K. Miura	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☒ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☐ Other	

The following has been changed to increase the latitude for compliance with EMI Standards.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B4775561	B4775571	ADF Main Control Board	1	O/O	39	8	

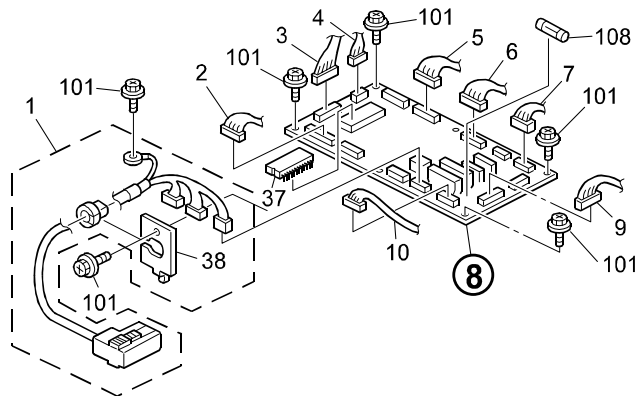

Reissued: 10-Jan-03

Model: Martini-C1	Date: 17-Dec-02	No.: MB064015a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4221000001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282090001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P11120001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4220900001
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4220800210
Ricoh Aficio 1060	220/50,60	China	B064-69	J42209xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4321000001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292080041
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20820064
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4320800293
Ricoh Aficio 1075	220/60	Korea	B065-28	J43212xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4320800507
Ricoh Aficio 1075	220/50, 60	China	B065-69	J43212xxxxx


[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4225700456
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4325700651

Model: Martini-C1		Date: 17-Dec-02	No.: MB064016
Modified Article: Hot Roller		Prepared by: K. Miura	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Please correct your Parts Catalog as follows:

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AE011069	AE011074	Hot Roller	1		99	23	

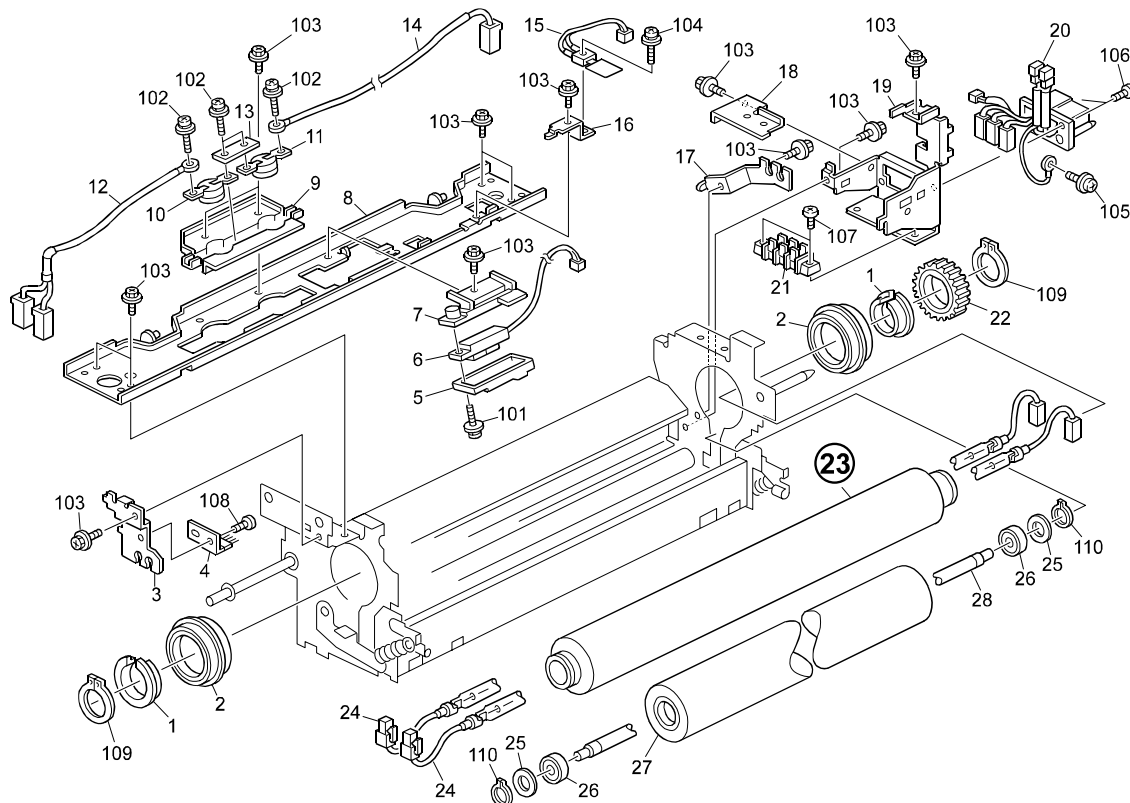

Reissued: 10-Jan-03

Model: Martini-C1	Date: 20-Dec-02	No.: MB064017a
-------------------	-----------------	----------------

Serial Number Update

The Serial Number information has been updated.


Modified Article: Cushion		Prepared by: K. Miura	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The following part has been added to ensure the Brush Roller Gear does not break:

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	AA130042	Sleeve	1		85	30	
	A3764131	Cushion - T1	1		85	31	
04514008B		Tapping Screw M4x8			85	104	
	04514014B	Tapping Screw M4x14		X/O	85	107	

Before installing the Cushion -T1 (A3764131), insert the Sleeve (AA130042) into the hole in the Cushion - T1.

Note: Another part was also added for this issue, as announced in MB# MB064018. For details on the above issue, see RTB #RB064010.

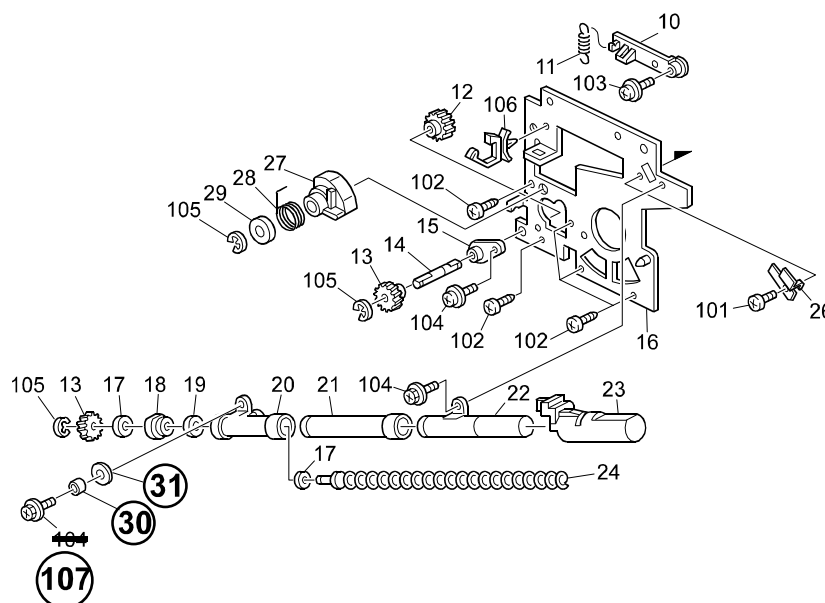

Reissued: 10-Jan-03

Model: Martini-C1	Date: 20-Dec-02	No.: MB064017a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4221100001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282120001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P11120001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4221100216
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4221100541
Ricoh Aficio 1060	220/50,60	China	B064-69	J42211xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4321100001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292110008
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P21120001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4321100101
Ricoh Aficio 1075	220/60	Korea	B065-28	J4321100223
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4321100157
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4321100208

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4225800864
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4325800494

Reissued: 10-Jan-03

Model: Martini-C1	Date: 20-Dec-02	No.: MB064018a
-------------------	-----------------	----------------

Serial Number Update


The Serial Number information has been updated.

Modified Article: Spacer - M6		Prepared by: K. Miura	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The following part has been added to ensure the Brush Roller Gear does not break:

Part number	Description	Q'ty	Page	Index	Note
AA132208	Spacer - M6	3 -> 4	85	29	

Note: Another part was also added for this issue, as announced in MB# MB064017. For details on the above issue, see RTB #RB064010.

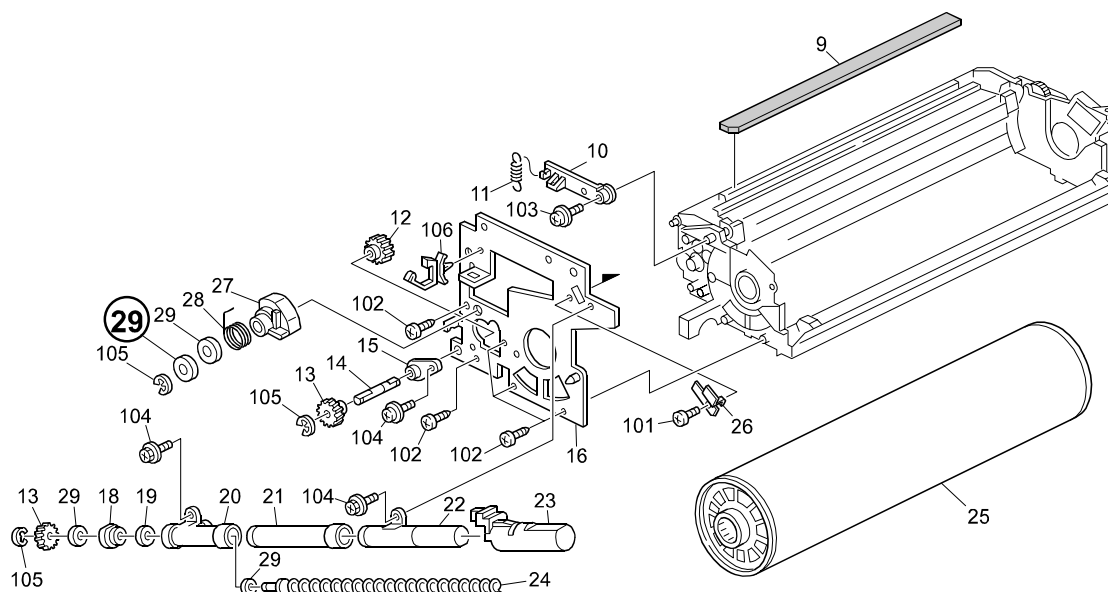

Reissued: 10-Jan-03

Model: Martini-C1	Date: 20-Dec-02	No.: MB064018a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J42212xxxxx
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4221200178
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282120001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P11220065
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4221200063
Ricoh Aficio 1060	220/60	Korea	B064-28	J42212xxxxx
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4221200640
Ricoh Aficio 1060	220/50,60	China	B064-69	J4221200667
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J43212xxxxx
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J43212xxxxx
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292120001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P21220061
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4321200001
Ricoh Aficio 1075	220/60	Korea	B065-28	J43212xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4321200299
Ricoh Aficio 1075	220/50, 60	China	B065-69	J43212xxxxx

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4234900203
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4334900007

Reissued: 10-Jan-03

Model: Martini-C1	Date: 20-Dec-02	No.: MB064019a
-------------------	-----------------	----------------


Serial Number Update

The Serial Number information has been updated.

Modified Article: Exit Drive Roller		Prepared by: K. Miura	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☒ Other	

Although used on previous models, the two plastic rollers in between the rubber exit drive rollers that give the paper added stiffness (optional tray) have been deleted, as they are not necessary for this model.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AF020508	AF020581	Exit Drive Roller	1	X/O	107	3	

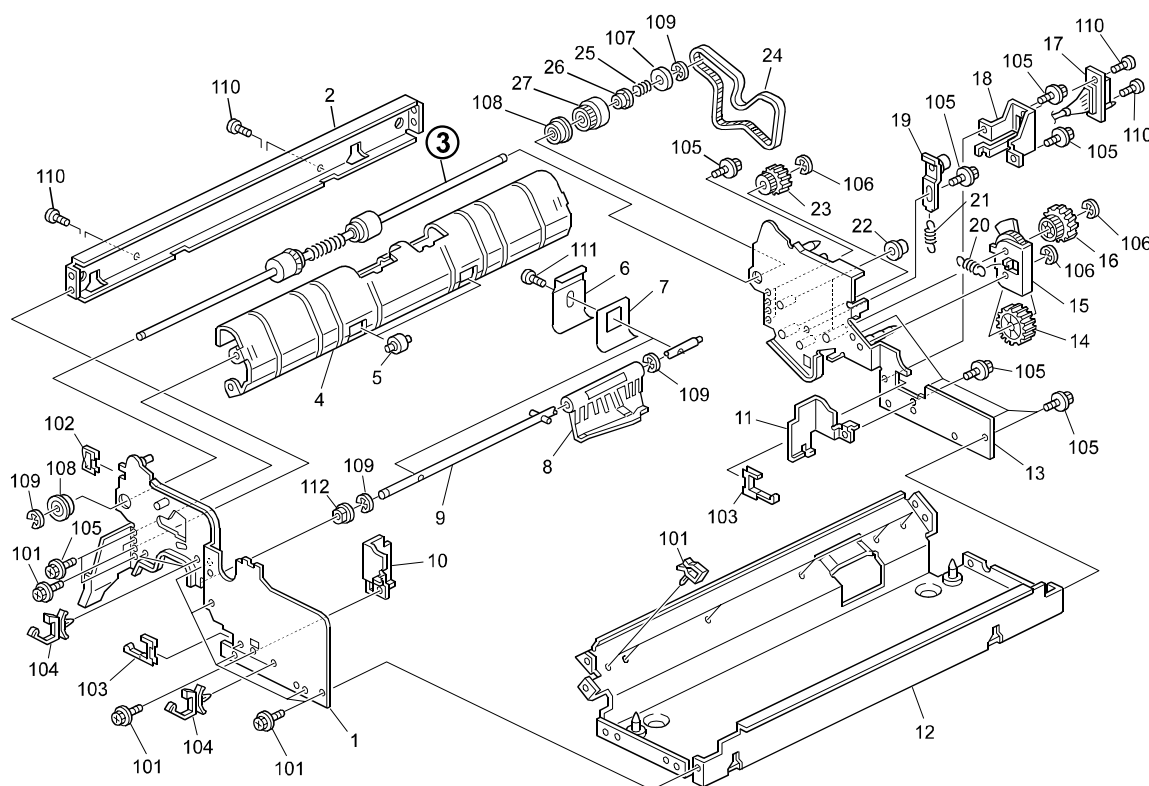

Reissued: 10-Jan-03

Model: Martini-C1	Date: 20-Dec-02	No.: MB064019a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4221000001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282090001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P11120001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4220900001
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4220900079
Ricoh Aficio 1060	220/50,60	China	B064-69	J42209xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4321000001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292090001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P21020001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4320900001
Ricoh Aficio 1075	220/60	Korea	B065-28	J43212xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4320900115
Ricoh Aficio 1075	220/50, 60	China	B065-69	J43212xxxxx

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4225800595
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4325800242

Reissued: 28-Jan-03

Model: Martini-C1	Date: 20-Dec-02	No.: MB064020b
-------------------	-----------------	----------------


Serial Number Update

The Serial Number information has been update.

Modified Article: Hot Roller		Prepared by: K. Miura	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The following has been changed to ensure that the adhesive between the surface layer and the metallic core is applied evenly.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AE011074	AE011075	Hot Roller	1	X/O	99	23	

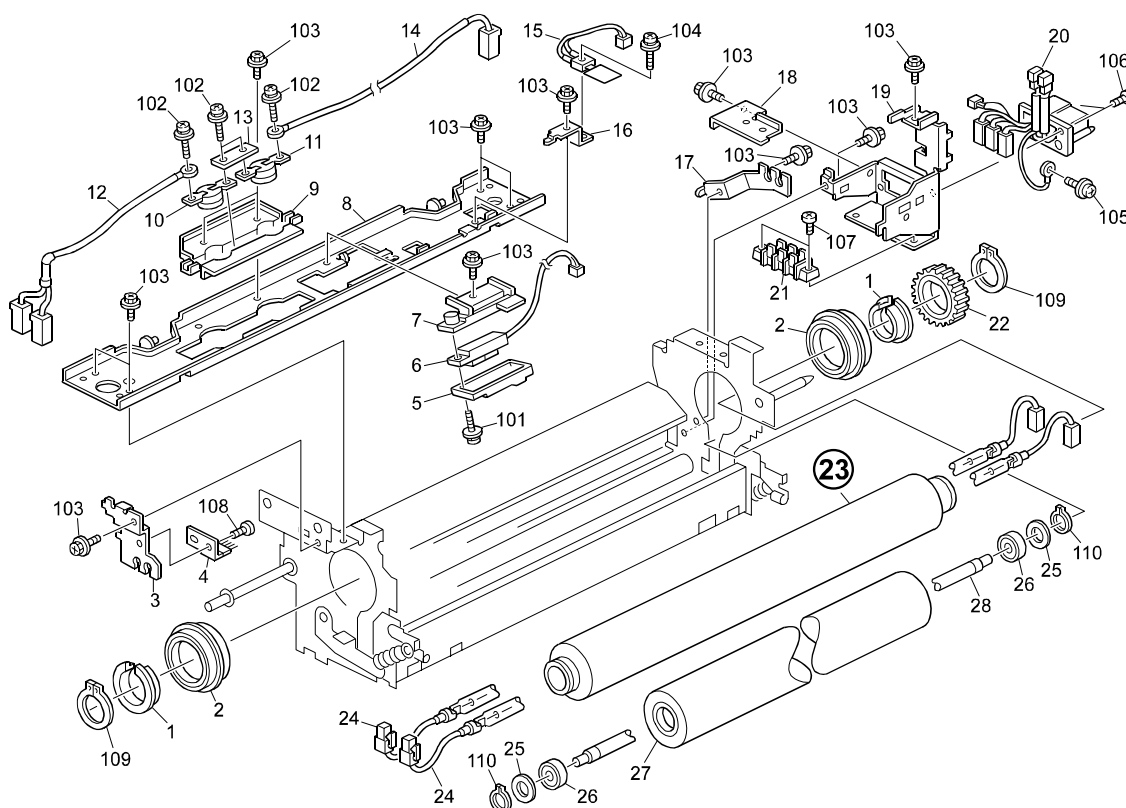

Reissued: 28-Jan-03

Model: Martini-C1	Date: 20-Dec-02	No.: MB064020b
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4221000001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282090001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P11120001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4220900001
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4220800210
Ricoh Aficio 1060	220/50,60	China	B064-69	J42209xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4321000001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292080041
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20820064
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4320800293
Ricoh Aficio 1075	220/60	Korea	B065-28	J43212xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4320800507
Ricoh Aficio 1075	220/50, 60	China	B065-69	J43212xxxxx


[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4225500684
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4325500690

Model: Martini-C1		Date: 20-Dec-02	No.: MB064021
Modified Article: Gear - 22Z		Prepared by: K. Miura	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Please correct your Parts Catalog as follows:

Part number	Old description	New description	Q'ty	Page	Index	Note
B0653645	Toner Collection Seal	Gear - 22Z	1	123	41	

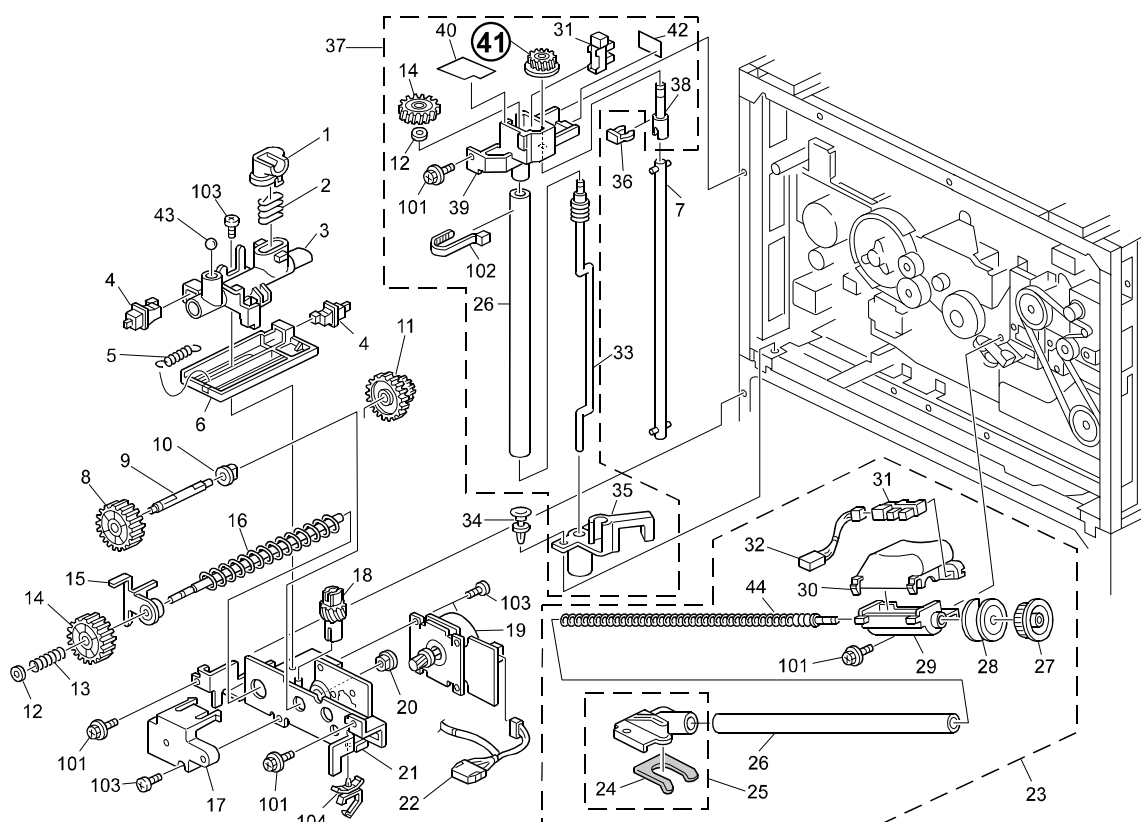


Model: Martini-C1		Date: 25-Dec-02	No.: MB064022
Modified Article: Paper Set Decal		Prepared by: K. Miura	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Please correct your Parts Catalog as follows:


Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2936637		Tray Bottom Plate - Left Middle (KOR)	1	—	53	10	
	→ B0656833	Tray Bottom Plate - Left Middle (KOR/CHN/TWN)	1	—	53	10	
AA003015		Decal - Left Paper Set (KOR)	1	—	53	12	
	→ B0656879	Decal - Left Paper Set (KOR/CHN/TWN)	1	—	53 175	12 3	
AA003014		Decal - Right Paper Set (KOR)	1	—	55	12	
	→ B0656878	Decal - Right Paper Set (KOR/CHN/TWN)	1	—	55 175	12 2	
A2936678		Base - Right Tandem LCT (KOR)	1	—	55	13	
	→ B0656885	Base - Right Tandem Tray (KOR/CHN/TWN)	1	—	55	13	

<Page 53>

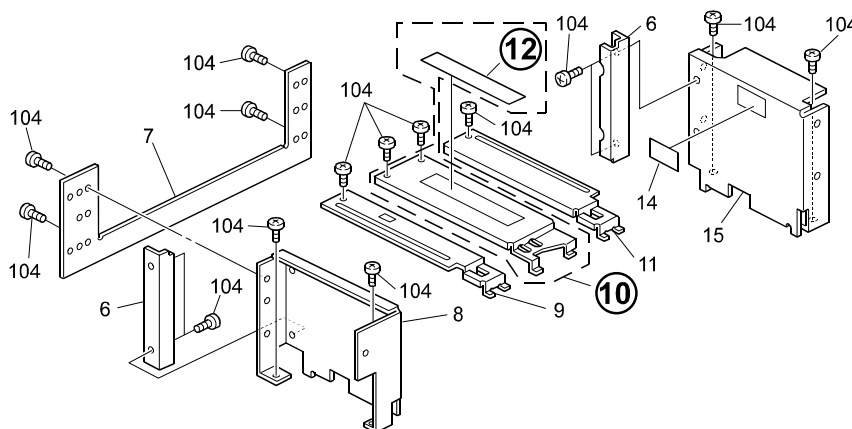


Model: Martini-C1	Date: 25-Dec-02	No.: MB064022
-------------------	-----------------	---------------

<Page 55>

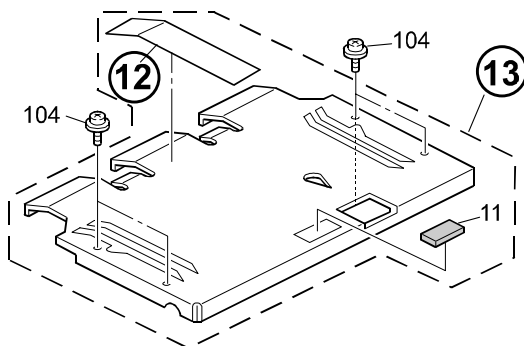

<Page 175>

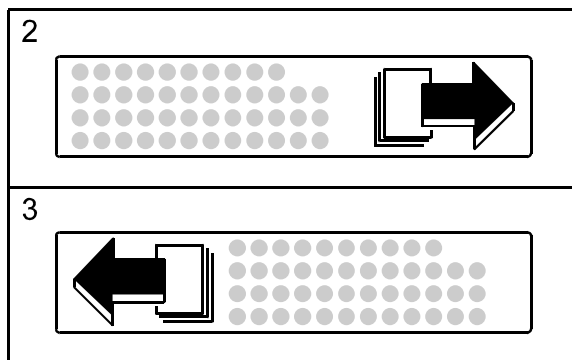


Model: Martini-C1		Date: 25-Dec-02	No.: MB064023
Modified Article: LD Decal		Prepared by: K. Miura	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()


Please correct your Parts Catalog as follows:

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	AA000250	LD - Decal (CHN/TWN)	1	—	45 49 175	2 28 39	

<Page 45>

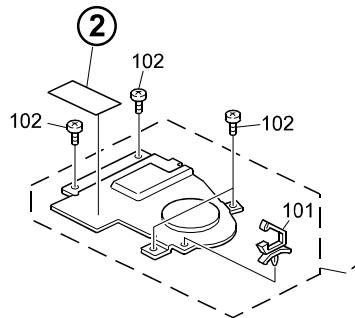

<Page 49>

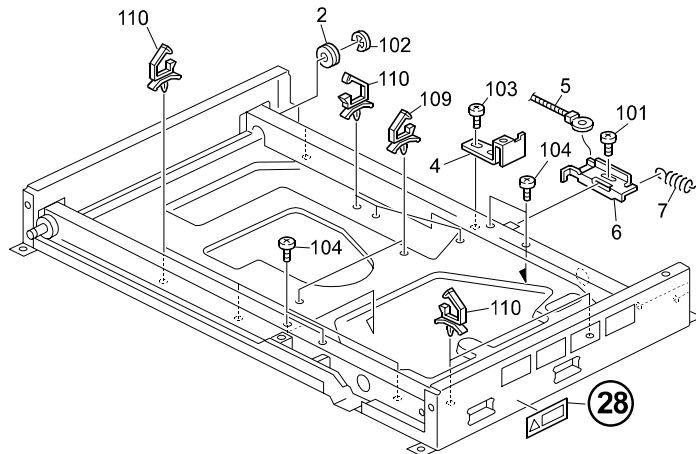


Model: Martini-C1

Date: 25-Dec-02

No.: MB064023

<Page 175>

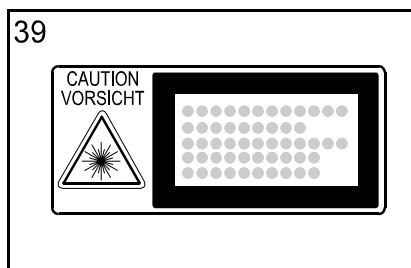


Model: Martini-C1		Date: 25-Dec-02	No.: MB064024
Modified Article: LD Decal		Prepared by: K.Miura	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()


Please correct your Parts Catalog as follows:

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	B0657133	Decal - Cleaning (CHN)	1	—	15 175	32 41	
	B0657134	Decal - Cleaning (TWN)	1	—	15 175	32 41	
	B4774341	Decal - Exposure Glass (CHN)	1	—	27 175	8 40	
	B4774342	Decal - Exposure Glass (TWN)	1	—	27 175	8 40	
	B0653343	Decal - Toner Supply (CHN)	1	—	75 175	41 45	
	B0653344	Decal - Toner Supply (TWN)	1	—	75 175	41 45	



<Page 15>

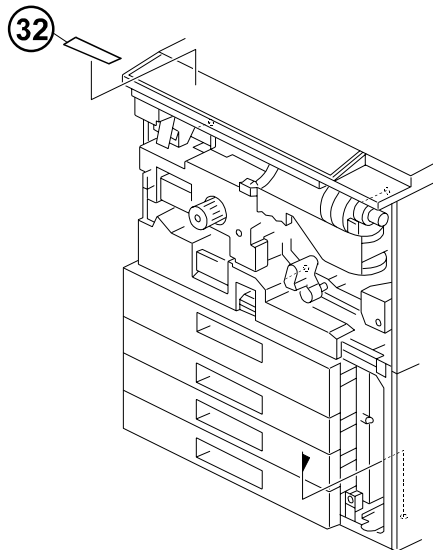

<Page 75>

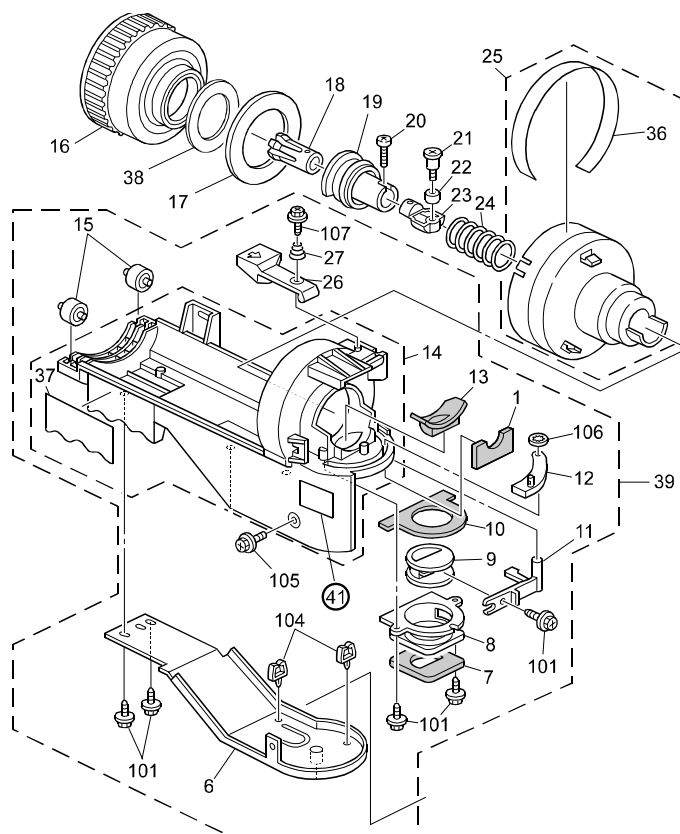

<Page 175>

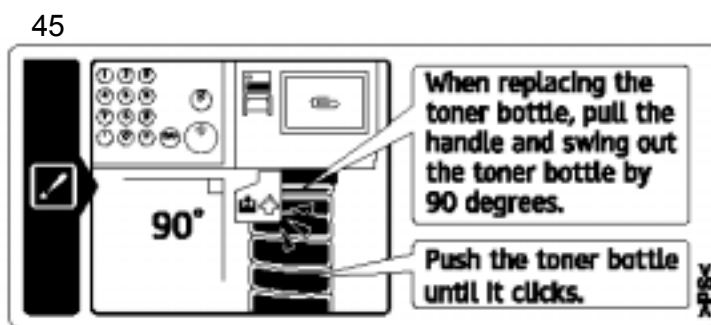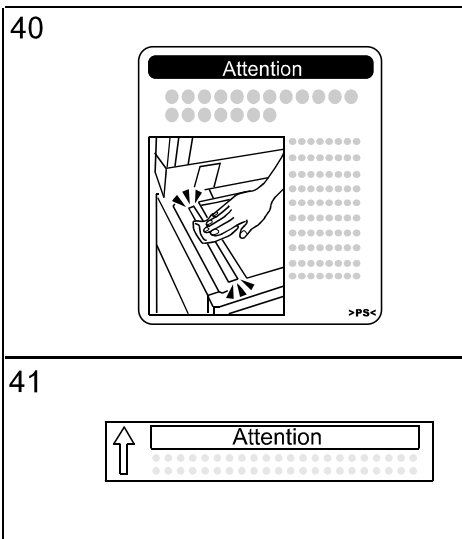


Model: Martini-C1		Date: 25-Dec-02	No.: MB064025
Modified Article: Misfeed Removal Decal		Prepared by: K. Miura	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()


Please correct your Parts Catalog as follows:

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	B0654253	Decal - Misfeed Removal (KOR)	1	—	95 175	2 20	
	B0654256	Decal - Misfeed Removal (CHN)	1	—	95 175	2 20	
	B0654257	Decal - Misfeed Removal (TWN)	1	—	95 175	2 20	

<Page 95>

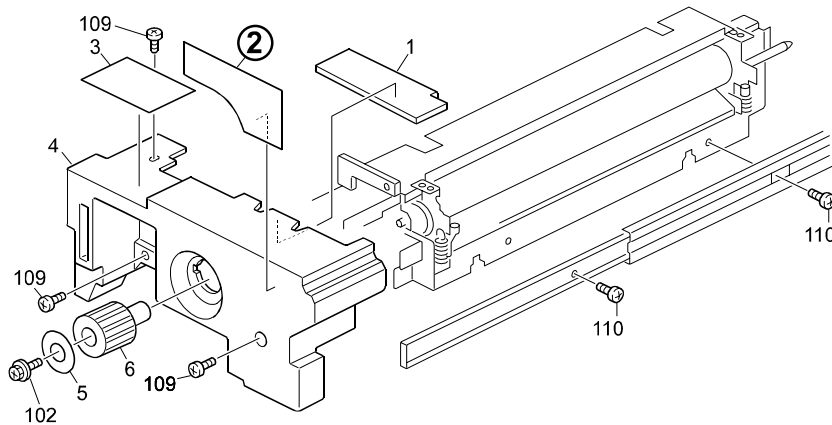


<Page 175>

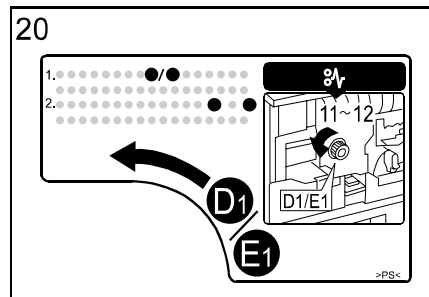

Model: Martini-C1		Date: 25-Dec-02	No.: MB064026
Modified Article: Model Name Plate		Prepared by: K. Miura	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Please correct your Parts Catalog as follows:

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	B0647015	Model Name Plate - GES 6002	1		15	12	
	B0647016	Model Name Plate - NSH 6005	1		15	12	
	B0647017	Model Name Plate - REX 6008	1		15	12	
	B0657015	Model Name Plate - GES 7502	1		15	12	
	B0657016	Model Name Plate - NSH 7505	1		15	12	
	B0657017	Model Name Plate - REX 7508	1		15	12	

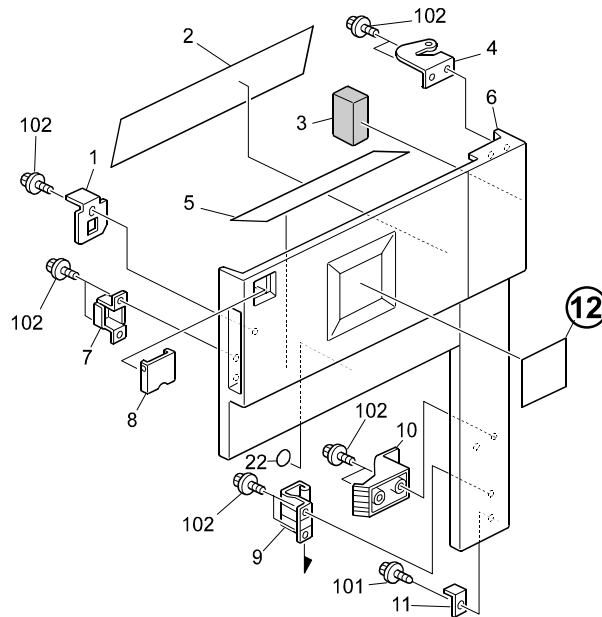

Reissued: 21-Apr-03

Model: Martini-C1	Date: 25-Dec-02	No.: MB064027a
-------------------	-----------------	----------------

MB Correction


The items in bold italics have been corrected or added.

Modified Article: Caster (NA Field only)		Prepared by: K. Miura	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☒ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☐ Other	

The following part has been changed due to a vendor change:

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AH012016		Caster - G60	4		145	7	
	AH012015	Caster - 1470N	4	O/O	145	7	

Note: NA field only.

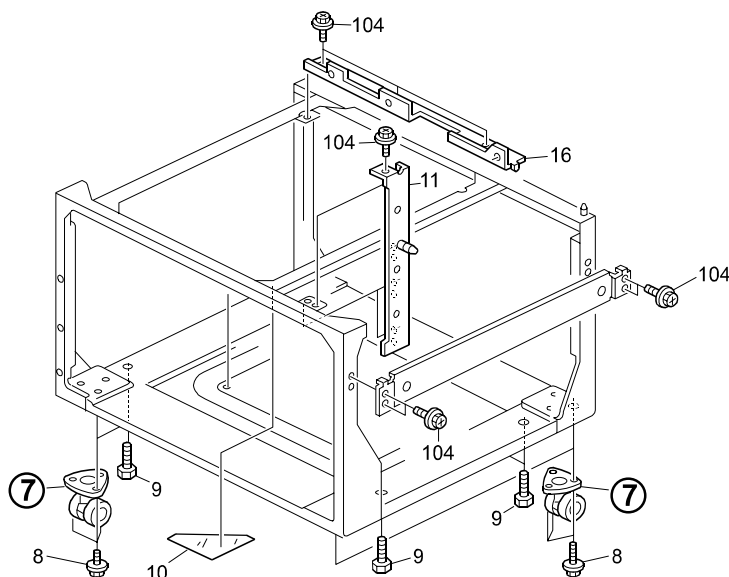


Model: Martini-C1		Date: 27-Dec-02	No.: MB064028
Modified Article: Caution Decal		Prepared by: K. Miura	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()


The following part has been changed due to the adding the Korean, Simplified Chinese, and Traditional Chinese languages:

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0654798	B0654797	Caution Decal - Duplex	1	O/O	109 175	2 23	

<Page 109>

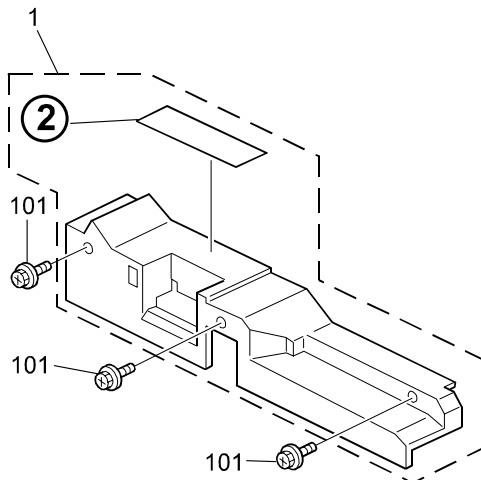

<Page 175>

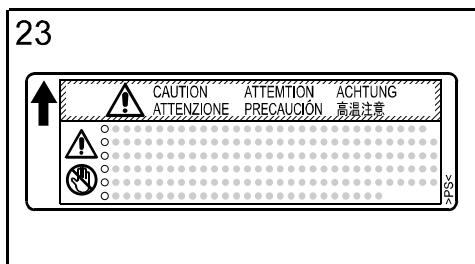

Reissued: 17-Jan-03

Model: Martini-C1	Date: 27-Dec-02	No.: MB064029a
-------------------	-----------------	----------------

Serial Number Update


The Serial Number information has been updated.

Modified Article: Oil Supply Roller Bushing and Bracket		Prepared by: K. Miura	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

To prevent the cleaning web pressure roller from locking up, the following parts have been changed:

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AE031026	AE031026	Bushing - Oil Supply Roller	2->1		95	9	
	B0654210	Rear Bushing - Oil Supply Roller	1	X/X	95	40	A
B0654212	B0654209	Stopper Bracket	1	X/X	95	11	A

Note: Replace both parts marked "A" together as a set.

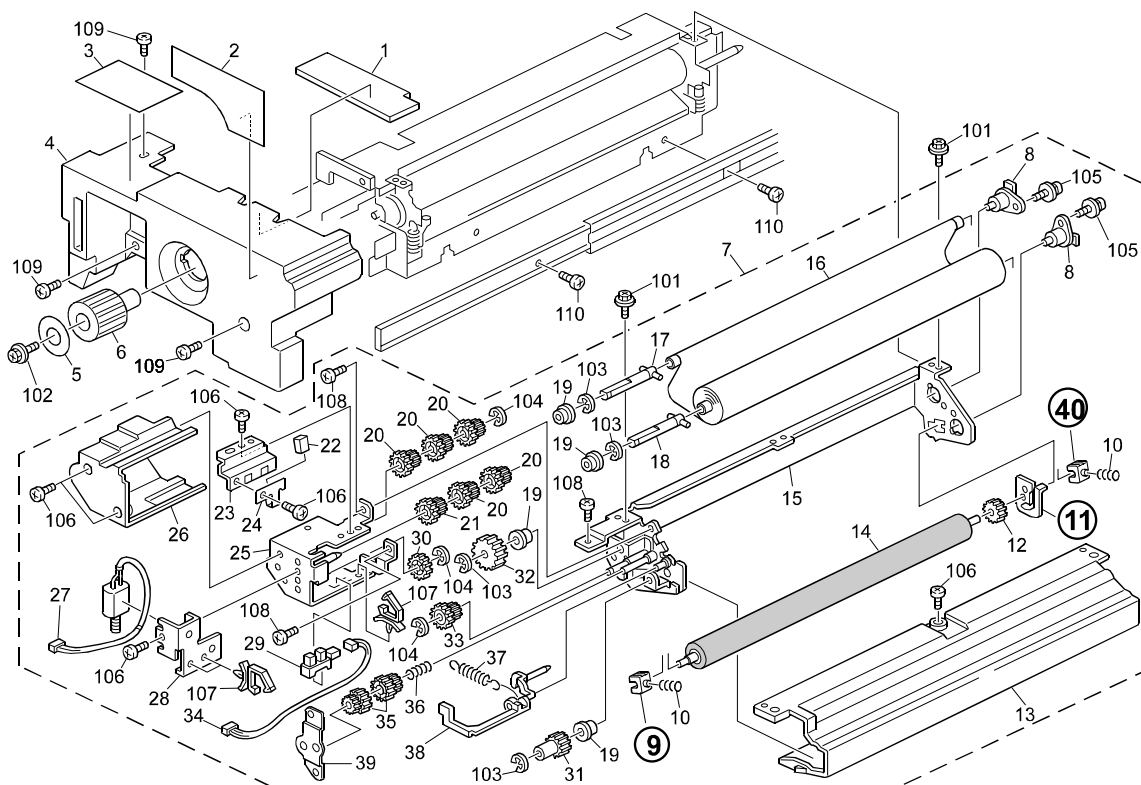

Reissued: 17-Jan-03

Model: Martini-C1	Date: 27-Dec-02	No.: MB064029a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4221000225
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282110001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P11120001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4221100216
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4221000365
Ricoh Aficio 1060	220/50,60	China	B064-69	J42211xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4321100001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292110001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P21120001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4321100101
Ricoh Aficio 1075	220/60	Korea	B065-28	J4321100223
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4321100157
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4321000478

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4225900493
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4325900502

Reissued: 10-Jan-03

Model: Martini-C1	Date: 27-Dec-02	No.: MB064030a
-------------------	-----------------	----------------

Serial Number Update


The Serial Number information has been updated.

Modified Article: PFC Board		Prepared by: K. Miura	
From: Technical Service Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The software for the PFC Board has been changed for the following reasons:

- To ensure the 1st tray lift motor does not over-run, which can cause jamming or skewing.
- To ensure that paper in the right tandem tray is correctly detected.
- To minimize occurrences of SC501/502/503.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0655132	B0655139	PFC Board	1	X/O	133	3	

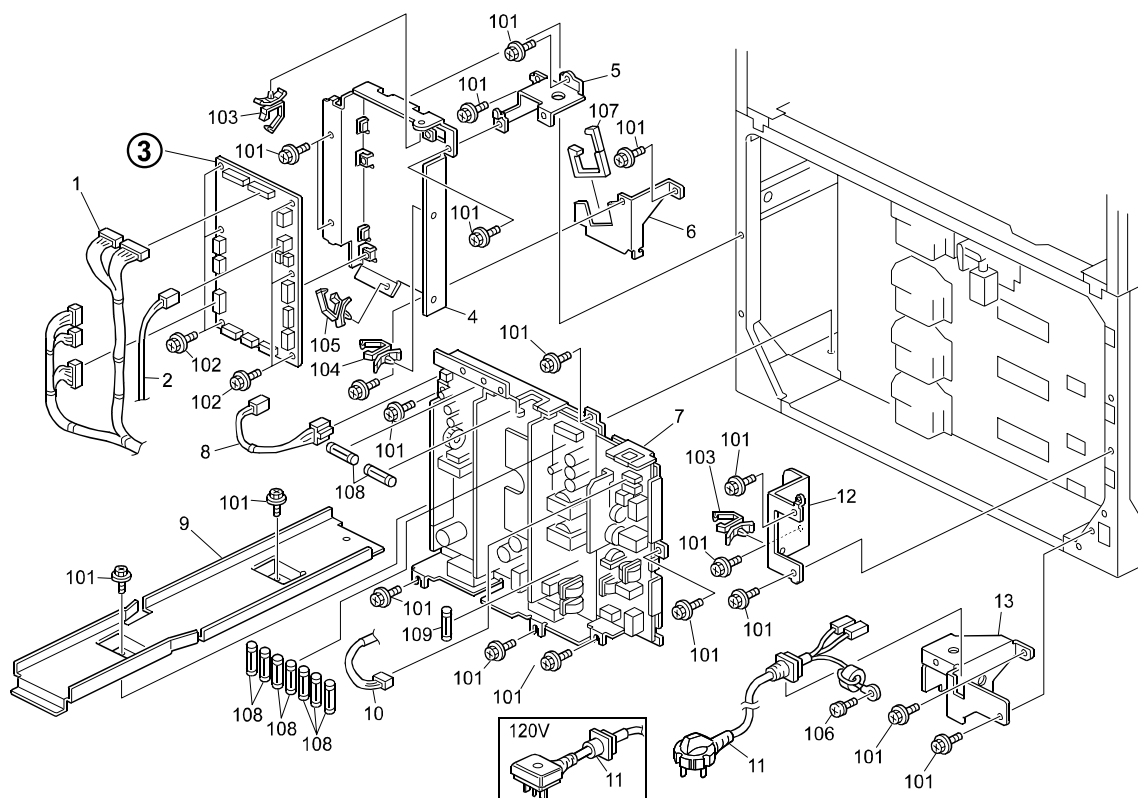

Reissued: 10-Jan-03

Model: Martini-C1	Date: 27-Dec-02	No.: MB064030a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4220700001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282070001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10720009
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4220700176
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4220700942
Ricoh Aficio 1060	220/50,60	China	B064-69	J42207xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4320700001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292070001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20720001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4320700201
Ricoh Aficio 1075	220/60	Korea	B065-28	J43212xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4320700479
Ricoh Aficio 1075	220/50, 60	China	B065-69	J43212xxxxx

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4225500200
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4325500248

Reissued: 17-Jan-03

Model: Martini-C1	Date: 27-Dec-02	No.: MB064031a
-------------------	-----------------	----------------


Serial Number Update

The Serial Number information has been updated.

Modified Article: Lower Right Cover and Lower Left Cover		Prepared by: K. Miura	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The Lower Right and Left Covers have been changed to ensure they are not deformed from stress during transport.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0651306	B0651333	Lower Right Cover	1	X/O	17	32	
B0651307	B0651334	Lower Left Cover	1	X/O	17	6	

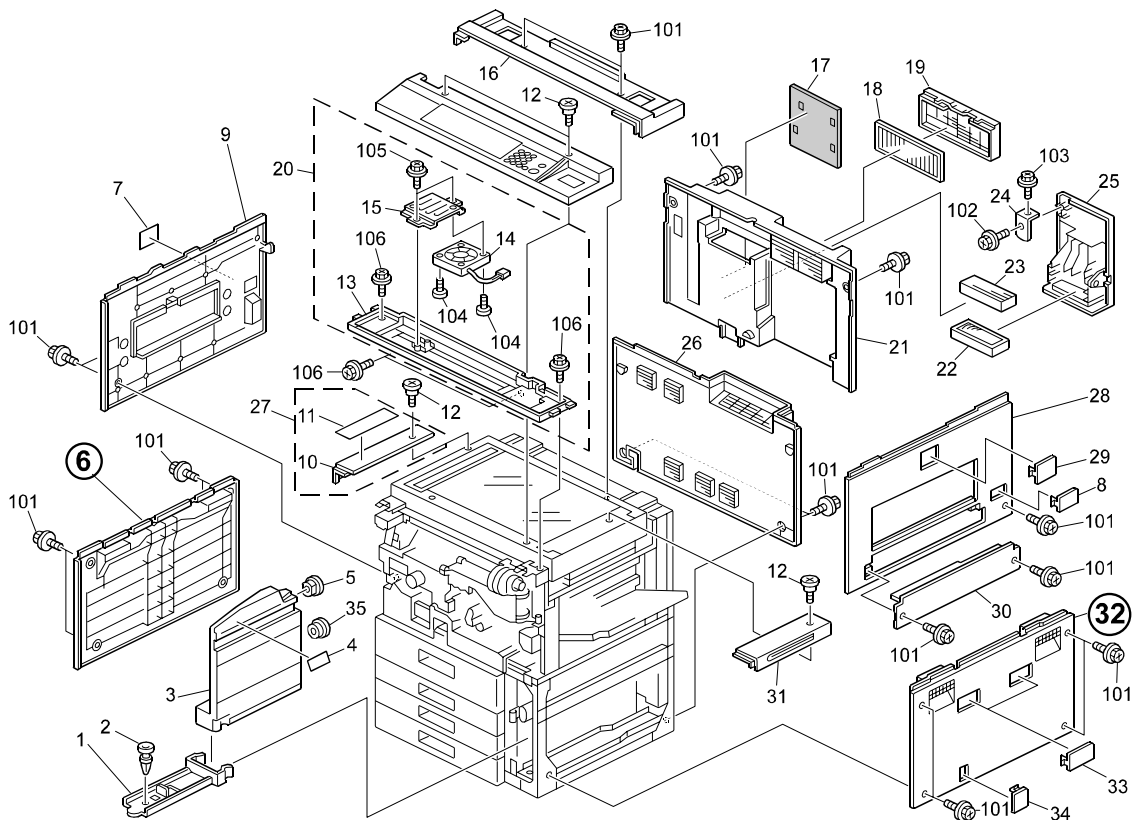

Reissued: 17-Jan-03

Model: Martini-C1	Date: 27-Dec-02	No.: MB064031a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4221000001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282100001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P11120001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4221000077
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4221000365
Ricoh Aficio 1060	220/50,60	China	B064-69	J42210xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4321000001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292100001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P21020001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4321000232
Ricoh Aficio 1075	220/60	Korea	B065-28	J4321100223
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4321000442
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4321000473

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4225800532
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4325800519

Reissued: 10-Jan-03

Model: Martini-C1	Date: 20-Dec-02	No.: MB064017a
-------------------	-----------------	----------------

Serial Number Update

The Serial Number information has been updated.


Modified Article: Cushion		Prepared by: K. Miura	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The following part has been added to ensure the Brush Roller Gear does not break:

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	AA130042	Sleeve	1		85	30	
	A3764131	Cushion - T1	1		85	31	
04514008B		Tapping Screw M4x8			85	104	
	04514014B	Tapping Screw M4x14		X/O	85	107	

Before installing the Cushion -T1 (A3764131), insert the Sleeve (AA130042) into the hole in the Cushion - T1.

Note: Another part was also added for this issue, as announced in MB# MB064018. For details on the above issue, see RTB #RB064010.

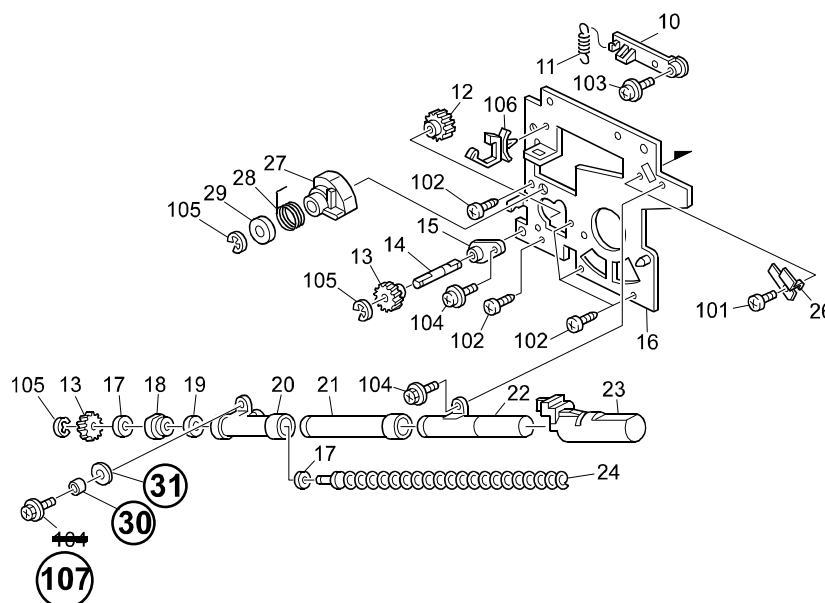

Reissued: 10-Jan-03

Model: Martini-C1	Date: 20-Dec-02	No.: MB064017a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4221100001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282120001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P11120001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4221100216
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4221100541
Ricoh Aficio 1060	220/50,60	China	B064-69	J42211xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4321100001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292110008
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P21120001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4321100101
Ricoh Aficio 1075	220/60	Korea	B065-28	J4321100223
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4321100157
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4321100208

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4225800864
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4325800494

Reissued: 10-Jan-03

Model: Martini-C1	Date: 20-Dec-02	No.: MB064020a
-------------------	-----------------	----------------


Serial Number Update

The Serial Number information has been updated.

Modified Article: Hot Roller		Prepared by: K. Miura	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The following has been changed to ensure that the adhesive between the surface layer and the metallic core is applied evenly.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AE011074	AE011075	Hot Roller	1	X/O	99	23	

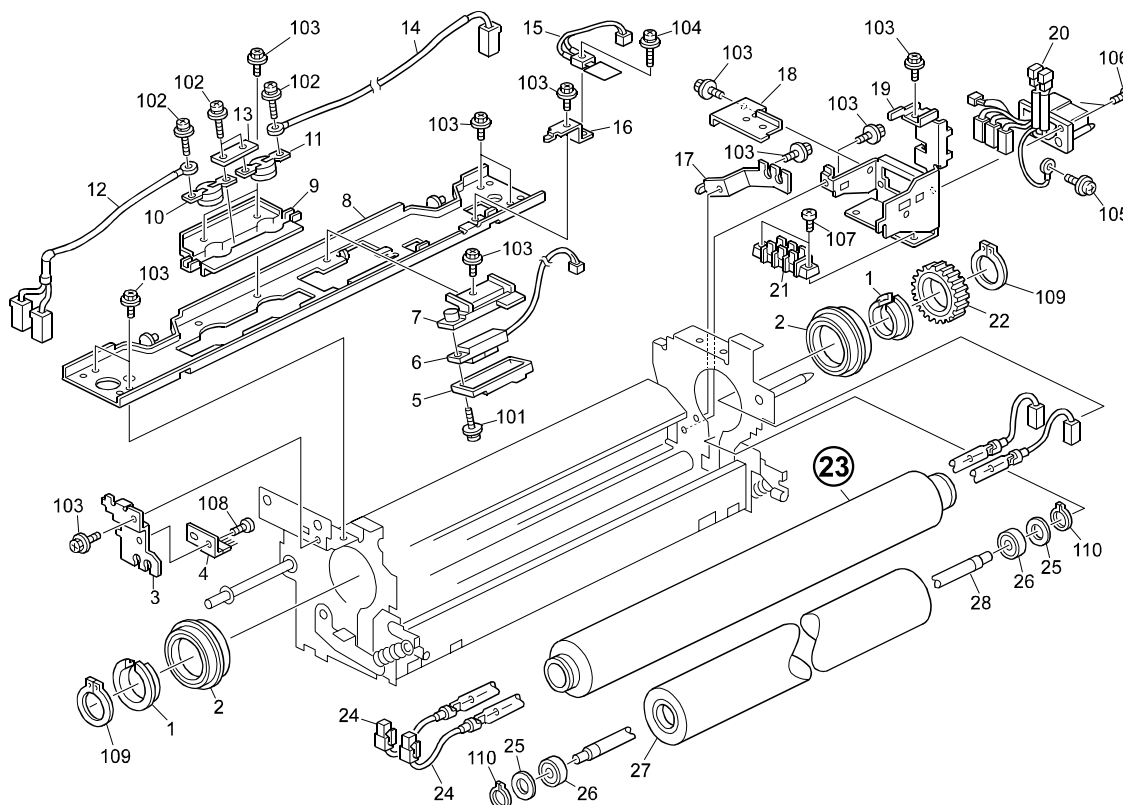

Reissued: 10-Jan-03

Model: Martini-C1	Date: 20-Dec-02	No.: MB064020a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4221000001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282090001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P11120001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4220900001
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4220800210
Ricoh Aficio 1060	220/50,60	China	B064-69	J42209xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4321000001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292080041
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20820064
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4320800293
Ricoh Aficio 1075	220/60	Korea	B065-28	J43212xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4320800507
Ricoh Aficio 1075	220/50, 60	China	B065-69	J43212xxxxx

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4225800629
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4325800358

Reissued: 18-Feb-03

Model: Martini-C1	Date: 7-Jan-03	No.: MB064032a
-------------------	----------------	----------------

Serial Number Update


The Serial Number information has been updated.

Modified Article: Registration Rollers		Prepared by: K. Miura	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The Upper and Lower Registration Rollers have been changed to ensure noise does not occur from the rollers.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0652613	B0652623	Upper Registration Roller	1	X/X	71	6	
B0652617	B0652627	Lower Registration Roller	1	X/X	71	5	

NOTE: These parts should be changed as a set.

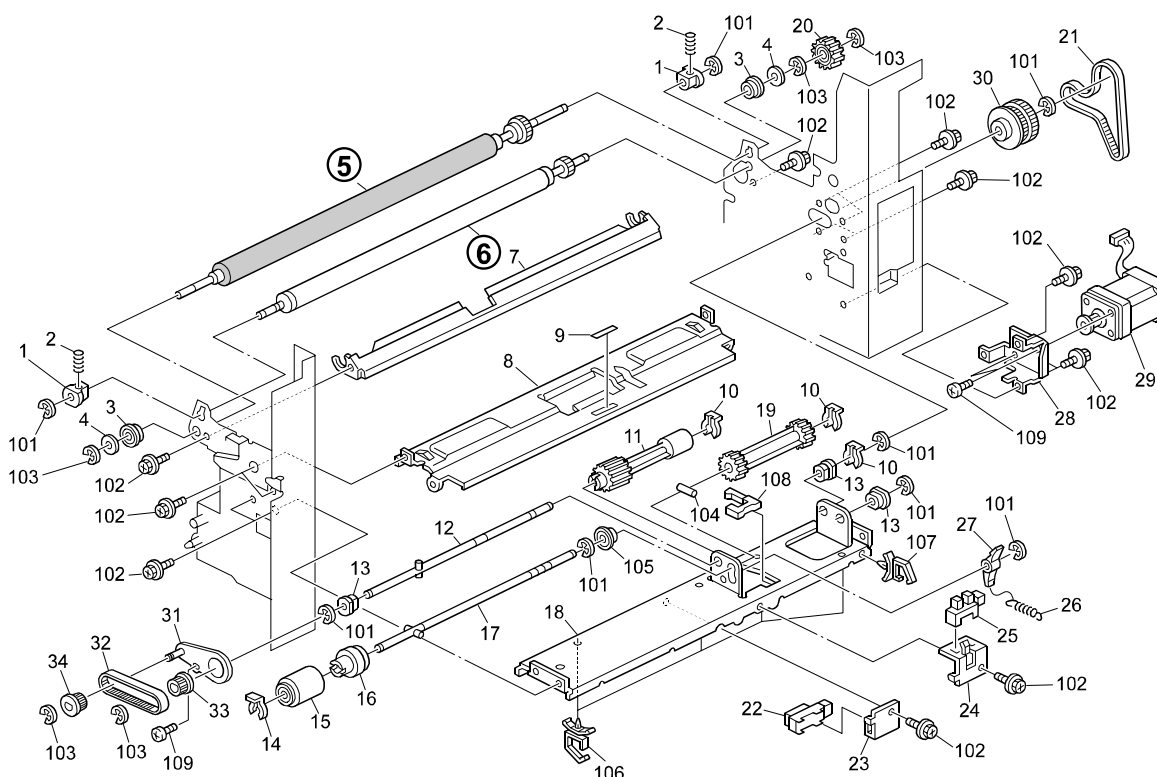

Reissued: 18-Feb-03

Model: Martini-C1	Date: 7-Jan-03	No.: MB064032a
-------------------	----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4211000203
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282110001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P11120001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4221100216
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4221000365
Ricoh Aficio 1060	220/50,60	China	B064-69	J42211xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4321100001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292110001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P21120001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4321100101
Ricoh Aficio 1075	220/60	Korea	B065-28	J4321100223
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4321100157
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4321000478

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4225900846
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4325900720

Reissued: 18-Feb-03

Model: Martini-C1	Date: 7-Jan-03	No.: MB064033a
-------------------	----------------	----------------


Serial Number Update

The Serial Number information has been updated.

Modified Article: Pick-up Roller Bracket		Prepared by: K. Miura	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

To ensure that operators do not bend the pick-up roller back too far when removing jammed originals, which can prevent the roller from returning to its default position, the shape of the following part has been changed.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B4772221	B4772222	Pick-up Roller Bracket	1	X/O	25	3	

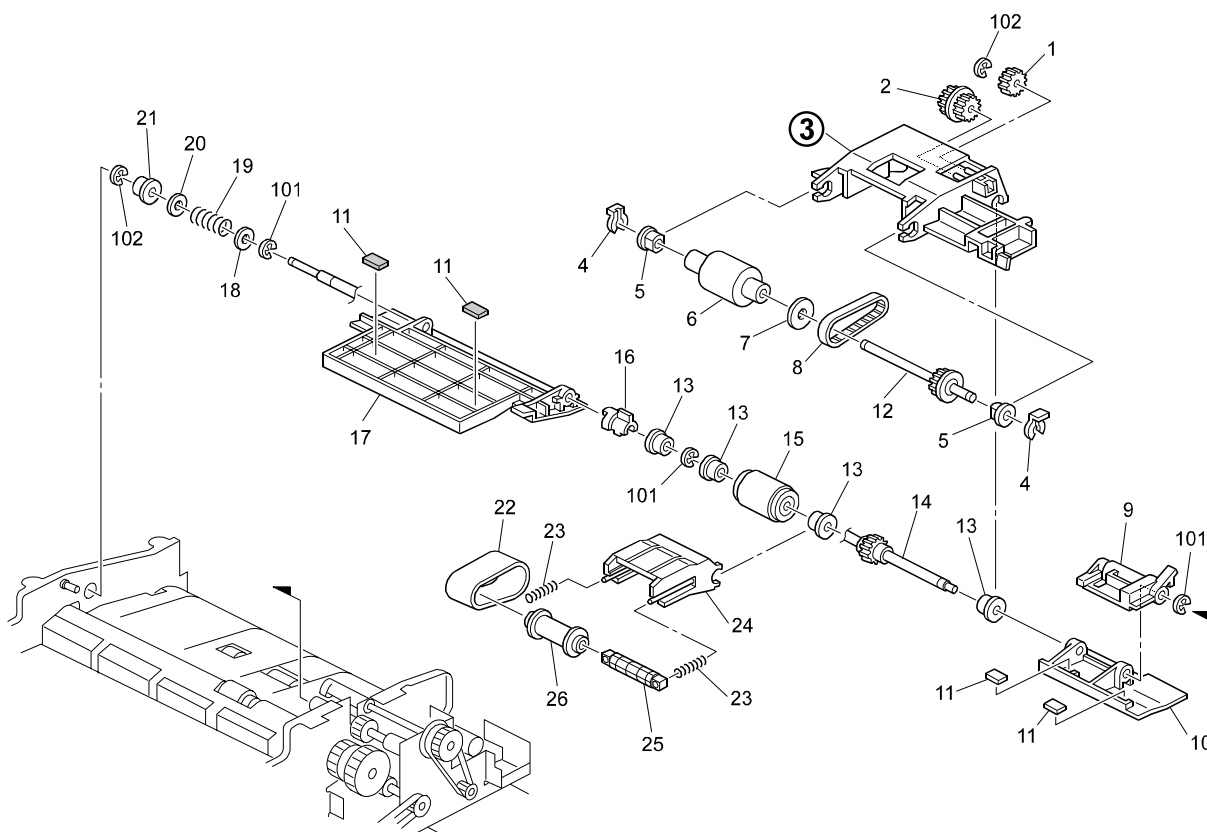

Reissued: 18-Feb-03

Model: Martini-C1	Date: 7-Jan-03	No.: MB064033a
-------------------	----------------	----------------

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4220800001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282080001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10820001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4220700250
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4220700942
Ricoh Aficio 1060	220/50,60	China	B064-69	J42208xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4320800001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292080001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20820001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4320700201
Ricoh Aficio 1075	220/60	Korea	B065-28	J4321100223
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4320700479
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4321000473

[REI (U.S.A) Production]


MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4225600518
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4325600304

Model: Martini-C1		Date: 7-Jan-03	No.: MB064034
Modified Article: Caution Decal		Prepared by: K. Miura	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()


Please correct your Parts Catalog as follows:

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	AA000550	Caution Decal - CHN	1		17 175	4 5	

<Page 17>

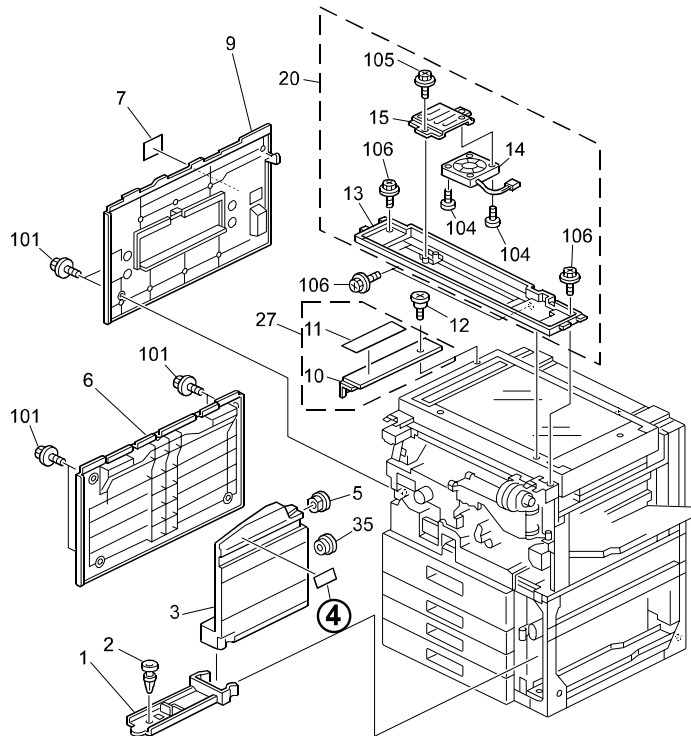

<Page 175>

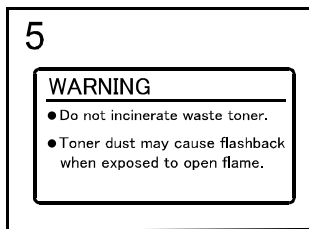

Reissued: 14-Mar-03

Model: Martini-C1	Date: 7-Feb-03	No.: MB064035a
-------------------	----------------	----------------


Serial Number Update

The Serial Number information has been update.

Modified Article: Paper Feed Sensor Bracket		Prepared by: M.Tsuyuki	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The following part has been modified to ensure that the Driven Exit Roller stays properly secured in place.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0654355	B0654358	Paper Feed Sensor Bracket	1	X/O	103	12	

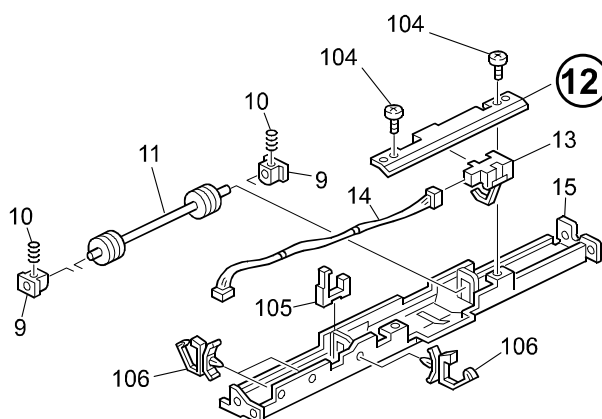

Reissued: 14-Mar-03

Model: Martini-C1	Date: 7-Feb-03	No.: MB064035a
-------------------	----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4221100101
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282120001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P11120001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4221100216
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4221100541
Ricoh Aficio 1060	220/50,60	China	B064-69	J42211xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4321100001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292120001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P21120001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4321100101
Ricoh Aficio 1075	220/60	Korea	B065-28	J4321100223
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4321100157
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4321100208

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4226001310
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4334900001

Reissued: 19-Mar-03

Model: Martini-C1	Date: 18-Feb-03	No.: MB064036a
-------------------	-----------------	----------------


Serial Number Update

The Serial Number information has been updated.

Modified Article: One-way Clutch Gears		Prepared by: M.Tsuyuki	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

To ensure the one-way clutch gear does not slip, the following parts have been changed.
For details, please refer to RTB #RB064020.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AB011467	AB011490	Gear - 38Z	1	X/O	65	23	
AB011468	AB011491	Gear - 21Z	1	X/O	65	24	

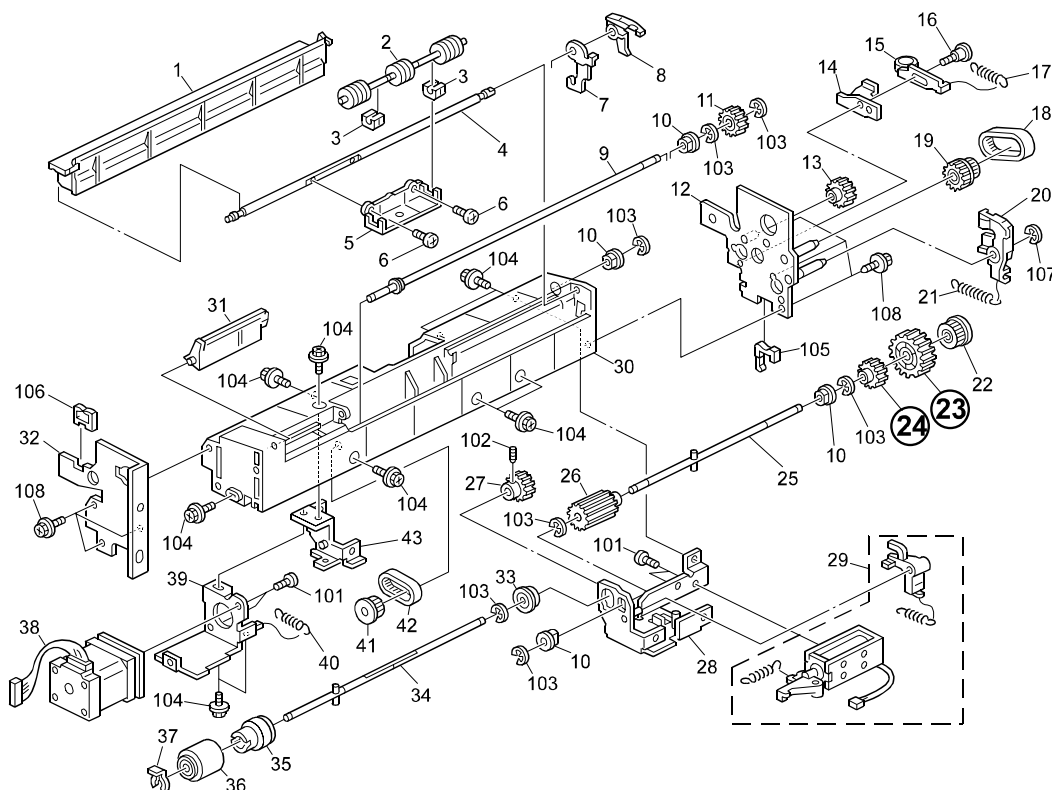

Reissued: 19-Mar-03

Model: Martini-C1	Date: 18-Feb-03	No.: MB064036a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4230200416
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4230200001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1283020001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P1023xxxx
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4230200146
Ricoh Aficio 1060	220/60	Korea	B064-28	J4230200316
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4230200336
Ricoh Aficio 1060	220/50,60	China	B064-69	J42302xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J43302xxxxx
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4330200145
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L129302xxxx
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P2023xxxx
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4330200001
Ricoh Aficio 1075	220/60	Korea	B065-28	J4330200021
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4330200031
Ricoh Aficio 1075	220/50, 60	China	B065-69	J43302xxxxx

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4235100526
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4335100428

Reissued: 5-Mar-03

Model: Martini-C1	Date: 18-Feb-03	No.: MB064037a
-------------------	-----------------	----------------


Serial Number Update

The Serial Number information has been updated.

Modified Article: Sensor Harnesses		Prepared by: K. Miura	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☒ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☐ Other	

The following have been changed to provide an even greater margin in conforming to EMI Standards.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B4775641		Paper Size Sensor Harness	1		39	2	
B4775661	B4775601	Registration Sensor Harness	1	X/O	39	3	
	16070622	Ferrite Core TFC16816	1		39	109	

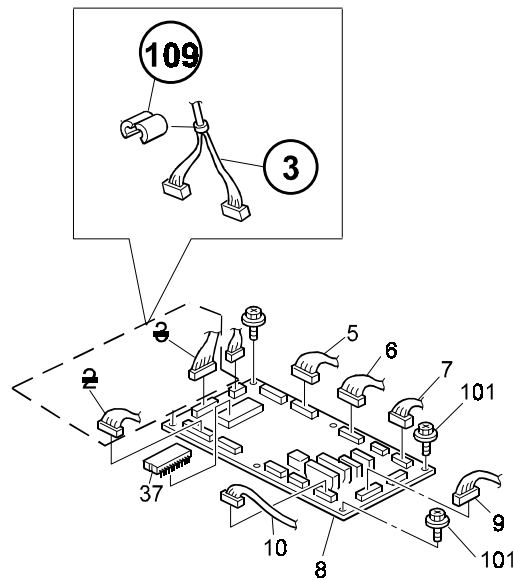

Reissued: 5-Mar-03

Model: Martini-C1	Date: 18-Feb-03	No.: MB064037a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4230200416
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4230100275
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1283010021
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10130001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4230200146
Ricoh Aficio 1060	220/60	Korea	B064-28	J4230200316
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4230200336
Ricoh Aficio 1060	220/50,60	China	B064-69	J4230100348
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J43302xxxxx
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4330200145
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1293010003
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20130001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4330100037
Ricoh Aficio 1075	220/60	Korea	B065-28	J4330200021
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4330200031
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4330100034

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4235100003
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4335100001

Reissued: 14-Mar-03

Model: Martini-C1	Date: 18-Feb-03	No.: MB064038a
-------------------	-----------------	----------------

Serial Number Update


The Serial Number information has been updated.

Modified Article: Decals		Prepared by: M.Tsuyuki	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☒ Other	

The German, French, Italian and Spanish versions of the following decals have been changed or added.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0651369	B4774371	Decal - Cleaning	1	X/O	15 175	32 41	
	B0653345	Toner Supply Decal - German	1		75 175	41 45	
	B0653346	Toner Supply Decal - French	1		75 175	41 45	
	B0653347	Toner Supply Decal - Italian	1		75 175	41 45	
	B0653348	Toner Supply Decal - Spanish	1		75 175	41 45	
G5646076	G5646077	Decal - Exposure Glass	1	X/O	27 175	8 40	


<Page 15 Index 32>

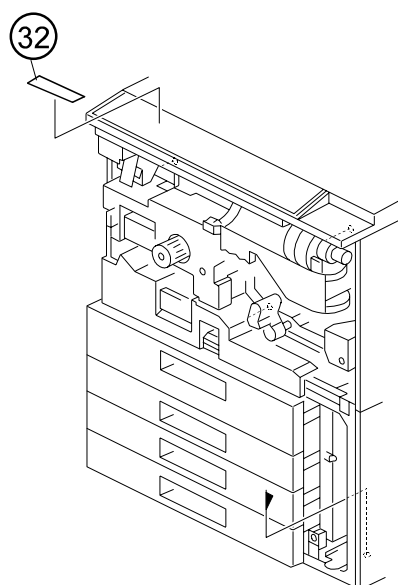


Reissued: 14-Mar-03

Model: Martini-C1	Date: 18-Feb-03	No.: MB064038a
-------------------	-----------------	----------------

<Page 27 Index 8>

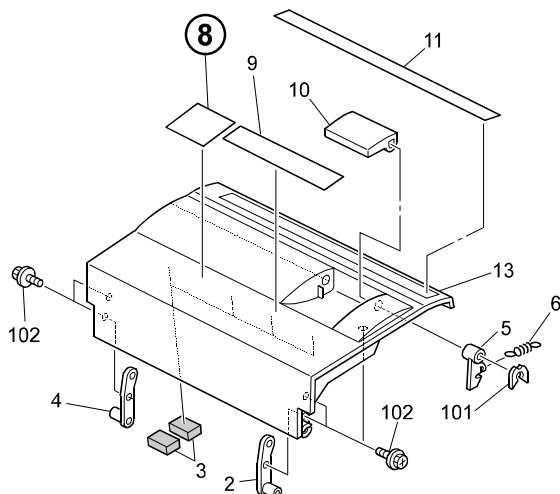


<Page 75 Index 41>

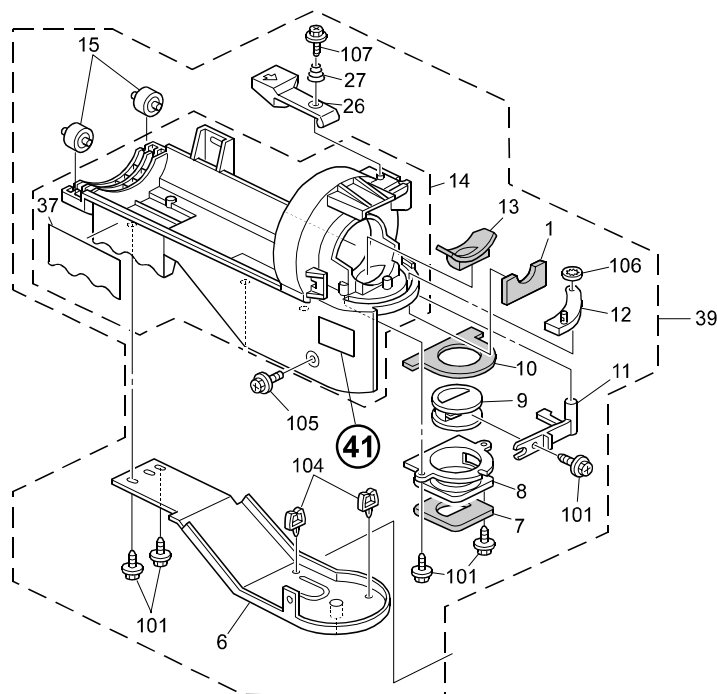


Reissued: 14-Mar-03

Model: Martini-C1	Date: 18-Feb-03	No.: MB064038a
-------------------	-----------------	----------------


<Page 175 Index 40>

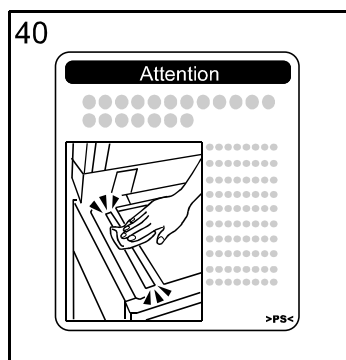

<Page 175 Index 41>

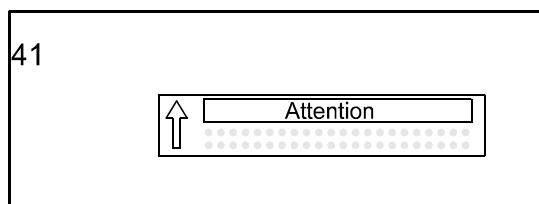

<Page 175 Index 45>

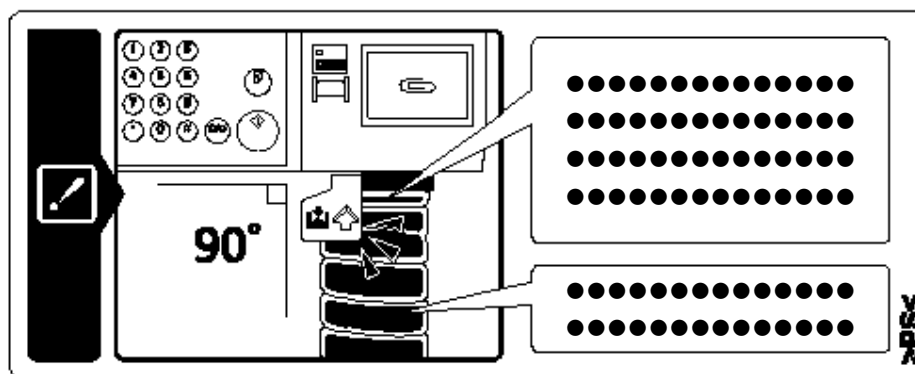

Reissued: 14-Mar-03

Model: Martini-C1	Date: 18-Feb-03	No.: MB064038a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J42303xxxxx
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4230100210
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1283010001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10130001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4230100001
Ricoh Aficio 1060	220/60	Korea	B064-28	J42303xxxxx
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4230100284
Ricoh Aficio 1060	220/50,60	China	B064-69	J42303xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J43303xxxxx
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4330200145
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1293010001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20130001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4321200064
Ricoh Aficio 1075	220/60	Korea	B065-28	J43303xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4330100001
Ricoh Aficio 1075	220/50, 60	China	B065-69	J43303xxxxx

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4234901037
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4335000001

Reissued: 21-May-03

Model: Martini-C1	Date: 6-Mar-03	No.: MB064039a
-------------------	----------------	----------------

MB Correction

The cut-in serial numbers for REI (USA) production have been deleted, as the following part is not used on the N.A. model.

Modified Article: End Fence Guide		Prepared by: K. Miura	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	


The parts below have been modified to ensure that the shaft for the front end fence of the tandem tray does not break.

This part can break under the following conditions:

1. If the right tray is pushed in with the paper in the left tray not properly pushed up against the back fence, the end fence will rub up against the paper stack, which can cause the end fence to open and the end fence guide to hit the left tray bottom plate.
2. If the right tray is pushed in after it has separated from the rail, the end fence can open momentarily when the tray tries to return to the rail. If the opened fence lines up with the side indentations of the left tray bottom plate, the end fence guide can hit the left tray bottom plate.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2936712	B0656712	End Fence Guide	2	X/O	57	7	

Note: Both the old and new End Fence Guides above can be used with the Rear End Fence (O/O).

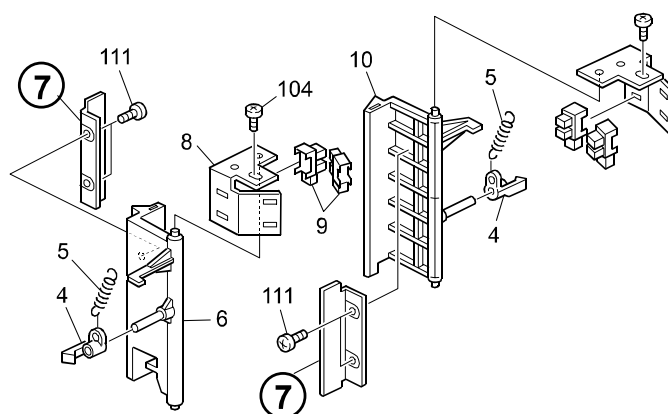

Reissued: 21-May-03

Model: Martini-C1	Date: 6-Mar-03	No.: MB064039a
-------------------	----------------	----------------

[RCL (Japan) Production]


MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4230200416
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4230100210
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1283010001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10130001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4230100180
Ricoh Aficio 1060	220/60	Korea	B064-28	J4230200316
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4230100284
Ricoh Aficio 1060	220/50,60	China	B064-69	J4230100344
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4330100029
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4330200145
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1293010001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20130001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4330100037
Ricoh Aficio 1075	220/60	Korea	B065-28	J4330200021
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4330100001
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4330100034

Model: Martini-C1		Date: 14-Mar-03	No.: MB064040
Modified Article: Upper Fusing Cover and Guide Plate Bracket		Prepared by: M.Tsuyuki	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The following have been changed due to parts standardization with the Japanese model.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0654117	B1104117	Upper Fusing Cover	1	O/O	97	7	
B0654391	B1104391	Guide Plate Bracket	1	O/O	97	19	
03604006B		Hexagonal Head Screw - M4x6			99	103	
	09544006B	Screw - M4x6		O/O	99	111	

<Page 97>

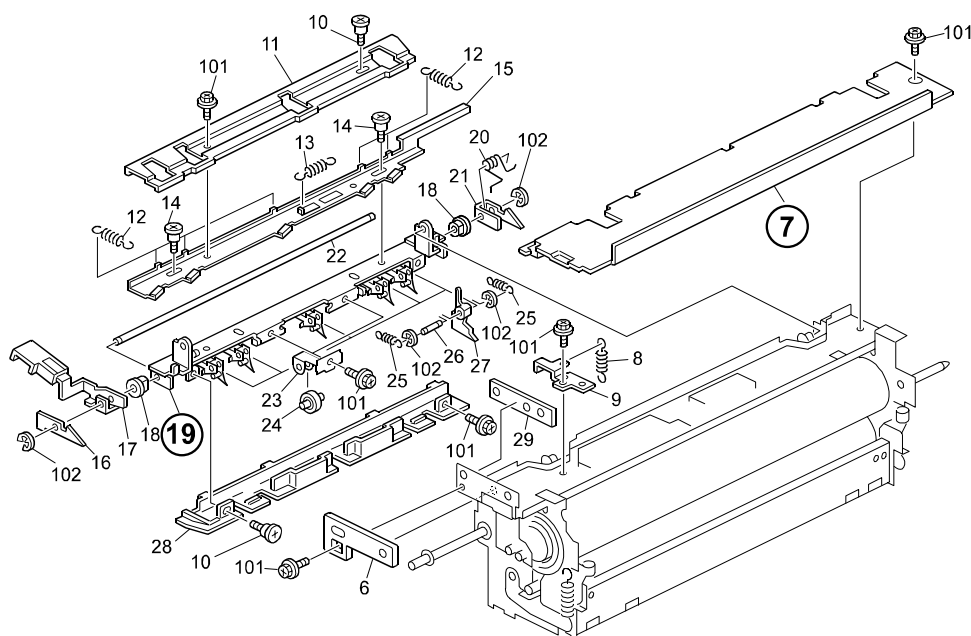


Model: Martini-C1

Date: 14-Mar-03

No.: MB064040

<Page 99>

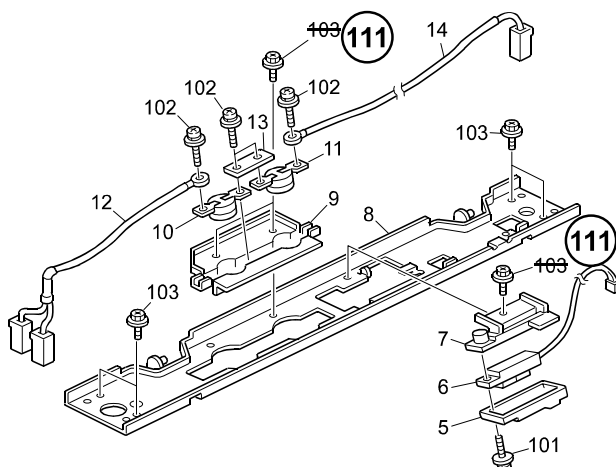

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J42ymmxxxxx
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J42ymmxxxxx
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L128ymmxxxxx
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P1mmyxxxxx
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J42ymmxxxxx
Ricoh Aficio 1060	220/60	Korea	B064-28	J42ymmxxxxx
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J42ymmxxxxx
Ricoh Aficio 1060	220/50,60	China	B064-69	J42ymmxxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J43ymmxxxxx
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J43ymmxxxxx
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L129ymmxxxxx
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P2mmyxxxxx
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J43ymmxxxxx
Ricoh Aficio 1075	220/60	Korea	B065-28	J43ymmxxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J43ymmxxxxx
Ricoh Aficio 1075	220/50, 60	China	B065-69	J43ymmxxxxx

Model: Martini-C1	Date: 14-Mar-03	No.: MB064040
-------------------	-----------------	---------------

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J42ymm(+48)xxxxx
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J43ymm(+48)xxxxx

Reissued: 6-May-03

Model: Martini-C1	Date: 14-Apr-03	No.: MB064041a
-------------------	-----------------	----------------

Serial Number Update


The Serial Number information has been updated.

Modified Article: Middle Thermistor		Prepared by: K. Miura	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The following have been changed to ensure that an abnormal temperature misdetection does not occur, which can occur when the silver contained in the adhesive separates out and gets in between the thermistor chip electrodes.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0654017	B0654018	Fusing Unit - 120V	1	X/O	97	1	
B0654027	B0654028	Fusing Unit - 230V	1	X/O	97	1	
B0654019	B0654020	Fusing Unit (TWN)	1	X/O	97	1	
AW100075		Thermistor	1		99	6	
	AW100084	Middle Thermistor	1	X/O	99	6	


<Page 97>

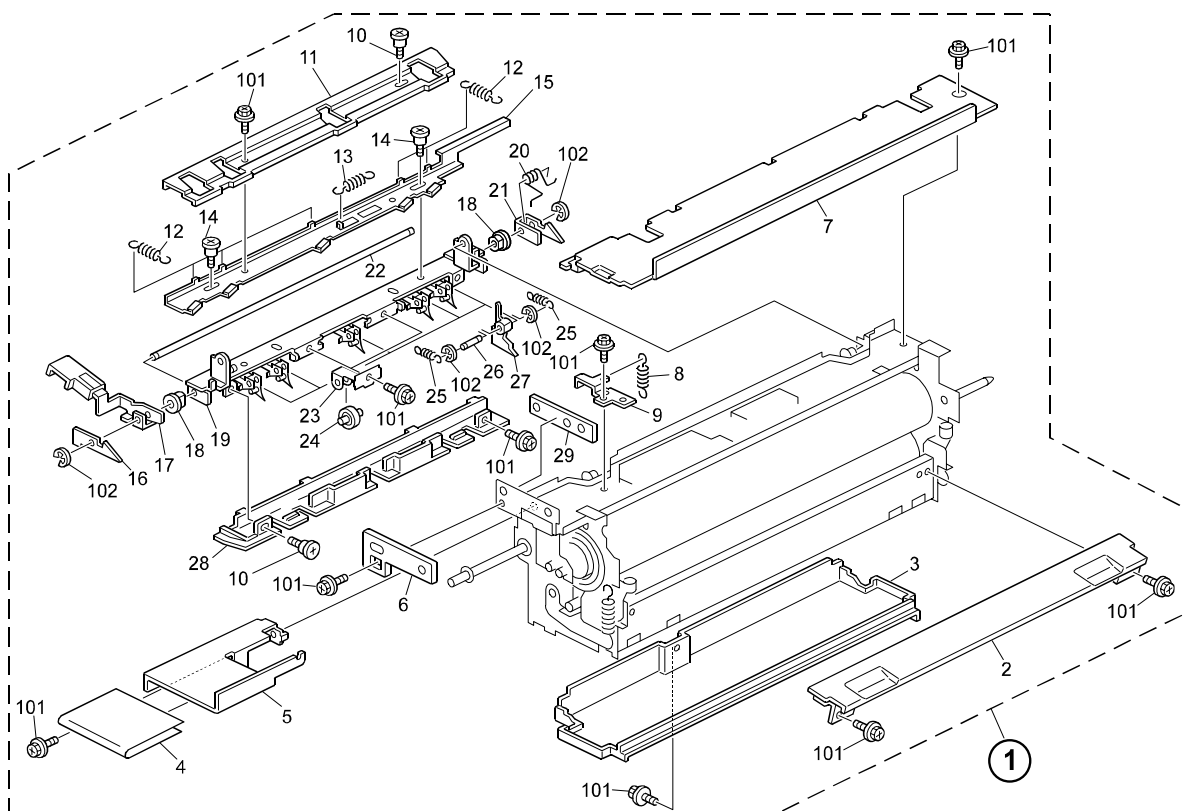

Reissued: 6-May-03

Model: Martini-C1	Date: 14-Apr-03	No.: MB064041a
-------------------	-----------------	----------------

<Page 99>

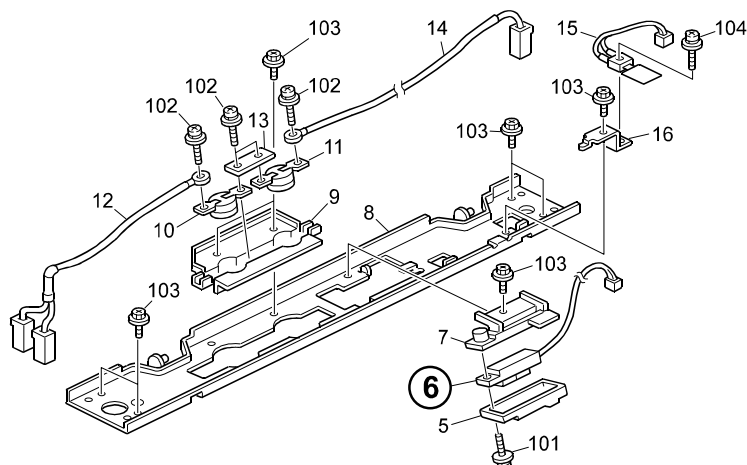

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4230200416
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4230100279
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1283010021
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10130001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4230200146
Ricoh Aficio 1060	220/60	Korea	B064-28	J4230200316
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4230200336
Ricoh Aficio 1060	220/50,60	China	B064-69	J4230200643
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J43302xxxxx
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4330200145
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1293010003
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20130001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4330100037
Ricoh Aficio 1075	220/60	Korea	B065-28	J4330200021
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4330200031
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4330400182

Reissued: 6-May-03

Model: Martini-C1	Date: 14-Apr-03	No.: MB064041a
-------------------	-----------------	----------------

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4234900550
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4334900338

Reissued: 6-May-03

Model: Martini-C1	Date: 15-Apr-03	No.: MB064042a
-------------------	-----------------	----------------

Serial Number Update


The Serial Number information has been updated.

Modified Article: Pulley Drive Wire A'ssy		Prepared by: K. Miura	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The Pulley Drive Wire Assembly has been changed to ensure that the wire does not get locked between the pulley and pulley cover.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2486684	A2936684	Pulley Drive Wire Ass'y	2	X/X	57	19	

Note: When replacing, it is necessary to replace **both** Pulley Drive Assemblies together as a set.

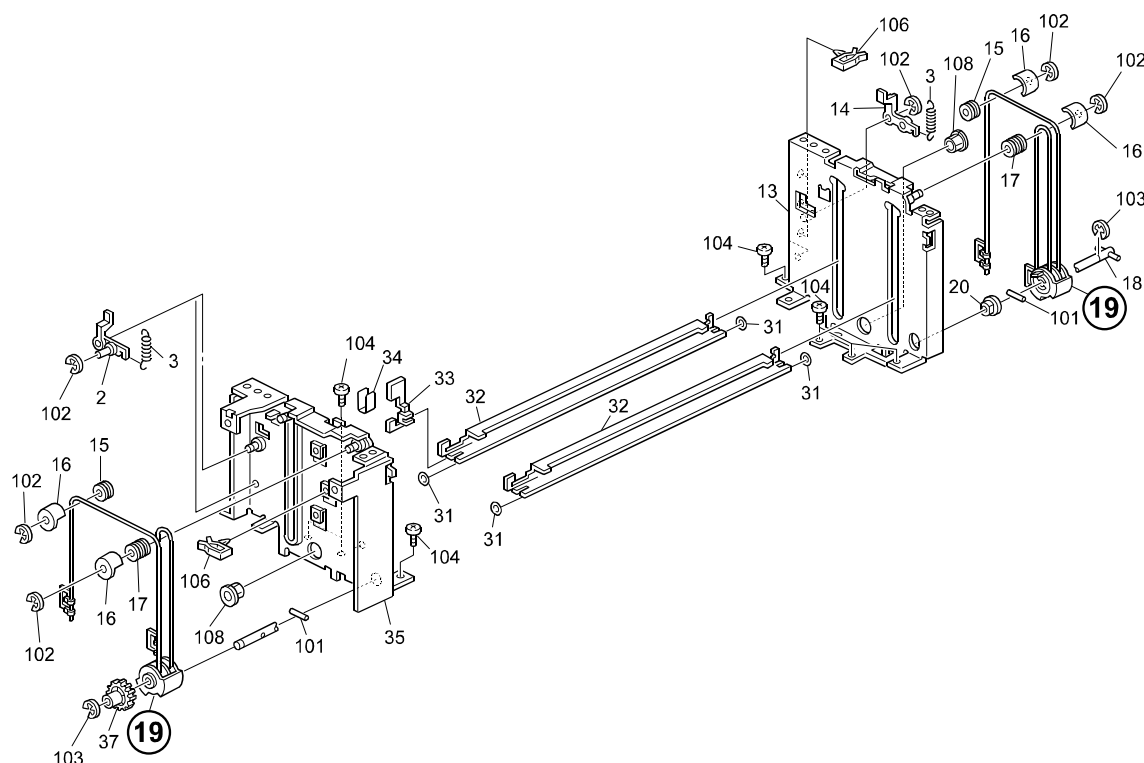

Reissued: 6-May-03

Model: Martini-C1

Date: 15-Apr-03

No.: MB064042a

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4221000001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282100001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P11120001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4221000077
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4221000365
Ricoh Aficio 1060	220/50,60	China	B064-69	J42210xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4321000001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292100001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P21020001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4321000232
Ricoh Aficio 1075	220/60	Korea	B065-28	J4321100223
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4321000442
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4321000473


[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4225900298
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4325900292

Model: Martini-C1		Date: 17-Apr-03	No.: MB064043
Modified Article: Contact Image Sensor		Prepared by: K. Miura	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☒ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The following part has been changed due to a vendor change.


Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B4775830	B4775840	Contact Image Sensor	1	O/O	33	14	

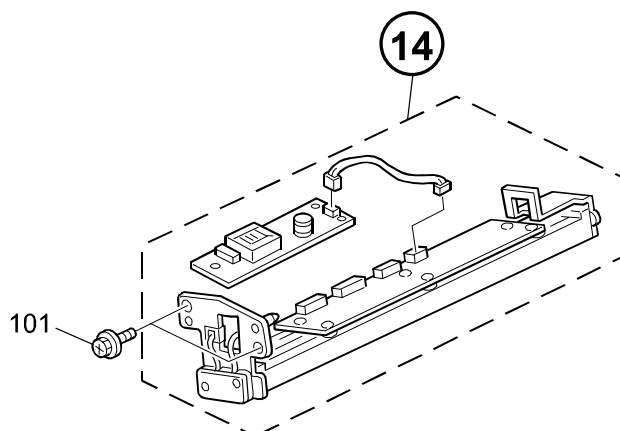

Model: Martini-C1		Date: 17-Apr-03	No.: MB064044
Modified Article: Harness Clamp		Prepared by: K. Miura	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☒ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The following has been changed to facilitate assembly.


Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
11050511	11050516	Harness Clamp - LWS-0306ZC			117	104	
		Clamp		O/O	117	110	

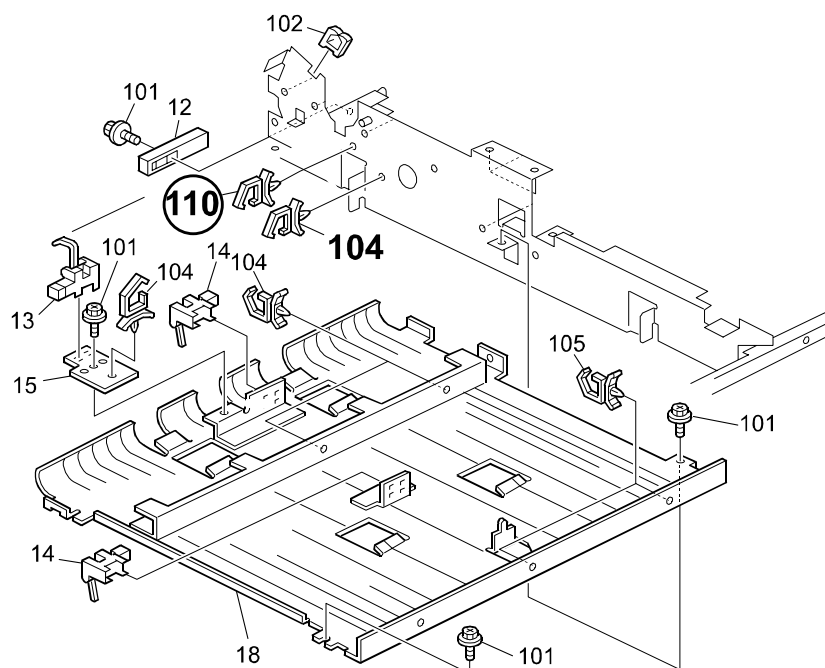

Model: Martini-C1		Date: 9-May-03	No.: MB064045
Modified Article: Original Connecting Harness		Prepared by: K. Miura	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Please apply the following correction to your Parts Catalogs.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B4775671		Registration Relay Harness	1		23	17	
	B4775741	Original Connecting Harness	1		23	17	

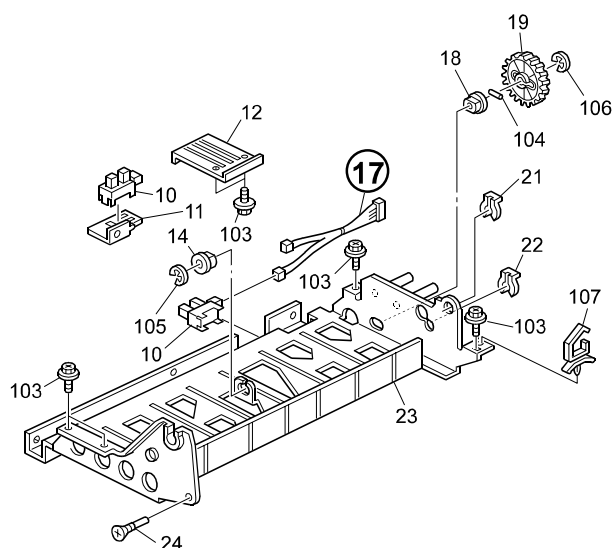

Reissued: 2-Jul-03

Model: Martini-C1	Date: 4-Jun-03	No.: MB064046a
-------------------	----------------	----------------

Serial Number Update


The Serial Number information has been update.

Modified Article: Hot Roller		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The Hot Roller has been modified to ensure that it reaches its lifetime of 500k.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0654018	B0654016	Fusing Unit - 120V	1	X/O	97	1	
B0654028	B0654029	Fusing Unit - 230V	1	X/O	97	1	
B0654020	B0654021	Fusing Unit (TWN)	1	X/O	97	1	
AE011075	AE011087	Hot Roller	1	X/O	99	23	


<Page 97>

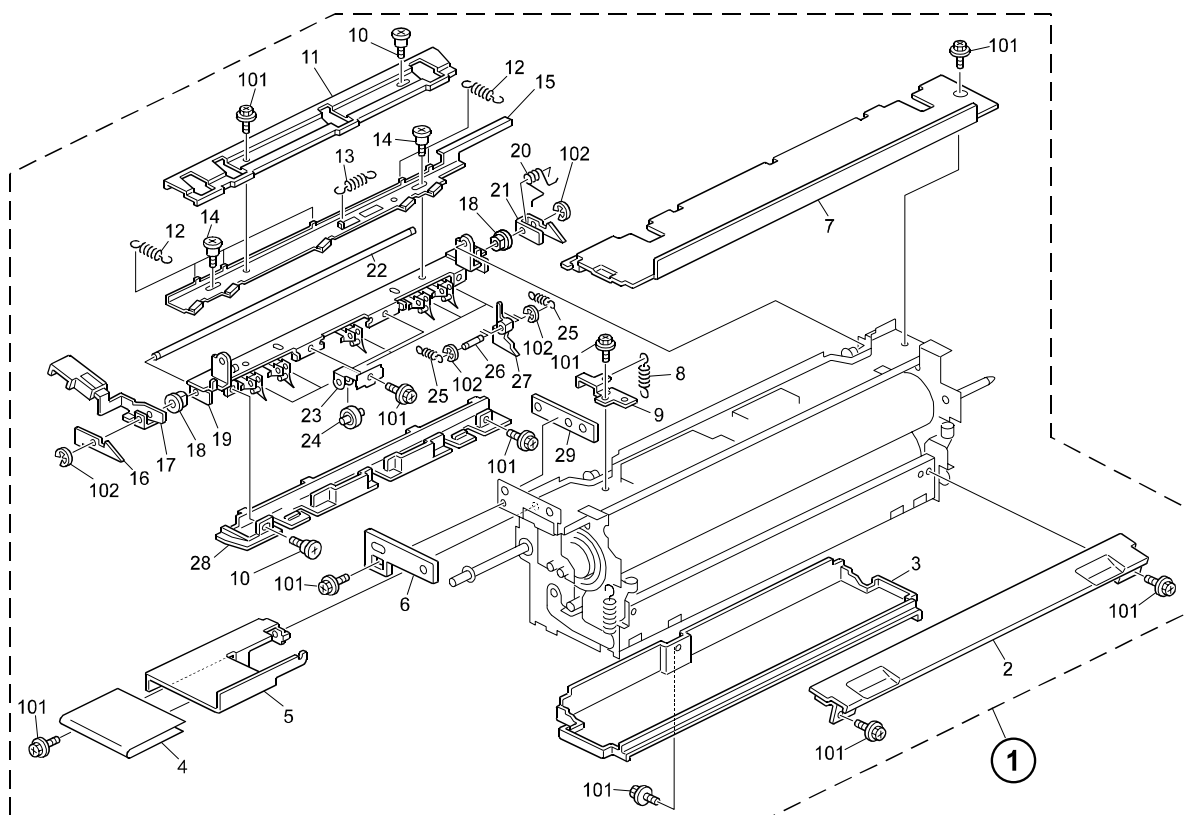

Reissued: 2-Jul-03

Model: Martini-C1	Date: 4-Jun-03	No.: MB064046a
-------------------	----------------	----------------

<Page 99>

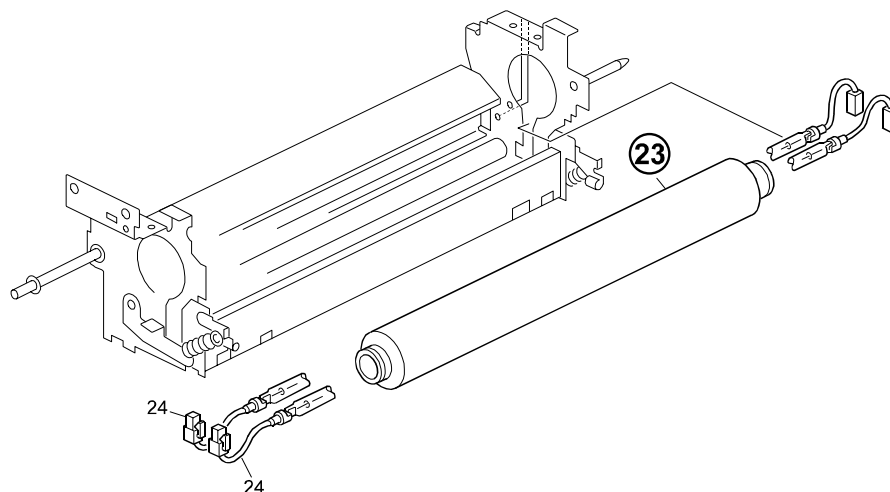

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4230500622
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4230500307
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1283050001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10530001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4230500001
Ricoh Aficio 1060	220/60	Korea	B064-28	J4230500246
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4230500256
Ricoh Aficio 1060	220/50,60	China	B064-69	J4230500300
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J43305xxxxx
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4330500063
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1293050001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20530001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4330500001
Ricoh Aficio 1075	220/60	Korea	B065-28	J4330500078
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4330500088
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4330500096

Reissued: 2-Jul-03

Model: Martini-C1	Date: 4-Jun-03	No.: MB064046a
-------------------	----------------	----------------


[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4235400001
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4335400001

Model: Martini-C1		Date: 4-Jun-03	No.: MB064047
Modified Article: Development Drive Motor		Prepared by: K. Miura	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The following has been changed due to parts standardization with the Japanese model.


Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0655305	B1105305	Development Drive Motor	1	O/O	119	1	

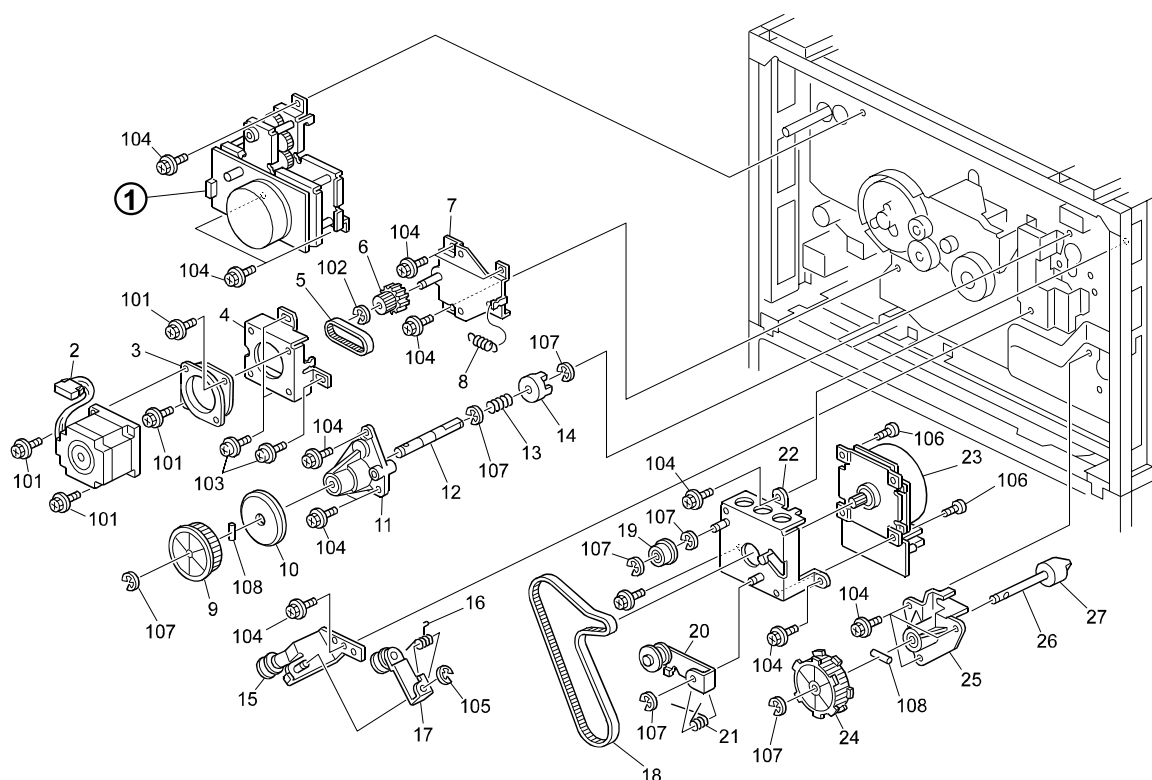

Model: Martini-C1		Date: 4-Jun-03	No.: MB064048
Modified Article: Screw for Heater Holder		Prepared by: K. Miura	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☒ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The following has been changed to facilitate factory assembly.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
04514008B	03604008B	Philips Tapping Screw - M4x8			139	101	
		Screw - M3x8		O/O	139	105	

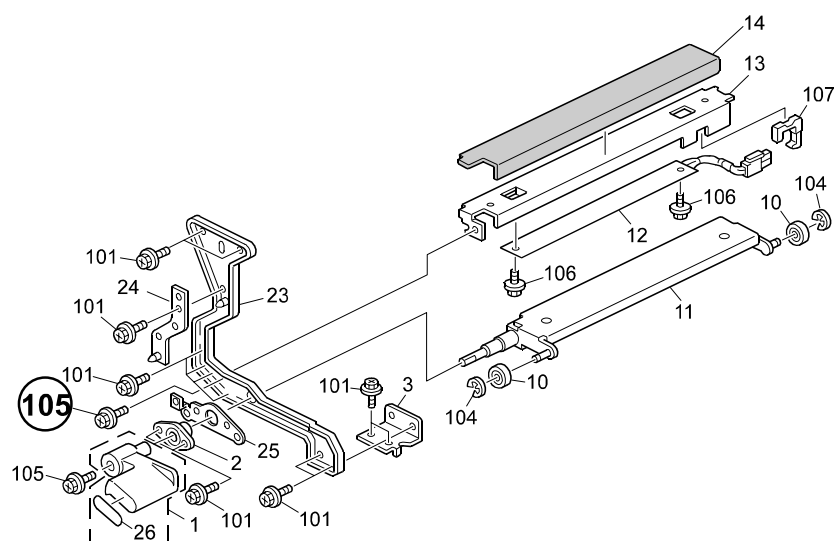


Model: Martini-C1		Date: 4-Jun-03	No.: MB064049
Modified Article: IPU Board		Prepared by: K. Miura	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The following has been changed due to parts standardization with the Japanese model.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0655144	B1105140	IPU Board	1	O/O	127 163	28 *	

<Page 127>

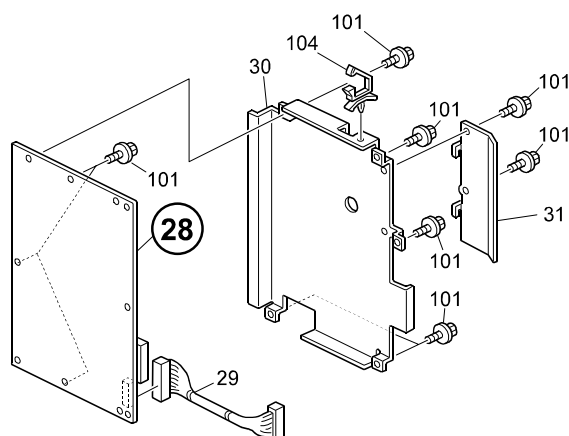

Reissued: 2-Jul-03

Model: Martini-C1	Date: 6-Jun-03	No.: MB064050a
-------------------	----------------	----------------


Serial Number Update

The Serial Number information has been update.

Modified Article: ADF Exposure Glass Cloth and Holder		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☒ Other	

When streaks appear on ADF scanned images, it is necessary to clean the ADF exposure glass. The cloth and cloth holder are added as accessories.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	B0651371	Cloth Holder	1		27	28	
	B0651374	Cloth - DF Exposure Glass	1		27	29	

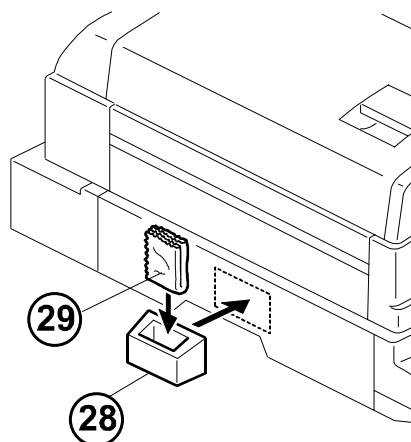

Reissued: 2-Jul-03

Model: Martini-C1	Date: 6-Jun-03	No.: MB064050a
-------------------	----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4221100366
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4221100101
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1282120001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P11120001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4221100216
Ricoh Aficio 1060	220/60	Korea	B064-28	J4221100582
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4221100541
Ricoh Aficio 1060	220/50,60	China	B064-69	J4221200667
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4321100152
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J43212xxxxx
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1292120001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P21120001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4321100101
Ricoh Aficio 1075	220/60	Korea	B065-28	J4321100223
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4321100157
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4321100208

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4226000353
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4326000259

Reissued: 5-Dec-03

Model: Martini-C1	Date: 10-Jun-03	No.: MB064051b
-------------------	-----------------	----------------

MB Correction

The illustrations have changed as shown below.

Modified Article: OPC Drum and Cleaning Brush		Prepared by: S.Watanabe	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The following have been changed to prevent recurrences of black lines and noise from the cleaning brush gears. For details, please see RTB #RB064035.

Note: Except for the PCU Lower Assembly, when installing the parts below for the first time, it is necessary to replace the parts marked "A" **together as a set**.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0649510		Drum			85	25	
	A2949510	OPC Drum	1	X/X	85	25	A
B0652423		Release Cam - Cleaning Blade	1->0		85	27	A
B0652424		Cam Spring	1->0		85	28	A
AA132208		Spacer - M6	4->2		85	29	A
AA130042		Sleeve	1->0		85	30	A
A3764131		Cushion - T1	1->0		85	31	A
B0652263	B1102261	PCU Lower A'ssy	1	X/O	85	32	
07200040E		Retaining Ring - M4	2->1		85	105	A
04514014B		Tapping Screw - M4x14			85	107	
	04514008B	Philips Tapping Screw - M4x8	1	X/X	85	104	A
B0652421		Agitator Shaft			87	2	
	B1102322	Agitator A'ssy	1	X/X	87	2	A
B0652347	AD042038	Cleaning Brush	1	X/X	87	7	A
B0652422		Agitator Cleaning	1->0		87	23	A
09513006B		Philips Screw with Flat Washer - M3x6	1->0		87	101	A


Reissued: 5-Dec-03

Model: Martini-C1


Date: 10-Jun-03

No.: MB064051b

<Page 85>

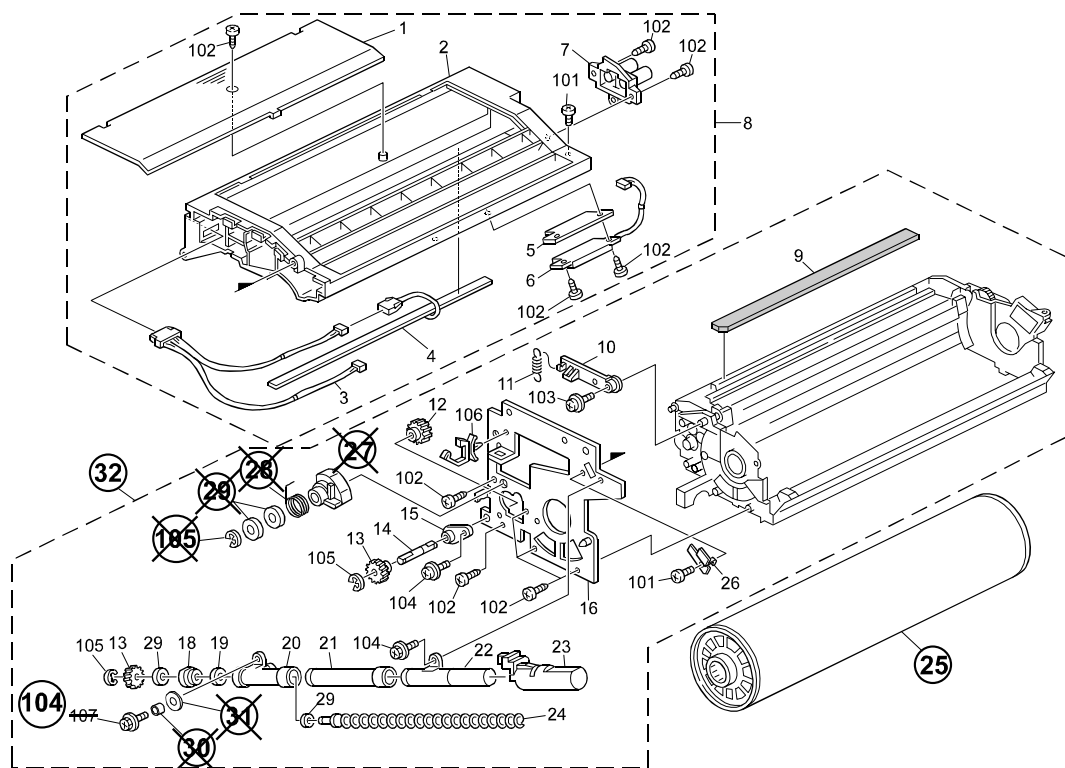

<Page 87>

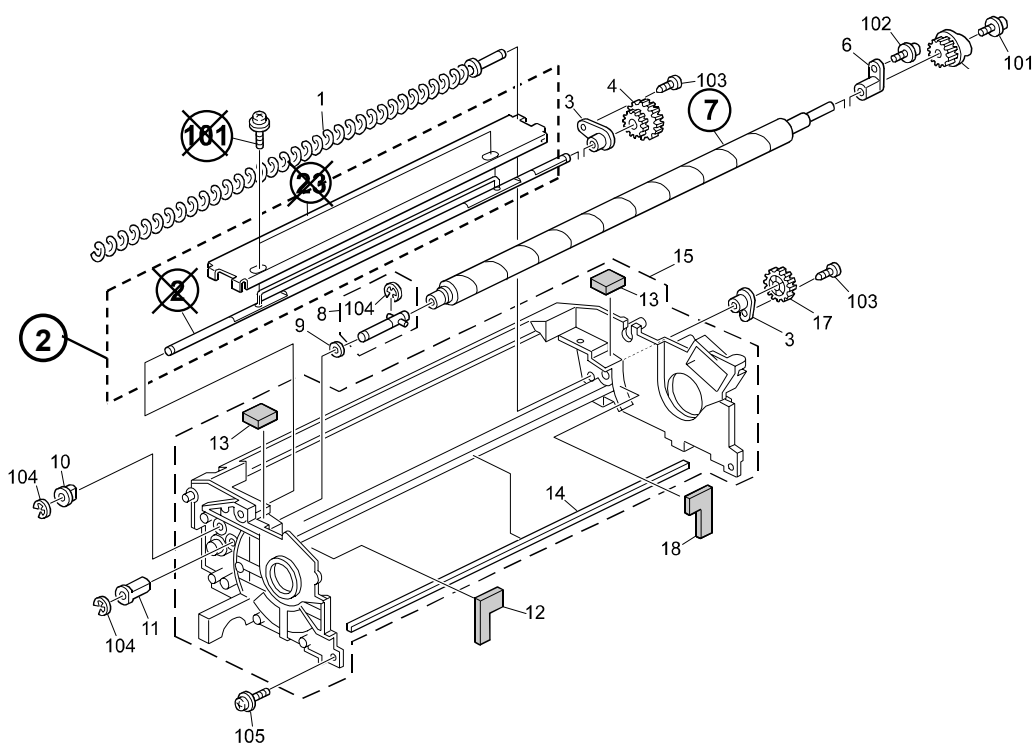

Reissued: 5-Dec-03

Model: Martini-C1

Date: 10-Jun-03

No.: MB064051b

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4230500622
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4230500427
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1283050037
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10530101
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4230500547
Ricoh Aficio 1060	220/60	Korea	B064-28	J42307xxxxx
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4230600076
Ricoh Aficio 1060	220/50,60	China	B064-69	J4230600160
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J43307xxxxx
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4330600001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1293060001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20630001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4330600139
Ricoh Aficio 1075	220/60	Korea	B065-28	J4330600155
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4330600165
Ricoh Aficio 1075	220/50, 60	China	B065-69	J43307xxxxx

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4235400001
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4335400001

Reissued: 2-Jul-03

Model: Martini-C1	Date: 12-Jun-03	No.: MB064052a
-------------------	-----------------	----------------

Serial Number Update


The Serial Number information has been update.

Modified Article: MLB Board		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☒ Other	

The following has been changed to support the Copy Connector Kit modification.

Note: This is not the MLB option board.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0665300	B0665400	MLB Board	1	X/O	127	36	

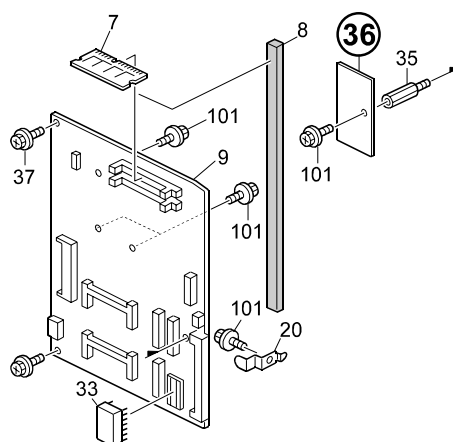

Reissued: 2-Jul-03

Model: Martini-C1	Date: 12-Jun-03	No.: MB064052a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J42304xxxxx
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4230400119
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1283040001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10430001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4230300409
Ricoh Aficio 1060	220/60	Korea	B064-28	J4230400505
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4230400472
Ricoh Aficio 1060	220/50,60	China	B064-69	J42304xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J43304xxxxx
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4330400101
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1293040001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20430001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4330400001
Ricoh Aficio 1075	220/60	Korea	B065-28	J4330500078
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4330400192
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4330400182

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4235300054
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4335300191

Reissued: 2-Jul-03

Model: Martini-C1	Date: 13-Jun-03	No.: MB064053a
-------------------	-----------------	----------------

Serial Number Update

The Serial Number information has been update.


Modified Article: Fusing Gear		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☒ Part standardization	☐ Other	

The following have been temporarily changed to the gear used on the Mojito for customs purposes. These parts will be changed back to their original P/N in the near future.


Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AB012316	AB013792	Fusing Gear	1	X/X	99	22	
AB012317	AB017357	Fusing Drive Gear	1	X/X	101	22	

Note: When installing for the first time, these parts should be changed **together as a set**.

<Page 99>

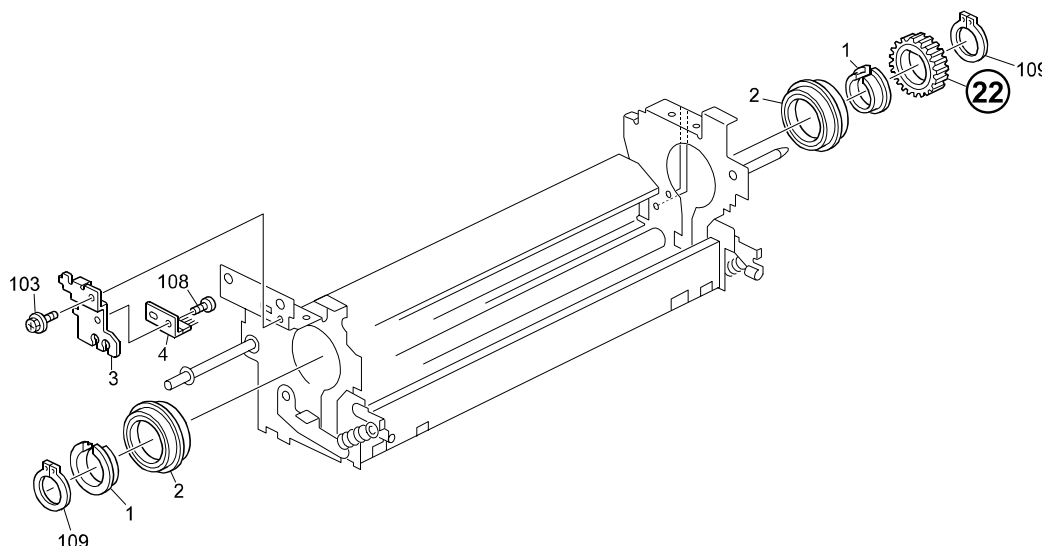

<Page 101>

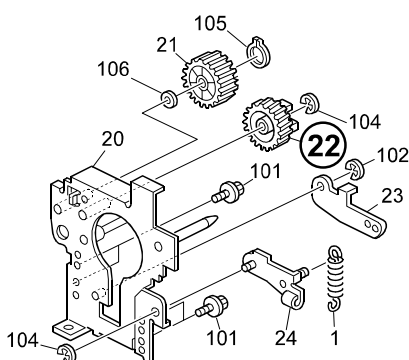

Reissued: 2-Jul-03

Model: Martini-C1	Date: 13-Jun-03	No.: MB064053a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4230500622
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4230400650
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1283050001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10530001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4230500001
Ricoh Aficio 1060	220/60	Korea	B064-28	J4230500246
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4230500256
Ricoh Aficio 1060	220/50,60	China	B064-69	J4230500300
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J43305xxxxx
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4330500063
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1293050001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20530001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4330500001
Ricoh Aficio 1075	220/60	Korea	B065-28	J4330500078
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4330500088
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4330500096

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4235000127
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4335000261

Model: Martini-C1		Date: 16-Jun-03	No.: MB064054
Modified Article: Gear – 16Z		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Due to a vendor change, the following P/N has changed.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AB013492	B0983492	Gear – 16Z	1-1	O/O	61	17	

Reissued: 2-Jul-03

Model: Martini-C1	Date: 30-Jun-03	No.: MB064055a
-------------------	-----------------	----------------


Serial Number Update

The Serial Number information has been update.

Modified Article: Toner Collection Coil		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The following has been changed to further improve PCU toner transport efficiency.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AD043077	B1102326	Toner Collection Coil	1-1	O/O	87	1	

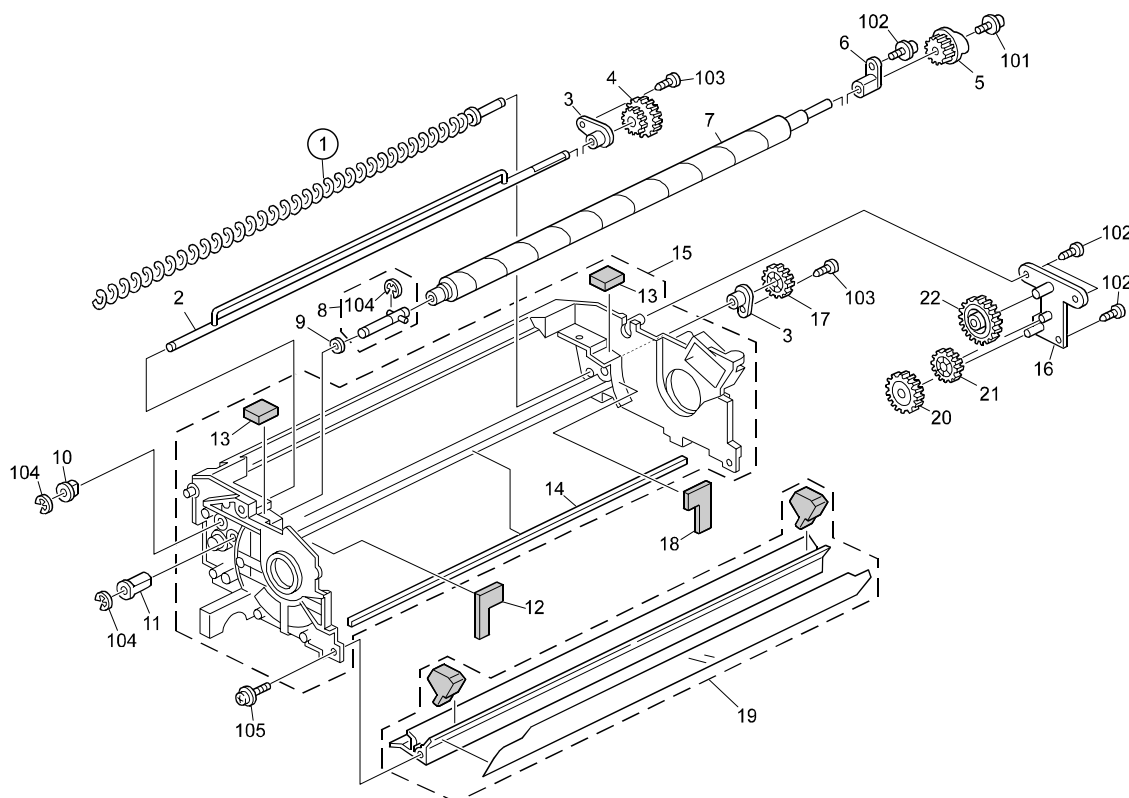

Reissued: 2-Jul-03

Model: Martini-C1

Date: 30-Jun-03

No.: MB064055a

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4230500622
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4230500307
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1283050001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10530001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4230500001
Ricoh Aficio 1060	220/60	Korea	B064-28	J4230500246
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4230500256
Ricoh Aficio 1060	220/50,60	China	B064-69	J4230500300
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J43305xxxxx
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4330500063
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1293050001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20530001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4330500001
Ricoh Aficio 1075	220/60	Korea	B065-28	J4330500078
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4330500088
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4330500096

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4235400252
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4335400346

Reissued: 20-Nov-03

Model: Martini-C1	Date: 24-Jul-03	No.: MB064056b
-------------------	-----------------	----------------



MB Correction

The items in bold italics have been corrected or added.

Modified Article: <i>Document Feeder Pick-up Roller</i>		Prepared by: M.Tsuyuki	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☒ Part standardization	☐ Other	

The Pickup Roller and Coupling have been registered separately due to parts standardization with the next DF model.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A8061321		Pickup Roller	1-0		25	6	
	B4772225	Pickup Roller	0-1		25	6	
	B4772226	Pickup Roller - Coupling	0-1		25	27	

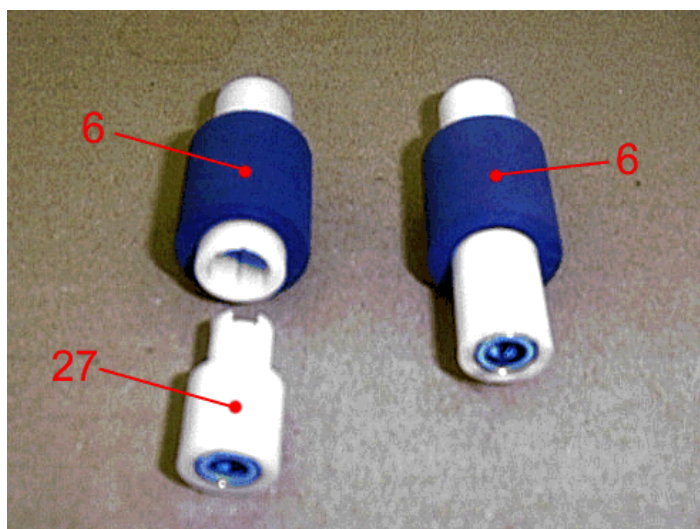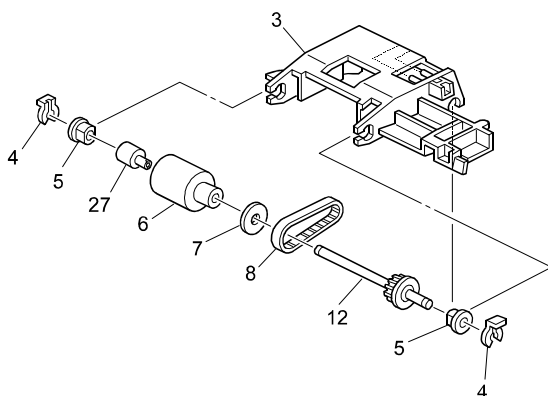

Reissued: 20-Nov-03

Model: Martini-C1	Date: 24-Jul-03	No.: MB064056b
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4230600474
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4230600229
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1283060011
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10630001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4230600175
Ricoh Aficio 1060	220/60	Korea	B064-28	J42307xxxxx
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4230600381
Ricoh Aficio 1060	220/50,60	China	B064-69	J4230600160
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J43307xxxxx
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4330600191
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1293060052
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20630061
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4330600326
Ricoh Aficio 1075	220/60	Korea	B065-28	J43307xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4330600173
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4330600565

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4335500043
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4235500191

Reissued: 12-Sep-03

Model: Martini-C1	Date: 1-Aug-03	No.: MB064057a
-------------------	----------------	----------------


MB Correction

The items in bold italics have been corrected or added.

Modified Article: Development Screw		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☒ Other	

Please note the following part has added to the Martini-C1 Parts Catalog, which were applied from the beginning of mass production. Please correct your part catalogue.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	A2943116	Development Screw	0-1		79	20	

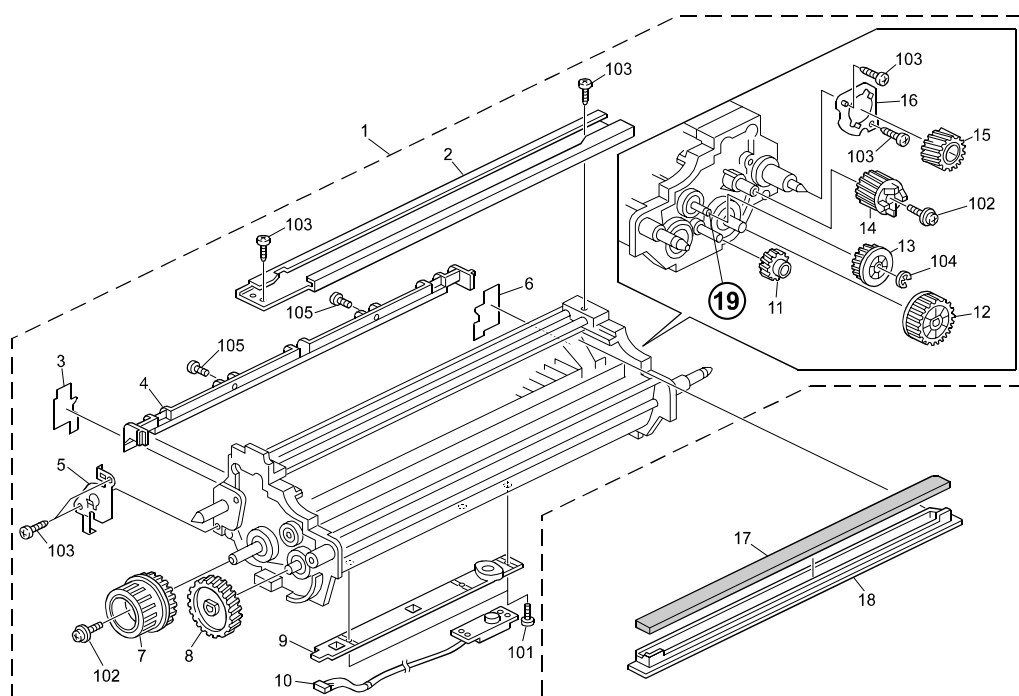

Reissued: 3-Sep-03

Model: Martini-C1	Date: 28-Aug-03	No.: MB064058a
-------------------	-----------------	----------------

Serial Number Update

The Serial Number information has been updated.

Modified Article: Feed Lever		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The following part has been added to further ensure paper is fed properly without jamming.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	B0656445	Feed Lever	0-1		71	35	

The serial number information is as follows.

[RCL (Japan) Production]


MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4230800133
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4230800096
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L128309xxxx
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10930001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4230800139
Ricoh Aficio 1060	220/60	Korea	B064-28	J42309xxxxx
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4230800196
Ricoh Aficio 1060	220/50,60	China	B064-69	J4230800083
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4330900001
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4330900006
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L129309xxxx
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P2093xxxx
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4330900103
Ricoh Aficio 1075	220/60	Korea	B065-28	J4330900182
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4330900187
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4330800039

Reissued: 3-Sep-03

Model: Martini-C1	Date: 28-Aug-03	No.: MB064058a
-------------------	-----------------	----------------

REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4235400001
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4335400001

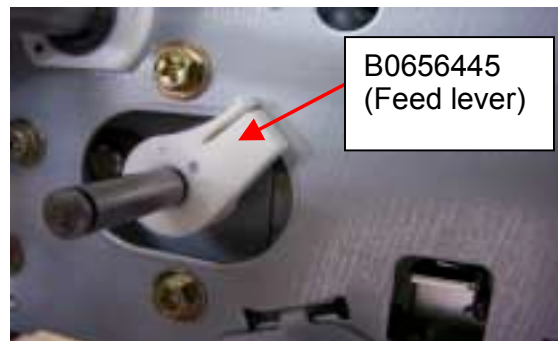

Reissued: 2-Oct-03

Model: Martini-C1	Date: 24-Sep-03	No.: MB064059a
-------------------	-----------------	----------------

Serial Number Update

The Serial Number information has been updated.


Modified Article: Fusing Gear		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☒ Other	

The following have been changed back to the original P/N after checked customs purposes.


Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AB013792	AB012316	Fusing Gear	1	X/X	99	22	
AB017357	AB012317	Fusing Drive Gear	1	X/X	101	22	

Note: When installing for the first time, these parts should be changed **together as a set**.

<Page 99>

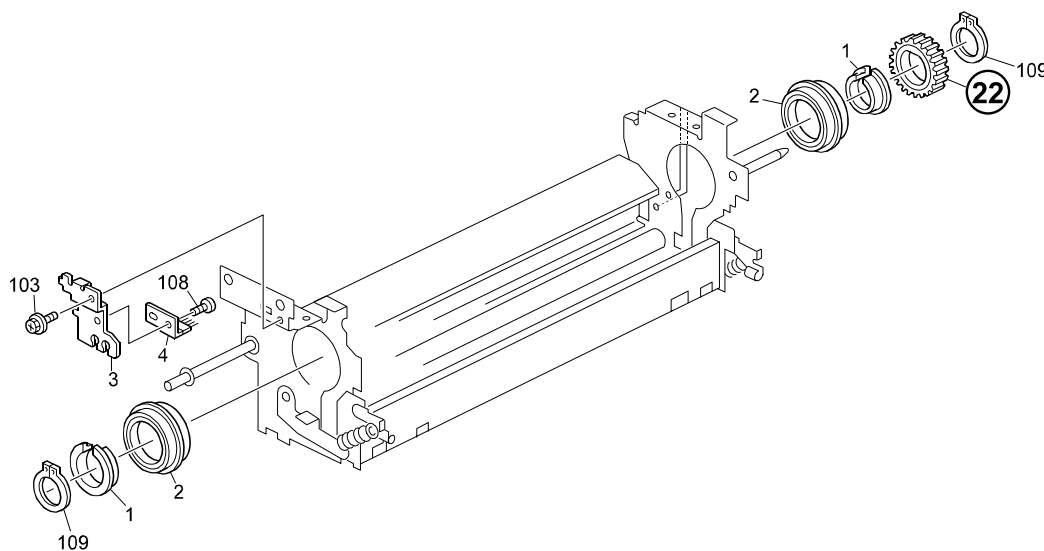

<Page 101>

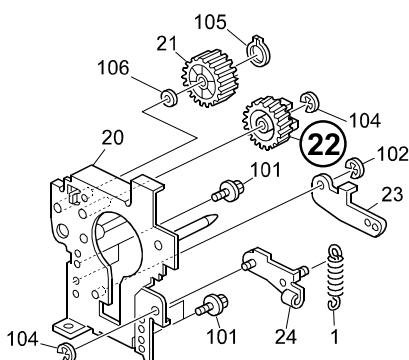

Reissued: 2-Oct-03

Model: Martini-C1	Date: 24-Sep-03	No.: MB064059a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4230900614
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4230900305
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L128310xxxx
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10930001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4230900293
Ricoh Aficio 1060	220/60	Korea	B064-28	J42310xxxxx
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4231000139
Ricoh Aficio 1060	220/50,60	China	B064-69	J42310xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J43310xxxxx
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4330900142
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L129310xxxx
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P2103xxxx
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4330900063
Ricoh Aficio 1075	220/60	Korea	B065-28	J43310xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4330900035
Ricoh Aficio 1075	220/50, 60	China	B065-69	J43310xxxxx

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4235700452
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4335700495

Reissued: 11-May-04

Model: Martini-C1	Date: 3-Oct-03	No.: MB064060b
-------------------	----------------	----------------


Serial Number Update

The Serial Number information has been updated.

Modified Article: Phillips Pan Head Screw – M4x10		Prepared by: S.Watanabe	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☒ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☐ Other	

The following has been changed to facilitate assembly.

Incorrect part number	Correct part number	Description	Q'ty	Int	Page	Index	Note
03140100B	03140120B	Phillips Pan Head Screw – M4x10	1-1	X/X	99	107	

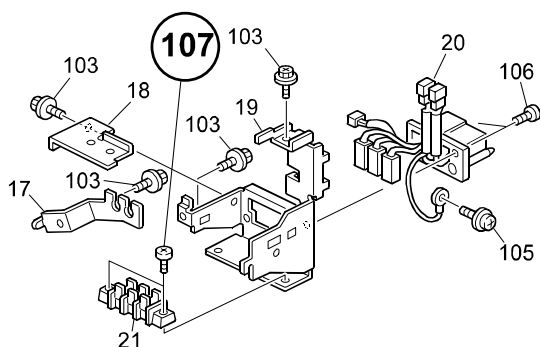

Reissued: 2-Feb-04

Model: Martini-C1	Date: 3-Oct-03	No.: MB064060a
-------------------	----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4230900001
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4230900208
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L128309xxxx
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10930001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4230900067
Ricoh Aficio 1060	220/60	Korea	B064-28	J42309xxxxx
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4230900008
Ricoh Aficio 1060	220/50,60	China	B064-69	J42309xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4330900001
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4330900142
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L129309xxxx
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P2093xxxx
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4330900063
Ricoh Aficio 1075	220/60	Korea	B065-28	J4330900030
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4330900006
Ricoh Aficio 1075	220/50, 60	China	B065-69	J43309xxxxx

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J42ymm(+48)xxxxx
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J43ymm(+48)xxxxx

Reissued: 22-Jan-04

Model: Martini-C1	Date: 17-Dec-03	No.: MB064061a
-------------------	-----------------	----------------

Serial Number Update

The Serial Number information has been updated.

Modified Article: HDD		Prepared by: S. Watanabe	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☒ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The HDD has been changed due to a vendor change.

Note: When installing the new HDD(B5145970), it is necessary to install the B0655102M (GW/GEN.al/V3.53.3) firmware together as a set.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B5145960	B5145970	HDD-40GB	O/O	1	126	13	

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4231200181
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4231100346
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1283120001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P11230001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4231100375
Ricoh Aficio 1060	220/60	Korea	B064-28	J42312xxxxx
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4231200021
Ricoh Aficio 1060	220/50,60	China	B064-69	J42312xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J43312xxxxx
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4331200001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1293120001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P21230001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4331200215
Ricoh Aficio 1075	220/60	Korea	B065-28	J43312xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4331200048
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4331200093

Reissued: 22-Jan-04

Model: Martini-C1	Date: 17-Dec-03	No.: MB064061a
-------------------	-----------------	----------------

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4235900321
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4335900813

Reissued: 8-Jan-04

Model: Martini-C1	Date: 19-Dec-03	No.: MB064062a
-------------------	-----------------	----------------


Serial Number Update

The Serial Number information has been updated.

Modified Article: Duplex Fan Bracket		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The shape of the following has been changed to further ensure the proper gap between the fan bracket and DLT Kit.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0651195	B0651200	Duplex Fan Bracket	1-1	X/O	141	20	

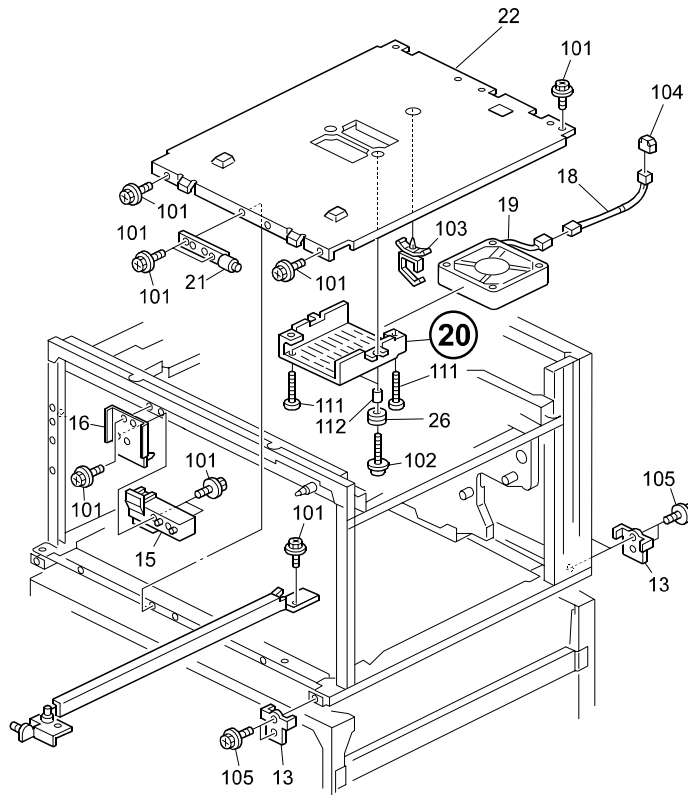

Reissued: 8-Jan-04

Model: Martini-C1	Date: 19-Dec-03	No.: MB064062a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4231200181
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4231200067
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1283120024
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P11230026
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4231200293
Ricoh Aficio 1060	220/60	Korea	B064-28	J42401xxxxx
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4231200186
Ricoh Aficio 1060	220/50,60	China	B064-69	J42401xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J43401xxxxx
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4331200098
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1293120049
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P21230026
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4331200215
Ricoh Aficio 1075	220/60	Korea	B065-28	J43401xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4331200051
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4331200093

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4235700784
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4335800001

Reissued: 9-Feb-04

Model: Martini-C1	Date: 29-Jan-04	No.: MB064063a
-------------------	-----------------	----------------


Serial Number Update

The Serial Number information has been updated.

Modified Article: Rear Side Fence		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The following have been changed to increase the durability of the Rear Side Fence.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0656541	B0656543	Rear Side Fence	1-1	X/O	59	22	
B0656540	B0656542	Rear Side Fence Ass'y	1-1	X/O	59	27	

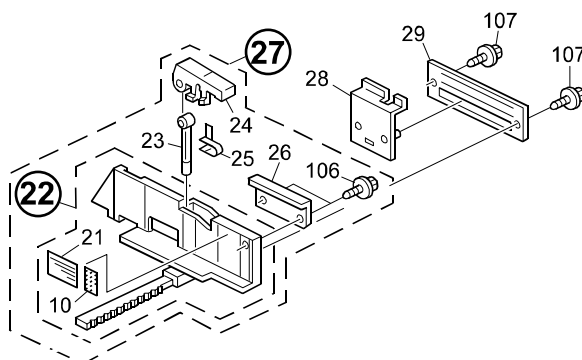

Reissued: 9-Feb-04

Model: Martini-C1	Date: 29-Jan-04	No.: MB064063a
-------------------	-----------------	----------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4230900614
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4230900236
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L128310xxxx
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10930001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4230900242
Ricoh Aficio 1060	220/60	Korea	B064-28	J42310xxxxx
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4231000139
Ricoh Aficio 1060	220/50,60	China	B064-69	J42310xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4331000021
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4330900142
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1293100001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P21030001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4330900063
Ricoh Aficio 1075	220/60	Korea	B065-28	J43310xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4330900035
Ricoh Aficio 1075	220/50, 60	China	B065-69	J43ymmxxxxx

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4235800182
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4335800001

Reissued: 12-Apr-04

Model: Martini-C1	Date: 30-Jan-04	No.: MB064064a
-------------------	-----------------	----------------

Serial Number Update

The Serial Number information has been updated.

Modified Article: Development Unit		Prepared by: S. Watanabe	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☒ Part standardization	☐ Other	

The following have been changed due to parts standardization with the new model.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0653050	B1103050	Development Unit	1	O/O	79	1	
B0653091	B1103091	Entrance Seal	1	O/O	79	4	
B0653099	B1103099	Front Drum Seal	1	O/O	79	3	
B0653100	B1103100	Rear Drum Seal	1	O/O	79	6	

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4231200181
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4231200067
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1283120024
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P11230026
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4231200293
Ricoh Aficio 1060	220/60	Korea	B064-28	J42401xxxxx
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4231200052
Ricoh Aficio 1060	220/50,60	China	B064-69	J42401xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4340100001
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4331200098
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1293120049
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P21230026
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4331200215
Ricoh Aficio 1075	220/60	Korea	B065-28	J43401xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4331200048
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4331200093

Reissued: 12-Apr-04

Model: Martini-C1	Date: 30-Jan-04	No.: MB064064a
-------------------	-----------------	----------------

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4245100786
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4345200001


Model: Martini-C1		Date: 30-Jan-04	No.: MB064065
Modified Article: Parts Catalog Correction		Prepared by: S. Watanabe	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Please correct your Parts Catalogs as follows.

Description and Illustration correction.

Part Number	Incorrect Description	Correct Description	Int	Page	Index	Note
B0653301	BOTTLE:DRIVE	BOTTLE:DRIVE:ASS'Y	1	74	39	

39 BOTTLE DRIVE ASS'Y

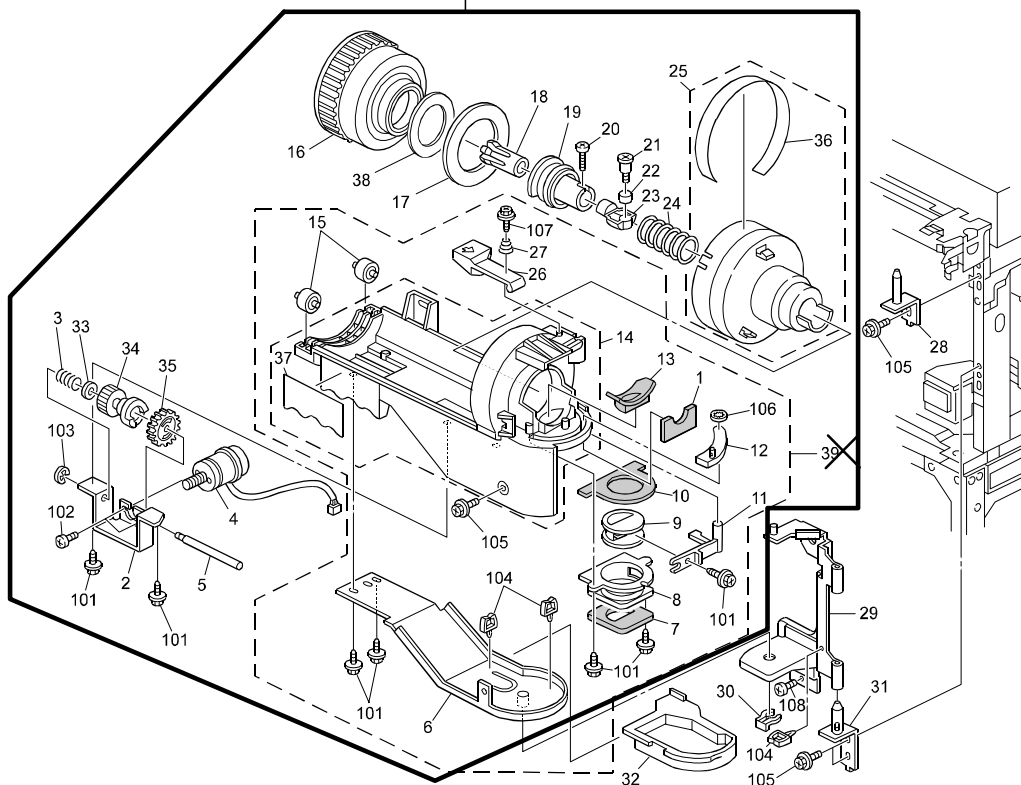

Reissued: 4-Aug-04

Model: Martini-C1	Date: 17-Feb-04	No.: MB064066b
-------------------	-----------------	----------------

MB Correction

The items in bold italics have been corrected.

Modified Article: Polygon Motor Cover		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☒ Part standardization	☐ Other	

Due to parts standardization the polygon motor cover has been changed.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
<i>BO651691</i>	<i>B1101691</i>	Polygon Motor Cover	1	O/O	45	1	
<i>B1101691</i>	<i>B1401691</i>	Polygon Motor Cover	1	O/O	45	1	

Reissued: 24-Mar-04

Model: Martini-C1	Date: 19-Feb-04	No.: MB064067a
-------------------	-----------------	----------------

Serial Number Update

The Serial Number information has been updated.

Modified Article: Charge Power Pack		Prepared by: S. Watanabe	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☒ Other	

The following has been changed to a lead-free component as part of the ongoing utilization of environmentally-friendly materials.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AZ320106	AZ320139	Charge Power Pack	1	O/O	129	13	

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J42402xxxxx
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4240100308
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1284010039
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P1024xxxx
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4240100363
Ricoh Aficio 1060	220/60	Korea	B064-28	J42402xxxxx
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J42402xxxxx
Ricoh Aficio 1060	220/50,60	China	B064-69	J42402xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J43402xxxxx
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4340200001
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1294010027
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P2024xxxx
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4340200022
Ricoh Aficio 1075	220/60	Korea	B065-28	J43402xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4340200074
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4340100228

Reissued: 24-Mar-04

Model: Martini-C1	Date: 19-Feb-04	No.: MB064067a
-------------------	-----------------	----------------

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4245100690
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4345100581

Model: Martini-C1		Date: 02-Sep-04	No.: MB064068
Modified Article: ADF Unit etc.		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Due to parts standardization with another model, the following parts have been changed.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2931343		Upper Hinge	1 - 1	O/O	15	4	
	B0981342	Hinge: upper					
B0651223		Lower Hinge	1 - 1	O/O	15	9	
	B1401223	Hinge Lower Ass'y					
B0657001	B0657002	ADF Unit	1 - 1	O/O	21	12	
B4775571	B4775581	ADF Main Control Board	1 - 1	O/O	39	8	
B0655469		FFC/SBC Harness - 15P					
	B1405469	Harness - FFC SBU 15WICK/120mm	2 - 2	O/O	45	7	
B0655470		FFC/SBC Harness - 40P					
	B1405470	Harness - FFC SBU 40WICK/120mm	1 - 1	O/O	45	8	
B0651715	B1401715	Scanner wire	2 - 2	O/O	49	5	
A1341698	B1401680	Idle Pulley	2 - 2	O/O	49	18	
AX060250		Polygon Mirror Motor	1 - 1	O/O	51	13	
	AX060277	Polygon Mirror Motor Ass'y					
A2935310		SYNC Detector Board	1 - 1	O/O	51	29	
	B1405301	PCB:SYNC Detector					
B0651852		IPS Unit	1 - 1	O/O	51	30	
	B1401852	Imaging Unit: Ass'y					
B0656320		Reverse Roller - Pressure Release	1 - 1	O/O	65	29	
	B1406320	Reverse Roller: Pressure Release					
B1406320		Reverse Roller: Pressure Release	1 - 1	O/O	65	29	
	B1406321	Reverse Roller: Pressure Release					
A4234432	AA143809	Shoulder Screw - M2.5	1 - 1	O/O	67	29	
B0652655		Guide Plate Solenoid	1 - 1	X/O	73	30	
	B1402655	DC Solenoid: Guide Plate					
A1343216		Screw	1 - 1	O/O	75	20	
	AA143816	Flat Screw: Chuck: Bottle					
AD004091	B0702010	Charge Corona Unit	1 - 1	O/O	83	3	
A0962053	B0702365	Cleaner Motor Cover	1 - 1	O/O	83	4	
AD020053	B0702364	Charge Corona Wire	1 - 1	O/O	83	19	
07200025B	07200025E	RETAINING RING - M2.5	n - n	O/O	83	102	
09653008B		Tapping Screw with Washer- M3X8	n - n	O/O	83	103	
	04503008N	Tapping Screw - M3X8					
B0654209		Stopper Bracket	1 - 1	X/O	95	11	
	B1404209	Bracket: Stopper: Ass'y					

Model: Martini-C1	Date: 02-Sep-04	No.: MB064068
-------------------	-----------------	---------------

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AA143037	AA143810	Development Cover Screw	1 - 1	O/O	101	16	
B0654500	B0654501	Duplex Unit	1 - 1	O/O	109	15	
AA143307		Stepped Screw – M3	3 – 3	O/O	109	17	
	AA143811	Stepped Screw – M3X4	1 - 1		113	26	
A2291132		Bracket – Registration Motor	1 - 1	O/O	119	4	
	B1401132	Stepper Motor Bracket					
A2291133	B1401133	Stepper Motor Base Ass'y	1 - 1	O/O	119	7	
A0961173		Fusing Drive Joint	1 - 1	X/O	119	14	
	B1101173	Joint: Fusing Drive: Sub Unit					
B1101173		Joint: Fusing Drive: Sub Unit	1 - 1	X/O	119	14	
	B1401173	Fusing Drive Sub-Unit Joint					
AX310044		Counter	1 - 1	O/O	139	7	
	AX310047	Total Counter: 7FIG: 24V: MI2					
53011662		Hexagon Bolt	12 - 12	X/O	145	8	
	AA143803	Flanged hexagonal Head Bolt					
AA143749		Stand – Hexagonal Bolt M12X35	4 - 4	X/O	145	9	
	AA143798	HEXAGONAL BOLT: M12X35					
A0966693		Paper Guide Sheet	1 - 1	O/O	145	10	
	B0986693	Shield: Frame: paper Bank: Upper					

Model: Martini-C1		Date: 2-Sep-04	No.: MB064069
Modified Article: OPC Drum		Prepared by: S. Watanabe	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

The following part has been changed.
For details, please refer to RTB #RB064042.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2949510	B0709510	OPC Drum	1	O/O	85	25	

Model: Martini-C1	Date: 2-Sep-04	No.: MB064069
-------------------	----------------	---------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4240300160
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4240300001
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1284030001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10340001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4240300038
Ricoh Aficio 1060	220/60	Korea	B064-28	J4240400283
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4240300175
Ricoh Aficio 1060	220/50,60	China	B064-69	J42404xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4340300001
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4340300040
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1294030001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P20340001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4340300127
Ricoh Aficio 1075	220/60	Korea	B065-28	J4340400032
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4340300006
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4340300035

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J42ymm(+48)xxxxx
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J43ymm(+48)xxxxx

Reissued: 7-Sep-04

Model: Martini-C1	Date: 28-Aug-03	No.: MB064058b
-------------------	-----------------	----------------

MB Correction

The items in bold italics has been added.

Modified Article: Feed Lever		Prepared by: S.Watanabe	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

The following have been changed to further ensure paper is fed properly without jamming.

Note: It is necessary to replace the parts marked "A" together as a set.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
<i>AB030577</i>		<i>Timing Pulley – 18Z</i>	<i>1->0</i>		<i>71</i>	<i>33</i>	
<i>AB030578</i>		<i>Timing Pulley – 20Z</i>	<i>1->0</i>		<i>71</i>	<i>34</i>	
<i>B0652703</i>		<i>Bracket – Brake Peen</i>	<i>1->0</i>		<i>71</i>	<i>31</i>	
	B0656445	Feed Lever	0->1		71	35	<i>A</i>
<i>B0652713</i>	<i>B1102713</i>	<i>Drive Reverse Shaft</i>	<i>1</i>	<i>X/O</i>	<i>71</i>	<i>12</i>	<i>A</i>
<i>B4783505</i>		<i>Timing Belt – B40S2M84</i>	<i>1->0</i>		<i>71</i>	<i>32</i>	

New Drive Reverse Shaft



Feed Lever



Reissued: 7-Sep-04

Model: Martini-C1	Date: 28-Aug-03	No.: MB064058b
-------------------	-----------------	----------------

The serial number information is as follows.

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4230800133
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4230800096
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L128309xxxx
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P10930001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4230800139
Ricoh Aficio 1060	220/60	Korea	B064-28	J42309xxxxx
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4230800196
Ricoh Aficio 1060	220/50,60	China	B064-69	J4230800083
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4330900001
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4330900006
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L129309xxxx
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P2093xxxx
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4330900103
Ricoh Aficio 1075	220/60	Korea	B065-28	J4330900182
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4330900187
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4330800039

Reissued: 7-Sep-04

Model: Martini-C1	Date: 28-Aug-03	No.: MB064058b
-------------------	-----------------	----------------

REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J4235400001
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J4335400001

Model: Martini-C1	Date: 8-Sep-04	No.: MB064070
-------------------	----------------	---------------


The item in bold italics have been added.

Modified Article: ADF UNIT		Prepared by: S. Watanabe	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☒ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☐ Other	

The ADF Unit has been changed due to vender change.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0657001	B0657002	ADF UNIT	1	O/O	21	12	

4.DF EXTERIOR

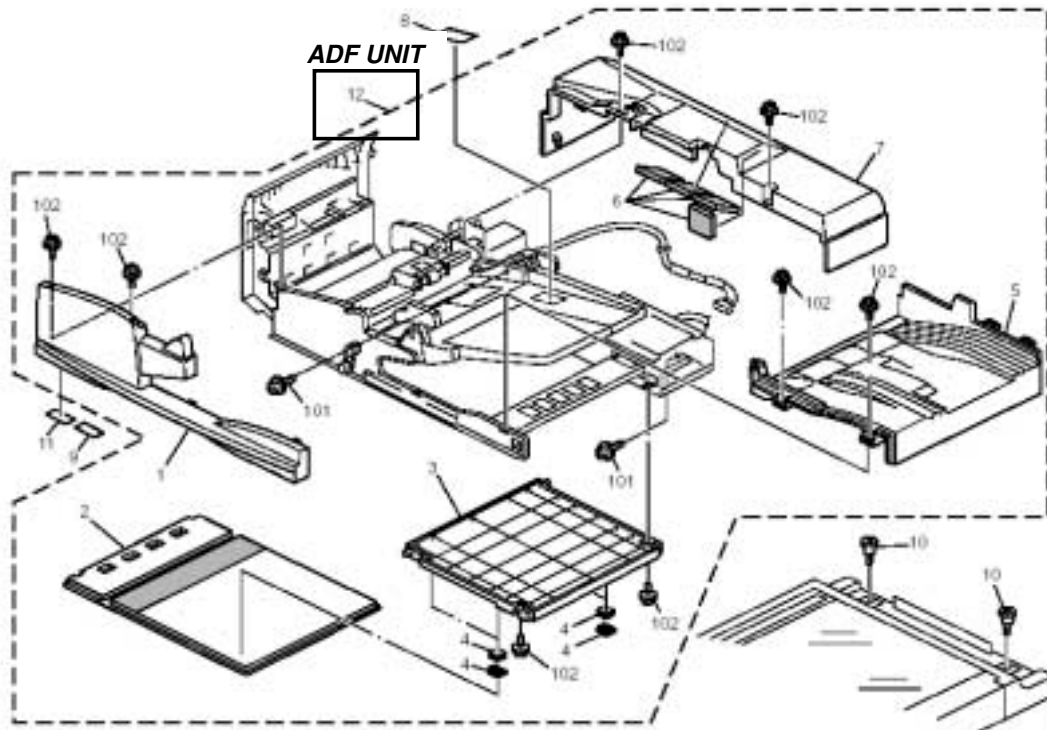

Model: Martini-C1	Date: 8-Sep-04	No.: MB064070
-------------------	----------------	---------------

[RCL (Japan) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060	110/60	Taiwan	B064-19	J4231100001
Gestetner 6002 Nashuatec 6005 Rex Rotary 6008	220-240V/50,60	Europe, etc.	B064-22	J4231000402
Lanier LD060	220-240V/50,60	Europe, Australia	B064-24	L1283120001
Infotec IS 2060	220-240V/50,60	Europe, etc.	B064-26	7P11030001
Ricoh Aficio 1060	220-240/50,60	Europe, etc.	B064-27	J4231000509
Ricoh Aficio 1060	220/60	Korea	B064-28	J42311xxxxx
Ricoh Aficio 1060	220/50,60	Asia, Australia	B064-29	J4231000347
Ricoh Aficio 1060	220/50,60	China	B064-69	J42311xxxxx
Ricoh Aficio 1075	110/60	Taiwan	B065-19	J4331000021
Gestetner 7502 Nashuatec 7505 Rex Rotary 7508	220-240/50,60	Europe, etc.	B065-22	J4331000045
Lanier LD075	220-240/50,60	Europe, Australia	B065-24	L1293100001
Infotec IS 2075	220-240/50,60	Europe, etc.	B065-26	7P21030001
Ricoh Aficio 1075	220-240/50, 60	Europe, etc	B065-27	J4331000127
Ricoh Aficio 1075	220/60	Korea	B065-28	J43311xxxxx
Ricoh Aficio 1075	220/50, 60	Asia, Australia	B065-29	J4331000024
Ricoh Aficio 1075	220/50, 60	China	B065-69	J4331100011

[REI (U.S.A) Production]

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
Ricoh Aficio 1060 Savin 2560 Gestetner 6002 Lanier LD060	120/60	USA	B064-17	J42ymm(+48)xxxxx
Ricoh Aficio 1075 Savin 2575 Gestetner 7502 Lanier LD075	120/60	USA	B065-17	J43ymm(+48)xxxxx

Model: Martini-C1		Date: 2-Nov-07	No.: MB064071
Modified Article: Fusing Unit		Prepared by: S. Watanabe	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☒ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0654016	B0654022	Fusing Unit - 120V	1	O/O	97	1	
B0654029	B0654031	Fusing Unit - 230V	1	O/O	97	1	

Change/ Reason: Due to vendor change, the part numbers have been changed.

Reissued: 21-Apr-08

Model: Martini-C1	Date: 10-Jan-08	No.: MB064072a
-------------------	-----------------	----------------

MB Reissue

The items in ***bold italics*** were corrected or added.

Modified Article: Paper Size Switch		Prepared by: S. Ishizu	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for	☐ Parts catalog correction	☐ Vendor change	☐ Other
Modification:	☐ To facilitate assembly	☐ To improve reliability	☐ To meet standards
	☒ Part standardization	☐ Product Safety	()

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A0965335	<i>B2472745</i>	Paper Size Switch	1	X/O	61	18	

Change/Reason: Parts standardization

Model: Martini-C1		Date: 5-Jun-08	No.: MB064073
Modified Article: Cleaning motor		Prepared by: S. Ishizu	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☒ To meet standards ☐ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AX040136	AX040159	Cleaning motor	1	O/O	95	27	

Change: Materials change.

Reason: Ricoh's ongoing changes toward more environmentally-friendly materials



Part Change Information List

Date: March 18, 2009

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number
Martini-C1	B064	200903		B0656366	B2476366	BRACKET:DRIVE	3	3	X/X		63	27	A	X/O	Y		V0803733
Martini-C1	B064	200903		B1327580	B2476487	HARNESS:PAPER FEED UNIT:LOWER:ASS'Y	3	3	O/O		63	20					V0803888
Martini-C1	B065	200903		B0656366	B2476366	BRACKET:DRIVE	3	3	X/X		63	27	A	X/O	Y		V0803733
Martini-C1	B065	200903		B1327580	B2476487	HARNESS:PAPER FEED UNIT:LOWER:ASS'Y	3	3	O/O		63	20					V0803888
Martini-C1	B110	200903		B0656366	B2476366	BRACKET:DRIVE	4	4	X/X		63	27	A	X/O	Y		V0803733
Martini-C1	B110	200903		B1327580	B2476487	HARNESS:PAPER FEED UNIT:LOWER:ASS'Y	4	4	O/O		63	20					V0803888
Martini-C1	B111	200903		B0656366	B2476366	BRACKET:DRIVE	4	4	X/X		63	27	A	X/O	Y		V0803733
Martini-C1	B111	200903		B1327580	B2476487	HARNESS:PAPER FEED UNIT:LOWER:ASS'Y	4	4	O/O		63	20					V0803888
Martini-C1	B064	200903		B0656330	B2476335	SIDE PLATE:REAR:PAPER FEED UNIT:ASS'Y	3	3	X/X		65	12	A	X/O	Y		V0803733
Martini-C1	B065	200903		B0656330	B2476335	SIDE PLATE:REAR:PAPER FEED UNIT:ASS'Y	3	3	X/X		65	12	A	X/O	Y		V0803733
Martini-C1	B110	200903		B0656330	B2476335	SIDE PLATE:REAR:PAPER FEED UNIT:ASS'Y	3	3	X/X		65	12	A	X/O	Y		V0803733
Martini-C1	B111	200903		B0656330	B2476335	SIDE PLATE:REAR:PAPER FEED UNIT:ASS'Y	3	3	X/X		65	12	A	X/O	Y		V0803733
Martini-C1	B064	200903		B2473865	B2473869	FRAME:TRANSFER BELT	1	1	O/O		91	14					V0803888
Martini-C1	B065	200903		B2473865	B2473869	FRAME:TRANSFER BELT	1	1	O/O		91	14					V0803888
Martini-C1	B110	200903		B2473865	B2473869	FRAME:TRANSFER BELT	1	1	O/O		91	14					V0803888
Martini-C1	B064	200903		B0654378	B2474378	ROLLER:DECURA:DRIVEN:ASS'Y	1	1	X/O		107	28					V0900202
Martini-C1	B064	200903		B0654785	B2474785	STEPPER MOTOR:DC5.12V 3.1W	1	1	O/O		117	6					V0804277
Martini-C1	B065	200903		B0654785	B2474785	STEPPER MOTOR:DC5.12V 3.1W	1	1	O/O		117	6					V0804277
Martini-C1	B110	200903		B0654785	B2474785	STEPPER MOTOR:DC5.12V 3.1W	1	1	O/O		117	6					V0804277
Martini-C1	B111	200903		B0654785	B2474785	STEPPER MOTOR:DC5.12V 3.1W	1	1	O/O		117	6					V0804277
Martini-C1	B064	200903		AX400161	AX400198	HEATER - 240V/9W	1	1	O/O		147	12					V0804329
Martini-C1	B065	200903		AX400161	AX400198	HEATER - 240V/9W	1	1	O/O		147	12					V0804329
Martini-C1	B064	200903		B0652746	B1322875	DECAL:PAPER SET DIRECTION	1	1	O/O		221	17					V0804557



Part Change Information List

Date: April 30, 2009

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number
Martini-C1	B064	200904		B0651084	B2471084	GUIDE PLATE:POSITIONING PIN:DUPLEX:ASS'Y	1	1	O/O		125	20					V0803189
Martini-C1	B065	200904		B0651084	B2471084	GUIDE PLATE:POSITIONING PIN:DUPLEX:ASS'Y	1	1	O/O		125	20					V0803189
Martini-C1	B064	200904		AX060151	B1401037	STEPPER MOTOR:REGISTRATION:ASS'Y	1	1	O/O		123	2					V0804347
Martini-C1	B065	200904		AX060151	B1401037	STEPPER MOTOR:REGISTRATION:ASS'Y	1	1	O/O		123	2					V0804347
Martini-C1	B110	200904		AX060151	B1401037	STEPPER MOTOR:REGISTRATION:ASS'Y	1	1	O/O		123	2					V0804347
Martini-C1	B111	200904		AX060151	B1401037	STEPPER MOTOR:REGISTRATION:ASS'Y	1	1	O/O		123	2					V0804347



Part Change Information List

Date: May 30, 2009

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number
MT-C1	B064	200905		B4772342	B4772343	GUIDE:PAPER FEED:UPPER	1	1	X/O		27	26					V0900699
MT-C1	B065	200905		B4772342	B4772343	GUIDE:PAPER FEED:UPPER	1	1	X/O		27	26					V0900699
MT-C1	B064	200905		B1104117	D0664117	FUSING COVER:UPPER:ASS'Y	1	1	O/O		97	7					V0900179
MT-C1	B065	200905		B1104117	D0664117	FUSING COVER:UPPER:ASS'Y	1	1	O/O		97	7					V0900179
MT-C1	B110	200905		B1104117	D0664117	FUSING COVER:UPPER:ASS'Y	1	1	O/O		97	7					V0900179
MT-C1	B111	200905		B1104117	D0664117	FUSING COVER:UPPER:ASS'Y	1	1	O/O		97	7					V0900179
MT-C1	B064	200905		H0841501	B2474247	SCREW:SLIDER	2	2	O/O		97	14					V0900109
MT-C1	B065	200905		H0841501	B2474247	SCREW:SLIDER	2	2	O/O		97	14					V0900109
MT-C1	B110	200905		H0841501	B2474247	SCREW:SLIDER	2	2	O/O		97	14					V0900109
MT-C1	B111	200905		H0841501	B2474247	SCREW:SLIDER	2	2	O/O		97	14					V0900109
MT-C1	B110	200905		B0651084	B2471084	GUIDE PLATE:POSITIONING PIN:DUPLEX:ASS'Y	1	1	O/O		125	20					V0803189



Part Change Information List

Date: June 30, 2009

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	200906		AX640136	AX640183	FAN MOTOR DC24V/1.92W	2	2	O/O		139/149	4/19						



Part Change Information List

Date: August 31, 2009

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	200908		B4772343	B4772344	GUIDE:PAPER FEED:UPPER	1	1	X/O		27	26					V0901140	
MT-C1	B065	200908		B4772343	B4772344	GUIDE:PAPER FEED:UPPER	1	1	X/O		27	26					V0901140	



Part Change Information List

Date: September 30, 2009

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	200909		B0656488	B2476488	HARNESS:PAPER FEED UNIT:UPPER:ASS'Y	1	1	O/O		63	19					V0901264	
MT-C1	B065	200909		B0656488	B2476488	HARNESS:PAPER FEED UNIT:UPPER:ASS'Y	1	1	O/O		63	19					V0901264	
MT-C1	B110	200909		B0656488	B2476488	HARNESS:PAPER FEED UNIT:UPPER:ASS'Y	1	1	O/O		63	19					V0901264	
MT-C1	B111	200909		B0656488	B2476488	HARNESS:PAPER FEED UNIT:UPPER:ASS'Y	1	1	O/O		63	19					V0901264	
MT-C1	B064	200909		B0653271	B2473271	CONTACT POINT STAY - LOWER	1	1	O/O		75	31					V0900897	
MT-C1	B065	200909		B0653271	B2473271	CONTACT POINT STAY - LOWER	1	1	O/O		75	31					V0900897	
MT-C1	B110	200909		B0653271	B2473271	CONTACT POINT STAY - LOWER	1	1	O/O		75	31					V0900897	
MT-C1	B111	200909		B0653271	B2473271	CONTACT POINT STAY - LOWER	1	1	O/O		75	31					V0900897	



Part Change Information List

Date: October 30, 2009

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	200910		B0654674	B1404675	GRIP:RELEASE:DUPLEX UNIT:ASS'Y	1	1	O/O		113	3					V0901533	
MT-C1	B065	200910		B0654674	B1404675	GRIP:RELEASE:DUPLEX UNIT:ASS'Y	1	1	O/O		113	3					V0901533	
MT-C1	B110	200910		B0654674	B1404675	GRIP:RELEASE:DUPLEX UNIT:ASS'Y	1	1	O/O		113	3					V0901533	
MT-C1	B111	200910		B0654674	B1404675	GRIP:RELEASE:DUPLEX UNIT:ASS'Y	1	1	O/O		113	3					V0901533	



Part Change Information List

Date: November 30, 2009

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	200911		B0652377	B2472377	SHAFT:CONNECTING:TONER RECYCLING	1	1	X/O		85	14					V0901324	
MT-C1	B065	200911		B0652377	B2472377	SHAFT:CONNECTING:TONER RECYCLING	1	1	X/O		85	14					V0901324	
MT-C1	B110	200911		B0652377	B2472377	SHAFT:CONNECTING:TONER RECYCLING	1	1	X/O		85	14					V0901324	
MT-C1	B111	200911		B0652377	B2472377	SHAFT:CONNECTING:TONER RECYCLING	1	1	X/O		85	14					V0901324	
MT-C1	B064	200911		AB012317	AB012328	GEAR:DRIVE:FUSING	1	1	X/O		109	9					V0901823	
MT-C1	B065	200911		AB012317	AB012328	GEAR:DRIVE:FUSING	1	1	X/O		109	9					V0901823	
MT-C1	B110	200911		AB012317	AB012328	GEAR:DRIVE:FUSING	1	1	X/O		109	9					V0901823	
MT-C1	B111	200911		AB012317	AB012328	GEAR:DRIVE:FUSING	1	1	X/O		109	9					V0901823	
MT-C1	B064	200911		AB012317	AB012328	GEAR:DRIVE:FUSING	1	1	X/O		111	10					V0901823	
MT-C1	B065	200911		AB012317	AB012328	GEAR:DRIVE:FUSING	1	1	X/O		111	10					V0901823	
MT-C1	B110	200911		AB012317	AB012328	GEAR:DRIVE:FUSING	1	1	X/O		111	10					V0901823	
MT-C1	B111	200911		AB012317	AB012328	GEAR:DRIVE:FUSING	1	1	X/O		111	10					V0901823	



Part Change Information List

Date: December 29, 2009

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	200912		B0653966	B2473966	DC SOLENOID 24V	1	1	O/O		93	28					V0902691	
MT-C1	B065	200912		B0653966	B2473966	DC SOLENOID 24V	1	1	O/O		93	28					V0902691	
MT-C1	B110	200912		B0653966	B2473966	DC SOLENOID 24V	1	1	O/O		93	28					V0902691	
MT-C1	B111	200912		B0653966	B2473966	DC SOLENOID 24V	1	1	O/O		93	28					V0902691	



Part Change Information List

Date: February 26, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	201002		A2486701	B2476901	OIL DAMPER:FALL	1	1	O/O		57	36					V0902719	
MT-C1	B065	201002		A2486701	B2476901	OIL DAMPER:FALL	1	1	O/O		57	36					V0902719	
MT-C1	B064	201002		B0656429	B2476430	COVER:RELEASE:VERTICAL TRANSPORT	1	1	X/O		67	11					V0902811	
MT-C1	B065	201002		B0656429	B2476430	COVER:RELEASE:VERTICAL TRANSPORT	1	1	X/O		67	11					V0902811	
MT-C1	B110	201002		B0656429	B2476430	COVER:RELEASE:VERTICAL TRANSPORT	1	1	X/O		67	11					V0902811	
MT-C1	B111	201002		B0656429	B2476430	COVER:RELEASE:VERTICAL TRANSPORT	1	1	X/O		67	11					V0902811	
MT-C1	B064	201002		B0654650	B1324650	STEPPER MOTOR:JOGGER:ASS'Y	1	1	O/O		117	11					V0902838	
MT-C1	B065	201002		B0654650	B1324650	STEPPER MOTOR:JOGGER:ASS'Y	1	1	O/O		117	11					V0902838	
MT-C1	B110	201002		B0654650	B1324650	STEPPER MOTOR:JOGGER:ASS'Y	1	1	O/O		117	11					V0902838	
MT-C1	B111	201002		B0654650	B1324650	STEPPER MOTOR:JOGGER:ASS'Y	1	1	O/O		117	11					V0902838	
MT-C1	B064	201002		B0656266	B2476252	SLIDE RAIL - RIGHT	1	1	O/O		151	13					V0902816	
MT-C1	B065	201002		B0656266	B2476252	SLIDE RAIL - RIGHT	1	1	O/O		151	13					V0902816	



Part Change Information List

Date: Jun 30, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	201006		A0966553	B2342864	PAD:CLEANER	4	4	O/O		59	10					V1000308	
MT-C1	B065	201006		A0966553	B2342864	PAD:CLEANER	4	4	O/O		59	10					V1000308	
MT-C1	B110	201006		A0966553	B2342864	PAD:CLEANER	6	6	O/O		59	10					V1000308	
MT-C1	B111	201006		A0966553	B2342864	PAD:CLEANER	6	6	O/O		59	10					V1000308	



Part Change Information List

Date: Jul 30, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	201007		B0656405	B1406405	GUIDE PLATE:VERTICAL TRANSPORT:ASS'Y	1	1	X/O		67	18					V1001162	
MT-C1	B065	201007		B0656405	B1406405	GUIDE PLATE:VERTICAL TRANSPORT:ASS'Y	1	1	X/O		67	18					V1001162	
MT-C1	B110	201007		B0656405	B1406405	GUIDE PLATE:VERTICAL TRANSPORT:ASS'Y	1	1	X/O		67	18					V1001162	
MT-C1	B064	201007		B0654308	B1404308	EFT REVERSE GUIDE PLATE ASS'Y	1	1	X/O		111	4					V1001125	
MT-C1	B065	201007		B0654308	B1404308	EFT REVERSE GUIDE PLATE ASS'Y	1	1	X/O		111	4					V1001125	
MT-C1	B110	201007		B0654308	B1404308	EFT REVERSE GUIDE PLATE ASS'Y	1	1	X/O		111	4					V1001125	
MT-C1	B111	201007		B0654308	B1404308	EFT REVERSE GUIDE PLATE ASS'Y	1	1	X/O		111	4					V1001125	



Part Change Information List

Date: Aug 31, 2010

Model	Code	PCIL Nr.	PCIL Correctio	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	201008		B4772343	B4772347	GUIDE:PAPER FEED:UPPER	1	1	O/O		27	26					V1000721	
MT-C1	B065	201008		B4772343	B4772347	GUIDE:PAPER FEED:UPPER	1	1	O/O		27	26					V1000721	



Part Change Information List

Date: September 30, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
M-C1	B064	201009		B0702010	B2472010	CHARGE CORONA UNIT	1	1	X/O		83	3					T0503749	



Part Change Information List

Date: March 31, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	201101		B0654210	D0624192	BUSHING:INNER BACK:OIL SUPPLY	1	1	O/O		95	40					V1001401	
MT-C1	B064	201101		AA060899	AA061076	COIL SPRING:PRESSURE RELEASE:PICKUP	1	1	X/O		63	11					V1002523	10100777
MT-C1	B064	201101		A2294727	D0624727	HOLDER:PRESSURE:GUIDE PLATE	2	2	X/O		113	26	A		RD062055		V1002689	10090493
MT-C1	B064	201101		AA063581	D0624741	COMPRESSION SPRING:HOLDER:GUIDE PLAT	4	4	X/O		113	25	A		RD062055		V1002689	10090493
MT-C1	B064	201101		B0654730	D0624730	GUIDE PLATE:TRANSPORT:LOWER	1	1	X/O		113	23	A		RD062055		V1002710	
MT-C1	B064	201101		04503008N	08025320	HEXAGON HEAD TAPPING SCREW:ES:3X10	4	4	X/O		113	103	A		RD062055			
MT-C1	B064	201101			B1801743	SBU WASHER	0	4			113	32	A		RD062055			
MT-C1	B065	201101		B0654210	D0624192	BUSHING:INNER BACK:OIL SUPPLY	1	1	O/O		95	40					V1001401	
MT-C1	B065	201101		AA060899	AA061076	COIL SPRING:PRESSURE RELEASE:PICKUP	1	1	X/O		63	11					V1002523	10100777
MT-C1	B065	201101		A2294727	D0624727	HOLDER:PRESSURE:GUIDE PLATE	2	2	X/O		113	26	A		RD062055		V1002689	10090493
MT-C1	B065	201101		AA063581	D0624741	COMPRESSION SPRING:HOLDER:GUIDE PLAT	4	4	X/O		113	25	A		RD062055		V1002689	10090493
MT-C1	B065	201101		B0654730	D0624730	GUIDE PLATE:TRANSPORT:LOWER	1	1	X/O		113	23	A		RD062055		V1002710	
MT-C1	B065	201101		04503008N	08025320	HEXAGON HEAD TAPPING SCREW:ES:3X10	4	4	X/O		113	103	A		RD062055			
MT-C1	B065	201101			B1801743	SBU WASHER	0	4			113	32	A		RD062055			



Part Change Information List

Date: March 31, 2011

Model	Code	PCIL Nr.	PCIL Correcti on	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	201103		AA043576	AA043676	SYNCHRONOUS BELT:CONNECTING:DC STEPPER MOTOR	3	3	O/O		65	42					V1002205	
MT-C1	B065	201103		AA043576	AA043676	SYNCHRONOUS BELT:CONNECTING:DC STEPPER MOTOR	3	3	O/O		65	42					V1002205	
MT-C1	B110	201103		AA043576	AA043676	SYNCHRONOUS BELT:CONNECTING:DC STEPPER MOTOR	4	4	O/O		65	42					V1002205	
MT-C1	B111	201103		AA043576	AA043676	SYNCHRONOUS BELT:CONNECTING:DC STEPPER MOTOR	4	4	O/O		65	42					V1002205	
MT-C1	B064	201103		AE031036	D0624236	BUSHING:DIA6	4	4	O/O		95	19					V1001401	
MT-C1	B065	201103		AE031036	D0624236	BUSHING:DIA6	4	4	O/O		95	19					V1001401	
MT-C1	B110	201103		AE031036	D0624236	BUSHING:DIA6	4	4	O/O		95	19					V1001401	
MT-C1	B111	201103		AE031036	D0624236	BUSHING:DIA6	4	4	O/O		95	19					V1001401	
MT-C1	B064	201103		B0654745	B2474745	DC SOLENOID 24V	1	1	X/O		117	5					V1001629	
MT-C1	B065	201103		B0654745	B2474745	DC SOLENOID 24V	1	1	X/O		117	5					V1001629	
MT-C1	B110	201103		B0654745	B2474745	DC SOLENOID 24V	1	1	X/O		117	5					V1001629	
MT-C1	B111	201103		B0654745	B2474745	DC SOLENOID 24V	1	1	X/O		117	5					V1001629	
MT-C1	B064	201103		AA043575	AA043675	SYNCHRONOUS BELT:REVERSE:S2M118	4	4	O/O		65	18					V1002204	
MT-C1	B065	201103		AA043575	AA043675	SYNCHRONOUS BELT:REVERSE:S2M118	4	4	O/O		65	18					V1002204	
MT-C1	B110	201103		AA043575	AA043675	SYNCHRONOUS BELT:REVERSE:S2M118	4	4	O/O		65	18					V1002204	
MT-C1	B111	201103		AA043575	AA043675	SYNCHRONOUS BELT:REVERSE:S2M118	4	4	O/O		65	18					V1002204	



Part Change Information List

Date: April 28, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	201104		G5644151	B7144151	RAIL:SIDE FENCE	1	1	O/O		23	3					V1100602	11020443
MT-C1	B065	201104		G5644151	B7144151	RAIL:SIDE FENCE	1	1	O/O		23	3					V1100602	11020443



Part Change Information List

Date: June 30, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	201105		B2473966	D0623966	DC SOLENOID:ON-OFF.MC4.ASS'Y	1	1	O/O		93	28					V1001876	
MT-C1	B065	201105		B2473966	D0623966	DC SOLENOID:ON-OFF.MC4.ASS'Y	1	1	O/O		93	28					V1001876	
MT-C1	B110	201105		B2473966	D0623966	DC SOLENOID:ON-OFF.MC4.ASS'Y	1	1	O/O		93	28					V1001876	
MT-C1	B111	201105		B2473966	D0623966	DC SOLENOID:ON-OFF.MC4.ASS'Y	1	1	O/O		93	28					V1001876	
MT-C1	B064	201105		AA070058	AA070077	SLIDE RAIL - RIGHT	1	1	O/O		147	17					V1002276	
MT-C1	B065	201105		AA070058	AA070077	SLIDE RAIL - RIGHT	1	1	O/O		147	17					V1002276	
MT-C1	B110	201105		AA070058	AA070077	SLIDE RAIL - RIGHT	1	1	O/O		147	17					V1002276	
MT-C1	B111	201105		AA070058	AA070077	SLIDE RAIL - RIGHT	1	1	O/O		147	17					V1002276	



Part Change Information List

Date: June 30, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	201106		B0653838	B2473838	HEAT INSULATION:HEATER	1	1	O/O		147	14					V1100405	
MT-C1	B065	201106		B0653838	B2473838	HEAT INSULATION:HEATER	1	1	O/O		147	14					V1100405	
MT-C1	B110	201106		B0653838	B2473838	HEAT INSULATION:HEATER	1	1	O/O		147	14					V1100405	
MT-C1	B111	201106		B0653838	B2473838	HEAT INSULATION:HEATER	1	1	O/O		147	14					V1100405	



Part Change Information List

Date: August 31, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	201108		B4771152	B6521152	STAY:FRAME:LEFT	1	1	O/O		41	7					V1000621	10020694
MT-C1	B065	201108		B4771152	B6521152	STAY:FRAME:LEFT	1	1	O/O		41	7					V1000621	10020694
MT-C1	B110	201108		11026311	11026297	CONNECTOR - 4P	2	2	O/O		171	107					V1100884	11040959
MT-C1	B111	201108		11026311	11026297	CONNECTOR - 4P	2	2	O/O		171	107					V1100884	11040959



Part Change Information List

Date: November 30, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	201111		B0653273	B2473273	CONTACT POINT STAY - UPPER	1	1	O/O		75	28					V0901269	
MT-C1	B065	201111		B0653273	B2473273	CONTACT POINT STAY - UPPER	1	1	O/O		75	28					V0901269	
MT-C1	B110	201111		B0653273	B2473273	CONTACT POINT STAY - UPPER	1	1	O/O		75	28					V0901269	
MT-C1	B111	201111		B0653273	B2473273	CONTACT POINT STAY - UPPER	1	1	O/O		75	28					V0901269	



Part Change Information List

Date: March 30, 2012

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	201203		B0651303	D0621303	COVER:LARGE CAPACITY TRAY	1	1	O/O		17	30					V1101321	
MT-C1	B065	201203		B0651303	D0621303	COVER:LARGE CAPACITY TRAY	1	1	O/O		17	30					V1101321	



Part Change Information List

Date: April 27, 2012

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Qty	New Qty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	8064	201204		AX040135	AX040254	DC MOTOR RISING TRAY ASSY	2	2	O/O		143	8					V1200216	
MT-C1	8065	201204		AX040135	AX040254	DC MOTOR RISING TRAY ASSY	2	2	O/O		143	8					V1200216	
MT-C1	8110	201204		AX040135	AX040254	DC MOTOR RISING TRAY ASSY	4	4	O/O		143	8					V1200216	
MT-C1	8111	201204		AX040135	AX040254	DC MOTOR RISING TRAY ASSY	4	4	O/O		143	8					V1200216	



Part Change Information List

Date: May 31, 2012

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Qty	New Qty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	201205		B3514135	AG070513	MAGNET CATCH	1	1	O/O		61	11					V1101406	
MT-C1	B065	201205		B3514135	AG070513	MAGNET CATCH	1	1	O/O		61	11					V1101406	
MT-C1	B110	201205		B3514135	AG070513	MAGNET CATCH	1	1	O/O		61	11					V1101406	
MT-C1	B111	201205		B3514135	AG070513	MAGNET CATCH	1	1	O/O		61	11					V1101406	

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	201211		B2474745	D0624745	DC SOLENOID:REVERSAL:ASS'Y	1	1	O/O		117	5					V1103982	
MT-C1	B065	201211		B2474745	D0624745	DC SOLENOID:REVERSAL:ASS'Y	1	1	O/O		117	5					V1103982	
MT-C1	B110	201211		B2474745	D0624745	DC SOLENOID:REVERSAL:ASS'Y	1	1	O/O		117	5					V1103982	
MT-C1	B111	201211		B2474745	D0624745	DC SOLENOID:REVERSAL:ASS'Y	1	1	O/O		117	5					V1103982	



Part Change Information List

Date: December 28, 2012

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
MT-C1	B064	201212		AX040159	AX040180	DC MOTOR:CLEANING	1	1	X/O		95	27					V1203438	
MT-C1	B065	201212		AX040159	AX040180	DC MOTOR:CLEANING	1	1	X/O		95	27					V1203438	
MT-C1	B110	201212		AX040159	AX040180	DC MOTOR:CLEANING	1	1	X/O		95	27					V1203438	
MT-C1	B111	201212		AX040159	AX040180	DC MOTOR:CLEANING	1	1	X/O		95	27					V1203438	



Part Change Information List

Date: January 31, 2013

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B064	201301		D0664117	D1334117	FUSING COVER:UPPER:D133:ASS'Y	1	1	O/O		97	7					V1102571	11090115
MT-C1	B065	201301		D0664117	D1334117	FUSING COVER:UPPER:D133:ASS'Y	1	1	O/O		97	7					V1102571	11090115
MT-C1	B110	201301		D0664117	D1334117	FUSING COVER:UPPER:D133:ASS'Y	1	1	O/O		97	7					V1102571	11090115
MT-C1	B111	201301		D0664117	D1334117	FUSING COVER:UPPER:D133:ASS'Y	1	1	O/O		97	7					V1102571	11090115



Part Change Information List

Date: February 28, 2013

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B064	201302		B0652362	D1312362	ENTRANCE SEAL:CLEANING:ASS'Y	1	1	O/O		89	24					V1202371	12050340
MT-C1	B065	201302		B0652362	D1312362	ENTRANCE SEAL:CLEANING:ASS'Y	1	1	O/O		89	24					V1202371	12050340
MT-C1	B110	201302		B0652362	D1312362	ENTRANCE SEAL:CLEANING:ASS'Y	1	1	O/O		89	24					V1202371	12050340
MT-C1	B111	201302		B0652362	D1312362	ENTRANCE SEAL:CLEANING:ASS'Y	1	1	O/O		89	24					V1202371	12050340



Part Change Information List

Date: November 29, 2013

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B064	201311		B0654307	D1314307	SIDE PLATE:EXHAUST:REAR	1	1	O/O		149	24				V1200022	12010115
MT-C1	B064	201311		B0654433	G1484433	SIDE PLATE:REAR:EXIT:ASS'Y	1	1	O/O		149	24				V1301086	
MT-C1	B065	201311		B0654307	D1314307	SIDE PLATE:EXHAUST:REAR	1	1	O/O		149	24				V1200022	12010115
MT-C1	B065	201311		B0654433	G1484433	SIDE PLATE:REAR:EXIT:ASS'Y	1	1	O/O		149	24				V1301086	
MT-C1	B110	201311		B0654307	D1314307	SIDE PLATE:EXHAUST:REAR	1	1	O/O		149	24				V1200022	12010115
MT-C1	B110	201311		B0654433	G1484433	SIDE PLATE:REAR:EXIT:ASS'Y	1	1	O/O		149	24				V1301086	
MT-C1	B111	201311		B0654307	D1314307	SIDE PLATE:EXHAUST:REAR	1	1	O/O		149	24				V1200022	12010115
MT-C1	B111	201311		B0654433	G1484433	SIDE PLATE:REAR:EXIT:ASS'Y	1	1	O/O		149	24				V1301086	



Part Change Information List

Date: January 31, 2014

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B064	201401		B0654306	D1314306	SIDE PLATE:EXHAUST:FRONT	1	1	O/O		149	4					V1200022	12010115
MT-C1	B065	201401		B0654306	D1314306	SIDE PLATE:EXHAUST:FRONT	1	1	O/O		149	4					V1200022	12010115
MT-C1	B110	201401		B0654306	D1314306	SIDE PLATE:EXHAUST:FRONT	1	1	O/O		149	4					V1200022	12010115
MT-C1	B111	201401		B0654306	D1314306	SIDE PLATE:EXHAUST:FRONT	1	1	O/O		149	4					V1200022	12010115



Part Change Information List

Date: February 28, 2014

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B064	201402		B0653111	D1313210	TONER SUPPLY UNIT:ASS'Y	1	1	O/O		77	18					V1303738	
MT-C1	B065	201402		B0653111	D1313210	TONER SUPPLY UNIT:ASS'Y	1	1	O/O		77	18					V1303738	
MT-C1	B110	201402		B0653111	D1313210	TONER SUPPLY UNIT:ASS'Y	1	1	O/O		77	18					V1303738	
MT-C1	B111	201402		B0653111	D1313210	TONER SUPPLY UNIT:ASS'Y	1	1	O/O		77	18					V1303738	



Part Change Information List

Date: April 30, 2014

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B064	201404		B0653161	D1313161	CASE:CLASSIFICATION:ASS'Y	1	1	O/O		77	1				V1303644	
MT-C1	B065	201404		B0653161	D1313161	CASE:CLASSIFICATION:ASS'Y	1	1	O/O		77	1				V1303644	
MT-C1	B110	201404		B0653161	D1313161	CASE:CLASSIFICATION:ASS'Y	1	1	O/O		77	1				V1303644	
MT-C1	B111	201404		B0653161	D1313161	CASE:CLASSIFICATION:ASS'Y	1	1	O/O		77	1				V1303644	
MT-C1	B064	201404		B0654252	D1314252	STAY:EXIT:LEFT	1	1	O/O		111	2				V1200022	12010115
MT-C1	B065	201404		B0654252	D1314252	STAY:EXIT:LEFT	1	1	O/O		111	2				V1200022	12010115
MT-C1	B110	201404		B0654252	D1314252	STAY:EXIT:LEFT	1	1	O/O		111	2				V1200022	12010115
MT-C1	B111	201404		B0654252	D1314252	STAY:EXIT:LEFT	1	1	O/O		111	2				V1200022	12010115
MT-C1	B064	201404		AX640183	AX640218	FAN:MM80:25MM:24V	2	2	O/O		139	4				V1303887	
MT-C1	B065	201404		AX640183	AX640218	FAN:MM80:25MM:24V	2	2	O/O		139	4				V1303887	
MT-C1	B110	201404		AX640183	AX640218	FAN:MM80:25MM:24V	2	2	O/O		139	4				V1303887	
MT-C1	B111	201404		AX640183	AX640218	FAN:MM80:25MM:24V	2	2	O/O		139	4				V1303887	
MT-C1	B064	201404		AA070061	D0624440	SLIDE RAIL:FUSING/PAPER EXIT UNIT:LEFT:ASS'Y	1	1	O/O		149	5				V1304077	
MT-C1	B065	201404		AA070061	D0624440	SLIDE RAIL:FUSING/PAPER EXIT UNIT:LEFT:ASS'Y	1	1	O/O		149	5				V1304077	
MT-C1	B110	201404		AA070061	D0624440	SLIDE RAIL:FUSING/PAPER EXIT UNIT:LEFT:ASS'Y	1	1	O/O		149	5				V1304077	
MT-C1	B111	201404		AA070061	D0624440	SLIDE RAIL:FUSING/PAPER EXIT UNIT:LEFT:ASS'Y	1	1	O/O		149	5				V1304077	



Part Change Information List

Date: June 30, 2014

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B064	201406		AA043294	AA043435	TIMING BELT:40S2M810	1	1	O/O		121	9					V1001515	10040715
MT-C1	B065	201406		AA043294	AA043435	TIMING BELT:40S2M810	1	1	O/O		121	9					V1001515	10040715
MT-C1	B110	201406		AA043294	AA043435	TIMING BELT:40S2M810	1	1	O/O		121	9					V1001515	10040715
MT-C1	B111	201406		AA043294	AA043435	TIMING BELT:40S2M810	1	1	O/O		121	9					V1001515	10040715



Part Change Information List

Date: May 8, 2015

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B064	201504		AX040180	AX040187	DC MOTOR:CLEANING	1	1	O/O	N	95	27					V1400420	
MT-C1	B065	201504		AX040180	AX040187	DC MOTOR:CLEANING	1	1	O/O	N	95	27					V1400420	
MT-C1	B110	201504		AX040180	AX040187	DC MOTOR:CLEANING	1	1	O/O	N	95	27					V1400420	
MT-C1	B111	201504		AX040180	AX040187	DC MOTOR:CLEANING	1	1	O/O	N	95	27					V1400420	



Part Change Information List

Date: August 3, 2015

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B065	201507		A8064261	B3014261	COIL SPRING:BELT:PAPER FEED:8N	2	2	O/O	N	25	23					V1501671	



Part Change Information List

Date: November 2, 2015

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B064	201510		B7144151	B7144152	RAIL:SIDE FENCE	1	1	O/O	N	23	3					V1500444	
MT-C1	B064	201510		AF020562	AF020779	TRANSPORT ROLLER:DRIVE:GRIP	4	4	O/O	N	63, 67	24, 5					V1403764	
MT-C1	B065	201510		AF020562	AF020779	TRANSPORT ROLLER:DRIVE:GRIP	4	4	O/O	N	63, 67	24, 5					V1403764	



Part Change Information List

Date: April 7, 2016

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B065	201603		B0656361	D2236481	GUIDE PLATE:CONNECTING:PAPER BANK	1	1	O/O	N	67	2					V1501779	15050703
MT-C1	B110	201603		B0656361	D2236481	GUIDE PLATE:CONNECTING:PAPER BANK	1	1	O/O	N	67	2					V1501779	15050703
MT-C1	B111	201603		B0656361	D2236481	GUIDE PLATE:CONNECTING:PAPER BANK	1	1	O/O	N	67	2					V1501779	15050703
MT-C1	B065	201603			D2231069	STAY:UPPER:FRONT:DOM	---	1		N	*	*			Y		V1501895	
MT-C1	B110	201603			D2231069	STAY:UPPER:FRONT:DOM	---	1		N	*	*			Y		V1501895	
MT-C1	B111	201603			D2231069	STAY:UPPER:FRONT:DOM	---	1		N	*	*			Y		V1501895	



Part Change Information List

Date: April 28, 2016

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B065	201604		B0654400	B2474400	BRACKET:SWIVEL:ASS'Y	1	1	O/O	N	111	15					V1601029	
MT-C1	B110	201604		B0654400	B2474400	BRACKET:SWIVEL:ASS'Y	1	1	O/O	N	111	15					V1601029	
MT-C1	B111	201604		B0654400	B2474400	BRACKET:SWIVEL:ASS'Y	1	1	O/O	N	111	15					V1601029	



Part Change Information List

Date: July 1, 2016

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B065	201606		B0656581	D2236141	STAY:HOLDER:PAPER TRAY:ASS'Y	2	2	O/O	N	59	33					V1501779	15050703
MT-C1	B110	201606		B0656581	D2236141	STAY:HOLDER:PAPER TRAY:ASS'Y	3	3	O/O	N	59	33					V1501779	15050703
MT-C1	B111	201606		B0656581	D2236141	STAY:HOLDER:PAPER TRAY:ASS'Y	3	3	O/O	N	59	33					V1501779	15050703
MT-C1	B065	201606		B0654733	D2234732	GATE PAWL:DUPLX	1	1	O/O	N	121	4					V1601030	



Part Change Information List

Date: July 1, 2016

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B065	201607		B0653080	D2233080	BALL BEARING:12X21X5	1	1	O/O	N	81	2					V1602044	
MT-C1	B110	201607		B0653080	D2233080	BALL BEARING:12X21X5	1	1	O/O	N	81	2					V1602044	
MT-C1	B111	201607		B0653080	D2233080	BALL BEARING:12X21X5	1	1	O/O	N	81	2					V1602044	
MT-C1	B065	201607		B0703115	D2233115	PLAIN SHAFT BEARING:DIA4:ASS'Y	2	2	O/O	N	81	6					V1601990	
MT-C1	B110	201607		B0703115	D2233115	PLAIN SHAFT BEARING:DIA4:ASS'Y	2	2	O/O	N	81	6					V1601990	
MT-C1	B111	201607		B0703115	D2233115	PLAIN SHAFT BEARING:DIA4:ASS'Y	2	2	O/O	N	81	6					V1601990	



Part Change Information List

Date: November 2, 2016

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B065	201611		B0654232	D1314218	BRACKET:GUARD:FEELER	1	1	X/O	N	95	23					V1503729	



Part Change Information List

Date: January 6, 2017

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B065	201612		B0652740	B2472749	SUPPORT STAY:MANUAL FEED:REAR:ASS'Y	1	1	X/O	N	61	15					V1601499	16050229
MT-C1	B065	201612		B0654933	D2704933	GUIDE PLATE LEVER HOOK	1	1	O/O	N	113	28					V1603121	16090499



Part Change Information List

Date: Apeil 4, 2017

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DRC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B065	201703		B0652738	B2472748	SUPPORT STAY:MANUAL FEED:FRONT:ASSY	1	1	X/O	N	61	14					V1601499	16050229



Part Change Information List

Date: June 5, 2017

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B065	201705		D0624730	D2234730	GUIDE PLATE:TRANSPORT:LOWER	1	1	O/O	N	113	23				3SD223E229	V1601917	
MT-C1	B110	201705		D0624730	D2234730	GUIDE PLATE:TRANSPORT:LOWER	1	1	O/O	N	113	23				3SD223E229	V1601917	
MT-C1	B111	201705		D0624730	D2234730	GUIDE PLATE:TRANSPORT:LOWER	1	1	O/O	N	113	23				3SD223E229	V1601917	



Part Change Information List

Date: July 5, 2017

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B065	201706		B0986643	D1316697	SIDE FENCE:TANDEM LCT:LEFT FRONT	1	1	X/X	N	53	8	A		Y		V1700979	
MT-C1	B065	201706		B0986644	D1316698	SIDE FENCE:TANDEM LCT:LEFT REAR	1	1	X/X	N	53	15	A		Y		V1700979	



Part Change Information List

Date: September 1, 2017

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B065	201707		B0653301	B2473326	BOTTLE:DRIVE:ASS'Y	1	1	O/O	N	75	39					V1701069	
MT-C1	B110	201707		B0653301	B2473326	BOTTLE:DRIVE:ASS'Y	1	1	O/O	N	75	39					V1701069	
MT-C1	B111	201707		B0653301	B2473326	BOTTLE:DRIVE:ASS'Y	1	1	O/O	N	75	39					V1701069	



Part Change Information List

Date: November 2, 2017

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B065	201710		B0654259	D2234259	LEVER:LOCK:FUSING/PAPER EXIT UNIT:ASS'Y	1	1	O/O	N	107	4					V1701571	
MT-C1	B110	201710		B0654259	D2234259	LEVER:LOCK:FUSING/PAPER EXIT UNIT:ASS'Y	1	1	O/O	N	107	4					V1701571	
MT-C1	B111	201710		B0654259	D2234259	LEVER:LOCK:FUSING/PAPER EXIT UNIT:ASS'Y	1	1	O/O	N	107	4					V1701571	
MT-C1	B064	201710		54429101	B2348614	SETTING POWDER	1	1	O/O	Y	223	7						



Part Change Information List

Date: December 27, 2017

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
MT-C1	B065	201712		B2471223	D2231227	HINGE:LOWER:ASS'Y	1	1	O/O	N	15	9					V1702245	
MT-C1	B110	201712		B2471223	D2231227	HINGE:LOWER:ASS'Y	1	1	O/O	N	15	9					V1702245	
MT-C1	B111	201712		B2471223	D2231227	HINGE:LOWER:ASS'Y	1	1	O/O	N	15	9					V1702245	