

Reissued: 19-Sep-00

Model: Mojito	Date: 26-Apr-00	No.: MA293001a
---------------	-----------------	----------------

MB Correction


The items in bold italics have been corrected or added.

Modified Article: Parts Catalog Correction		Prepared by: A. Sasaki	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☒ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☐ Other	

Section 1. EXTERIOR 1 (A292/A293)

Incorrect part number	Correct part number	Description	Q'ty	Int	Page	Index	Note
0434 0080	0434 0082W	Tapping Screw – M4x8			15	103	
---	0450 3008B	Tapping Screw – M3x8			15	106	*1

*1: New index number

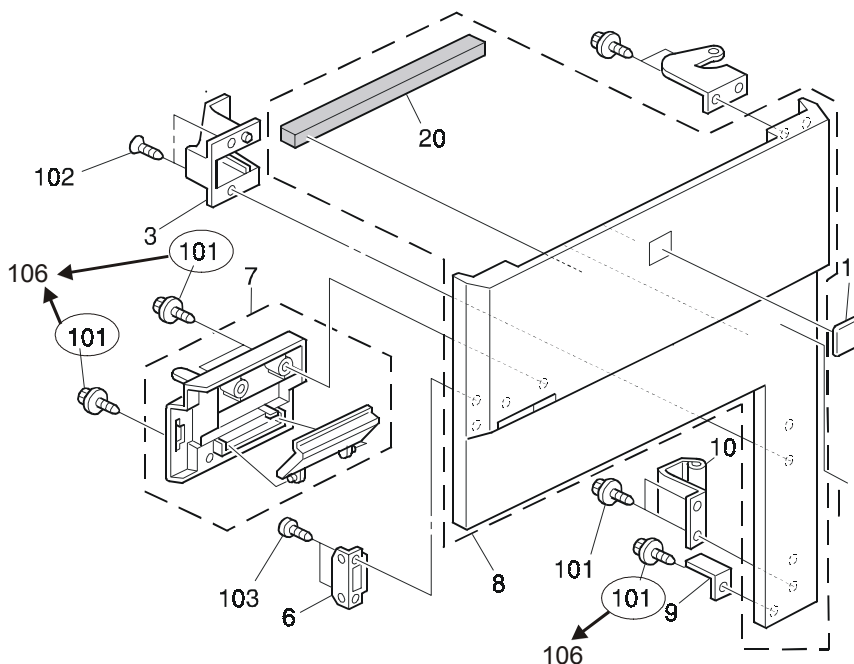

Reissued: 19-Sep-00

Model: Mojito	Date: 26-Apr-00	No.: MA293001a
---------------	-----------------	----------------

Section 10. ORIGINAL EXIT SECTION 2 (A292/A293)

Incorrect part number	Correct part number	Description	Q'ty	Int	Page	Index	Note
0353 0060B		Philips Pan Head Screw - M3x6			33	103	
	0353 0030B	Philips Truss Head Screw - M3x3			33	103	


Section 14. OPTICS SECTION 1 (A292/A293)

Incorrect part number	Correct part number	Description	Q'ty	Int	Page	Index	Note
5442 1924		Exposure Glass Cushion	2		41	16	
	AA16 1137	Cushion - 0.5	2		41	16	

Section 25. PAPER FEED UNIT 2 (A292/A293)

Incorrect part number	Correct part number	Description	Q'ty	Int	Page	Index	Note
---	5442 1924	Exposure Glass Cushion	2		65	16	*2

*2: New index number

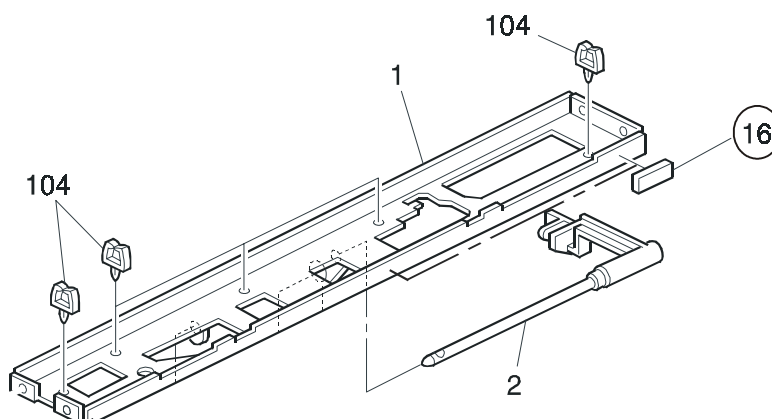


Reissued: 19-Sep-00

Model: Mojito	Date: 26-Apr-00	No.: MA293001a
---------------	-----------------	----------------

Section 39. PCU (A292/A293)

Incorrect part number	Correct part number	Description	Q'ty	Int	Page	Index	Note
---	AA15 3088	Cleaning Entrance Seal - 3x345x2	1		91	26	*3


*3: New index number

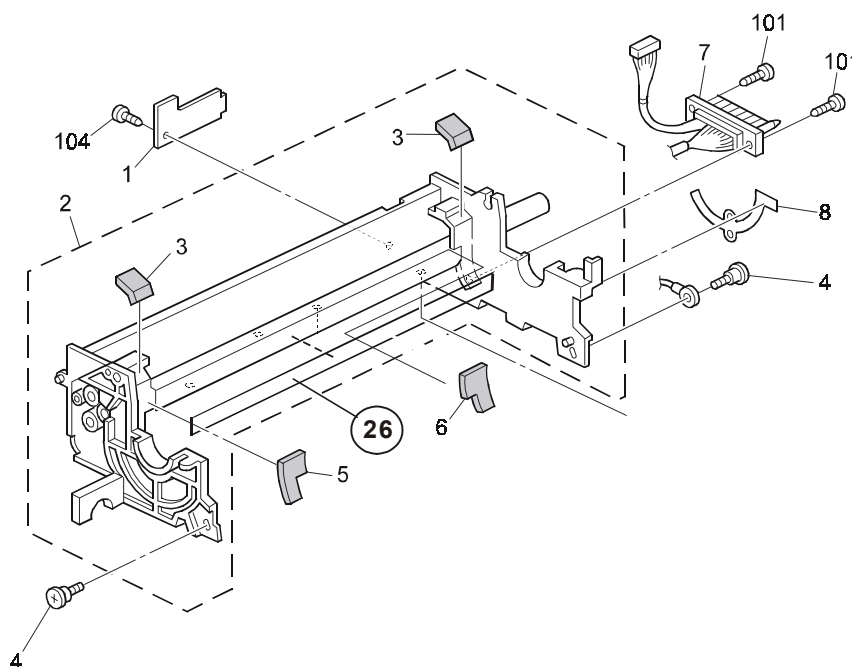

Section 57. DRIVE SECTION 5 (A292/A293)

Incorrect part number	Correct part number	Description	Q'ty	Int	Page	Index	Note
	11050199	Clamp			127	114	*4
---	0414 0120B	Tapping Bind Screw - M4x12			127	115	*4

*4: New index number

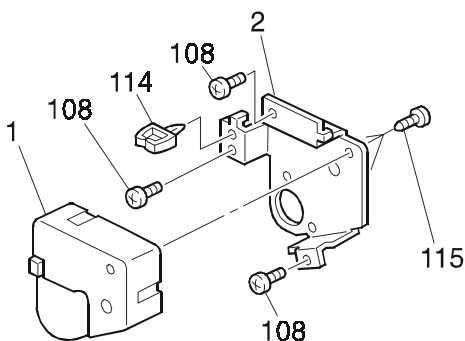

Reissued: 19-Sep-00

Model: Mojito	Date: 26-Apr-00	No.: MA293001a
---------------	-----------------	----------------

MODEL NAME	V/ Hz	DESTINATION	CODE	JAPAN PRODUCTION SERIAL NO.	REI PRODUCTION SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14		
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15		
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17		
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22		
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24		
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26		
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27		
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29		
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14		
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15		
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17		
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22		
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24		
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26		
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27		
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29		

Reissued: 10-Jul-00

Model: Mojito	Date: 06-Jun-00	No.: MA293002b
---------------	-----------------	----------------

MB Correction


The items in bold italics have been corrected or added.

Modified Article: BICU Board		Prepared by: M. Tsuyuki	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2935101		BICU Board (LAN)	1	X/O	43	18	
	→ A2937552	BICU Board (NA)			157	*	
	→ A2937562	BICU Board (EU)					

Please correct your parts catalog.
The BICU for Lanier is same as other versions.

15. Optics Section 2

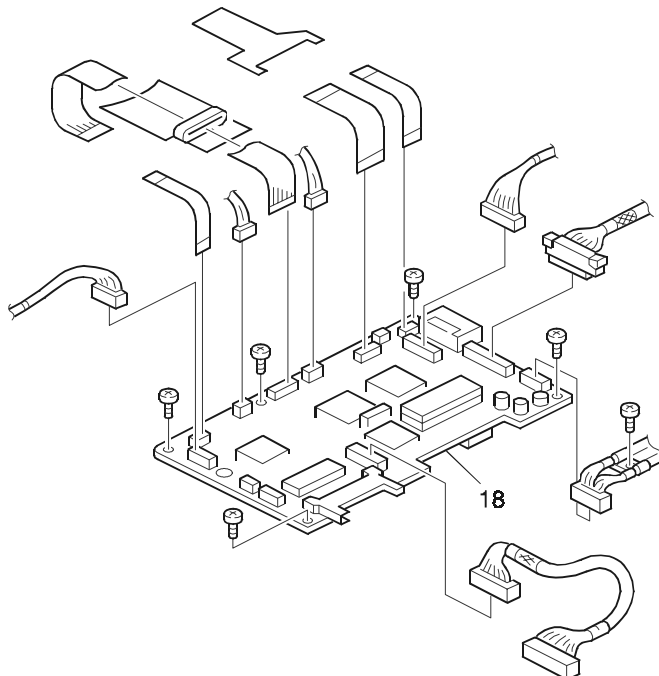

Reissued: 24-Jul-00

Model: Mojito	Date: 06-Jun-00	No.: MA293003a
---------------	-----------------	----------------

Serial Number Update


The serial number information has been updated.

Modified Article: Bracket – I/O Board		Prepared by: M. Tsuyuki	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2935850	A2935845	Bracket – I/O Board	15	X/O	129	15	

To ensure grounding, a grounding plate has been added to the I/O board bracket.

58. Electrical Section 1

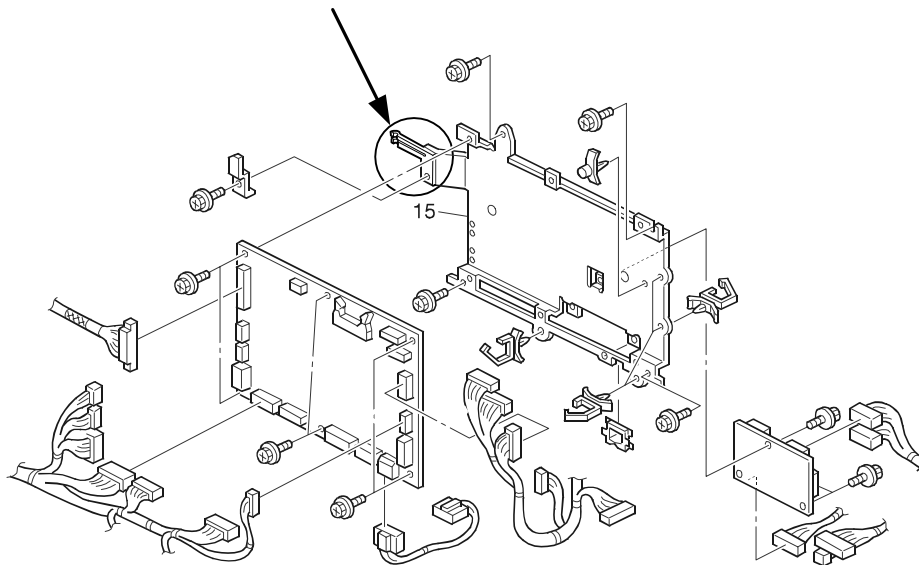

Reissued: 24-Jul-00

Model: Mojito

Date: 06-Jun-00

No.: MA293003a

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0710050001
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4700500001
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0710050051
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60500001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4700500278
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4700500616
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0720050001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4800500354
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0720050051
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50500001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4800400376
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4800400408

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	H4705300449
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	H4705300389
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	H4805300002
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	H4805200624

Reissued: 24-Jul-00

Model: Mojito	Date: 06-Jun-00	No.: MA293004b
---------------	-----------------	----------------

Serial Number Update

The serial number information has been updated.

Modified Article: Cleaning Roller Gear		Prepared by: M. Tsuyuki	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()


Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AB014104	AB014175	Cleaning Roller Gear – 50Z	1	X/X	93	8	
A2933850	A2833851	Transfer Belt Unit	1	X/X	93	24	
AB014093	AB014176	Cleaning Roller Gear Cam Gear – 37Z	1	X/X	95	31	
A2933900	A2933910	Transfer Casing Unit	1	X/X	95	1	

To reduce uneven density in halftone areas, the numbers of teeth on the gears have been changed as follows. The part number of each unit has also changed. Those parts must be replaced as a set.


AB014104 (25Z) → AB014175 (50Z)

AB014093 (18Z) → AB014176 (37Z)

40. Transfer Section 1

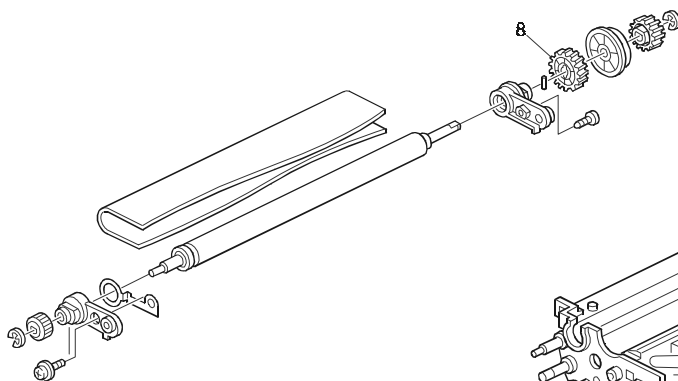

41. Transfer Section 2

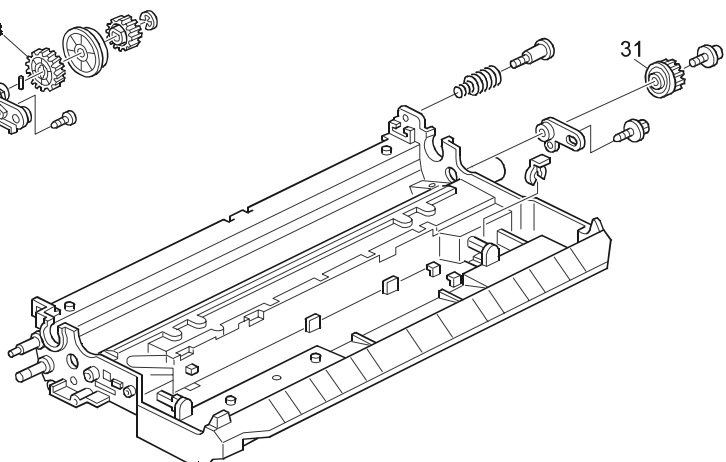

Reissued: 24-Jul-00

Model: Mojito

Date: 06-Jun-00

No.: MA293004b

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0710050001
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4700500001
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0710050051
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60500001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4700500278
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4700500616
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0720050001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4800500354
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0720050051
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50500001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4800500001
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4800500559

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	H4705500301
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	H4705400515
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	H4805500001
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	H4805500001

Reissued: 24-Jul-00

Model: Mojito	Date: 06-Jun-00	No.: MA293005a
---------------	-----------------	----------------

Serial Number Update


The serial number information has been updated.

Modified Article: DC Solenoid Ass'y		Prepared by: M. Tsuyuki	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2934781	A2934782	DC Solenoid Ass'y	1	X/O	109	3	

To prevent dog ears when using Legal paper, the DC solenoid bracket has been modified.

48. Inverter & Duplex Unit 4

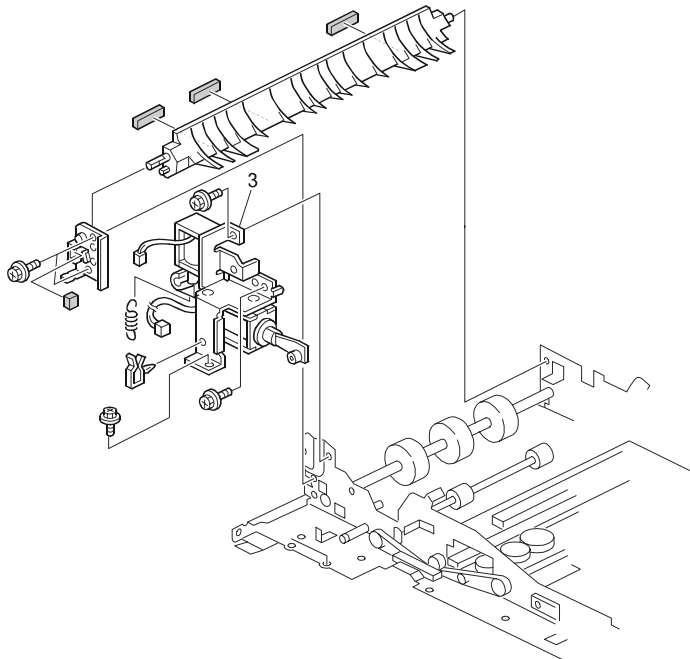

Reissued: 24-Jul-00

Model: Mojito

Date: 06-Jun-00

No.: MA293005a

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0710040111
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4700400403
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L07100400403
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60400001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4700400376
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4700400603
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0720040096
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4800400135
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0720050051
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50400001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4800400201
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4800400408

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	H4705300393
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	H4705300001
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	H4805300002
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	H4805200623

Reissued: 24-Jul-00

Model: Mojito	Date: 06-Jun-00	No.: MA293006a
---------------	-----------------	----------------

Serial Number Update


The serial number information has been updated.

Modified Article: Duplex Roller		Prepared by: M. Tsuyuki	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AF020498	AF020533	Duplex Roller	1	X/O	111	10	

To prevent the edges of the paper from becoming dirty when making duplex copies, the material of the duplex roller has been changed.

49. Inverter & Duplex Unit 5

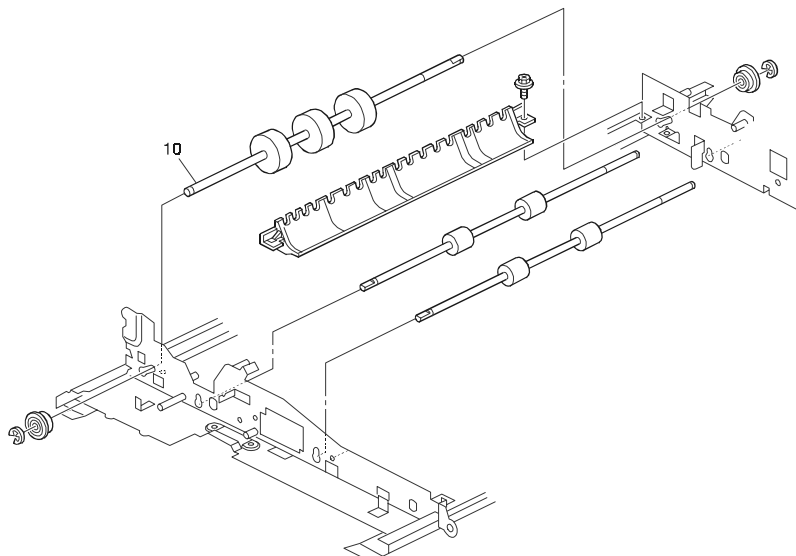

Reissued: 24-Jul-00

Model: Mojito

Date: 06-Jun-00

No.: MA293006a

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0710050001
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4700500001
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0710050051
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60500001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4700500278
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4700500616
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0720050001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4800500354
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0720050051
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50500001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4800500001
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4800500559

REI (U.S.A.) Production


MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	H4705200160
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	H4705300001
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	H4805200255
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	H4805200578

Model: Mojito		Date: 06-Jun-00	No.: MA293007
Modified Article: Lower Fusing Cover		Prepared by: M. Tsuyuki	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2934161	A0964161	Lower Fusing Cover	1	O/O	97	5	

As per factory request, the lower fusing cover for the US model has been changed.

42. Fusing Unit 1

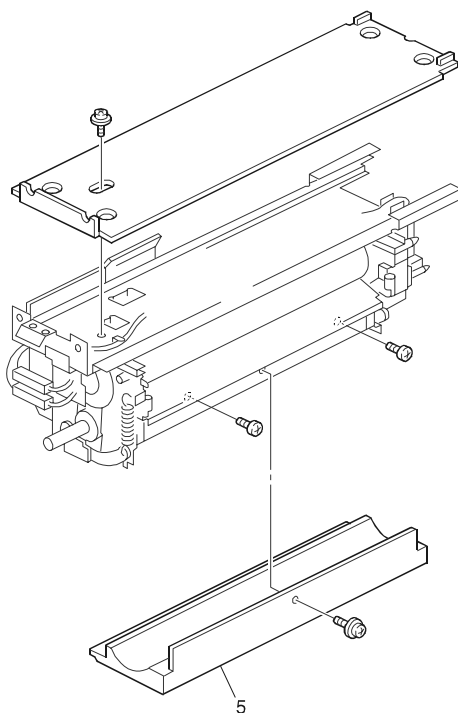

Model: Mojito		Date: 27-Jun-00	No.: MA293008
Modified Article: NV-RAM Minus Counter		Prepared by: F. Noguchi	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☒ Other	

To facilitate servicing, the NV-RAM Minus Counter (counter = 9990000) has been registered as a service part in place of IC – SRAM M48Z128Y-85PM.
Also, the table for the BICU board has been corrected as shown below.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
14075050		IC – SRAM M48Z128Y-85PM	1 - 0	X/	159	224	
	A2939099	NV-RAM Minus Counter	0 - 1	/O	157	*5	

* : New index

Section 67: BICU BOARD (A292/A293)

SYMBOL NO.	INDEX NO.
IC111	142
IC112	140
IC113	126
IC114	132
IC115	133
IC116	117
IC117	132
IC118	127
IC119	139
IC120	145



SYMBOL NO.	INDEX NO.
IC111	142
IC112	140
IC113	126
IC114	132
IC115	133
IC116	224 => 5
(Socket)	117
IC117	132
IC118	127
IC119	139
IC120	145

Model: Mojito		Date: 29-Jun-00	No.: MA293009
Modified Article: Parts Catalog		Prepared by: F. Noguchi	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☒ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☐ Other	


Section 16: Optics Section 3 (A292/A293)

Some descriptions deleted and added.

Note: Due to a vendor request, the following parts have been deleted and are no longer available. When these parts fail, please replace the 1st Scanner Unit.

Deleted part number	Added part number	Description	Q'ty	Page	Index	Note
A2931732		1st Scanner Frame	1 - 0	45	21	
A2931733		Front Side Plate – 1 st Scanner	1 - 0	45	16	
A2931734		Rear Side Plate – 1 st Scanner	1 - 0	45	19	
	A2931731	1 st Scanner Unit	0 - 1	45	* 26	

* : New Index

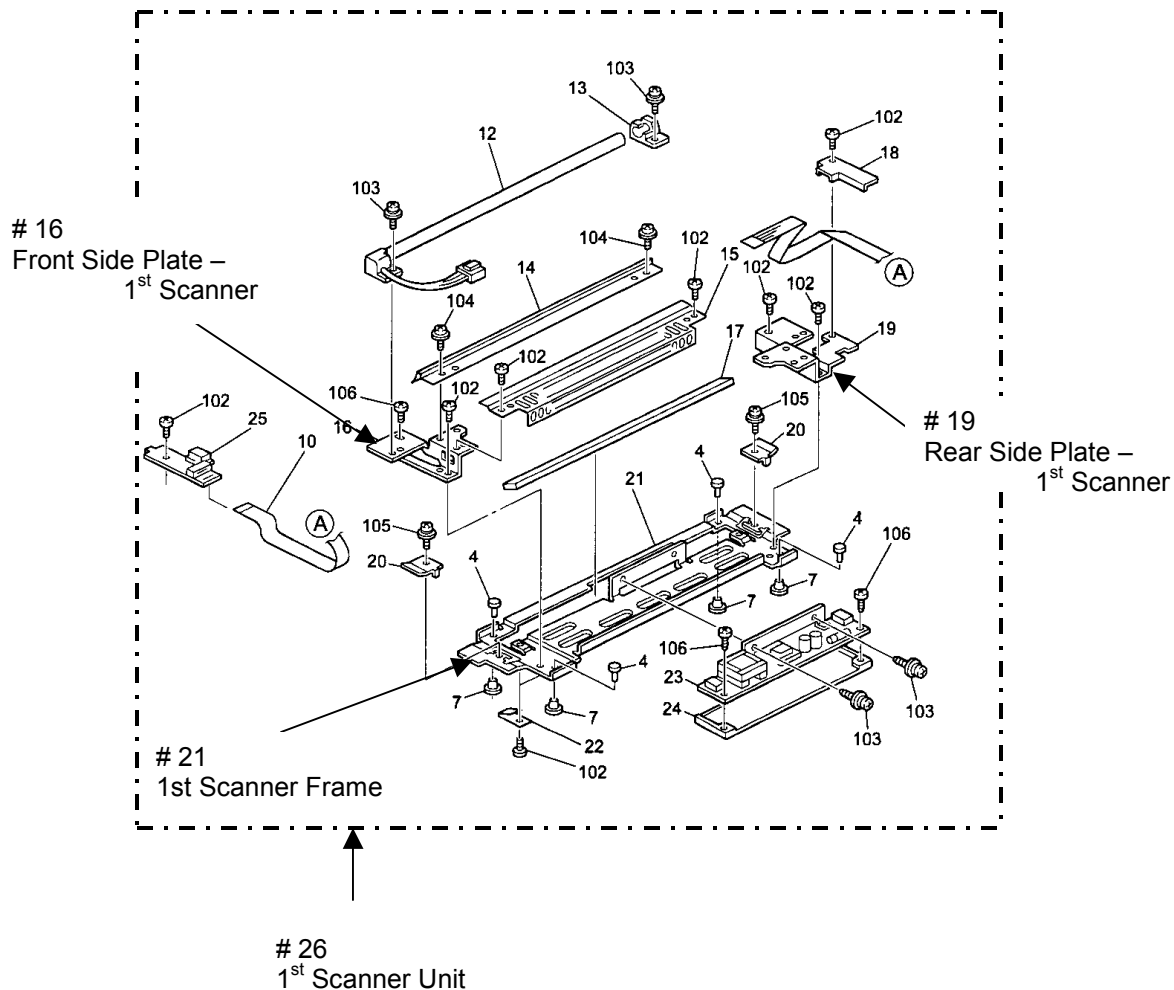

Model: Mojito

Date: 29-Jun-00


No.: MA293009

Section 54: Drive Section 2 (A292/A293)

Corrected index in illustration and added description.

New part number	Description	Q'ty	Page	Index	Note
05740040E	Hexagon Headless Set Screw - M4x4	n	121	* 117	

* : New Index

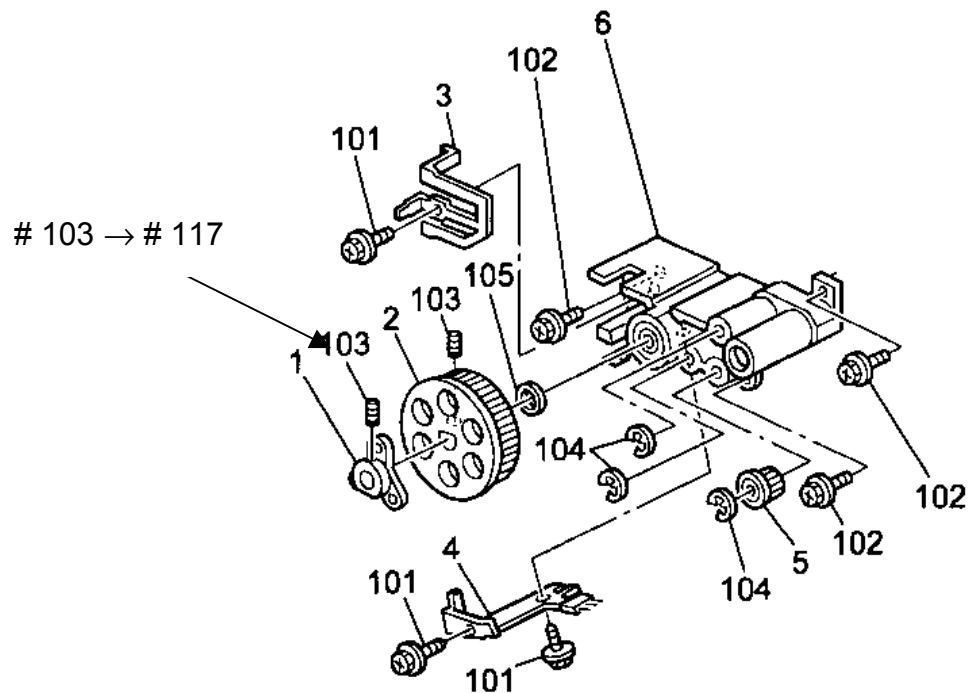

Reissued: 24-Jul-00

Model: Mojito	Date: 29-Jun-00	No.: MA293010a
---------------	-----------------	----------------

Serial Number Update


The serial number information has been updated.

Modified Article: Compression Spring		Prepared by: M. Tsuyuki	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☒ Other	

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AA063485		Compression Spring	1	-	95	22	

To ensure release of the transfer belt from the drum, the compression spring has been deleted.

41. Transport Section 2 (A292/A293)

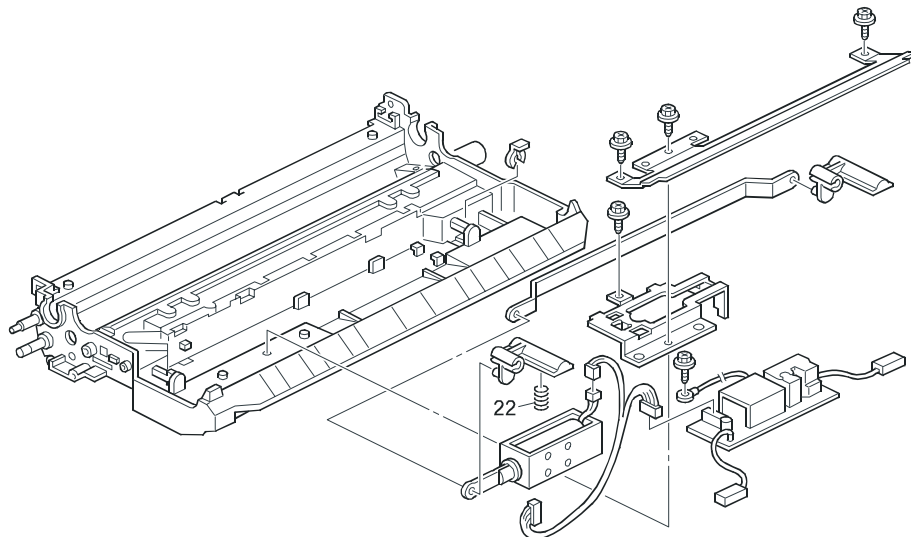

Reissued: 24-Jul-00

Model: Mojito

Date: 29-Jun-00

No.: MA293010a

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0710020001
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4700300001
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0710020003
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60300001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	From 1st Production
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4700300278
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0720020001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4800300001
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0720020003
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50300001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	From 1st Production
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4800300194

REI (U.S.A.) Production *From the very 1st unit ~ for each model


MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	H4705100281
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	H4705000001
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	H4805100181
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	H4805000001

Model: Mojito		Date: 12-Jul-00	No.: MA293011
Modified Article: Original Length Sensor		Prepared by: M. Tsuyuki	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AW010078	A2941843	Photosensor with Filter – H50	2	X/O	41	8	

To ensure the operation of the original length sensor, a filter has been added to the original length sensor.

14. Optics Section 1

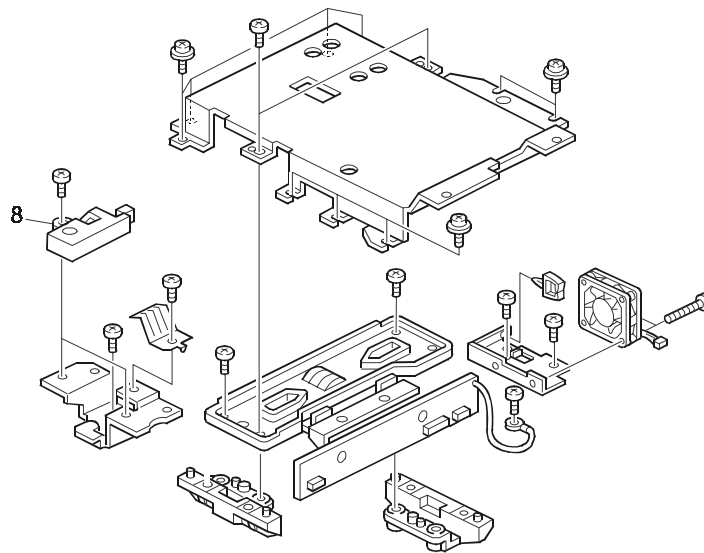

Model: Mojito

Date: 12-Jul-00

No.: MA293011

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0710040111
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4700400403
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0710040001
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60400001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4700400209
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4700500616
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0720040096
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4800400001
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0720040001
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50400001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4800400201
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4800400408

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	


Model: Mojito		Date: 21-Jul-00	No.: MA293012
Modified Article: Parts Catalog		Prepared by: F. Noguchi	
From: Technical Service Dept., GTS Division			
Reason for Modification:	☒ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☐ Other	

Please correct your parts catalog.

Section 3: Operation Panel (A292/A293)

Corrected part number.

Incorrect part number	Correct part number	Description	Q'ty	Page	Index	Note
A2291463	A2931463	Application Board	1	19	22	

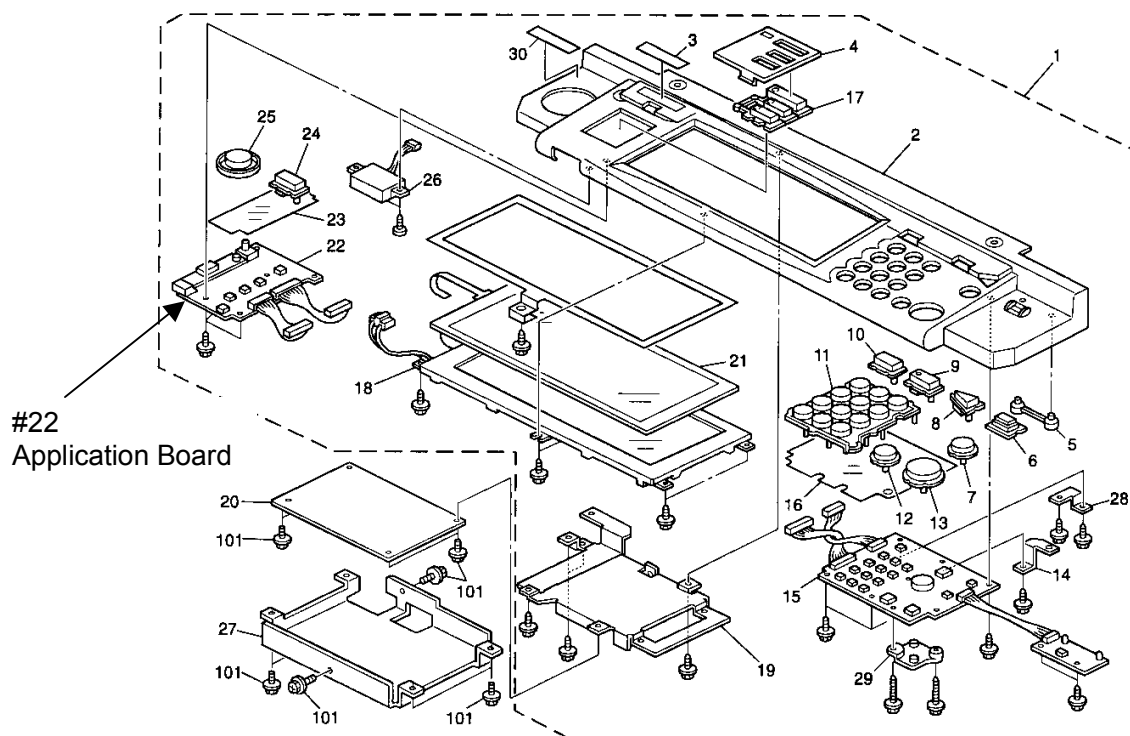

Reissued: 18-Sep-00

Model: Mojito	Date: 30-Aug-00	No.: MA293013a
---------------	-----------------	----------------

Serial Number Update

The serial number information has been updated.

Modified Article: ADF Main Control Board		Prepared by: F. Noguchi	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B3015500	B3015505	ADF Main Control Board	1 - 1	X/O	37	22	

When a motor lock occurs, surge current flows through the motor drive circuit on the ADF main control board, which may damage the circuit. The current capacitance of the circuit has been increased to protect the circuit in the event of a current surge.

Reissued: 18-Sep-00

Model: Mojito

Date: 30-Aug-00

No.: MA293013a

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0710050001
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4700500001
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0710050051
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60500001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4700500278
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4700500616
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0720050001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4800500354
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0720050051
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50500001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4800500001
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4800500559

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	H4705400146
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	H4705400252
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	H4805400362
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	H4805400442

Reissued: 18-Sep-00

Model: Mojito	Date: 30-Aug-00	No.: MA293014a
---------------	-----------------	----------------

Serial Number Update

The serial number information has been updated.


Modified Article: ADF Main Control Board		Prepared by: F. Noguchi	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B3015505	B3015510	ADF Main Control Board	1	X/O	37	22	

During the production process, it was found that some ADF Main Control Boards had a relatively narrow adjustment range for the transport drive motor speed. In some cases, the motors could not reach the target adjustment speed.

The defective boards were not installed in the ADF Units. Therefore, the same symptom will not occur on production machines released from the factory.

To ensure good function of the ADF Main Control Board, IC #NJM4151 on the ADF Main Control Board has been modified as follows:

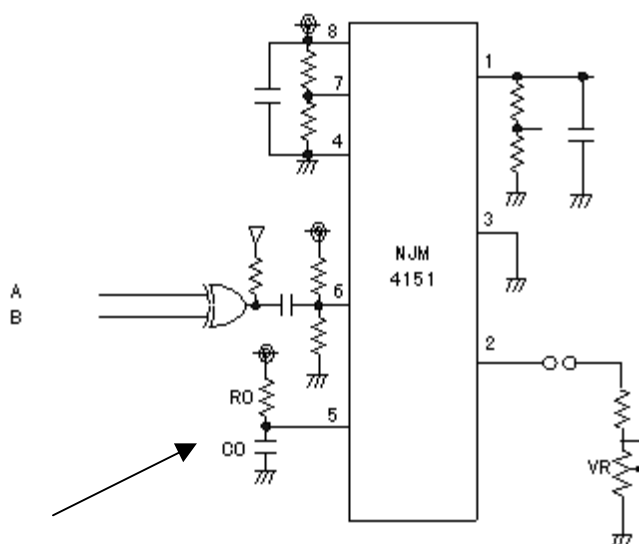

Old

$R_0: 6.2k\Omega \pm 5\%$

$C_0: 0.0047\mu F \pm 10\%$

New

$R_0: 8.2k\Omega \pm 5\%$

$C_0: 0.0022\mu F \pm 10\%$

Reissued: 18-Sep-00

Model: Mojito

Date: 30-Aug-00

No.: MA293014a

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0710070001
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4700700001
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0710070136
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60700001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4700600371
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4700600061
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0720070001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4800700001
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0720070105
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50600048
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4800600173
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4800600426

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	H4705600353
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	H4705600064
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	H4805600003
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	H4805600101

Reissued: 26-Oct-00

Model: Mojito	Date: 27-Sep-00	No.: MA293015a
---------------	-----------------	----------------

Serial Number Update


The Serial Number information has been updated.

Modified Article: Toner Bottle Holder		Prepared by: M. Tsuyuki	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☒ Other	

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2933201	A2933205	Toner Bottle Holder Ass'y (NRG/SVN/RIC Asia)	1	X/O	77	1	
A2933202	A2933206	Toner Bottle Holder Ass'y (RIC NA)	1	X/O	77	1	
A2933203	A2933207	Toner Bottle Holder Ass'y (RIC EU)	1	X/O	77	1	
A2933204	A2933208	Toner Bottle Holder Ass'y (INF/LAN)	1	X/O	77	1	

If the shutter cover is not hung on the hook of the right inner cover, machine vibration may cause the inner shutter to move and cover the entrance to the toner hopper. To secure the shutter cover in place, a boss (φ2, h=2) has been added to the cover. The part number for the bottle drive unit has been changed.

When installing the right inner cover, be sure to place the boss in the guide rail.

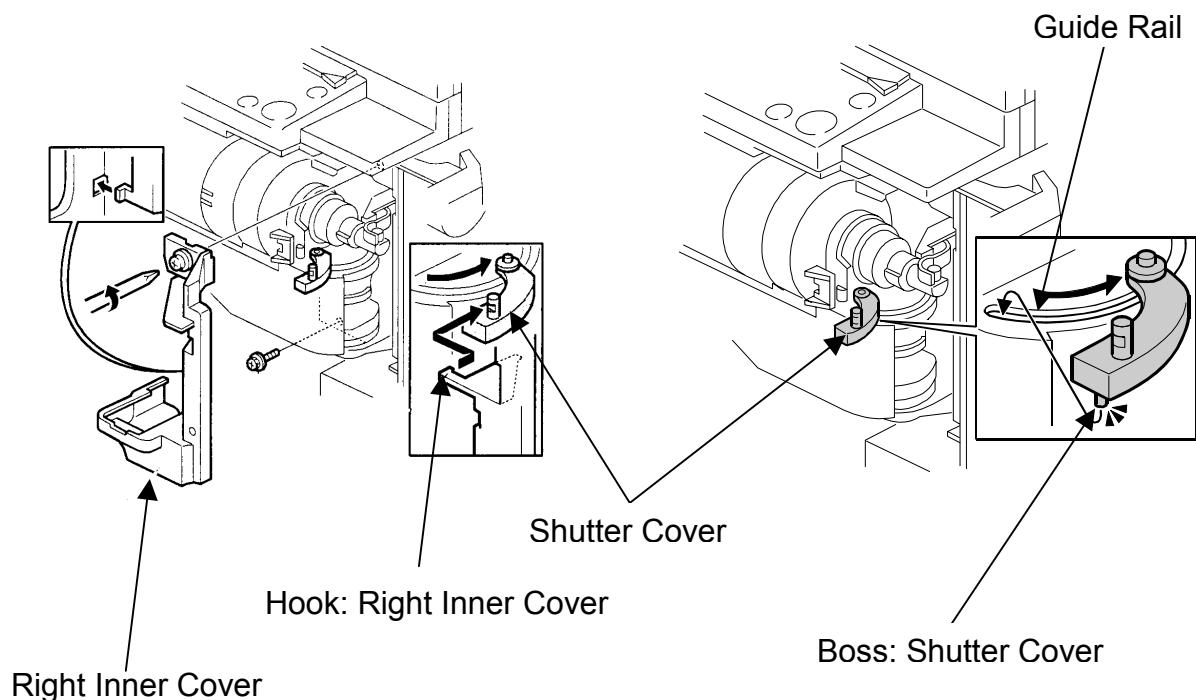

Reissued: 26-Oct-00

Model: Mojito

Date: 27-Sep-00

No.: MA293015a

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0710060001
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4700500001
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0710060126
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60500001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4700500427
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4700500616
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0720060001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4800500354
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0720060126
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50500001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4800500006
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4800500559

REI (U.S.A.) Production


MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	H4705400242
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	H4705400391
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	H4805400429
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	H4805500001

Model: Mojito		Date: 27-Sep-00	No.: MA293016
Modified Article: Caution Decal		Prepared by: M. Tsuyuki	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☒ Other	

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2933208	A2933209	Toner Bottle Holder Ass'y	1	X/O	77	1	
A2293223	A2933237	Bottle Holder	1	X/O	77	14	
	A2933238	Decal - Caution	1		77	37	

As per field request, a caution decal has been added to the bottle holder.

32. Toner Bottle Holder

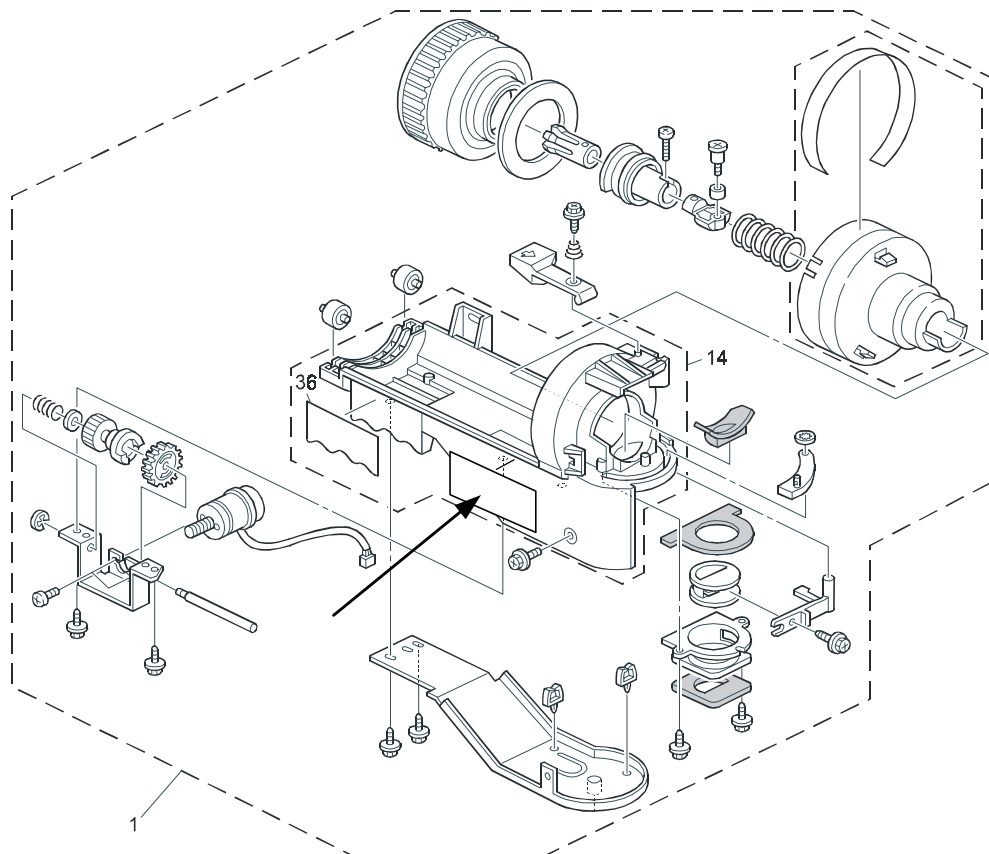

Model: Mojito

Date: 27-Sep-00

No.: MA293016

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0710050005
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0710050051
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0720060001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0720060126
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	

Reissued: 26-Oct-00

Model: Mojito	Date: 28-Sep-00	No.: MA293017a
---------------	-----------------	----------------

Serial Number Update


The Serial Number Information has been updated.

Modified Article: Left Scale Sheet		Prepared by: M. Tsuyuki	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A1931752	A2931793	Left Scale Guide Left Scale Sheet	1	X/O	41	3	

To ensure that the left scale fits the exposure glass correctly, the width of the left scale sheet has been changed from 15.5 mm to 14.5 mm.

14. Optics Section 1

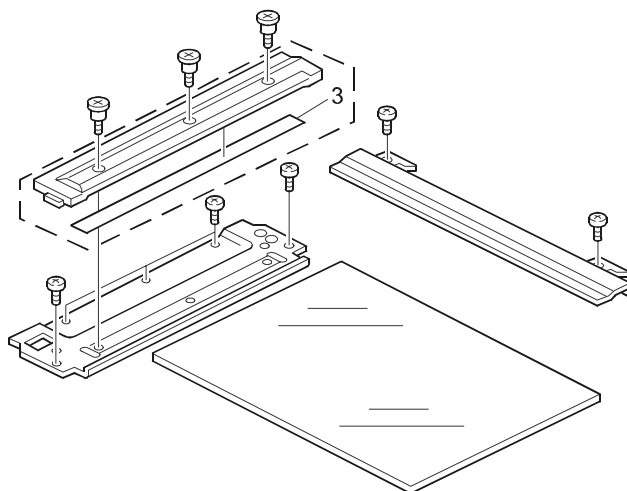

Reissued: 26-Oct-00

Model: Mojito

Date: 28-Sep-00

No.: MA293017a

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0710080001
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4700700001
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0710080114
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60700001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4700700301
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4700700978
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0720080001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4800700001
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0720070143
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50700001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4800700251
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4800700672

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	H4705700002
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	H4705700331
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	H4805700001
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	H4805600339

Reissued: 26-Oct-00

Model: Mojito	Date: 28-Sep-00	No.: MA293018a
---------------	-----------------	----------------

Serial Number Update


The Serial Number Information has been updated.

Modified Article: Gear - 32z		Prepared by: M. Tsuyuki	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Other	☐ To meet standards ()

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AB014155	AB013778	Gear – 32Z	1	X/O	63	20	

To improve reliability, the gear with a one-way clutch has been changed.

25. Paper Feed Section 1

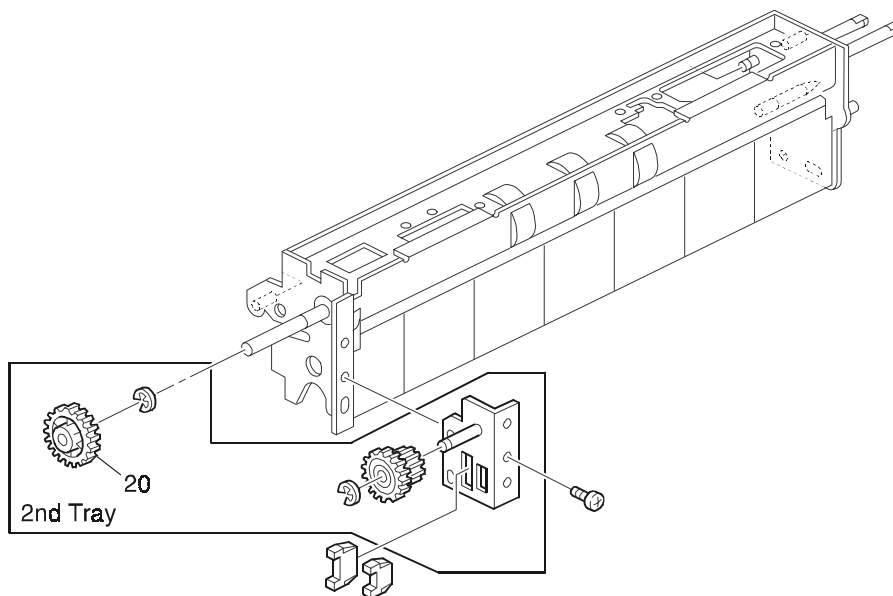

Reissued: 26-Oct-00

Model: Mojito

Date: 28-Sep-00

No.: MA293018a

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0710070001
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4700700001
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0710070136
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60700001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4700700301
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4700700978
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0720070001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4800700001
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0720070105
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50700001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4800700251
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4800700672

REI (U.S.A.) Production


MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	H4705600638
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	H4705600648
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	H4805600004
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	H4805600101

Model: Mojito		Date: 21-Dec-00	No.: MA293019
Modified Article: Belt Unit Knob		Prepared by: M. Tsuyuki	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A0963960	A2933960	Belt Unit Knob	1	X/O	139	16	

To improve ease of operation, a cover has been added to the belt unit knob.

63. Frame Section 2

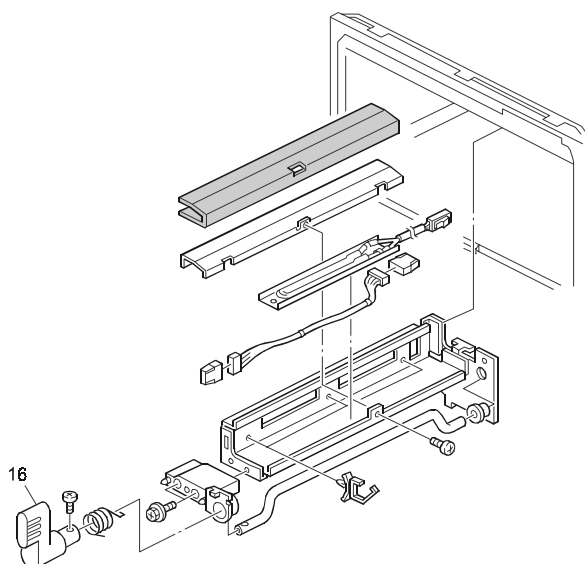

Model: Mojito

Date: 21-Dec-00

No.: MA293019

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0710070001
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4700600123
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0710050100
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60500001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4700500278
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4700500616
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0720060001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4800500354
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0720050051
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50500001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4800500001
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4800500559

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	


Model: Mojito		Date: 14-Feb-01	No.: MA293020
Modified Article: Optical Housing Ass'y		Prepared by: A. Sasaki	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	A293 1871	Optical Housing Ass'y	1		49	35	*1

*1: New index

As per field request, the parts encircled by a dotted line in the illustration below has been registered as an assembled service part.

18. LASER UNIT (A292/A293)

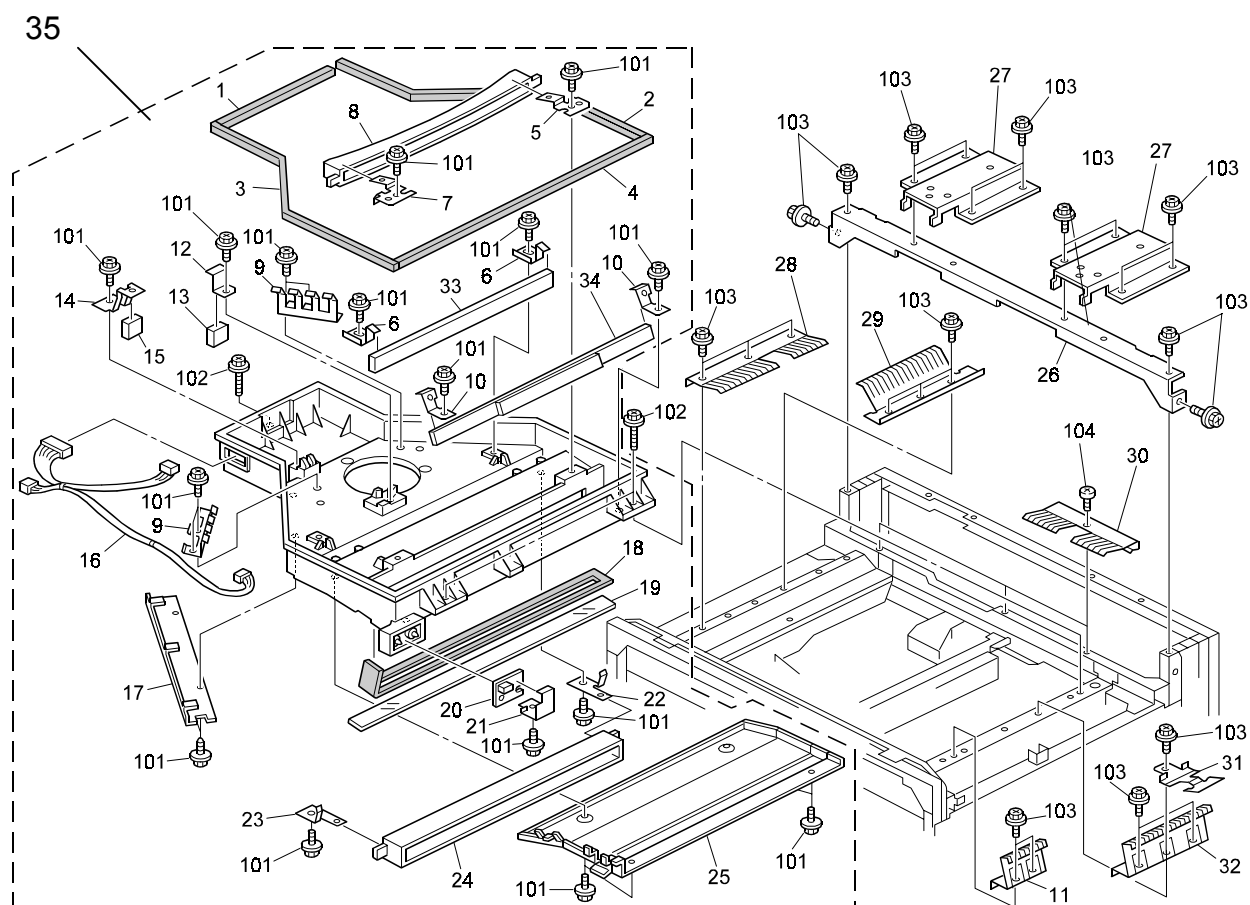

Model: Mojito		Date: 06-Mar-01	No.: MA293021
Modified Article: HDD		Prepared by: F. Noguchi	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2935890	A2935891	ATA HDD	O/O	1	135	18	

The old HDD has been discontinued by the manufacturer, so the HDD has been changed over to a new model.

Model: Mojito		Date: 06-Mar-01	No.: MA293022
Modified Article: Rear Drum Seal		Prepared by: M. Matsuda	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A134 2392	A294 3572	Rear Drum Seal	1	O/O	91	6	

To standardize the part with other models, the rear drum seal has been changed.

Model: Mojito

Date: 06-Mar-01

No.: MA293022

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0711020001
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4710200311
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0711020156
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60310001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4710300421
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4710200957
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0721020001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4810200141
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L072103xxxx
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50310001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4810200334
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4810200435

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	

Reissued: 13-Mar-01

Model: Mojito	Date: 06-Mar-01	No.: MA293023a
---------------	-----------------	----------------

MB Correction

The items in bold italics have been corrected or added.

Modified Article: Left and Right Holder (120V version only)		Prepared by: F. Noguchi	
From: Technical Service Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A0974126	A2944077	Left Holder	1	O/O	97	10	*
A0974129	A2944078	Right Holder	1	O/O	97	7	*

* These parts can individually be replaced but the modification is effective with all parts.

To prevent the left or right holder from breaking at the middle portion, the shape of the pressure roller cleaning roller holders has been changed. The strength has been increased by a factor of 1.65.

Model: Mojito		Date: 22-Jun-01	No.: MA293024
Modified Article: HDD		Prepared by: F. Noguchi	
From: Technical Service Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

The manufacturer has stopped making the original HDD. For this reason, the HDD has been changed to a new model.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2935891	A2935892	ATA - HDD	1	O/O	136	18	

Model: Mojito		Date: 22-Jun-01	No.: MA293025
Modified Article: Photointerrupter		Prepared by: F. Noguchi	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Due to part standardization, the photointerrupter has been changed.


Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AW020102	AW020126	Photointerrupter	1	O/O	103	14	

Model: Mojito		Date: 09-Aug-01	No.: MA293026
Modified Article: Inner Cover - Right Rear		Prepared by: F. Noguchi	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2486739	A2936739	Inner Cover – Right Rear	1	X/O	55	12	
	AA153138	Cushion	0 - 1		55	16	

The Right Rear Inner Cover has been strengthened and a cushion has been added, in order to ensure that the following does not occur even when the Tandem Tray is closed forcefully or the paper is mis-loaded:

The side fences reopen, which prevents the Right Tray from lifting up or sometimes causing damage to the Left Tray Back Fence (see RTB #RA293020 for details).

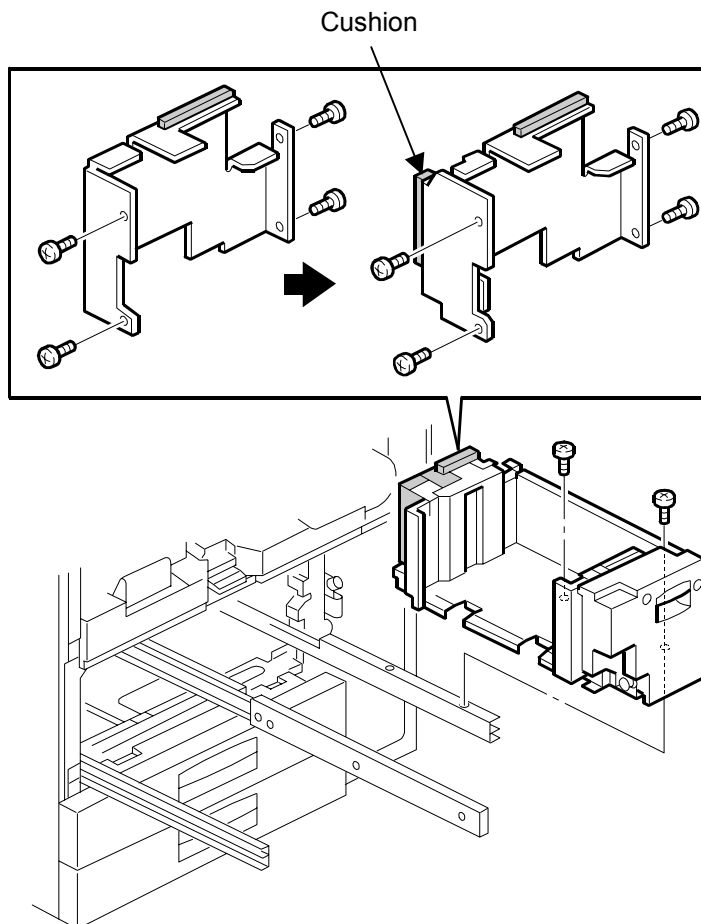

Model: Mojito

Date: 09-Aug-01

No.: MA293026

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0711050256
Ricoh Aficio 551	120/60	Taiwan	A292-19	
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4710500300
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0711050491
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60510001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4710500001
Ricoh Aficio 551	230/50	Korea	A292-28	H4710500276
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4710500148
Ricoh Aficio 551	230/50	China	A292-69	H4710500259
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0721050116
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4810500134
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0721070181
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50510001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4810500201
Ricoh Aficio 700	230/50	Korea	A293-28	H4810500393
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4810500327


REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	

Model: Mojito		Date: 29-Aug-01	No.: MA293027
Modified Article: Pick-up Roller Bracket		Prepared by: F. Noguchi	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☒ Part standardization	☐ Other	

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A8061314	B3011314	Pick-up Roller Bracket	1	X/O	25	17	

The pick-up roller bracket has been changed for parts standardization with a new model. As shown below, the new bracket contains a metallic shaft for the timing pulley (A8062151) to improve the bracket's durability.

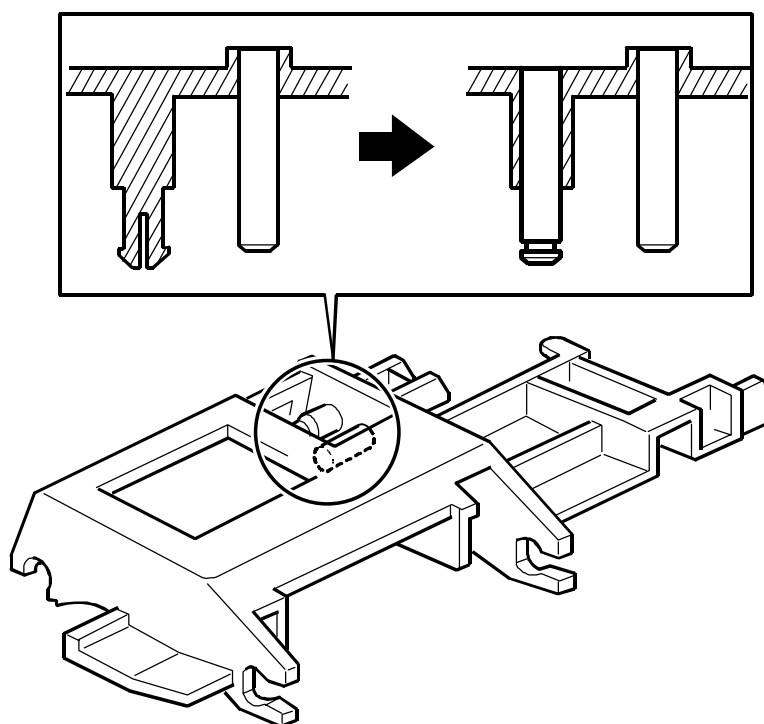

Model: Mojito	Date: 29-Aug-01	No.: MA293027
---------------	-----------------	---------------

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0711060001
Ricoh Aficio 551	120/60	Taiwan	A292-19	H4710600843
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4710600409
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0711060216
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60610001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4710600001
Ricoh Aficio 551	230/50	Korea	A292-28	H4710600848
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4710600734
Ricoh Aficio 551	230/50	China	A292-69	H47106XXXXX
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0721060001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4810600146
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0721070181
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50610001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4810600181
Ricoh Aficio 700	230/50	Korea	A293-28	H4810600407
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4810600339

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	

Reissued: 20-Nov-01

Model: Mojito	Date: 10-Aug-01	No.: MA293028a
---------------	-----------------	----------------

MB Correction

The items in bold italics have been corrected or added.


Modified Article: Right Scale		Prepared by: M.Kitajima	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☒ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☐ Other	

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	A2931774	Right Scale Spacer	2	-	41	#27	

#27: New Index

To facilitate assembly, two right scale spacers have been attached to the right scale as shown below.

Note: These spacers attach behind the right scale.

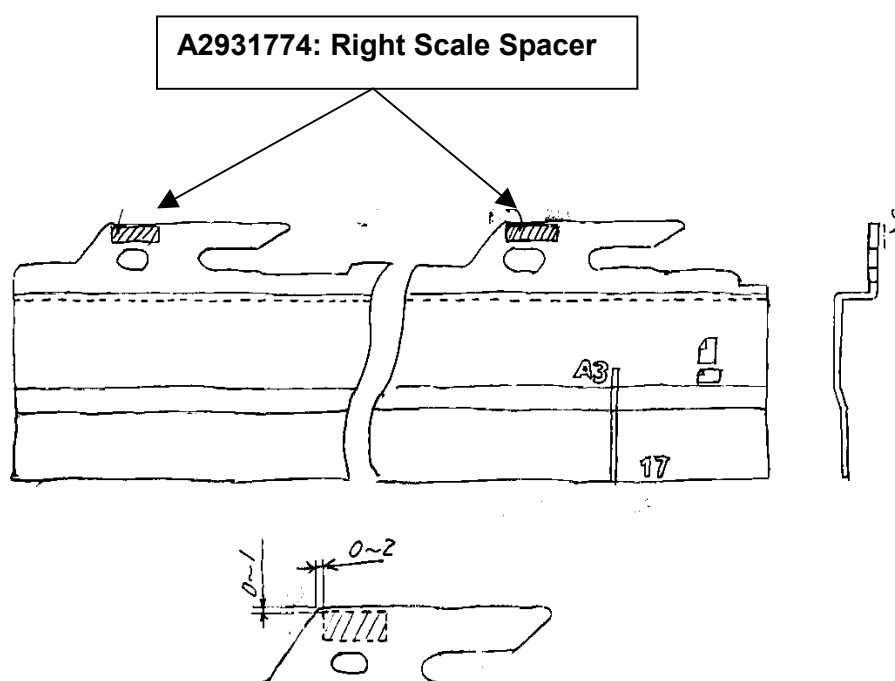

Reissued: 21-Jun-02

Model: Mojito	Date: 24-Aug-01	No.: MA293029a
---------------	-----------------	----------------

MB Correction

The items in bold italics have been corrected or added.

Modified Article: Parts Catalog		Prepared by: M.Matsuda	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☒ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☐ Other	

Please correct your Parts Catalogs as follows:

1. Newly registered parts (as per a request from the field):

Note: The Fusing Units listed below include all components listed on pages 97, 99 and 101 (section titles "Fusing Unit 1", "Fusing Unit 2", "Fusing Unit 3").

New part number	Description	Q'ty	Page	Index	Note
A2932320	Lower Drum unit	1	89	*	
A2934010	Fusing Unit – 120V (TWN/LAN)	1	97	*	*
A2934015	Fusing Unit – 230V				*
A2934018	Fusing Unit – 230V (Asia)				*
A2934032	Fusing Unit (Korea)				*
A2924050	Fusing Unit – 120V (RIC/SVN)				*

2. Index correction:

Page 45 16. Optics Section 3:

	Part number	Description	Index
Incorrect	A2931765	2 nd Mirror	2
	A2931767	3 rd Mirror	9
Correct	A2931765	3rd Mirror	2
	A2931767	2nd Mirror	9

3. Missing part number:

Page 69 28. Vertical Transport Section:

Add Part Number:	Description	Q'ty	Page	Index	Note
12042355	Micro Switch - AM51632A531	n	69	107	


Model: Mojito		Date: 29-Aug-01	No.: MA293030
Modified Article: Parts Catalog		Prepared by: F. Noguchi	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Please add the following components, which were missing from the Parts Catalog:

New part number	Description	Q'ty	Page	Index	Note
A2936712	End Fence Guide	2	57	38	*
04523006B	Tapping Screw – M3x6	n	57	110	*

*: New Index

0

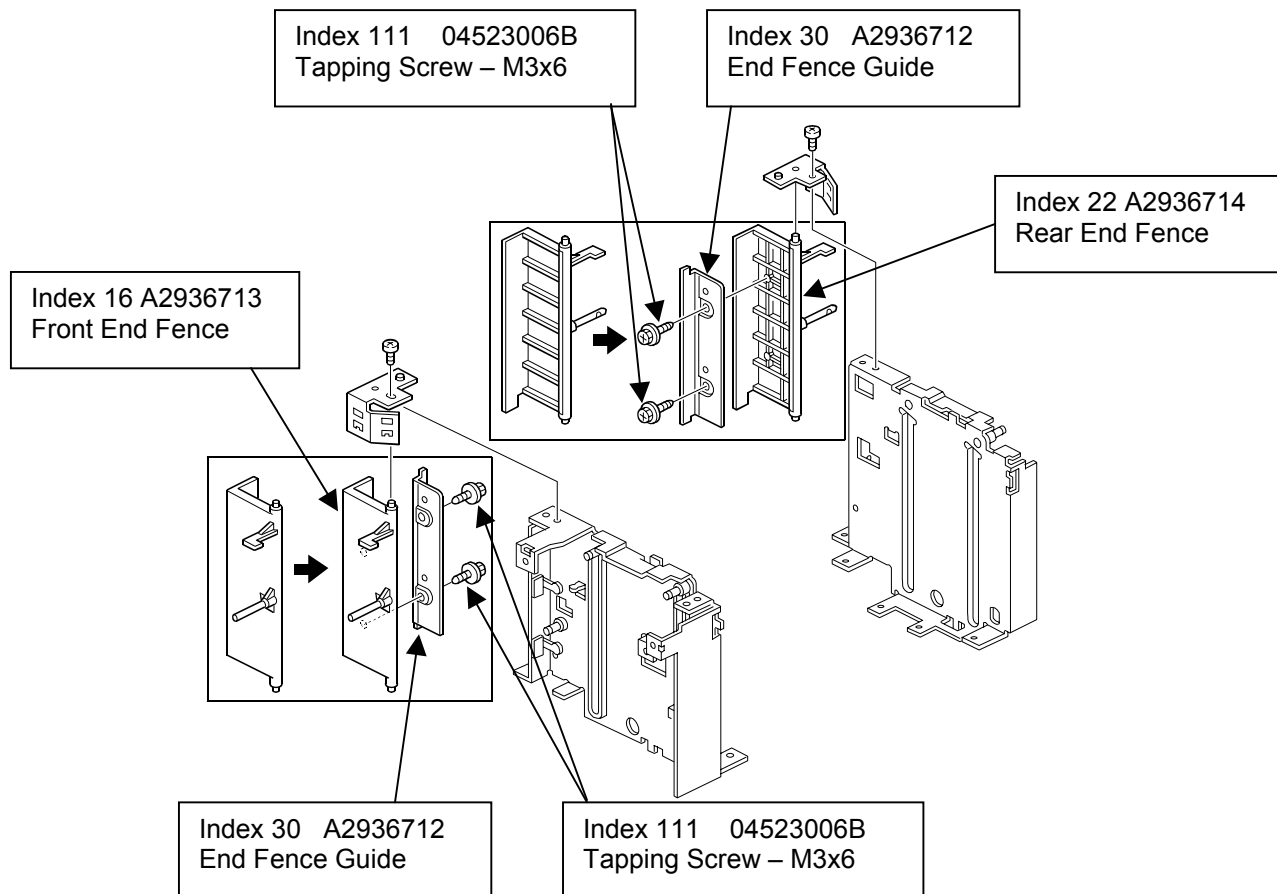


Model: Mojito		Date: 29-Aug-01	No.: MA293031
Modified Article: Sheet - Photointerrupter		Prepared by: F. Noguchi	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

Sheets for the photointerrupters have been added to ensure that the photointerrupters stay properly fixed to the brackets.


New part number	Description	Q'ty	Page	Index	Note
A2671820	Sheet - Photointerrupter	2	57	*39	
		1	63	*24	
		2	127	*30	

*: New index

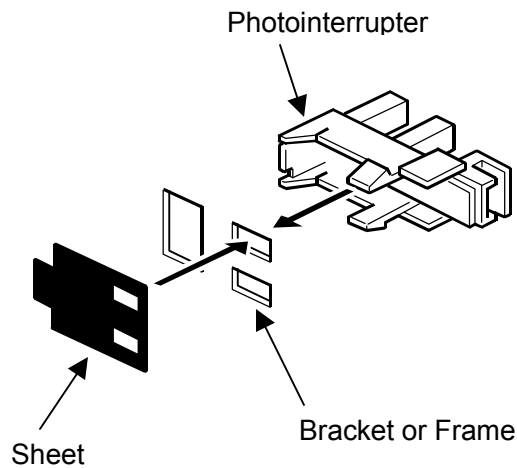


Note: The sheet is used on the following photointerrupters:

Page 56 22. Tandem LCT3

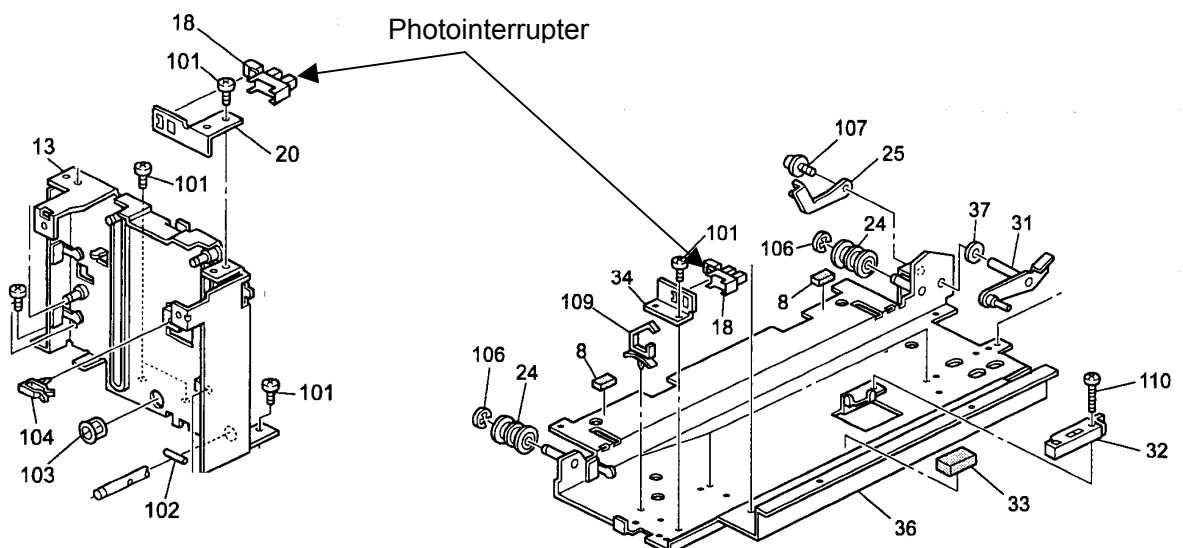


Page 62

25. Paper Feed Section 1

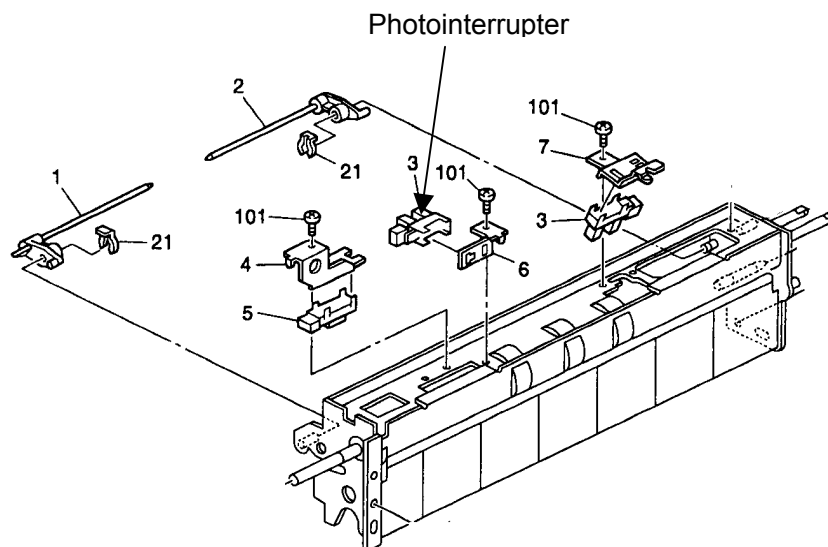

Page 126

57. Drive Section 5

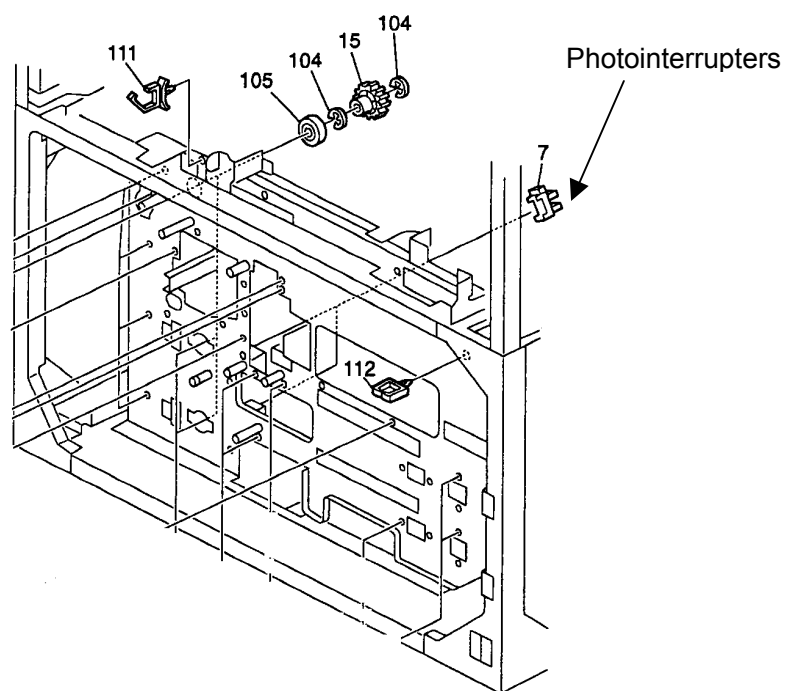

Model: Mojito

Date: 29-Aug-01

No.: MA293031

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0710100149
Ricoh Aficio 551	120/60	Taiwan	A292-19	H4710100001
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4701000001
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0710100001
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D61000001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4701000316
Ricoh Aficio 700	230/50	Korea	A292-28	From 1 st production
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4701000596
Ricoh Aficio 551	230/50	China	A292-69	H4701100712
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0720100001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4801000001
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0720100086
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D51000001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4801000107
Ricoh Aficio 700	230/50	Korea	A293-28	From 1 st production
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4801000215


REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	

Model: Mojito		Date: 07-Sep-01	No.: MA293032
Modified Article: Upper Guide Plate		Prepared by: F. Noguchi	
From: Technical Service Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

To improve durability, the material of the pin for the upper guide plate has been changed from resin to a metal insert.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A8061151	A8061153	Upper Guide Plate	1	X/O	25	2	

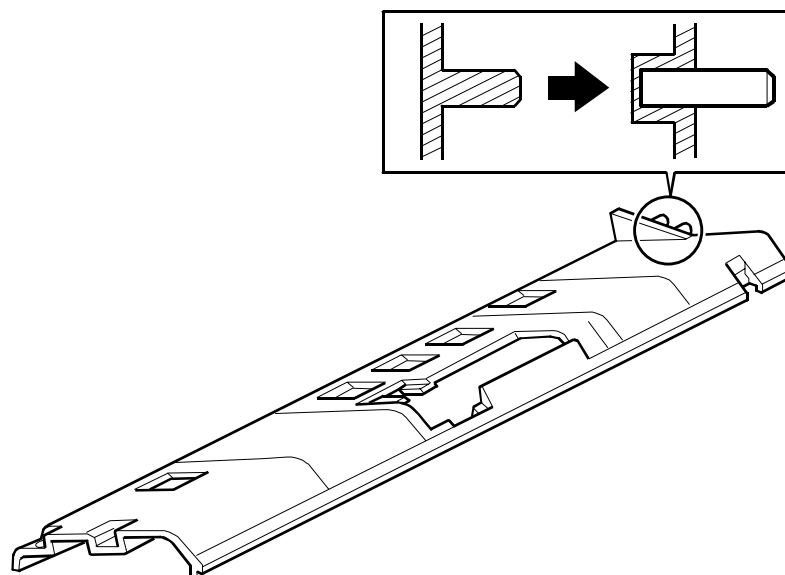

Model: Mojito

Date: 07-Sep-01

No.: MA293032

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0710110311
Ricoh Aficio 551	120/60	Taiwan	A292-19	H4710100001
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4701200001
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0710120691
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D61200001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4701100546
Ricoh Aficio 700	230/50	Korea	A292-28	From 1st Production
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4701100727
Ricoh Aficio 551	230/50	China	A292-69	H4710100353
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L07201100159
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4810200001
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0720120167
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D51200001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4801200001
Ricoh Aficio 700	230/50	Korea	A293-28	From 1st Production
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4801200156


REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	

Model: Mojito		Date: 07-Sep-01	No.: MA293033
Modified Article: Left Scale		Prepared by: F. Noguchi	
From: Technical Service Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Other	☐ To meet standards ()

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2941791	A2941794	Left Scale	1	X/O	41	2	

The shape of the left scale has been changed to further ensure that curled originals do not ride over the scale when they are set flush against the DF (which causes an image shift). The new scale edge will act to catch the original, as shown below:



Model: Mojito	Date: 07-Sep-01	No.: MA293033
---------------	-----------------	---------------

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0710110311
Ricoh Aficio 551	120/60	Taiwan	A292-19	H4710100001
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4701200001
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0710120691
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D61200001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4701100546
Ricoh Aficio 700	230/50	Korea	A292-28	From 1st Production
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4701100727
Ricoh Aficio 551	230/50	China	A292-69	H4710100353
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L07201100159
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4810200001
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0720120167
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D51200001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4801200001
Ricoh Aficio 700	230/50	Korea	A293-28	From 1st Production
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4801200156

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	

Model: Mojito		Date: 02-Oct-01	No.: MA293034
Modified Article: Sems Screw - M3x8		Prepared by: F. Noguchi	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Other	☐ To meet standards ()

The screw for the scanner pulley has been changed to a hexagonal headless type, which will maximize resistance to shock vibration. The strength of the new screw is 34.9 kgfcm, increased from 20.5 kgfcm.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2941765		Sems Screw – M3x8	1	X/O	47	21	
	A2931713	Hexagon Headless Set Screw – M3x8	3				*

Note: The quantity of screws has been corrected from 1 to 3 (parts catalog error).

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0711070001
Ricoh Aficio 551	120/60	Taiwan	A292-19	H47107XXXX
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4710600434
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0711060235
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60710001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4710700001
Ricoh Aficio 700	230/50	Korea	A292-28	H4710700550
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4710700565
Ricoh Aficio 551	230/50	China	A292-69	H4710900061
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0721060051
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4810700001
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0721070181
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50710001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4810700251
Ricoh Aficio 700	230/50	Korea	A293-28	H4810700514
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4810700524

Model: Mojito

Date: 02-Oct-01

No.: MA293034

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	


Model: Mojito		Date: 02-Oct-01	No.: MA293035
Modified Article: Sensor Bracket		Prepared by: F. Noguchi	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☒ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

This MB has been reissued to include previously missing information (in bold/italics).

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B3011542	B3011543	Sensor Bracket	X/O	1	39	1	*1
B3015380	B3015381	DF Position Sensor Harness	X/O	1	39	14	*1

*1: These parts should be replaced as a set.

To prevent contact with the Right Stay (B3011133), ***the routing of the DF Position Sensor Harness has been changed as shown below. In addition, the length of the harness has been increased.***

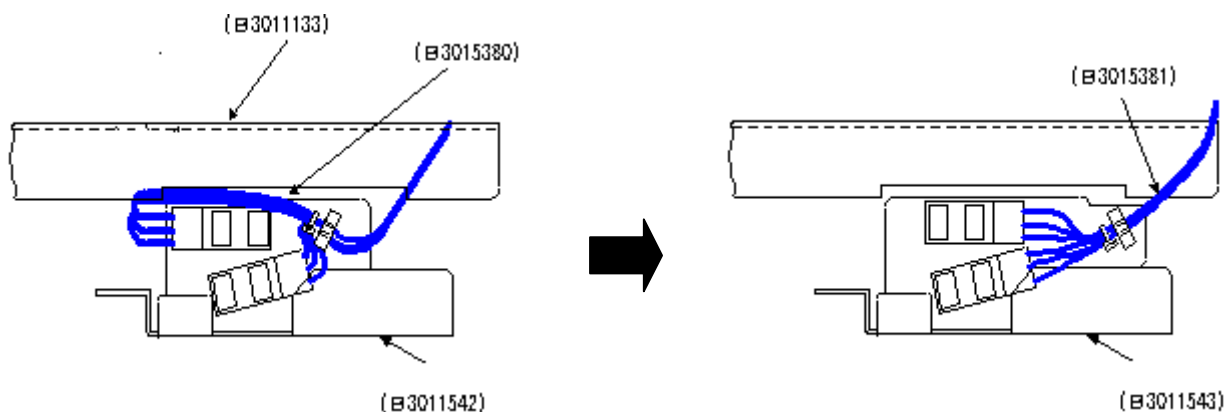

Model: Mojito

Date: 02-Oct-01

No.: MA293035

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0711020001
Ricoh Aficio 551	120/60	Taiwan	A292-19	H4710200990
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4710200311
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0711020156
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60310001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4710200600
Ricoh Aficio 700	230/50	Korea	A292-28	H4710201007
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4710200957
Ricoh Aficio 551	230/50	China	A292-69	H4710200973
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0721020001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4810200001
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0721070181
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50310001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4810200308
Ricoh Aficio 700	230/50	Korea	A293-28	H4810200447
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4810200435

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	

Model: Mojito		Date: 11-Oct-01	No.: MA293036
Modified Article: Timing belt and Pulley		Prepared by: F. Noguchi	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Other	☐ To meet standards ()

To ensure that toner blockages do not occur in the Toner Pump Unit, the rotation speed of the pump has been increased from 225 rpm to 400 rpm. In accordance with this change, the following changes have been made.

For details, please refer to RTB No. RA293021.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AB030458		Pulley – 28Z	1 - 1	X/X	121	28	*
	AB030720	Pulley – 50T					
AA043415		Timing Belt – 214P2M3	1 - 1	X/X	123	24	*
	AA043573	Timing Belt – 240P2M3					

*: as a set X/O

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0711060001
Ricoh Aficio 551	120/60	Taiwan	A292-19	H4710600843
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4710600409
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0711060216
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60610001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4710400048
Ricoh Aficio 700	230/50	Korea	A292-28	H4710600848
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4710600734
Ricoh Aficio 551	230/50	China	A292-69	H4710900061
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0721060001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4810600176
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0721070181
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50610001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4810700251
Ricoh Aficio 700	230/50	Korea	A293-28	H4810600407
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4810600339

Model: Mojito

Date: 11-Oct-01

No.: MA293036

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	

Reissued: 17-Oct-01

Model: Mojito	Date: 15-Oct-01	No.: MA293037a
---------------	-----------------	----------------

MB Correction

The items in bold italics have been corrected or added.

Modified Article: Gear - 25Z, Gear - 28Z		Prepared by: F. Noguchi	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☒ To improve reliability	
	☐ Part standardization	☐ Other	

Old part number	New part number	Description	Q'ty	Page	Index	Note
	AB012019	Gear – 25Z	1	123	29	
	AB012020	Gear – 28Z	1	123	30	


To improve the detection of the toner pump lock, the Toner Recycling unit has been changed as follows:

1. Changed the position of the Toner Recycling Pump Motor Sensor on the Bracket - Toner Recycling Drive.

Note: The bracket now contains an additional hole for the new sensor position, but the part number for the bracket has not been changed (A2293585).

2. Added two gears (index #29, 30 below).

Note: The part number for the Drive Sub-unit – Toner Recycling (A2293584) has not been changed.

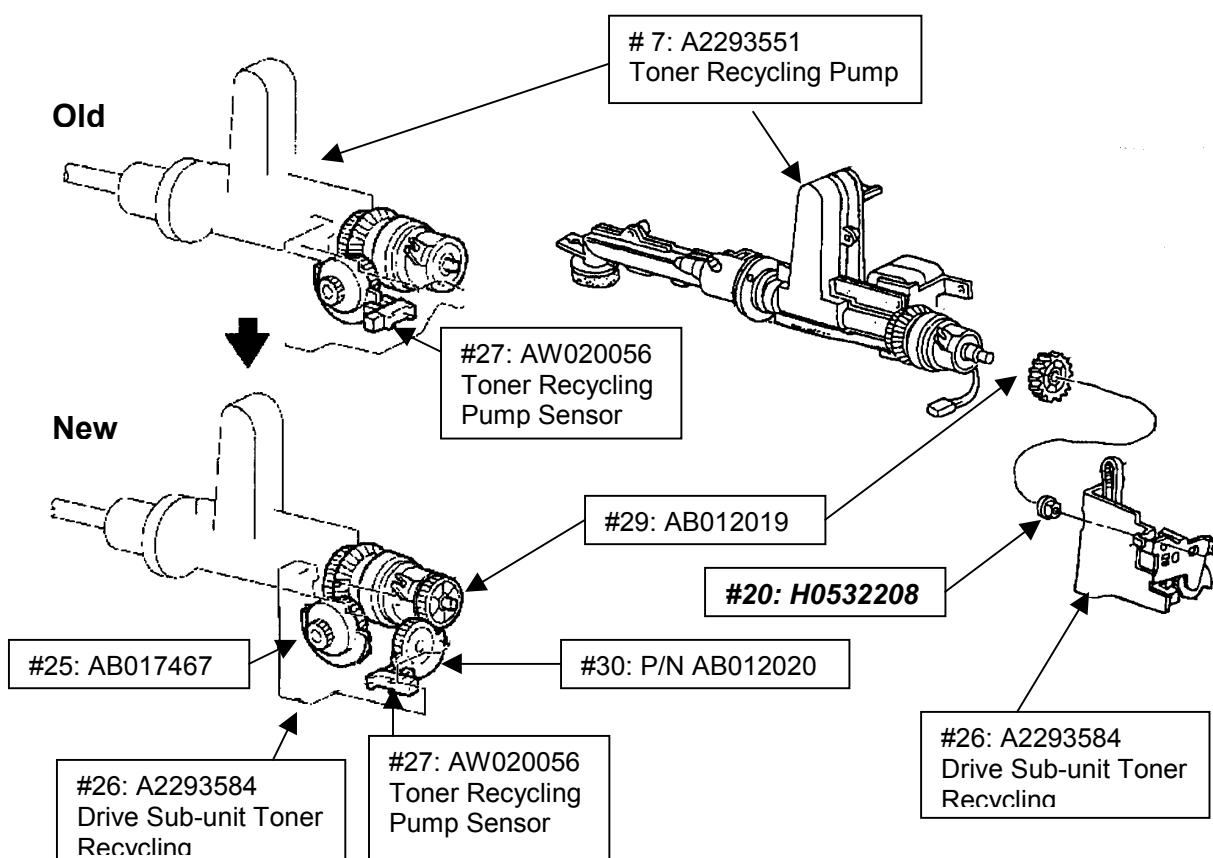

Reissued: 17-Oct-01

Model: Mojito	Date: 15-Oct-01	No.: MA293037a
---------------	-----------------	----------------

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0710110001
Ricoh Aficio 551	120/60	Taiwan	A292-19	H47011xxxxx
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4701000307
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0710110511
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D61000001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4701000316
Ricoh Aficio 700	230/50	Korea	A292-28	From 1st Production
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4701000596
Ricoh Aficio 551	230/50	China	A292-69	H4701100712
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0720110001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H48011xxxxx
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0720110188
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D51000001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4801000107
Ricoh Aficio 700	230/50	Korea	A293-28	From 1st Production
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4801000215

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	

Model: Mojito		Date: 29-Nov-01	No.: MA293038
Modified Article: MCU Board		Prepared by: S. Orita	
From: Technical Services Dept., GTS Division			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Other	☐ To meet standards ()

The MCU has been modified so that SC124 will be displayed earlier than before, in order to more quickly detect any abnormal movement of the scanner.

Old part number	New part number	Description	Q'ty	Int	Page	Index
A2945053	A2935180	MCU Board	1 - 1	X/O	131	9
					149	*

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0711080001
Ricoh Aficio 551	120/60	Taiwan	A292-19	H47108xxxxx
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4710700622
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0711070292
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D60810001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4710700356
Ricoh Aficio 700	230/50	Korea	A292-28	H4710800114
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4710800001
Ricoh Aficio 551	230/50	China	A292-69	H4710900061
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0721070001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4810700126
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0721070181
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50810001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4810700331
Ricoh Aficio 700	230/50	Korea	A293-28	H48108xxxxx
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4810800001

Model: Mojito

Date: 29-Nov-01

No.: MA293038

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	H4715600263
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	H4715600780
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	H4815600001
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	H4815700062

Model: Mojito		Date: 15-May-02	No.: MA293039
Modified Article: Operation Panel Upper Cover		Prepared by: M. Matsuda	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The following has been changed due to parts standardization.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2291327	A2931327	Operation Panel Upper Cover	1	X/O	17	27	

Model: Mojito		Date: 22-May-02	No.: MA293040
Modified Article: Pump Motor		Prepared by: M. Matsuda	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

This MB has been released to announce a modification previously made to the rubber sheet for the Pump Motor, where its durability was increased to ensure tears do not form.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2933621	A2933624	Pump Motor	1	X/O	125	21	

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0712050001
Ricoh Aficio 551	120/60	Taiwan	A292-19	H47203xxxxx
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H47203xxxxx
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0712020049
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D6032yxxxx
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4720400336
Ricoh Aficio 700	230/50	Korea	A292-28	H4720400418
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4703xxxxx
Ricoh Aficio 551	230/50	China	A292-69	H4720200576
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0722020130
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H48203xxxxx
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0722020053
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50420001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4820200249
Ricoh Aficio 700	230/50	Korea	A293-28	H4820400229
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4820200367

Model: Mojito

Date: 22-May-02

No.: MA293040

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	H47ymmxxxx
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	H47ymmxxxx
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	H48ymmxxxx
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	H48ymmxxxx

Model: Mojito-C1/C2		Date: 18-Sep-02	No.: MA293041
Modified Article: Spring Tandem LCT/Stepped Screw		Prepared by: F.Noguchi	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()


Due to parts standardization with the Martini, the following parts have been changed.

NOTE:

*1: This old P/N (AA063268) and Index (#16) were listed incorrectly in the P/C as P/N AA063609 and Index #6.

*2: These parts should be replaced together as a set.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AA063609		Spring - Tandem LCT	2 - 2	X/O	127	6	*1
	AA063880	Spring					*2
AA143483		Stepped Screw	2 - 2	X/O	127	4	*2
	54465832	Connector Guide pin					

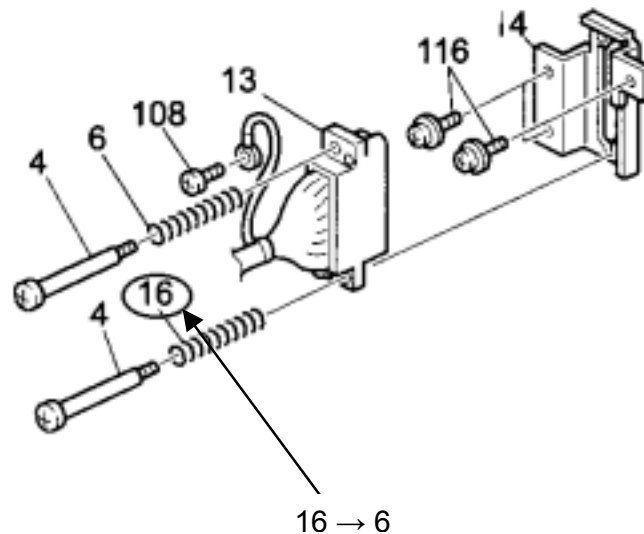

Model: Mojito-C1/C2	Date: 18-Sep-02	No.: MA293041
---------------------	-----------------	---------------

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	Service parts only
Ricoh Aficio 551	120/60	Taiwan	A292-19	
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	
Ricoh Aficio 700	230/50	Korea	A292-28	
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	
Ricoh Aficio 551	230/50	China	A292-69	
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	
Ricoh Aficio 700	230/50	Korea	A293-28	
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	
RicohAficio 1055 Savin 2555 Gestetner 5502 Lanier LD055	120/ 60	USA, Canada, S. America	B098-17	From 1st Production
Ricoh Aficio 1055	120/60	Taiwan	B098-19	
Gestetner 5502 nashuatec 5505 Rex Rotary 5508	120/ 60	Europe, etc.	B098-22	
Lanier LD055	220, 230, 240/ 50, 60	Europe	B098-24	
infotec IS2055	220, 230, 240/ 50, 60	Europe, etc.	B098-26	
Ricoh Aficio 1055	220, 230, 240/ 50, 60	Europe, etc.	B098-27	
Ricoh Aficio 1055	230/50	Korea	B098-28	
Ricoh Aficio 1055	220/ 50, 60	Asia, Oceania	B098-29	
Ricoh Aficio 1055	230/50	China	B098-69	

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, S. America	A292-15	Service parts only
Ricoh Aficio 551	120 / 60	USA, Canada, S. America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, S. America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, S. America	A293-17	

Model: Mojito-C1/C2		Date: 28-Nov-02	No.: MA293042
Modified Article: Decal: Toner Supply (B098 only)		Prepared by: F.Noguchi	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

As per a field request, the Toner Supply Decal has been changed from an English display with one containing multiple languages (English, French, German, Italian, Spanish).

Note: The old decal (English only) has not been changed on B098-28, -29 and -69.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0983241		Decal: Toner Supply: English (B098)	1	O/O	183	39	
	B0983242	Decal: Toner Supply: Multi (B098)					

Model: Mojito-C1/C2		Date: 28-Nov-02	No.: MA293043
Modified Article: I/O Board (B098 only)		Prepared by: F.Noguchi	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Please delete the following parts from your Parts Catalogs.

Part number	Description	Q'ty	Page	Index	Note
14071535	IC – TD62308AP	n – n-1	149	128	
14072218	TTLIC – SN74LS06NS	n – n-1	149	132	
16017791	Resistor Array – 1KΩ ± 5%	n – n-2	149	146	
16606103	Capacitor – 10000pF +80%-20%50V	n – n-1	149	192	

66. I/O CONTROL BOARD (B098)

CAPACITOR

SYMBOL NO.	INDEX NO.
C191	192
C192	192
C193	192
C194	192
C195	192
C196	192
C197	192
C198	190
C199	190
C200	192

IC

SYMBOL NO.	INDEX NO.
IC101	131
IC102	130
IC103	131
IC104	129
IC105	130
IC106	139
IC107	1
IC108	131
IC109	136
IC110	132

Q

SYMBOL NO.	INDEX NO.
Q111	118
Q112	141
Q113	117
Q114	117
Q115	128
Q116	119

RN

SYMBOL NO.	INDEX NO.
RN111	146
RN112	145
RN113	144
RN114	144
RN115	146
RN116	145
RN117	146
RN118	146
RN119	145
RN120	144

SYMBOL NO.	INDEX NO.
RN131	144
RN132	144
RN133	144
RN134	144
RN135	146
RN136	144
RN137	145
RN138	144
RN139	148
RN140	145

Reissued: 4-Dec-02

Model: Mojito –C1/C2	Date: 28-Nov-02	No.: MA293044a
----------------------	-----------------	----------------

Serial Number Update

The Serial Number information has been update.


Modified Article: Roller – Slide Rail		Prepared by: F.Noguchi	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☒ Other	

The Slide Rail Roller can sometimes come off the rail when the customer pulls out the right tray, which can cause damage to other components if the tray is pushed back in this condition.

To ensure that the rollers re-engage the rail when the tray is pushed back in (even if they derail), 1 of the 2 Slide Rail Rollers has been deleted, and a Side Rail Front Roller has been newly added.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AF022105	AF022105	Roller – Slide Rail	2 - 1	-	57	24	-
	A2946655	Roller – Slide Rail Front	0 - 1	-	57	*40	-

*:New Index

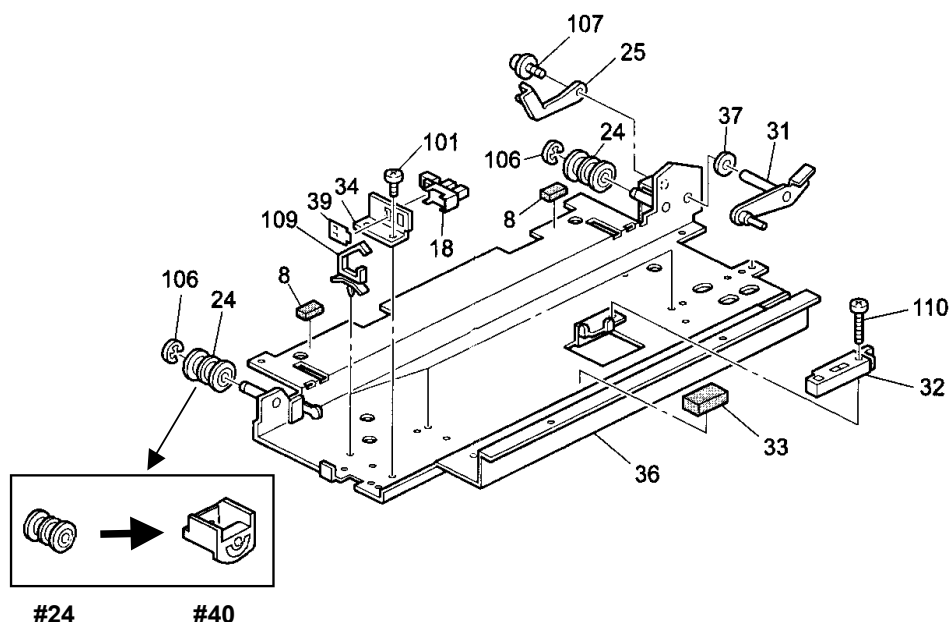

Reissued: 4-Dec-02

Model: Mojito –C1/C2	Date: 28-Nov-02	No.: MA293044a
----------------------	-----------------	----------------

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0712010001
Ricoh Aficio 551	120/60	Taiwan	A292-19	H472012xxxxx
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4720100001
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0712010401
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D6122xxxxx
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4720100226
Ricoh Aficio 700	230/50	Korea	A292-28	H4720100617
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4720100545
Ricoh Aficio 551	230/50	China	A292-69	H4720100642
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0722010001
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4820100001
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0722010126
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D50220001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4820100026
Ricoh Aficio 700	230/50	Korea	A293-28	H4820400229
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4820100287
Ricoh Aficio 1055 Savin 2555 Gestetner 5502 Lanier LD055	120/ 60	USA, Canada, S. America	B098-17	From 1st production
Ricoh Aficio 1055	120/60	Taiwan	B098-19	
Gestetner 5502 nashuatec 5505 Rex Rotary 5508	120/ 60	Europe, etc.	B098-22	
Lanier LD055	220, 230, 240/ 50, 60	Europe	B098-24	
infotec IS2055	220, 230, 240/ 50, 60	Europe, etc.	B098-26	
Ricoh Aficio 1055	220, 230, 240/ 50, 60	Europe, etc.	B098-27	
Ricoh Aficio 1055	230/50	Korea	B098-28	
Ricoh Aficio 1055	220/ 50, 60	Asia, Oceania	B098-29	
Ricoh Aficio 1055	230/50	China	B098-69	


REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, S. America	A292-15	H47250xxxxx
Ricoh Aficio 551	120 / 60	USA, Canada, S. America	A292-17	H4724901217
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, S. America	A293-15	H48250xxxxx
Ricoh Aficio 700	120 / 60	USA, Canada, S. America	A293-17	H48250xxxxx

Model: Mojito-C1		Date: 13-Feb-03	No.: MA293045
Modified Article: End Fence Guide		Prepared by: M. Matsuda	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

The shape of the End Fence Guide has been changed so that it does not contact the left tandem tray bottom plate when the right tray is pushed back in, which can cause the end fence to open and become damaged. This occurs when the customer loads the paper incorrectly (not flush against the left tray back fence), or when the right tray has slipped off its rail.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2936712	B0656712	End Fence Guide	2	X/O	57	38	

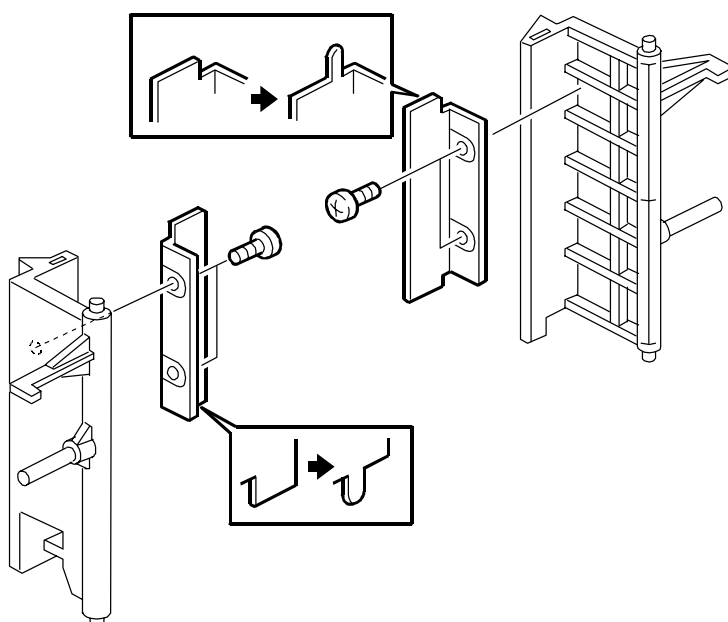

Model: Mojito-C1	Date: 13-Feb-03	No.: MA293045
------------------	-----------------	---------------

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	Service Parts Only
Ricoh Aficio 551	120/60	Taiwan	A292-19	Service Parts Only
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	Service Parts Only
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	Service Parts Only
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	Service Parts Only
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	Service Parts Only
Ricoh Aficio 700	230/50	Korea	A292-28	Service Parts Only
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	Service Parts Only
Ricoh Aficio 551	230/50	China	A292-69	Service Parts Only
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	Service Parts Only
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	Service Parts Only
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	Service Parts Only
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	Service Parts Only
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	Service Parts Only
Ricoh Aficio 700	230/50	Korea	A293-28	Service Parts Only
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	Service Parts Only

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, South America	A292-15	Service Parts Only
Ricoh Aficio 551	120 / 60	USA, Canada, South America	A292-17	Service Parts Only
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, South America	A293-15	Service Parts Only
Ricoh Aficio 700	120 / 60	USA, Canada, South America	A293-17	Service Parts Only

Model: Mojito-C1/C2		Date: 26-Feb-03	No.: MA293046
Modified Article: Feed Rollers		Prepared by: F.Noguchi	
From: Technical Services Sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Other	☐ To meet standards ()

The paper feed rollers have been changed due to parts standardization and to increase their target yield from 300K to 1000K.

Note:

- 1) At PM parts replacement, be sure to check the target yield setting and change it in SP mode if necessary, depending on whether the part to be installed is old or new.
- 2) For each tray, be sure to replace the feed rollers together in sets.
- 3) Color of the rollers:
 New type: Light blue
 Old type: Gray
- 4) Machines containing ver0.15 at arrival have been fitted with the new PM parts.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0986200	B0986201	Paper Feed Unit: Paper Bank Ass'y	1 - 1	O/O	63	*	
B0986210	B0986211	Paper Feed Unit: No.3: Ass'y	1 - 1	O/O	63	*	
B0986220	B0986221	Paper Feed Unit: No.1: Ass'y	1 - 1	O/O	63	*	
AF030040		Pick-up Roller	3 - 3	X/X	65	4	*
	AF030080	Paper Feed Roller: Pick-up					*
AF031040		Feed Roller	3 - 3	X/X	65	5	*
	AF031080	Paper Feed Roller: Feed					*
AF032040		Separation Roller	3 - 3	X/X	67	3	
	AF032080	Paper Feed Roller: Separate					
AF030041		Pick-up Roller - Bypass Feed	1 - 1	X/X	71	14	**
	AF030080	Paper Feed Roller: Pick-up					**
AF031041		Feed Roller - Bypass Feed	1 - 1	X/X	71	16	**
	AF031081	Paper Feed Roller: Feed: Manual Feed					**
AF032041		Separation Roller - Bypass Feed	1 - 1	X/X	73	5	**
	AF032080	Paper Feed Roller: Separate					**

Note * and **: as a set O/O

Model: Mojito-C1/C2	Date: 26-Feb-03	No.: MA293046
---------------------	-----------------	---------------

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	Service parts only
Ricoh Aficio 551	120/60	Taiwan	A292-19	
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	
Ricoh Aficio 700	230/50	Korea	A292-28	
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	
Ricoh Aficio 551	230/50	China	A292-69	
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	
Ricoh Aficio 700	230/50	Korea	A293-28	
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	
RicohAficio 1055 Savin 2555 Gestetner 5502 Lanier LD055	120/ 60	USA, Canada, S. America	B098-17	J5330100201
Ricoh Aficio 1055	120/60	Taiwan	B098-19	J53301xxxxx
Gestetner 5502 nashuatec 5505 Rex Rotary 5508	120/ 60	Europe, etc.	B098-22	J5330100280
Lanier LD055	220, 230, 240/ 50, 60	Europe	B098-24	L1333020001
infotec IS2055	220, 230, 240/ 50, 60	Europe, etc.	B098-26	2Q40130001
Ricoh Aficio 1055	220, 230, 240/ 50, 60	Europe, etc.	B098-27	J5330200111
Ricoh Aficio 1055	230/50	Korea	B098-28	J53301xxxxx
Ricoh Aficio 1055	220/ 50, 60	Asia, Oceania	B098-29	J5330100281
Ricoh Aficio 1055	230/50	China	B098-69	J5330300695

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, S. America	A292-15	Service parts only
Ricoh Aficio 551	120 / 60	USA, Canada, S. America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, S. America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, S. America	A293-17	

Reissued: 9-Apr-03

Model: Mojito-C1	Date: 10-Mar-03	No.: MA293047a
------------------	-----------------	----------------

MB Correction

Items in ***bold italics*** have been corrected or added.

Modified Article: ARDF and Bottle Holder		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☒ Part standardization	☐ Other	

The following parts have been changed due to parts standardization with the Mojito-C2.

Note: These changes have been applied to the new parts catalog for the Mojito/Mojito-C2


Old part number	New part number	Description	Q'ty	Int	Page	Index
B3015305	B3015405	DC Relay Harness	1 - 1	O/O	23	8
B3011186	B3011188	Sensor Bracket	1	O/O	23	16
B3011170	B3011176	Turn Guide Plate	1 - 1	O/O	23	35
AW010076		Photosensor – PS-117D1	1 - 1	X/O	23	36
			1 - 1		27	23
			2 - 2		31	2
<i>B3015310</i>		<i>DC Relay Harness</i>	<i>1 - 1</i>	<i>O/O</i>	<i>27</i>	<i>26</i>
	<i>B3015410</i>	<i>Harness: Connecting: Paper Feed</i>				
B3011423	B3011491	Tension Bracket	1 - 1	O/O	29	21
B3015355	B3015455	DC Relay Harness	1 - 1	O/O	31	22
B3012362	B3012367	Motor Bracket	1 - 1	O/O	35	2
B3012251	B3012281	Tension Bracket	1 - 1	O/O	35	15
B3012333	B3012336	Side Plate	1 - 1	O/O	35	37
B3013245	B3013345	Exit Motor Guide Plate	1 - 1	O/O	37	2
B3013241	B3013341	Exit Motor Bracket	1 - 1	O/O	37	3
B3015375	B3015475	Grounding Wire	1 - 1	O/O	37	13
B3015360	B3015460	DC Relay Harness	1 - 1	O/O	37	15
B3015300	B3015400	DC Harness	1 - 1	O/O	37	20
B3015330	B3015430	DC Harness	1 - 1	O/O	37	21
B3015510	B3015520	ADF Main Control Board	1 - 1	O/O	37	22
B3015350	B3015450	DC Harness	1 - 1	O/O	37	23
B3012322	B3012327	Holder Bracket	1 - 1	O/O	37	30
B3012316	B3012376	Tension Bracket	1 - 1	O/O	37	37
B3012311	B3012371	Motor Bracket	1 - 1	O/O	37	40
B3015381	B3015480	DF Position Sensor Harness	1 - 1	O/O	37 39	44 14
<i>B3015390</i>		<i>Relay Harness</i>	<i>1 - 1</i>	<i>O/O</i>	<i>37</i>	<i>46</i>
	<i>B3015490</i>	<i>Harness: Connecting: Sensor: Base</i>				
B3011131	B3011631	Rear Side Plate	1 - 1	O/O	39	3
B3011133	B3011633	Right Stay	1 - 1	O/O	39	10
A2293223	B0653304	Bottle Holder	1 - 1	O/O	77	14

Model: Mojito-C1/C2		Date: 10-Apr-03	No.: MA293048
Modified Article: ARDF		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Please apply the following corrections to your Parts Catalogs.


Section 5. ORIGINAL FEED SECTION 1 (A292/A293/B098)

	Part number	Description	Q'ty	Page	Index
Incorrect	B3011170	Paper Size Sensor Harness	1	23	35
Correct	B3011176	DC Harness	1	23	35

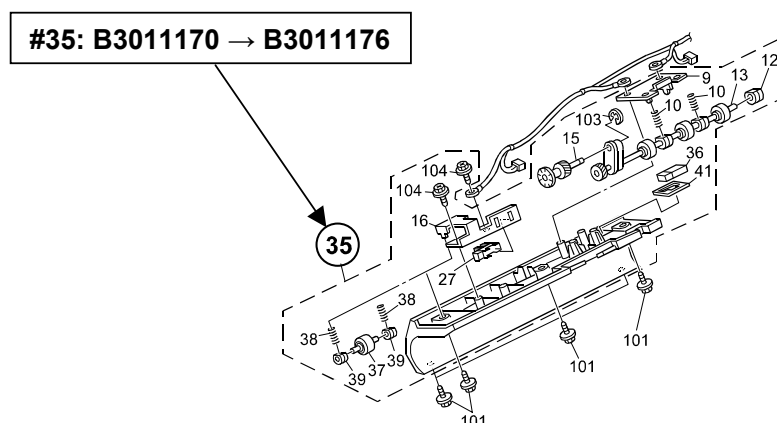

Section 6. ORIGINAL FEED SECTION 2 (A292/A293/B098)


	Part number	Description	Q'ty	Page	Index
Incorrect	A8065745	Paper Size Sensor Harness	1	25	29
Correct	B3015430	DC Harness	1	25	29

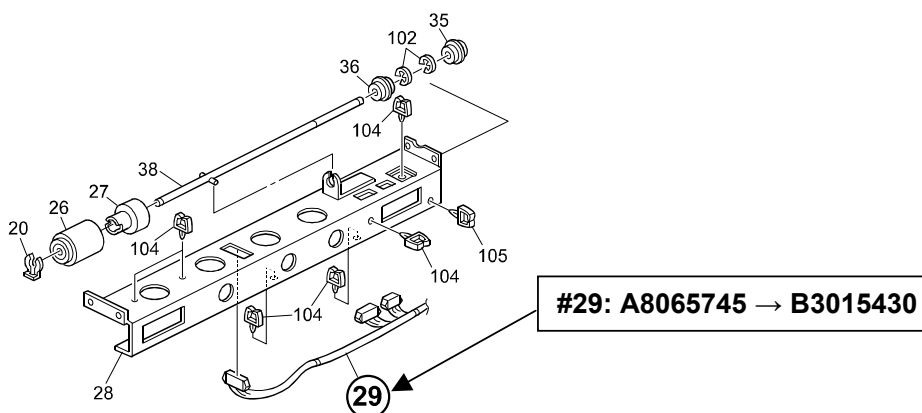

Model: Mojito-C1/C2	Date: 10-Apr-03	No.: MA293048
---------------------	-----------------	---------------

Section 7. ORIGINAL FEED SECTION 3 (A292/A293/B098)


	Part number	Description	Q'ty	Page	Index
Incorrect	B3015310	DC Relay Harness	1	27	26
Correct	B3015410	Harness: Connecting: Paper Feed	1	27	26

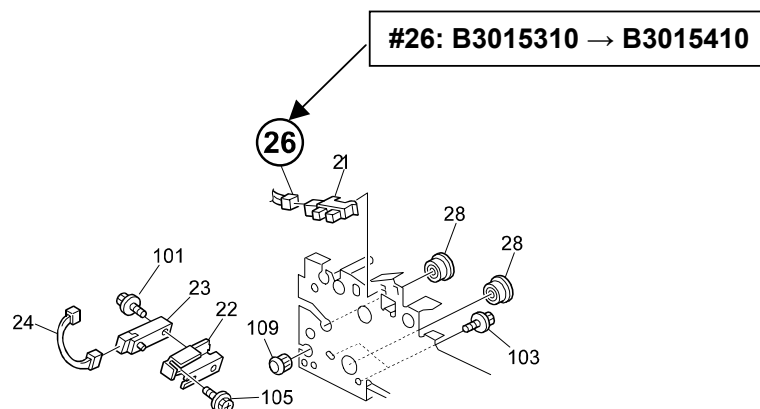

Section 7. ORIGINAL FEED SECTION 3 (A292/A293/B098)

	Part number	Description	Q'ty	Page	Index
Incorrect	B3015455	DC Relay Harness	1	31	22
Correct	B3015455	DC Relay Harness	1	31	22
	B3015460	DC Relay Harness	1	31	*24


*: New Index

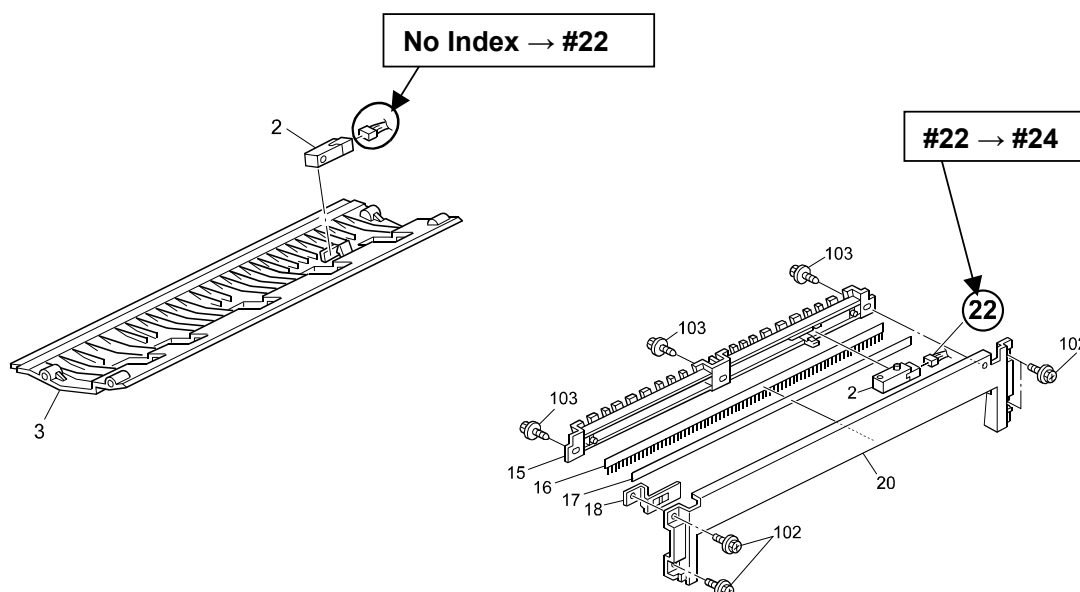


Section 12. ARDF DRIVE & ELECTRICAL 2 (A292/A293/B098)

	Part number	Description	Q'ty	Page	Index
Incorrect	B3015385	Relay Harness	1	37	19
	B3015430	DC Harness	1	37	21
	B3015390	Relay Harness	1	37	46
Correct	B3015340	DF Harness	1	37	17
	B3015490	Harness: Connecting: Sensor: Base	1	37	19
	B3015485	Harness: Connecting: Spring Clutch	1	37	46

Incorrect

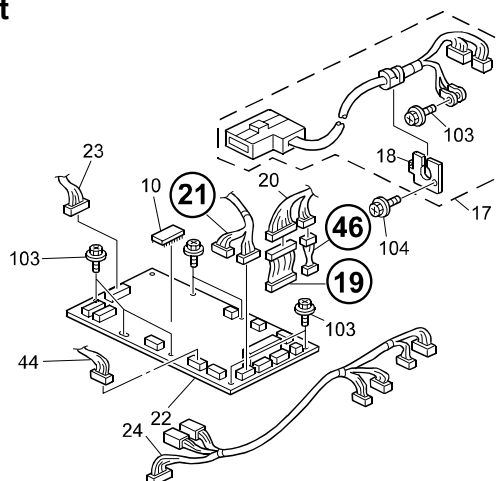

Correct

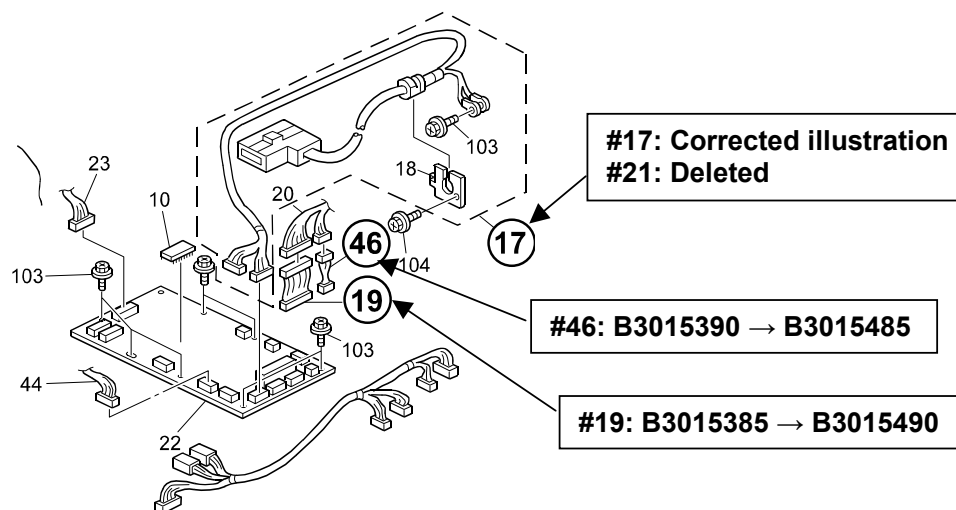

Model: Mojito-C1/C2		Date: 17-Apr-03	No.: MA293049
Modified Article: Rail Cover		Prepared by: F. Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

In accordance with the release of models for China (-69), Taiwan (-19) and Korea (-28), caution notes for "High temperature, Avoid contact" have been added in each language to the Rail Cover.

Note: For the China, Taiwan, and Korea models, please be sure to only use the new Rail Cover below.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2474155	B0984154	Rail Cover	1	O/O	97	2	
		Cover: Rail: Printing					*

Model: Mojito		Date: 27-May-03	No.: MA293050
Modified Article: Pulley Drive Wire Ass'Y		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Other	☐ To meet standards ()

The length of the Pulley Drive Wire (right tray) has been decreased as follows to ensure that a pulley flange overrun does not occur.

Long wire: 495mm → 475mm

Short wire: 409mm → 389mm

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2486684		Pulley Drive Wire Ass'y	2 - 2	X/O	57	5	
	A2936684	Pulley: Drive Wire: Ass'y					

Model: Mojito	Date: 27-May-03	No.: MA293050
---------------	-----------------	---------------

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	Service parts only
Ricoh Aficio 551	120/60	Taiwan	A292-19	
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	
Ricoh Aficio 700	230/50	Korea	A292-28	
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	
Ricoh Aficio 551	230/50	China	A292-69	
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	
Ricoh Aficio 700	230/50	Korea	A293-28	
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	
RicohAficio 1055 Savin 2555 Gestetner 5502 Lanier LD055	120/ 60	USA, Canada, S. America	B098-17	J5320901719
Ricoh Aficio 1055	120/60	Taiwan	B098-19	J53212xxxxx
Gestetner 5502 nashuatec 5505 Rex Rotary 5508	120/ 60	Europe, etc.	B098-22	J5321100446
Lanier LD055	220, 230, 240/ 50, 60	Europe	B098-24	L1332100001
infotec IS2055	220, 230, 240/ 50, 60	Europe, etc.	B098-26	2Q41020015
Ricoh Aficio 1055	220, 230, 240/ 50, 60	Europe, etc.	B098-27	J5321001324
Ricoh Aficio 1055	230/50	Korea	B098-28	J53301xxxxx
Ricoh Aficio 1055	220/ 50, 60	Asia, Oceania	B098-29	J53212xxxxx
Ricoh Aficio 1055	230/50	China	B098-69	J5321001524

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, S. America	A292-15	Service parts only
Ricoh Aficio 551	120 / 60	USA, Canada, S. America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, S. America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, S. America	A293-17	

Reissued: 3-Jul-03

Model: Mojito-C1/C2	Date: 9-Jun-03	No.: MA293051a
---------------------	----------------	----------------

Serial Number Update

The Serial Number information has been update.

Modified Article: Rear Side Fence		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☒ Part standardization	☐ Other	

A support rib has been added to the Rear Side Fence to ensure that the fence is not damaged when the tray is pushed in hard.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2296541		Rear Side Fence	1 - 1	X/X	59	27	*1, *2
	A2936541	Side Fence: Universal: Rear: Adhesion					
A2296545		Side Fence Plate – LT (A292/A293)	1 - 1	X/X	59	26	*1
	A2936545	Positioning Plate - LT					
A2296544		Side Fence Plate - A4 (A292/A293)	1 - 1	X/X	59	26	*2
	A2936544	Positioning Plate - A4					

***1: These parts should be replaced together as a set on the N.A. model.**

***2: These parts should be replaced together as a set on the EU model.**

Reissued: 3-Jul-03

Model: Mojito-C1/C2	Date: 9-Jun-03	No.: MA293051a
---------------------	----------------	----------------

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	L0711100001
Ricoh Aficio 551	120/60	Taiwan	A292-19	H4711200001
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	H4711000001
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	L0711100081
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	4D61010001
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	H4710900427
Ricoh Aficio 700	230/50	Korea	A292-28	H4711000386
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	H4711000401
Ricoh Aficio 551	230/50	China	A292-69	H4711000435
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	L0721100109
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	H4811000001
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	L0721100001
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	4D51010001
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	H4810900157
Ricoh Aficio 700	230/50	Korea	A293-28	H4811200244
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	H4811000226
RicohAficio 1055 Savin 2555 Gestetner 5502 Lanier LD055	120/ 60	USA, Canada, S. America	B098-17	From 1st production
Ricoh Aficio 1055	120/60	Taiwan	B098-19	From 1st production
Gestetner 5502 nashuatec 5505 Rex Rotary 5508	120/ 60	Europe, etc.	B098-22	From 1st production
Lanier LD055	220, 230, 240/ 50, 60	Europe	B098-24	From 1st production
infotec IS2055	220, 230, 240/ 50, 60	Europe, etc.	B098-26	From 1st production
Ricoh Aficio 1055	220, 230, 240/ 50, 60	Europe, etc.	B098-27	From 1st production
Ricoh Aficio 1055	230/50	Korea	B098-28	From 1st production
Ricoh Aficio 1055	220/ 50, 60	Asia, Oceania	B098-29	From 1st production
Ricoh Aficio 1055	230/50	China	B098-69	From 1st production

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, S. America	A292-15	Service Parts Only
Ricoh Aficio 551	120 / 60	USA, Canada, S. America	A292-17	Service Parts Only
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, S. America	A293-15	Service Parts Only
Ricoh Aficio 700	120 / 60	USA, Canada, S. America	A293-17	Service Parts Only

Model: Mojito-C1/C2		Date: 6-Oct-03	No.: MA293052
Modified Article: HDD		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☒ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The HDD has been changed due to a vendor change.

Note: When installing the new HDD for the first time, it is necessary to install the newly registered HDD Assembly below to ensure compliance with electrical standards.


Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	B0985029	HDD Ass'y	0 - 1	-	135	*33	
A2295843		HDD Ground Plate	1 - 1	X/X	135	17	
	B0985843	Ground Plate: HDD: D					
A2945173		HDD: ATA: SU5	1 - 1	X/X	135	18	
	B5485863	HDD: ATA: ST320014A					
A2935865		HDD Bracket	1 - 1	X/X	135	20	
	B0985865	Bracket: HDD					
A2935867		HDD Ground Plate - C	1 - 1	X/X	135	21	
	B0985867	Ground Plate: HDD: C					
A2935866		HDD Ground Plate - A	1 - 1	X/X	135	27	
	B0985866	Ground Plate: HDD: A					
A2935868		Ground Plate Bracket	1 - 1	X/X	135	28	
	B0985871	Bracket: Plate: Ground Plate: Ass'y					
08010153		Bind Screw	n - n-5	X/X	135	112	
	AA143525	Hexagonal Head Bolt - #6-32UNCX4	0 - 5			*34	
	B0985870	Bracket: HDD: Upper	0 - 1	-	135	*35	

*: New Index

Model: Mojito-C1/C2

Date: 6-Oct-03

No.: MA293052

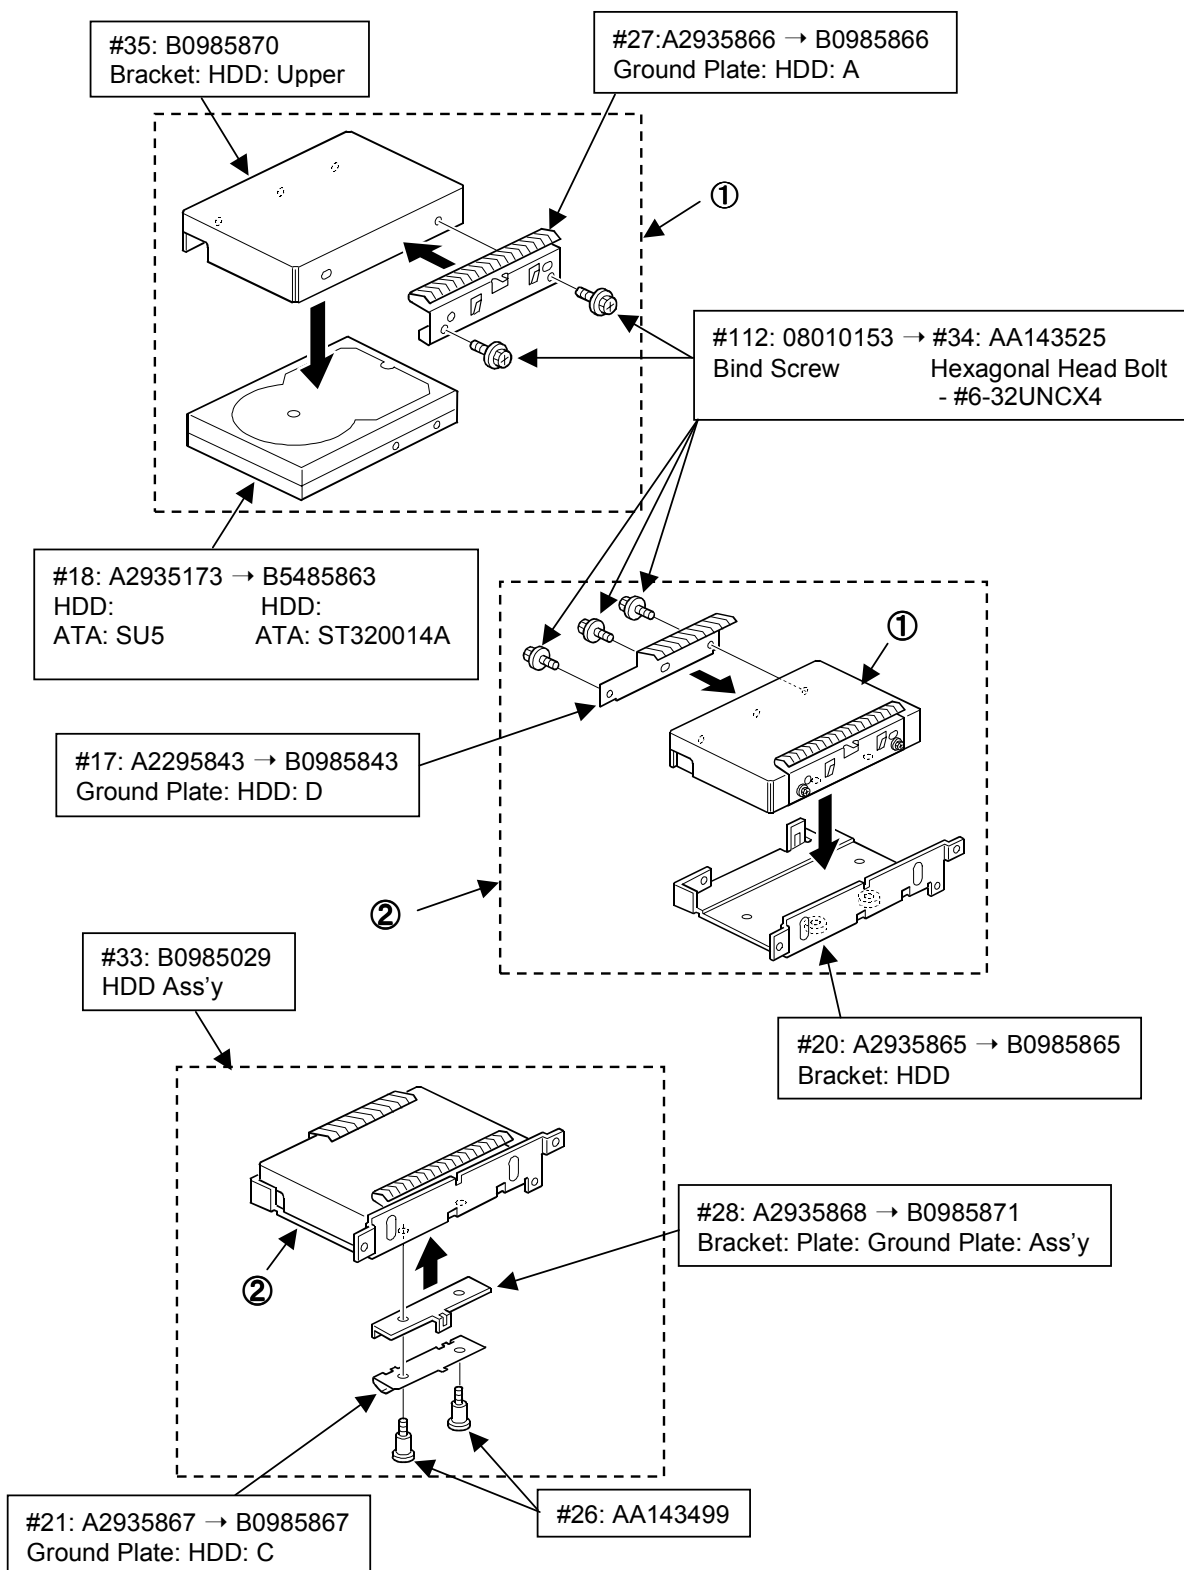

Model: Mojito-C1/C2	Date: 6-Oct-03	No.: MA293052
---------------------	----------------	---------------

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	Service parts only
Ricoh Aficio 551	120/60	Taiwan	A292-19	
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	
Ricoh Aficio 700	230/50	Korea	A292-28	
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	
Ricoh Aficio 551	230/50	China	A292-69	
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	
Ricoh Aficio 700	230/50	Korea	A293-28	
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	
RicohAficio 1055 Savin 2555 Gestetner 5502 Lanier LD055	120/ 60	USA, Canada, S. America	B098-17	J5321200331
Ricoh Aficio 1055	120/60	Taiwan	B098-19	J53301xxxxx
Gestetner 5502 nashuatec 5505 Rex Rotary 5508	120/ 60	Europe, etc.	B098-22	J5331200695
Lanier LD055	220, 230, 240/ 50, 60	Europe	B098-24	L1333020001
infotec IS2055	220, 230, 240/ 50, 60	Europe, etc.	B098-26	2Q041220016
Ricoh Aficio 1055	220, 230, 240/ 50, 60	Europe, etc.	B098-27	J5321200694
Ricoh Aficio 1055	230/50	Korea	B098-28	J5330300183
Ricoh Aficio 1055	220/ 50, 60	Asia, Oceania	B098-29	J5321200680
Ricoh Aficio 1055	230/50	China	B098-69	J5330300395

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, S. America	A292-15	Service parts only
Ricoh Aficio 551	120 / 60	USA, Canada, S. America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, S. America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, S. America	A293-17	

Model: Mojito-C1/C2	Date: 18-Dec-03	No.: MA293053
---------------------	-----------------	---------------

Number Correction

The bulletin number has been corrected. (MB098001a→MA293053)

Modified Article: Pick-up Roller		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☒ Part standardization	☐ Other	

Due to parts standardization with a newer model, the "Pick-up Roller" (one-way clutch assembly) has been separated into an individual pick-up roller and clutch.


Note:

Although the old assembly must be replaced with both new parts, following this the new parts can be replaced individually.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A8061321		Pick-up Roller	1 - 0	O/	25	23	
	B4772225	Pick-up Roller	0 - 1	/X	25	*23	
	B4772226	Pick-up Roller: Coupling	0 - 1	/X	25	*40	

*: New index

As a set O/O

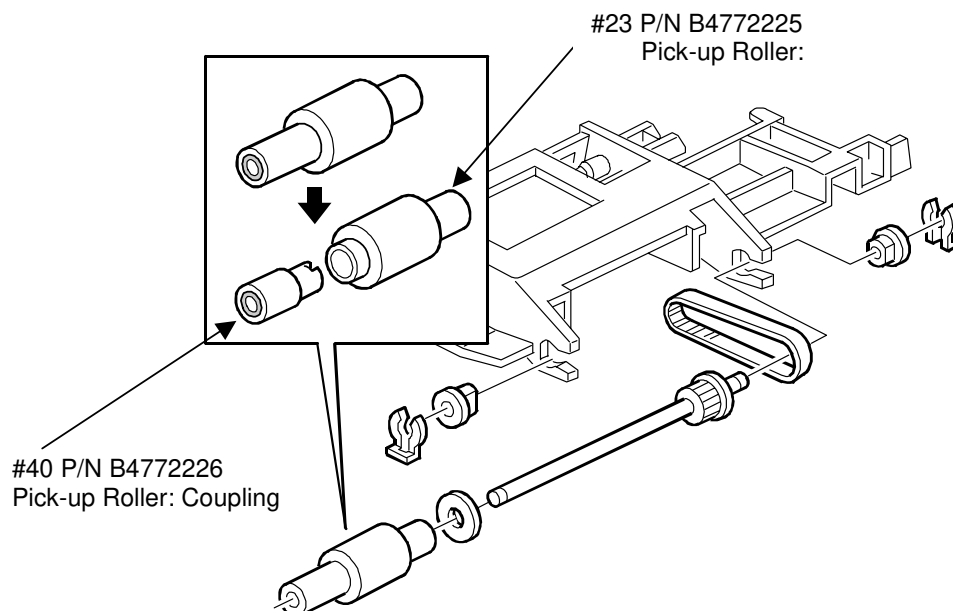

Model: Mojito-C1/C2	Date: 18-Dec-03	No.: MA293053
---------------------	-----------------	---------------

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	Service parts only
Ricoh Aficio 551	120/60	Taiwan	A292-19	
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	
Ricoh Aficio 700	230/50	Korea	A292-28	
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	
Ricoh Aficio 551	230/50	China	A292-69	
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	
Ricoh Aficio 700	230/50	Korea	A293-28	
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	
RicohAficio 1055 Savin 2555 Gestetner 5502 Lanier LD055	120/ 60	USA, Canada, S. America	B098-17	J5330701000
Ricoh Aficio 1055	120/60	Taiwan	B098-19	J5330800212
Gestetner 5502 nashuatec 5505 Rex Rotary 5508	120/ 60	Europe, etc.	B098-22	J5330800372
Lanier LD055	220, 230, 240/ 50, 60	Europe	B098-24	L1333080001
infotec IS2055	220, 230, 240/ 50, 60	Europe, etc.	B098-26	2Q40830001
Ricoh Aficio 1055	220, 230, 240/ 50, 60	Europe, etc.	B098-27	J5330701300
Ricoh Aficio 1055	230/50	Korea	B098-28	J53308xxxxx
Ricoh Aficio 1055	220/ 50, 60	Asia, Oceania	B098-29	J5330800528
Ricoh Aficio 1055	230/50	China	B098-69	J5330700998

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, S. America	A292-15	Service parts only
Ricoh Aficio 551	120 / 60	USA, Canada, S. America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, S. America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, S. America	A293-17	

Model: Mojito C1/C2		Date: 4-Feb-04	No.: MA293054
Modified Article: Bushing - 6x22x14		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()


The following has been changed due to parts standardization with the Bellini-C2.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2943170		Bushing – 6x22x14	1 - 1	O/O	83	13	
	B0703170	Bearing Case: Front: Ass'y					

Model: Mojito-C1/C2		Date: 9-Feb-04	No.: MA293055
Modified Article: Rear Bushing and Charge Corona Casing		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The following has been changed due to parts standardization with the Martini.


Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AA080148		Rear Bushing	1 - 1	O/O	85	10	
	B1402291	Bushing: Screw Shaft: Rear					
AD023106		Charge Corona Casing	1 - 1	O/O	85	11	
	B1402292	Case: Charge Corona					

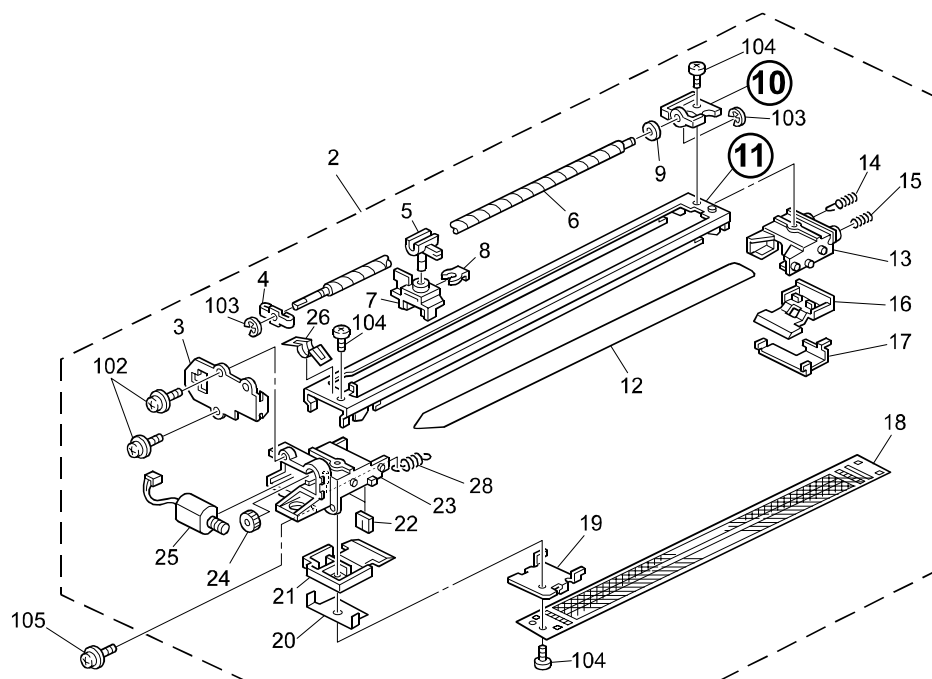

Model: Mojito-C1/C2		Date: 12-Feb-04	No.: MA293056
Modified Article: Parts catalog		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

Please correct your Parts Catalogs as follows:

56. Drive Section 4

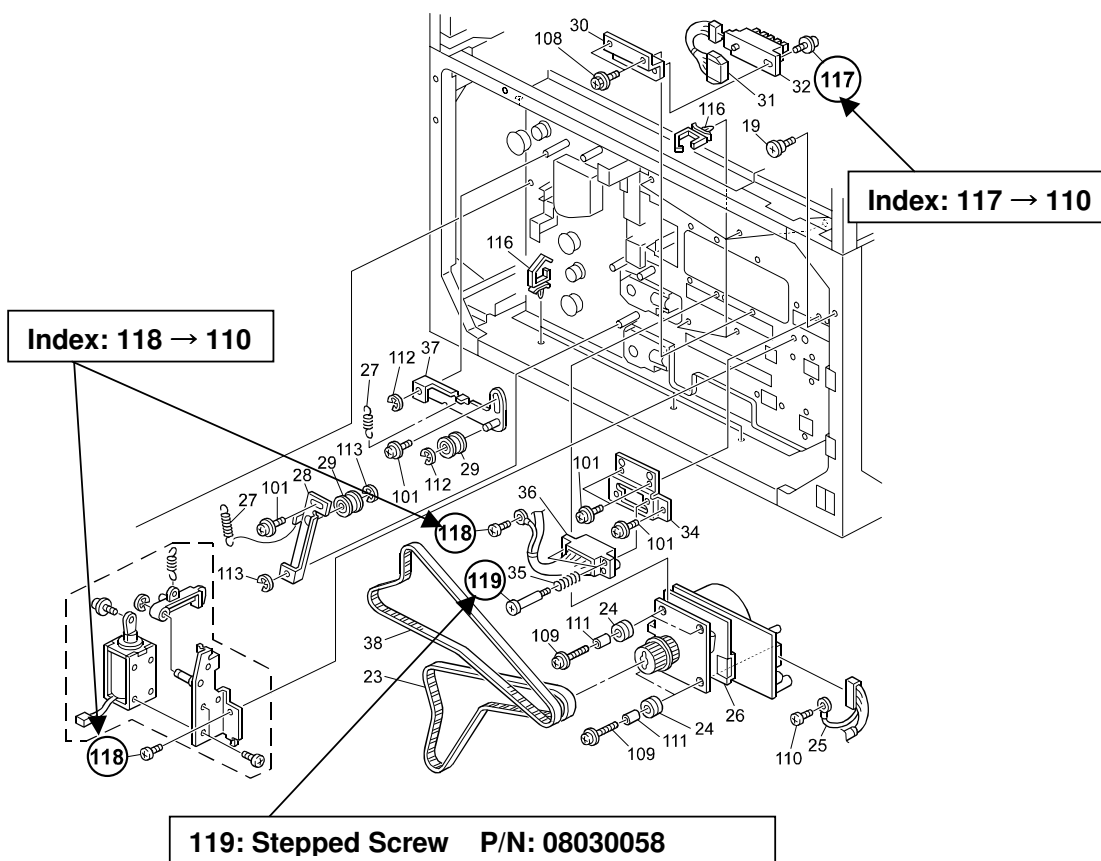

60. Electrical Section 3

Deleted: A2937724.

The above part does not exist as a service part, and is already a component part of the A2937724 Power Supply Cord Assembly.

	Part number	Description	Q'ty	Page	Index
Incorrect	A293 7723	Power Supply Cord - 120V (A292/A293)	1	133	13
	A293 7724	Power Supply Cord: NA: Ass'y (B098)			
Correct	A293 7723	Power Supply Cord - 120V (A292/A293/B098)	1	133	13

Model: Mojito-C1/C2		Date: 12-Feb-04	No.: MA293057
Modified Article: Separation Torque Limiter		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The following has been changed due to parts standardization with the Bellini.


Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2472900		Separation Torque Limiter	1 - 1	O/O	25	27	
	A2946700	Torque Limiter - 53MNXM					

Model: Mojito-C1/C2		Date: 12-Feb-04	No.: MA293058
Modified Article: Plate: Harness: MCU		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Other	☐ To meet standards ()

The following plate has been added to provide further protection for the MCU harness.

New part number	Description	Q'ty	Page	Index	Note
B0985875	Plate: Harness: MCU	0 - 1	135	36	*

*: New Index

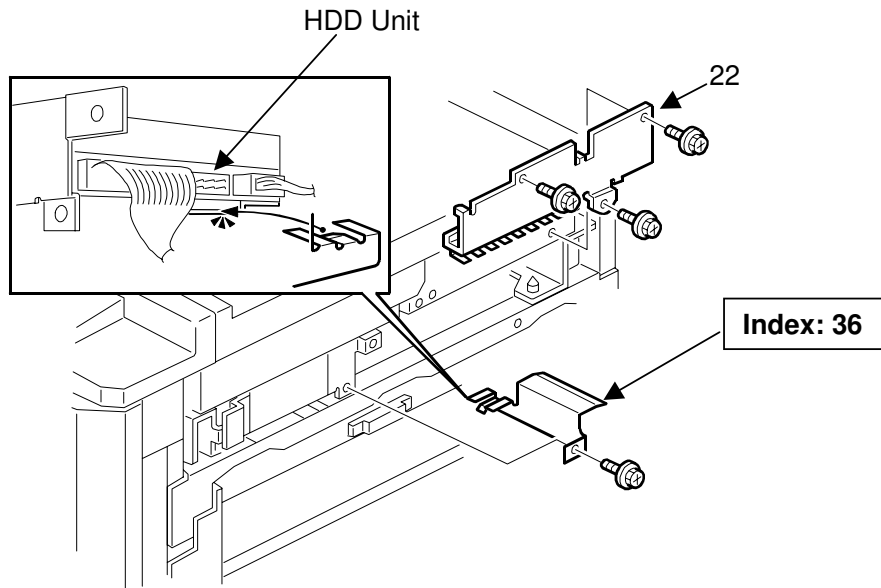

Model: Mojito-C1/C2	Date: 12-Feb-04	No.: MA293058
---------------------	-----------------	---------------

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	Service parts only
Ricoh Aficio 551	120/60	Taiwan	A292-19	
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	
Ricoh Aficio 700	230/50	Korea	A292-28	
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	
Ricoh Aficio 551	230/50	China	A292-69	
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	
Ricoh Aficio 700	230/50	Korea	A293-28	
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	
Ricoh Aficio 1055 Savin 2555 Gestetner 5502 Lanier LD055	120/ 60	USA, Canada, S. America	B098-17	J5330800593
Ricoh Aficio 1055	120/60	Taiwan	B098-19	J5330800791
Gestetner 5502 nashuatec 5505 Rex Rotary 5508	120/ 60	Europe, etc.	B098-22	J5330800380
Lanier LD055	220, 230, 240/ 50, 60	Europe	B098-24	L1333090001
infotec IS2055	220, 230, 240/ 50, 60	Europe, etc.	B098-26	2Q40930001
Ricoh Aficio 1055	220, 230, 240/ 50, 60	Europe, etc.	B098-27	J5330800498
Ricoh Aficio 1055	230/50	Korea	B098-28	J53309xxxxx
Ricoh Aficio 1055	220/ 50, 60	Asia, Oceania	B098-29	J5330800528
Ricoh Aficio 1055	230/50	China	B098-69	J5330800573

REI (U.S.A.) Production


MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, S. America	A292-15	Service parts only
Ricoh Aficio 551	120 / 60	USA, Canada, S. America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, S. America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, S. America	A293-17	

Model: Mojito-C1/C2		Date: 17-Feb-04	No.: MA293059
Modified Article: Paper Feed Unit		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

Please note the following parts description changes for the Paper Feed Units.

Specifically, the endings in **bold** below indicate which tray the particular PFU is to be used on. The reason these numbers differ is because the Mojito-C1/C2 for the Japanese market is based on a four-tray system.

Model	Part Number	Description	Q'ty	Page	Index
Mojito-C1	A2936200	Paper Feed Unit - 2nd/4th Feed (3rd Tray)	1	63	*
	A2936210	Paper Feed Unit - 3rd Feed (2nd Tray)	1		
	A2936220	Paper Feed Unit - 1st Feed (Tandem Tray)	1		
Mojito-C2	B0986201	Paper Feed Unit: Paper Bank:Ass'y (3rd Tray)	1	63	*
	B0986211	Paper Feed Unit: No.3: Ass'y (2nd Tray)	1		
	B0986221	Paper Feed Unit: No.1: Ass'y (Tandem Tray)			

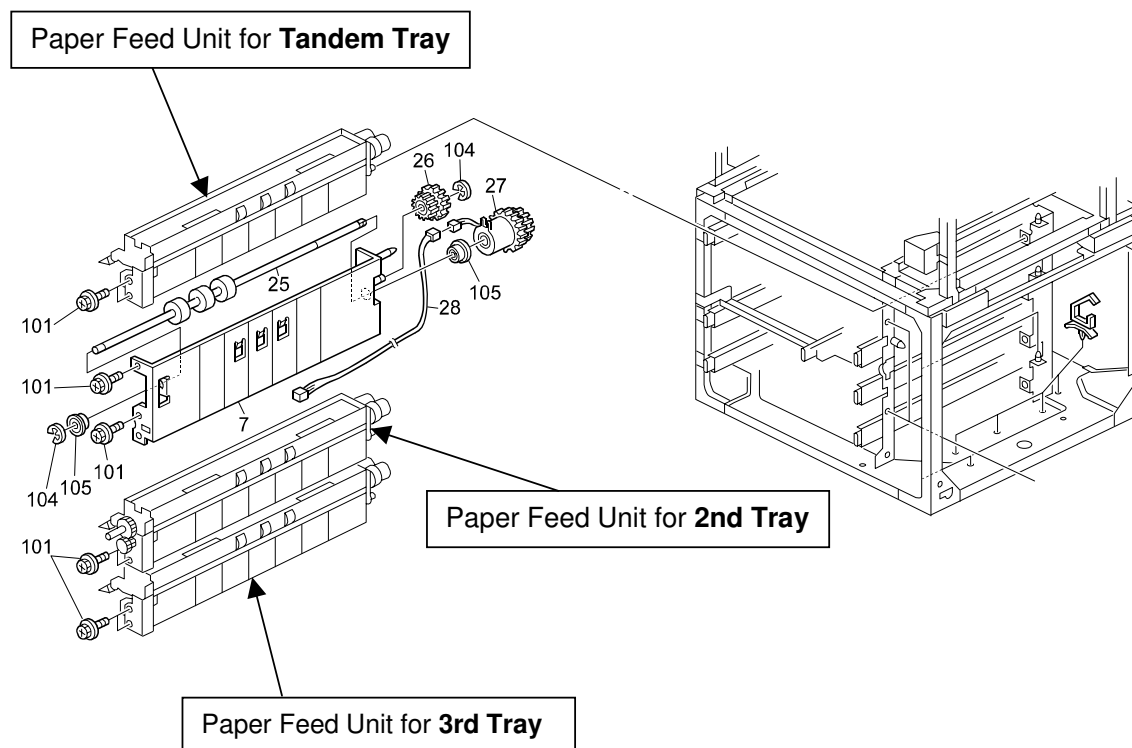

Model: Mojito-C1/C2		Date: 17-Feb-04	No.: MA293060
Modified Article: NV-RAM Minus Counter		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

The following has been changed due to the 0-counter specification change, in which the electronic counter is set to 0 when released from the factory instead of to a negative value. For more details, please refer to RTB RGene013.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2939099		NV-RAM Minus Counter	1 - 1	X/O	165	5	
	B0989590	Counter: NVRAM: M48Z128Y-85PM1					

NVRAM Replacement Procedure:

1. Print out all SMC data lists (SP 5-990-1).
2. Upload the NVRAM data from the BICU to the flash memory card (SP 5-824).
3. Turn the main power switch off.
4. Replace the NVRAM Zero Counter.
5. Turn the main power switch on.
6. Calibrate the LCD touch panel.
7. Turn the main power switch off and on.
8. Confirm the counter values are at "0" (SP7-003-1/-2/-4, SP7-006-1/-2).
9. Perform a Memory All Clear (SP 5-801).
It is necessary to perform a RAM clear, as the only RAM data that is cleared by power Off/On after replacement is the counter-related data.
10. Input the machine serial number (SP 5-811).
11. Download the NVRAM data from the flash memory card to the BICU (SP 5-825), **or**, referring to the SMC data lists, re-enter any value that has been changed from its factory setting.
12. Download the stamp data from the flash memory card (SP5-829).
13. Check the copy quality and paper path and perform any necessary adjustments.

Model: Mojito-C1/C2	Date: 17-Feb-04	No.: MA293060
---------------------	-----------------	---------------

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	Service Parts Only
Ricoh Aficio 551	120/60	Taiwan	A292-19	Service Parts Only
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	Service Parts Only
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	Service Parts Only
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	Service Parts Only
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	Service Parts Only
Ricoh Aficio 700	230/50	Korea	A292-28	Service Parts Only
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	Service Parts Only
Ricoh Aficio 551	230/50	China	A292-69	Service Parts Only
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	Service Parts Only
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	Service Parts Only
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	Service Parts Only
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	Service Parts Only
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	Service Parts Only
Ricoh Aficio 700	230/50	Korea	A293-28	Service Parts Only
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	Service Parts Only
RicohAficio 1055 Savin 2555 Gestetner 5502 Lanier LD055	120/ 60	USA, Canada, S. America	B098-17	J5331000001
Ricoh Aficio 1055	120/60	Taiwan	B098-19	J53402xxxxx
Gestetner 5502 nashuatec 5505 Rex Rotary 5508	120/ 60	Europe, etc.	B098-22	J5331000516
Lanier LD055	220, 230, 240/ 50, 60	Europe	B098-24	L1333100001
infotec IS2055	220, 230, 240/ 50, 60	Europe, etc.	B098-26	2Q41030001
Ricoh Aficio 1055	220, 230, 240/ 50, 60	Europe, etc.	B098-27	J5331000724
Ricoh Aficio 1055	230/50	Korea	B098-28	J53402xxxxx
Ricoh Aficio 1055	220/ 50, 60	Asia, Oceania	B098-29	J5331000802
Ricoh Aficio 1055	230/50	China	B098-69	J53402xxxxx

REI (U.S.A.) Production


MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, S. America	A292-15	Service Parts Only
Ricoh Aficio 551	120 / 60	USA, Canada, S. America	A292-17	Service Parts Only
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, S. America	A293-15	Service Parts Only
Ricoh Aficio 700	120 / 60	USA, Canada, S. America	A293-17	Service Parts Only

Model: Mojito-C1/C2		Date: 17-Feb-04	No.: MA293061
Modified Article: Philips Screw with Flatwasher		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☒ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The following screws have been standardized with those of the Martini to facilitate factory assembly.

Old part number	New part number	Description	Q'ty	Int	Page	Index
09514006B		Philips Screw with Washer - M4X6	n - n	O/O	79	101
	03540080B	Screw - M4X8				
09514008B		Philips Tapping Screw - M4X8	n - 0	O/O	85	101
09514006B		Philips Tapping Screw - M4X6				105
	03540080B	Screw - M4X8	0 - n			101
09514010W		Philips Screw with Flatwasher-M4X10	n - n	O/O	87	104
	03540080B	Screw - M4X8				

Section 35. DEVELOPMENT UNIT2

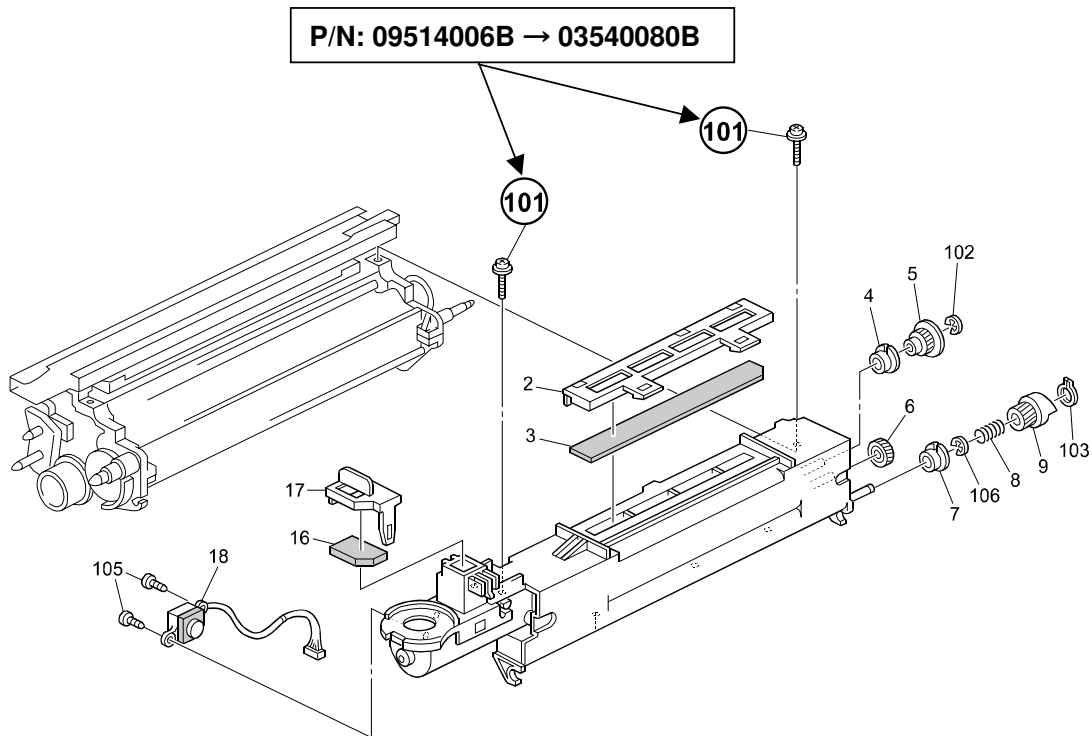


Model: Mojito-C1/C2


Date: 17-Feb-04

No.: MA293061

Section 36. PCU 1

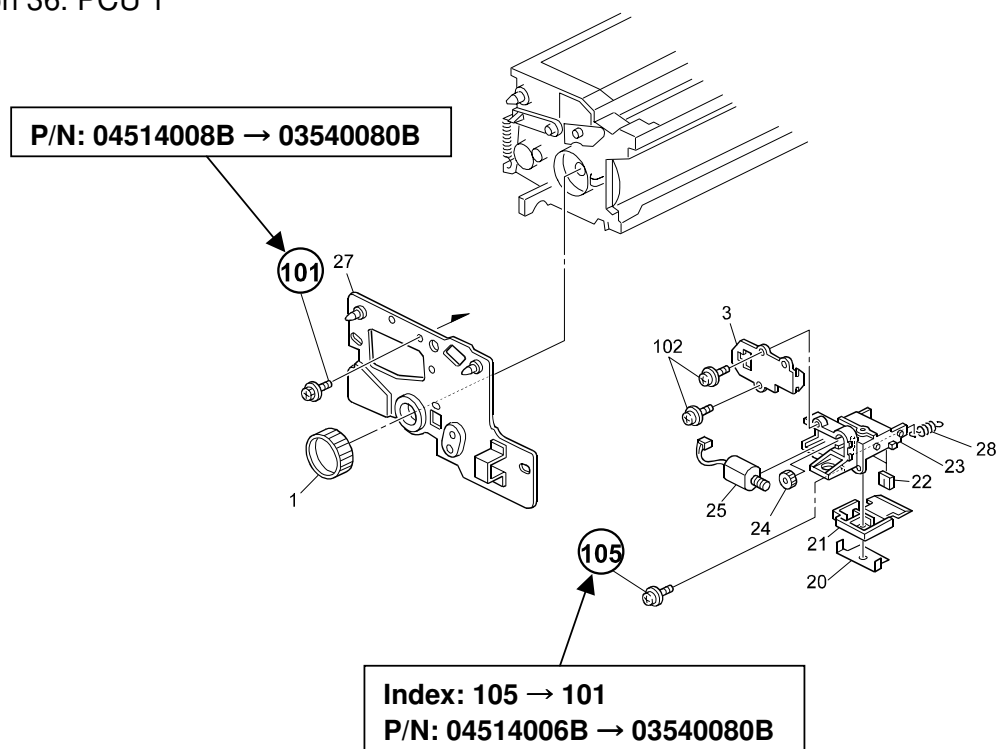

Section 37. PCU 2

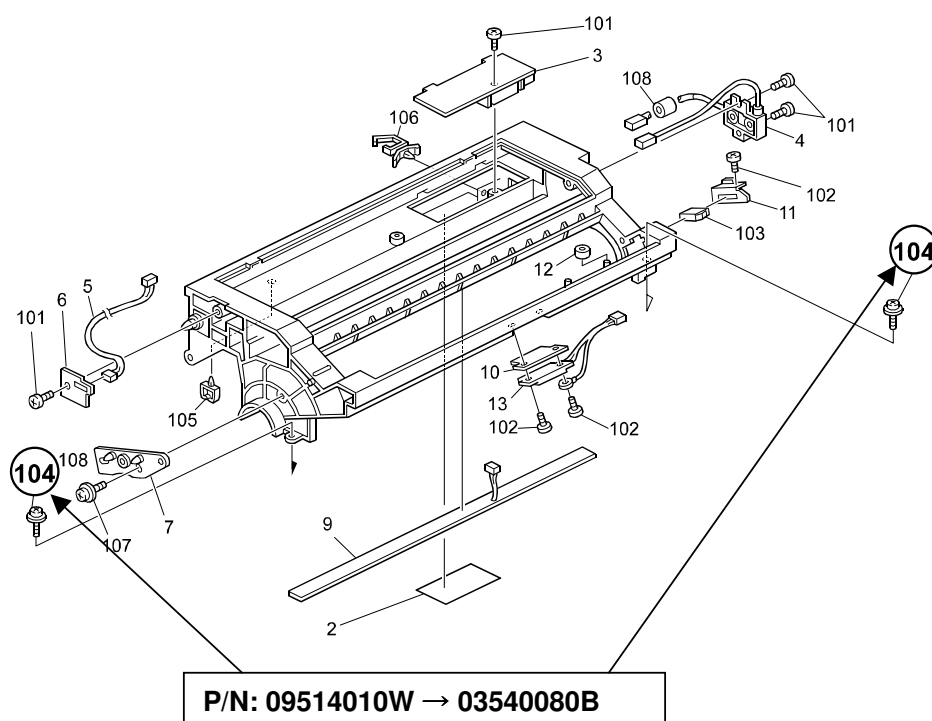

Model: Mojito-C1/C2		Date: 20-Feb-04	No.: MA293062
Modified Article: LCD		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☒ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The LCD has been changed due to a vendor change.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2935215		LCD – HVGA U65	1 - 1	O/O	19	18	
	B0105290	LCD: HVGA: SH: BL					

Model: Mojito-C1/C2		Date: 24-Feb-04	No.: MA293063
Modified Article: Tandem LCT: Left: Ass'y (B098 only)		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☒ To improve reliability ☐ Other	☐ To meet standards ()


The following changes have been made to further provide for accurate side-to-side positioning of the tandem LCT.

- A bead has been added to the DC motor bracket
- The shape of the side-to-side positioning stopper has been changed

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B0986609	B0986615	Tandem LCT: Left: Ass'y (NA: B098)	1 - 1	X/O	53	3	
B0986612	B0986616	Tandem LCT: Left: EU: Ass'y (EU:B098)					
B0986614	B0986617	Tandem LCT: Left: AA: Ass'y (TWN/CHN/KOR: B098)					
B0656827		Tandem LCT Base	1 - 1	X/X	53	36	*
	B0656832	Base: Tandem LCT: Left: Ass'y					
A2486636		DC Motor Bracket	1 - 1	X/X	53	19	*
	B0706666	Left DC Motor Bracket					

*: Interchange ability is X/O as a set

Note: When replacing the Motor Bracket or Tandem LCT Base, be sure to install both **together as a set**.

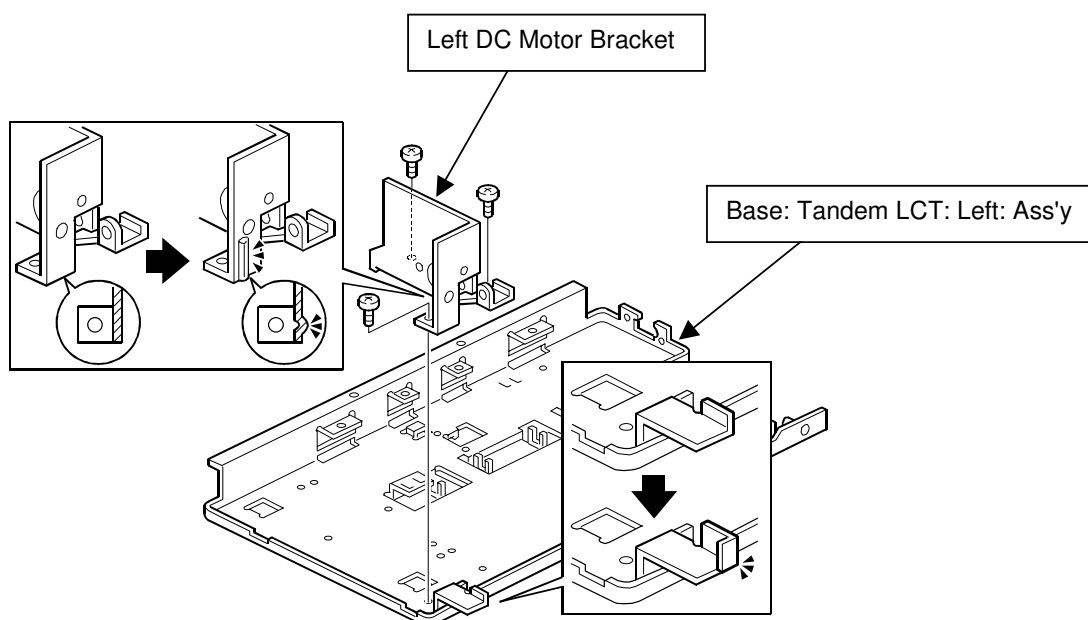

Model: Mojito-C1/C2

Date: 24-Feb-04

No.: MA293063

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	
Ricoh Aficio 551	120/60	Taiwan	A292-19	
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	
Ricoh Aficio 700	230/50	Korea	A292-28	
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	
Ricoh Aficio 551	230/50	China	A292-69	
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	
Ricoh Aficio 700	230/50	Korea	A293-28	
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	
RicohAficio 1055 Savin 2555 Gestetner 5502 Lanier LD055	120/ 60	USA, Canada, S. America	B098-17	J5330600034
Ricoh Aficio 1055	120/60	Taiwan	B098-19	J5330700251
Gestetner 5502 nashuatec 5505 Rex Rotary 5508	120/ 60	Europe, etc.	B098-22	J5330600353
Lanier LD055	220, 230, 240/ 50, 60	Europe	B098-24	L1333060001
infotec IS2055	220, 230, 240/ 50, 60	Europe, etc.	B098-26	2Q40630001
Ricoh Aficio 1055	220, 230, 240/ 50, 60	Europe, etc.	B098-27	J5330700815
Ricoh Aficio 1055	230/50	Korea	B098-28	J53703xxxxx
Ricoh Aficio 1055	220/ 50, 60	Asia, Oceania	B098-29	J5330600423
Ricoh Aficio 1055	230/50	China	B098-69	J5330600450

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, S. America	A292-15	
Ricoh Aficio 551	120 / 60	USA, Canada, S. America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, S. America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, S. America	A293-17	

Model: Mojito-C1/C2		Date: 26-Feb-04	No.: MA293064
Modified Article: Side and End Fences (Mojito-C1 only)		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The following parts have been standardized with the Mojito-C2.

Old part number	New part number	Description	Q'ty	Int	Page	Index
A0966536		Side Fence Cover (A292/A293)	1 - 1	O/O	59	32
	B0986536	Cover: Side fence: Universal: Front (B098)				
A0966562		End Fence (A292/A293) (B098)	1 - 1	O/O	59	7
	B0986562	End Fence: Universal (B098)				
A0966563		End Fence Cover (A292/A293)	1 - 1	O/O	59	4
	B0986563	Cover: End Fence: Universal (B098)				
A0966564		End Fence Plate (A292/A293)	1 - 1	O/O	59	8
	B0986564	Positioning plate: End Fence (B098)				
A0966551		Position Plate – Side Fence (A292/A293)	1 - 1	O/O	61	13
	B0986551	Positioning Plate: Side Fence: Fix (B098)				
A0966568		Position Plate – End Fence (A292/A293)	1 - 1	O/O	61	5
	B0986568	Positioning Plate: End Fence: Fix (B098)				

Model: Mojito-C1/C2		Date: 26-Feb-04	No.: MA293065
Modified Article: Lower Registration Guide (Mojito-C1 only)		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The following has been changed due to parts standardization with the new model.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A0962612	B1402612	Lower Registration Guide (A292/A293)	1 - 1	O/O	71	8	

Model: Mojito-C1/C2		Date: 26-Feb-04	No.: MA293066
Modified Article: Gear - 49Z and -31Z (for Mojito-C1 only)		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The following has been changed due to parts standardization with the Mojito-C2.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
AB013792	AB012316	Gear – 49Z (A292/A293)	1 - 1	X/X	101	10	*
		Fusing Gear (B098)					
AB017357	AB012317	Gear – 31Z (A292/A293)	1 - 1	X/X	101	28	*
		Fusing Drive Gear (B098)					

*: When installing for the first time, these parts should be changed **together as a set**.

Model: Mojito-C1/C2		Date: 30-Mar-04	No.: MA293067
Modified Article: Front and Rear Release Lever		Prepared by: F.Noguchi	
From: Technical Services sec. Service Planning Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The front and rear release levers have been changed due to parts standardization with the Bellini-C2.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2486717		Front Release Lever	1 - 1	X/O	57	10	
	B0706683	Lever: Release: Front					
A2486730		Rear Release Lever	1 - 1	X/O	57	27	
	B0706684	Lever: Release: Rear					

Model: Mojito-C1/C2	Date: 30-Mar-04	No.: MA293067
---------------------	-----------------	---------------

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	Service parts only
Ricoh Aficio 551	120/60	Taiwan	A292-19	
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	
Ricoh Aficio 700	230/50	Korea	A292-28	
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	
Ricoh Aficio 551	230/50	China	A292-69	
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	
Ricoh Aficio 700	230/50	Korea	A293-28	
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	
RicohAficio 1055 Savin 2555 Gestetner 5502 Lanier LD055	120/ 60	USA, Canada, S. America	B098-17	J5340200257
Ricoh Aficio 1055	120/60	Taiwan	B098-19	J53402xxxxx
Gestetner 5502 nashuatec 5505 Rex Rotary 5508	120/ 60	Europe, etc.	B098-22	J5340200127
Lanier LD055	220, 230, 240/ 50, 60	Europe	B098-24	L1334020001
infotec IS2055	220, 230, 240/ 50, 60	Europe, etc.	B098-26	2Q40240001
Ricoh Aficio 1055	220, 230, 240/ 50, 60	Europe, etc.	B098-27	J5340200001
Ricoh Aficio 1055	230/50	Korea	B098-28	J5340300898
Ricoh Aficio 1055	220/ 50, 60	Asia, Oceania	B098-29	J5340200237
Ricoh Aficio 1055	230/50	China	B098-69	J53402xxxxx

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, S. America	A292-15	Service parts only
Ricoh Aficio 551	120 / 60	USA, Canada, S. America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, S. America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, S. America	A293-17	

Model: Mojito-C1/C2		Date: 30-Apr-04	No.: MA293068
Modified Article: OPC Drum		Prepared by: F.Noguchi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

The following part has been changed. For details, please refer to RTB #RA293031.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2949510	A2959510	OPC Drum	1	O/O	87	8	

Model: Mojito-C1/C2	Date: 30-Apr-04	No.: MA293068
---------------------	-----------------	---------------

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Lanier 5455 AG	120/ 60	USA, Canada, S. America	A292-14	Service parts only
Ricoh Aficio 551	120/60	Taiwan	A292-19	
Gestetner 3355 nashuatec D555 Rex Rotary 2955	120/ 60	Europe, etc.	A292-22	
Lanier 5455 AH	220, 230, 240/ 50, 60	Europe	A292-24	
infotec 4551 MF	220, 230, 240/ 50, 60	Europe, etc.	A292-26	
Ricoh Aficio 551	220, 230, 240/ 50, 60	Europe, etc.	A292-27	
Ricoh Aficio 700	230/50	Korea	A292-28	
Ricoh Aficio 551	220/ 50, 60	Asia, Oceania	A292-29	
Ricoh Aficio 551	230/50	China	A292-69	
Lanier 5470 AG	120/ 60	USA, Canada, S. America	A293-14	
Gestetner 3370 nashuatec D570 Rex Rotary 2970	120/ 60	Europe, etc.	A293-22	
Lanier 5470 AH	220, 230, 240/ 50, 60	Europe	A293-24	
infotec 4700 MF	220, 230, 240/ 50, 60	Europe, etc.	A293-26	
Ricoh Aficio 700	220, 230, 240/ 50, 60	Europe, etc.	A293-27	
Ricoh Aficio 700	230/50	Korea	A293-28	
Ricoh Aficio 700	220/ 50, 60	Asia, Oceania	A293-29	
RicohAficio 1055 Savin 2555 Gestetner 5502 Lanier LD055	120/ 60	USA, Canada, S. America	B098-17	J5340300620
Ricoh Aficio 1055	120/60	Taiwan	B098-19	J5340400489
Gestetner 5502 nashuatec 5505 Rex Rotary 5508	120/ 60	Europe, etc.	B098-22	J5340400001
Lanier LD055	220, 230, 240/ 50, 60	Europe	B098-24	L1334040001
infotec IS2055	220, 230, 240/ 50, 60	Europe, etc.	B098-26	2Q40440001
Ricoh Aficio 1055	220, 230, 240/ 50, 60	Europe, etc.	B098-27	J5340400096
Ricoh Aficio 1055	230/50	Korea	B098-28	J53404xxxxx
Ricoh Aficio 1055	220/ 50, 60	Asia, Oceania	B098-29	J5340400246
Ricoh Aficio 1055	230/50	China	B098-69	J53404xxxxx

REI (U.S.A.) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
Savin 2055DP Gestetner 3355	120 / 60	USA, Canada, S. America	A292-15	Service parts only
Ricoh Aficio 551	120 / 60	USA, Canada, S. America	A292-17	
Savin 2070DP Gestetner 3370	120 / 60	USA, Canada, S. America	A293-15	
Ricoh Aficio 700	120 / 60	USA, Canada, S. America	A293-17	

Model: MojitoC1/C2		Date: 3-Jun-04	No.: MA293069
Modified Article: Vacuum Filter		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()



The material of the vacuum filter has been improved to an environmentally-friendly material, as part of Ricoh's ongoing application of in-house environmental management standards.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A2931098		Vacuum Filter	1 - 1	O/O	17	24	
	→ B0981098	Filter: Vacuum					

Model: Mojito-C1/C2		Date: 3-Jun-04	No.: MA293070
Modified Article: Power Supply Cord (B098-19 only)		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☒ To meet standards ()

A dedicated power cord for the B098 Taiwan version has been added to ensure compliance with Taiwanese safety/electrical standards (from the beginning of mass production on this version).

Old part number	New part number	Description	Q'ty	Int	Page	Index
A2937723		Power Supply Cord -120V (A292/293/B098)	1 - 0		133	13
	A2937723	Power Supply Cord -120V (A292/293/B098)	0 - 1		133	13
	B0985670	Power Supply Cord: 120V: TWN (B098)	0 - 1	X/O	133	13

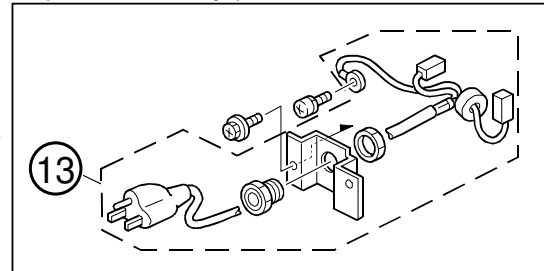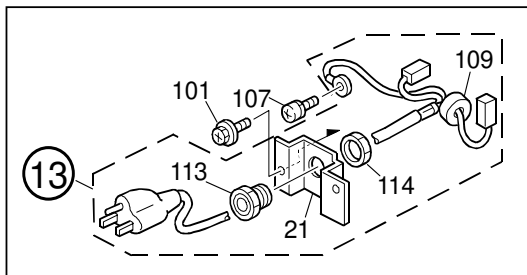

Model: Mojito-C1/C2		Date: 17-Jun-04	No.: MA293071
Modified Article: Paper Guide Sheet (A292/A293 only)		Prepared by: F. Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The following has been changed due to parts standardization with the Mojito-C2.

Old part number	New part number	Description	Q'ty	Int	Page	Index
A0966693		Paper Guide Sheet (A292/A293)	1 - 1	O/O	141	25
	B0989993	Shield: Frame: Paper Bank: Upper (B098)				

Model: Mojito-C1/C2		Date: 17-Jun-04	No.: MA293072
Modified Article: Cleaner Cushion/ Cushion - Wire		Prepared by: F. Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change ☐ To improve reliability ☒ Other	☐ To meet standards ()

The following has been modified to a more environmentally-friendly material, as part of Ricoh's ongoing application of in-house environmental management standards.

Old part number	New part number	Description	Q'ty	Int	Page	Index
AA161105		Cleaner Cushion	1 - 1	O/O	85	9
	AA161158	Cushion - Spacer				
AA161119	AA161159	Cushion - Wire	2 - 2	O/O	85	22

Model: Mojito-C1/C2		Date: 28-Jun-04	No.: MA293073
Modified Article: Polygon Mirror Motor (B098 onky)		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☒ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()

The polygon mirror motor has been changed due to a vendor change.

Old part number	New part number	Description	Q'ty	Int	Page	Index
AX060257		Polygon Mirror Motor: DC24V 24W (B098)	1 - 1	O/O	43	8
	AX060298	Polygon Mirror Motor: DC24V 7.2W (B098)				

RCL (Japan) Production

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NO.
RicohAficio 1055 Savin 2555 Gestetner 5502 Lanier LD055	120/ 60	USA, Canada, S. America	B098-17	J5340600627
Ricoh Aficio 1055	120/60	Taiwan	B098-19	J53408xxxxx
Gestetner 5502 nashuatec 5505 Rex Rotary 5508	120/ 60	Europe, etc.	B098-22	J5340600416
Lanier LD055	220, 230, 240/ 50, 60	Europe	B098-24	L1334070001
infotec IS2055	220, 230, 240/ 50, 60	Europe, etc.	B098-26	2Q040740001
Ricoh Aficio 1055	220, 230, 240/ 50, 60	Europe, etc.	B098-27	J5340600447
Ricoh Aficio 1055	230/50	Korea	B098-28	J53407xxxxx
Ricoh Aficio 1055	220/ 50, 60	Asia, Oceania	B098-29	J5340600582
Ricoh Aficio 1055	230/50	China	B098-69	J53407xxxxx

Reissued: 25-Mar-05

Model: Mojito-C1/C2	Date: 9-Feb-05	No.: MA293074a
---------------------	----------------	----------------

MB Correction

The items in bold italics have been corrected.

Modified Article: Tandem LCT: Left: Ass'y (B098 only)		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☒ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☐ Other	

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
<i>A2936607</i>	A2936617	Tandem LCT: Right: EU: Ass'y (A292/A293)	1 - 1	O/O	55	*	
<i>A2936608</i>	A2936618	Tandem LCT: Right: NA: Ass'y (A292/A293)					

Change: P/N change only.

Reason: Vendor change.

Model: Mojito-C1/C2		Date: 27-Mar-07	No.: MA293075
Modified Article: Hinge Shaft, Seal - 4x10x70		Prepared by: F.Noguchi	
From: 2nd Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☒ Part standardization ☐ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A0961355	B1321463	Hinge Shaft	1 - 1	O/O	135	23	
AA153063		Seal - 4X10X70	1 - 1	O/O	55	13	
	B4756855	Shield: Tandem LCT: Rear Right					

Change: The materials of these parts were changed to more environmentally-friendly types.

Reason: As part of Ricoh's ongoing application of in-house environmental management standards.



Part Change Information List

Date: March 18, 2009

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number
Mojito-C2	B098	200903		B3015405	B3015406	HARNESS:CONNECTING:SENSOR:PULL OUT	1	1	X/O		23	8					V0803433
Mojito-C2	B098	200903		A2936620	B0656831	SENSOR BRACKET	1	1	X/O		53	35					V0803888
Mojito-C2	B098	200903		AW010048	AW010106	PAPER FEED SENSOR	1	1	O/O		73	17					V0804408
Mojito-C2	B098	200903		A2931097	B2341097	FAN MOTOR DC24V 9.6W	1	1	O/O		129	2					V0803298
Mojito-C2	B098	200903		B0109005	B2475238	HDD:PATH2:40GB_CLIP:MASTER	3	3	O/O		135	36			Y		V0803064



Part Change Information List

Date: April 30, 2009

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number
Mojito-C2	B098	200904			AX060151	STEPPER MOTOR:REGISTRATION:ASS'Y	0	1			119	29			Y		
Mojito-C2	B098	200904		AX060151	B1401037	STEPPER MOTOR:REGISTRATION:ASS'Y	1	1	O/O		119	29			Y		V0804347



Part Change Information List

Date: July 31, 2009

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.
M-C2	B098	200907		B0109005	B2475238	HDD:PATH2:40GB_CLIP:MASTER	1	1	X/O		135	18					



Part Change Information List

Date: November 30, 2009

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
M-C2	B098	200911		AB012317	AB012328	GEAR:DRIVE:FUSING	1	1	X/O		101	28					V0901823	



Part Change Information List

Date: February 26, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
M-C2	B098	201002		A2486701	B2476901	OIL DAMPER:FALL	1	1	O/O		57	1					V0902719	
M-C2	B098	201002		AW020126	AW020158	PAPER FEED SENSOR	1	1	X/O		103	14					V0903006	4071464
M-C2	B098	201002		AW020126	AW020158	PAPER FEED SENSOR	2	2	X/O		111	18					V0903006	4071464



Part Change Information List

Date: Jun 30, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
M-C2	B098	201006		A0966553	B2342864	PAD:CLEANER	2	2	O/O		57	15					V1000308	



Part Change Information List

Date: October 29, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
M-C2	B098	201010		AA070044	AA070072	SLIDE RAIL-TANDEM LCT	1	1	X/O		141	9					V1002022	

RICOH**Part Change Information List**

Date: April 28, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
M-C2	B098	201104		G5644151	B7144151	RAILSIDE FENCE	1	1	O/O		23	21					V1100602	11020443



Part Change Information List

Date: July 28, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
M-C2	B098	201107		A2291133	B1401133	STEPPER MOTOR BASE ASS'Y	1	1	O/O		119	9					V1100488	

RICOH**Part Change Information List**

Date: August 31, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
M-C2	B098	201108		B1401133	B2471133	BASE:STEPPER MOTOR:ASS'Y	1	1	O/O		119	9					V1100820	



Part Change Information List

Date: December 28, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
M-C2	B098	201112		A6102161	B3012161	ROLLER:PRESSURE:BELT-MM24	1	1	O/O		29	25					V1100976	



Part Change Information List

Date: August 3, 2015

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
M-C2	B098	201507		A8064261	B3014261	COIL SPRING:BELT:PAPER FEED:8N	2	2	O/O	N	25	13					V1501671	



Part Change Information List

Date: November 2, 2015

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
M-C2	B098	201510		B7144151	B7144152	RAIL:SIDE FENCE	1	1	O/O	N	23	3					V1500444	



Part Change Information List

Date: July 1, 2016

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
M-C2	B098	201607		B0703115	D2233115	PLAIN SHAFT BEARING:DIA4:ASS'Y	2	2	O/O	N	81	6					V1601990	



Part Change Information List

Date: November 2, 2016

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
M-C2	B098	201611		B0986739	D1316819	SUPPORTING PLATE:TANDEM LCT:RIGHT REAR:ASS'Y	1	1	X/O	N	55	12					V1602115	



201805 **Part Change Information List**

Date: June 5, 2018

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
M-C2	B098	201805		B2475238	B2479101	HDD:PATH2:40GB_CLIP:MASTER:RC	3	3	O/O	N	-	-					V1702208	