

PAGE: 1/4

Reissued: 05-Jul-01

Model: H1	Date: 02-Mar-01	No.: MH538001a

MB Correction

The items in bold italics have been corrected or added.

Modified Article: Parts Catalog Correction			Prepared by: A. Ishiyama		
From: Technical Ser	vices Dept., GTS Division				
Reason for Modification:	☐ Parts catalog correction☐ To facilitate assembly☐ Part standardization	☐ Vendor change To improve	ū	☐ To meet standards ()	
Modification Schedule:	All new parts are available fro	om the first mas	ss productio	n.	

The following part numbers were printed incorrectly in the parts catalog.

Incorrect	Correct part	Description	Q'ty	Int	Page	Index	Note
part number	number	-					
G0251212		Plate Spring	1→0		3	23	Α
G0251213		Plate Spring - Left	1→0		3	28	Α
	H5384121	Spacer - Cover	0→2		3	32	Α
G0253018	H5383107	Left Bracket –Bottom Plate	1→1		11	1	
G0253202		Bottom Plate Ass'y – Paper Feed	1→0		11	34	*1
	H5384107	Insulating Sheet – Speaker	0→1		13	45	
H5381101	H5381120	ADF Base Frame	1→1		9	37	
H5381512	H5381612	Document Stopper	1→1		9	38	
H5381500	H5381600	ADF Upper Frame	1→1		9	45	
G0252489		Cover – Ground Plate	1→1		9	28	В
	H5381130	Anti-static Sheet – R1	1→1		9	54	В
	H5381131	Anti-static Sheet – R1	1→1		9	55	В
	H5384122	Spacer – Op-port	0→2		7	11	
H5383104	H5383108	Torque Limitter – Paper Feed	1→1		11	36	
G0252496		Shading Plate – ADF – Front	1→0		5	1	
G0251854		Laser Diode Unit	1→0		5	9	
	H5382046	Laser Unit	1→1		5	23	*2

^{*1:} As this is a complete assembled unit, it is not possible for SPC to supply this unit itself as spare parts. Therefore only child parts are available as spare parts.


^{*2:} The component level of the laser unit has been corrected.




PAGE: 2/4

Model: H1 Date: 02-Mar-01 No.: MH538001

1.EXTERIOR 1 (H538)

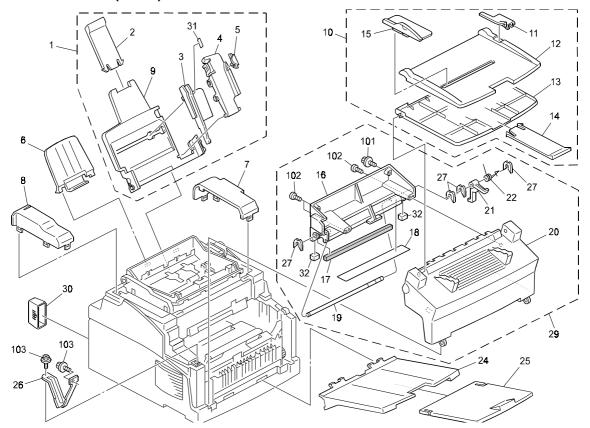

2.EXTERIOR 2 (H538)

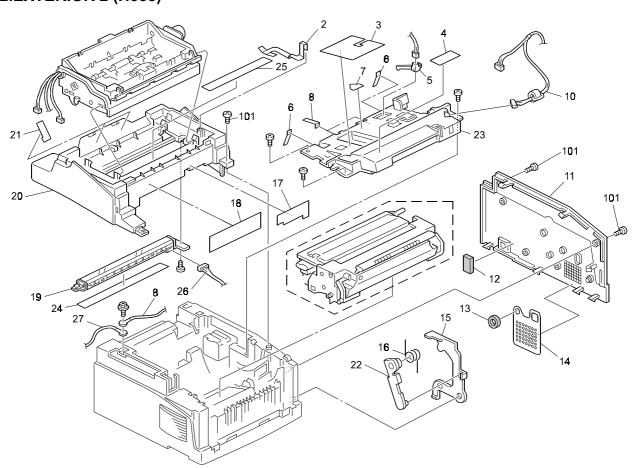





PAGE: 3/4

Model: H1 Date: 02-Mar-01 No.: MH538001

3.OPERATION PANEL (H538)

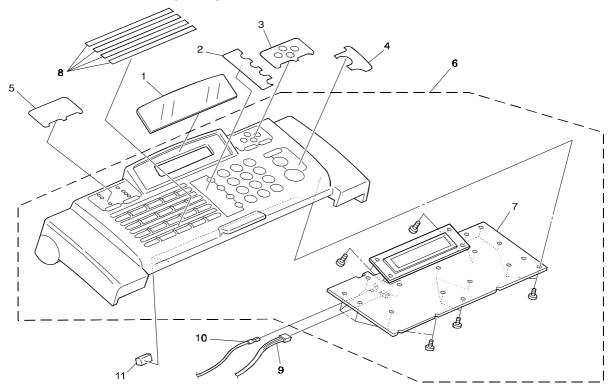

4.DF UNIT (H538)

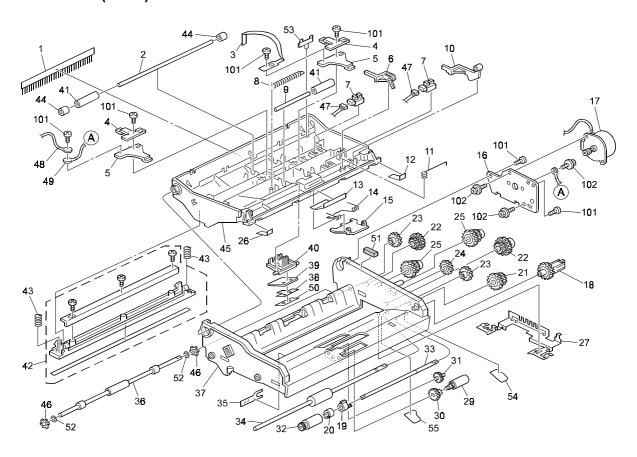





PAGE: 4/4

Model: H1 Date: 02-Mar-01 No.: MH538001

5.TRANSPORT SECTION 1(H538)

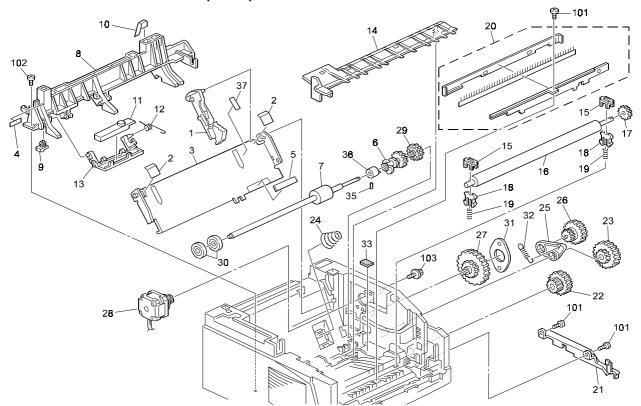

6.TRANSPORT SECTION 2(H538)

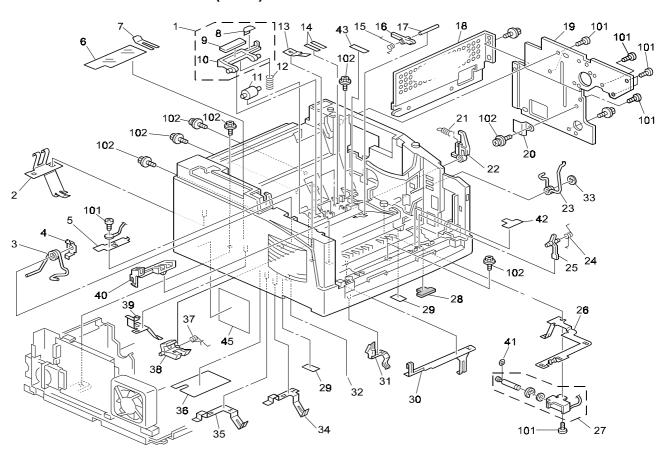


П	回	ന	巾巾
	ارتال	(0)	لآبا

Model: H1 Date					1	No.: MH538002
Modified Article:	Fusing Unit	Prepared	by: A.	Ishiyama		
From: Technical S	ervices Dept., GTS Division					
Reason for	☐ Parts catalog correction	⊠ Vend	or ch	ange	☐ To n	neet standards
Modification:	☐ To facilitate assembly	☐ To im	prove	e reliability	()
	☐ Part standardization	☐ Othe	r ()			
Modification	From March 2001 production	n run				
Schedule:						

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
H5382002D	H5382002E	Fusing Unit	1→1	X/O	15	7	
G0254521	H5382109	Thermofuse – 1	1→1	X/O	15	25	

Model: H1	Dat	:e: 06-Mar-0	1	No.: MH538003	
Modified Article: A	Prepared by: A. Ishiyama				
From: Technical Se	rvices Dept., GTS Division				
Reason for	☐ Parts catalog correction	☐ Vendor ch	nange	☐ To n	neet standards
Modification:	☐ To facilitate assembly	☐ To improv	e reliability	()
	☐ Part standardization	Other ()			
Modification	From January 2001 production	on run			
Schedule:					

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	H5381571	Mylar – Document Exit	0→2	X/O	9	53	

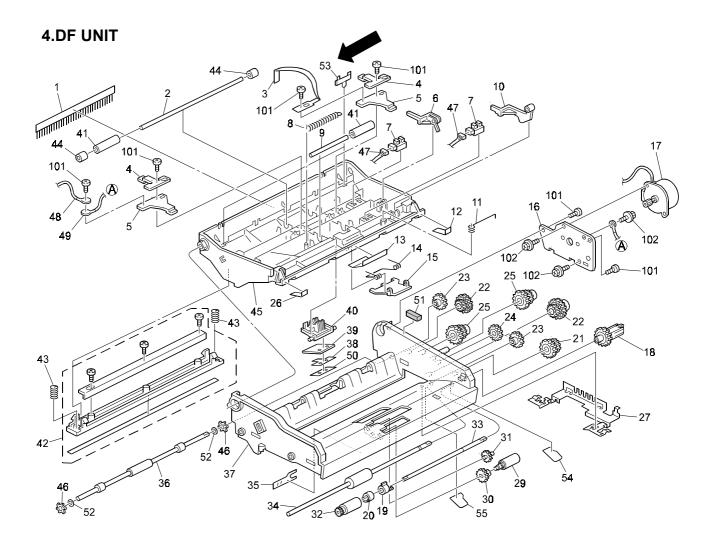

ΠŒ	ጠ	ιПЛ
(Բ	0	囧

Model: H1 Date				e: 06-Mar-0	1	No.: MH538004
Modified Article: Document Table					by: A.	Ishiyama
From: Technical Ser	vices Dept., GTS Division					
Reason for	☐ Parts catalog correction ☐ To facilitate assembly	☐ Vendo		ange e reliability	☐ To n	neet standards)
Modification:	Part standardization	Other		reliability	,	•
Modification	From January 2001 production	on run				
Schedule:						

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
G0252461	H5381552	Paper Tray - Back	1→1	X/O	3	13	

ΠŒ	ጠ	ιПЛ
(Բ	0	囧

Model: H1 Date			e: 06-Mar-01		No.: MH538005		
Modified Article: Registration Sensor					Prepared by: A. Ishiyama		
From: Technical Ser	vices Dept., GTS Division						
Reason for Modification:	☐ Parts catalog correction☐ To facilitate assembly	☐ Vendor change ☐ To improve reliability		O	☐ To m	neet standards)	
	☐ Part standardization	Other ()					
Modification	From January 2001 production	on run					
Schedule:							

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
G0252452	H5381651	Actuator – Registration Sensor	1→1	X/O	9	6	

ΠŒ	ጠ	ιПЛ
(Բ	0	囧

Model: H1 Date			e: 06-Mar-01		No.: MH538006		
Modified Article: Base				Prepared by: A. Ishiyama			
From: Technical Ser	vices Dept., GTS Division						
Reason for	☐ Parts catalog correction	☐ Vendo		J	☐ To m	neet standards	
Modification:	☐ To facilitate assembly	☐ To im	prove	e reliability	()	
	□ Part standardization	☐ Other	()				
Modification	After the old part is out of sto	ck.					
Schedule:							

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
G0251140	H5383302	Base	1→1		17	16	

	비비
	II 🗖 I
10070) I П I

Model: H1 Date			e: 06-Mar-01		No.: MH538007	
Modified Article: Paper Pick-up Cam					by: A. I	Ishiyama
From: Technical Services Dept., GTS Division						
Reason for	☐ Parts catalog correction	☐ Vendor	r cha	ange	☐ To m	neet standards
Modification:	☐ To facilitate assembly	□ To imp	rove	ereliability	()
	☐ Part standardization	Other ()				
Modification	From March 2001 production	run				
Schedule:						

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
H5383102	H5383109	Paper Pick-up Cam	1→1	X/O	11	6	


	ገመሰ	υпп
K		IJĪĪ

11	PA	GE: 1/
	N 1	

Model: H1 Dat			te: 06-Mar-0	1	No.: MH538008
Modified Article: Monitor Speaker Holder			Prepared	by: A.	Ishiyama
From: Technical Ser	rvices Dept., GTS Division				
Reason for	Parts catalog correction	☐ Vendor c	•	☐ To n	neet standards
Modification:	☐ To facilitate assembly☐ Part standardization	Other ()	ve reliability		,
Modification	From March 2001 production	run			
Schedule:					

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number				_		
H5383404	H5383408	Speaker Guide Plate	1→1		17	22	Α
H5383403	H5383410	IC Card Guide	1→1		17	24	Α
	H5383409	Holder – Speaker Guide Plate	0→1		17	30	Α
	H5383412	Spacer – Speaker Holder	0→2		17	31	Α
	04513006B	Tapping Screw – M3x6	2→3		17	102	Α

8.ELECTRICAL SECTION (H538)

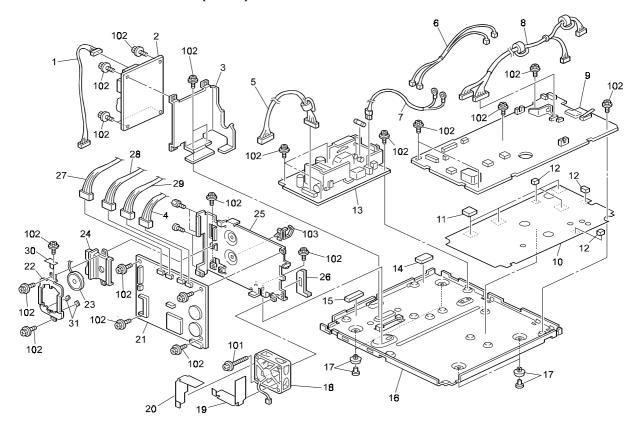

ΠŒ	ጠ	ιПЛ
(Բ	0	囧

Model: H1 D		Dat	Date: 06-Mar-01		No.: MH538009
Modified Article: P	aper Transport Section		Prepared	by: A.	Ishiyama
From: Technical Ser	vices Dept., GTS Division				
Reason for	☐ Parts catalog correction	n ☐ Vendor change ☐ To meet ☐ To meet ☐ To meet ☐ To meet		neet standards	
Modification:	☐ To facilitate assembly			()
	☐ Part standardization	Other ()			
Modification	From March 2001 production run				
Schedule:					

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
H5381560	H5383411	Feeler Plate – Paper Exit Sensor	1→1		13	42	

 	ПП
(G(O)	lπI

PAGE: 1/1

Model: H1 Da		Date: 07-Aug-01		1	No.: MH538010	
Modified Article: Paper Exit Tray Decals			Prepared by: A. Ishiyama			
From: Technical Services Dept., GTS Division						
Reason for	☐ Parts catalog correction	☐ Vendor change		☐ To m	neet standards	
Modification:	☐ To facilitate assembly	☐ To improve reliability			()
	☐ Part standardization	Other ()				
Modification	From August 2001 production run					
Schedule:						

To facilitate easier installation of the Paper Exit Tray, two arrow decals have been newly registered for the tray attachment areas and mainframe (Decals S and L, respectively). Also, a Paper Exit Tray already containing Decal S has been newly registered.

Please refer to RTB 005 (RH538005) for details.

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
	H5382110	Paper Exit Tray with Decal	1		3	34	
	H5384401	Paper Exit Tray Decal - S	2		3	33	
	H5384400	Paper Exit Tray Decal - L	2		13	46	