

Model: Adonis-C3 ARDF (DF76)	Date: 8-Jan-04	No.: MB541001
------------------------------	----------------	---------------

Number Correction

The bulletin number has been corrected. (MB082009→MB541001)

Modified Article: Parts catalog correction		Prepared by: Y.Urushihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction	☐ Vendor change	☐ To meet standards ()
	☐ To facilitate assembly	☐ To improve reliability	
	☐ Part standardization	☐ Other	

Please note the following revisions made to the parts catalog. These were applied from the beginning of mass production.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
G5646041	G5646032	Decal – Exit Misfeed Removal	1-1		25	7	
B3516041	G5646041	Decal – Misfeed Removal - Exit	1-1		25	8	

Model: Adonis-C3 ARDF (DF76)		Date: 16-Sep-04	No.: MB541002
Modified Article: Pressure Plate Assy		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☒ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other	☐ To meet standards ()


Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B3514351	B5974311	Pressure Plate Assy	1	X/O	21	10	
B3514333	-	Cushion - Pressure Plate	2-0		21	15	
B3514322	B3514322	Tape - Platen Sheet	4-1		21	9	
	B5974326	Cushion Tape - Left	2		21	16	
	B5974333	Cushion Tape - Middle	2		21	17	
	G5643622	Cushion - Guide Plate	2		21	18	
	G5643621	Cushion - Guide Plate - Middle	1		21	19	
	G5643631	Cushion - Pressure Plate - Rear Right	1		21	20	
	B5973632	Cushion - Pressure Plate - Right: T8	1		21	21	

Reason: Parts standardization with the Model - JC1 ARDF (DF77).


Important: See the next page for important notes on installing the new parts.

Installing the Velcro Patches (“Cushion” and “Cushion Tape”)

1. Remove the Pressure Plate.
2. Remove the 5 old Velcro patches from the underside of the ADF.
3. Attach the new Velcro patches to the underside of the ADF (#18-21 below).

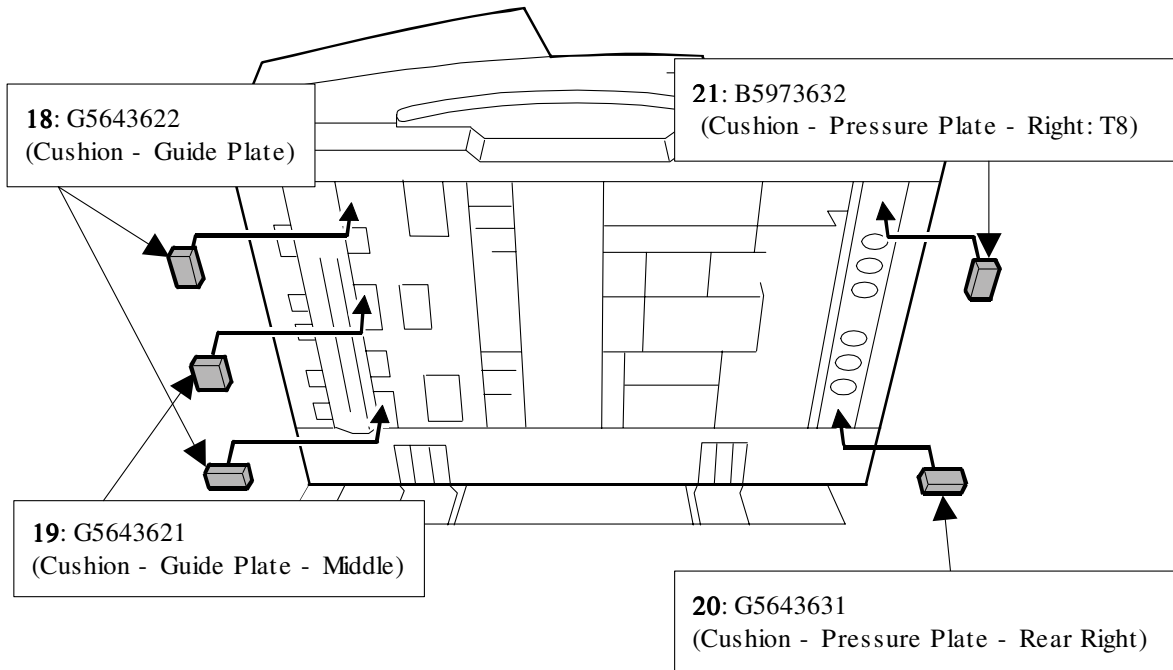

4. Attach the new Velcro patches to the underside of the Pressure Plate (#9, 10, 16, 17 below):

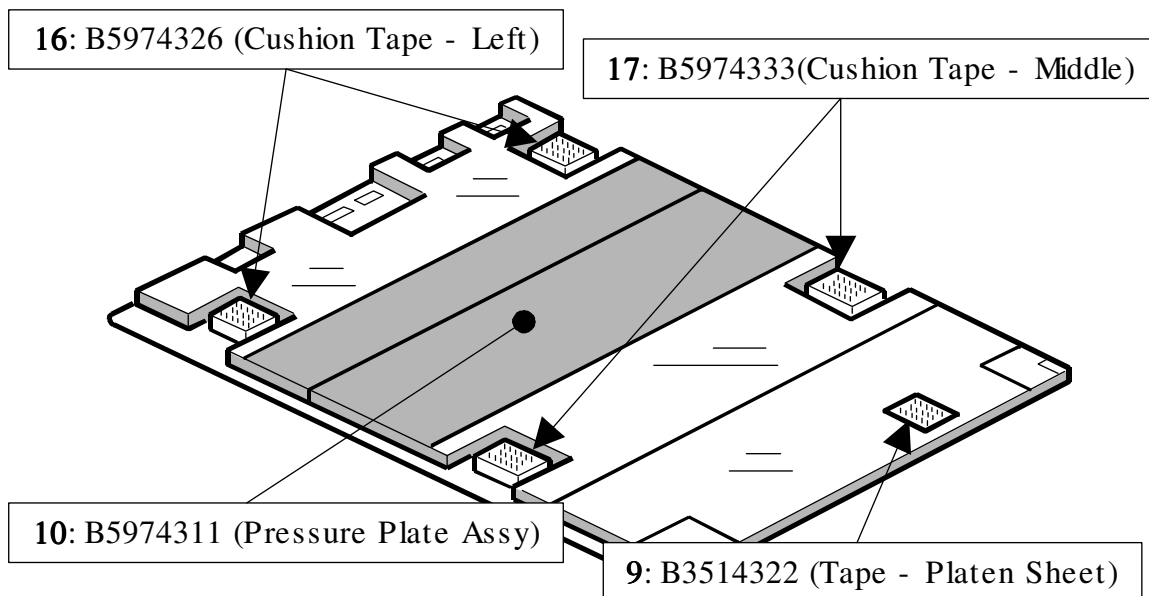

Model: Adonis-C3		Date: 25-Apr-07	No.: MB541003
Modified Article: Pressure Plate		Prepared by: K. Takagi	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☒ Product Safety ()		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B5974311	B7144313	Pressure Plate Ass'y	1-1	X/O	21	10	

Change: The shape of this part was changed.

Reason: To make sure the user does not touch the pressure plate.



Part Change Information List

Date: January 29, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3 ARDF (DF76)	B541	201001		AA083859	AA083861	COMPRESSION SPRING:PRESSURE ROLLER:SCANNING:REAR	10	10	X/O		15	14					V0903269	



Part Change Information List

Date: Jun 30, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3 ARDF(DF76)	B541	201006		B3513663	B7143663	SHAFT:LOCK:EXIT	1	1	O/O		21	6					V1000271	



Part Change Information List

Date: November 30, 2010

Model	Code	PCIL Nr.	PCIL Correctio	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3 ARDF (DF76)	B541	201011		G5643622	B7143634	CUSHION - LOWER GUIDE PLATE	1	1	X/O		21	18					T0402296	04081210
A-C3 ARDF (DF76)	B541	201011		G5643621	B7143633	CUSHION - LOWER GUIDE PLATE M	1	1	X/O		21	19					T0402296	04081210
A-C3 ARDF (DF76)	B541	201011		G5643631	B7143631	REAR RIGHT CUSHION - P COVER	1	1	X/O		21	20					T0402296	04081210
A-C3 ARDF (DF76)	B541	201011		B5973632	B7143632	CUSHION:RIGHT:T8	1	1	X/O		21	21					T0402296	04081210



Part Change Information List

Date: April 28, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3 ARDF (DF76)	B541	201104		G5644151	B7144151	RAIL:SIDE FENCE	1	1	O/O		5	1					V1100602	11020443



Part Change Information List

Date: May 31, 2012

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Qty	New Qty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
A-C3 ARDF (DF76)	B541	201205		B3514135	AG070513	MAGNET CATCH	1	1	O/O		5	11					V1101406	



Part Change Information List

Date: August 30, 2013

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
A-C3 ARDF (DF76)	B541	201308		B5415280	B7145280	HARNESS:MOTOR:PAPER FEED	1	1	O/O		19	4					V1300077	



Part Change Information List

Date: November 2, 2015

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
A-C3 ARDF _DF76_	B541	201510		B7144151	B7144152	RAIL:SIDE FENCE	1	1	O/O	N	5	1					V1500444	