RIGOH

Modification Bulletin

PAGE: 1/1

Reissued: 2-Apr-04

Model: Adonis-C3 Tray Finisher (SR880)	Date: 25-Dec-03	No.: MB545001a
--	-----------------	----------------


MB Correction

The items in bold italics have been corrected or added.

Modified Article: P	CB:Main Control	Prepared by: K.Takagi			
From: 1st Tech. Sup	pport Sec. Service Support Dep				
Reason for	☐ Parts catalog correction	☐ Vendor ch	ange	☐ To meet standards	
Modification:	☐ To facilitate assembly	⊠ To improve	e reliability	()	
Part standardization Other					

The following has been changed to further improve the accuracy of the staple tray mechanism.

Old part	New part	Description		Int	Page	Index	Note
number	number						
B5455100	B5455110	PCB:Main Control	1-1	X/O	39	1	
B5455103	B5455120	EPROM:Main Control	1-1	X/O	39	15	

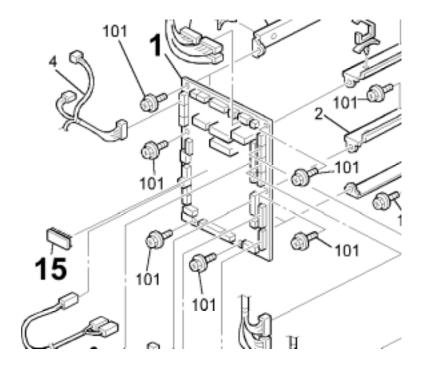

RCL (Japan) Production

\output;	- \									
Model Name	Destination	Code	Serial Number							
SR 880	USA, Europe, Asia	B545-17	J6531100001							
	Europe	B545-26	J65312xxxxx							

Modification Bulletin


PAGE: 1/1

Model: Adonis-C3	Da	te: 25-Apr	-07	No.: MB545002		
Modified Article:	F	Prepared	by: K. Ta	kagi		
From: 1st Tech. Su	upport Sec. Service Support D	Dept.				
Reason for	☐ Parts catalog correction	☐ Vendor c	chai	nge	Other	
Modification: ☐ To facilitate assembly ☐ To impro			ove	reliability	☐ To me	et standards
Part standardization Product Sa				ety	()

The software of the main control board has been changed to fix the following software bugs.

- Jam 28 occurs when the machine recovers from Energy Saver mode.
- A jam occurs near the finisher staple tray.

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
B5455110	B5455160	PCB:Main Control	1-1	X/O	39	1	
B5455120	B5455123	EPROM:Main Control	1-1	X/O	39	15	

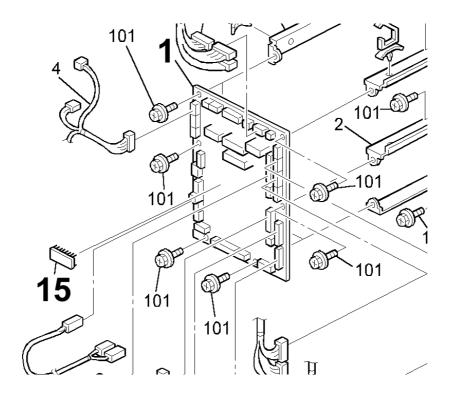

RCL (Japan) Production

Model Name	Destination	Code	Serial Number	
SR 880	USA, Europe, Asia	B545-17	J65ymmxxxxx	

Modification Bulletin

PAGE: 1/1

Model: Adonis-C3	ate: 28-May	y-07	No.: MB545003			
Modified Article: Shift Tray				Prepared	by: K.Tak	kagi
From: 1st Tech. Su	ipport Sec. Service Support [Dept.				
Reason for	☐ Parts catalog correction	☐ Vendor o	cha	ange	Other	
Modification: ☐ To facilitate assembly ☐ To improve			e reliability	☐ To mee	et standards	
	Modification: ☐ Part standardization ☐ Product S				()

Old part	New part	Description		Int	Page	Index	Note
number	number						
B3523911	B3523912	Shift Tray	1-1	X/X	7	18	
B3523840	G5653840	Lower Tray Holder	1-1	X/O	33	1	

Change: The shapes of the parts in the table were changed. **Reason:** To increase the durability of the sub tray.

Important: When you install these parts for the first time, replace them together as a set.

RCL (Japan) Production

Model Name			Serial Number					
SR 880	USA, Europe, Asia	B545-11	J6550800001					

Modification Bulletin

PAGE: 1/1

Model: Adonis-C3 2 Tray Finisher (SR880)				ate: 14-Feb	o-08	No.: MB545004
Modified Article: Lower Transport Roller				Prepared	by: K.Tak	kagi
From: 1st Tech. Su	pport Sec. Service Support [Dept.				
Reason for	☐ Parts catalog correction	☐ Vendor	cha	ange	Other	
Modification: ☐ To facilitate assembly ☐ To improve			e reliability		et standards	
	Modification: ☐ Part standardization ☐ Product S				(RoHS	8)

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
B3522620	B7044121	Lower Transport Roller	1-1	X/O	11	8	
			1-1	70	15	8	
	_						

Change: The materials of these parts were changed.

Reason: RoHS compliance

Modification Bulletin

PAGE: 1/1

Model: Adonis-C3	2 Tray Finisher (SR880)	ate: 14-Feb	-08	No.: MB545005				
Modified Article:	PCB: Main Control	Prepared by: K. Takagi						
From: 1st Tech. Su	pport Sec. Service Support [
Reason for	☐ Parts catalog correction	☐ Vendor	cha	ange	Other			
Modification:	☐ To facilitate assembly	□ To impress □	ove	e reliability	☐ To me	et standards		
	☐ Part standardization	☐ Product	Sa	afety	()		

The software of the main control board has been changed to fix the following software bugs.

 SC620 is displayed when a stapling job is attempted with a paper size that is not supported by the stapling function.
Conditions: A stapling job was performed just before this using a paper size that is supported by the stapling function (A4 LEF, LT LEF, B5 LEF).

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
B5455160	B5455165	PCB:Main Control	1-1	X/O	39	1	
B5455123	B5455124	EPROM:Main Control	1-1	X/O	39	15	

Modification **B**ulletin

PAGE: 1/1

Model: Adonis-C3	2 Tray Finisher (SR880)	ate: 24-Feb	-09	No.: MB545006					
Modified Article:	Caster		Prepared by: S. Tomoe						
From: 2nd Tech. S	upport Sec. Service Support								
Reason for	☐ Parts catalog correction		cha	ange	Other				
Modification:	☐ To facilitate assembly	☐ To impro	ove	et standards					
	☐ Part standardization	Sa	ıfety	()				

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
B5452019	B8041035	Caster:DIA50:400N	2-2	0/0	21	4	

Change/ Reason: Vendor change



Part Change Information List

		PCIL	PCIL	Old	New												
Model	Code	Number	Correction	part number	part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number
Adonis-C3 2 Tray Finisher (SR880)	B545	200903		A6973205	D4603205	BRACKET:PHOTOINTERRUPTOR:SHIFT	1	1	O/O		35	17					V0803530
Adonis-C3 2 Tray Finisher (SR880)	B545	200903		B5452500	B5452502	GUIDE PLATE:AUXILIARY:PUNCH:ASS'Y	1	1	X/O		11	7					V0804293

Part Change Information List

Date: August 31, 2009

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty Int	3DPC	Page	Index	Set Set Ir	t RTB	Note	Ref. Nr.	ECN Nr.
A-C3 2 Tray Finisher (SR880)	B545	200908		12042384	12042848	SWITCH:FA1L-AJAE	1	1 X/O)	17	102				V0901516	9050233