

|                                                    |                                                                                                                                                                                                                                                                                                                                                                                      |                        |               |
|----------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------|---------------|
| Model: Model J-P4                                  |                                                                                                                                                                                                                                                                                                                                                                                      | Date: 27-Jul-05        | No.: MG131001 |
| Modified Article: Parts Catalog Correction         |                                                                                                                                                                                                                                                                                                                                                                                      | Prepared by: H. Someya |               |
| From: 1st Tech. Support Sec. Service Support Dept. |                                                                                                                                                                                                                                                                                                                                                                                      |                        |               |
| Reason for Modification:                           | <input checked="" type="checkbox"/> Parts catalog correction <input type="checkbox"/> Vendor change <input type="checkbox"/> Other<br><input type="checkbox"/> To facilitate assembly <input type="checkbox"/> To improve reliability <input type="checkbox"/> To meet standards<br><input type="checkbox"/> Part standardization <input type="checkbox"/> Product Safety    (     ) |                        |               |

| Incorrect Part Number | Correct Part Number | Description             | Q'ty | Int | Page | Index | Note |
|-----------------------|---------------------|-------------------------|------|-----|------|-------|------|
| G1315701              | <b>G1305791</b>     | Controller Board – G130 |      |     | 87   | 6     |      |
| G1315701              | <b>G1315791</b>     | Controller Board – G131 |      |     | 87   | 6     |      |

**Change:** P/N change only.

**Reason:** The wrong P/N was listed in the Parts Catalog.


|                                                    |                                                                                                                                                                                                                                                                                                                                                                                      |                   |               |
|----------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|---------------|
| Model: Model J-P4                                  |                                                                                                                                                                                                                                                                                                                                                                                      | Date: 16-Nov-05   | No.: MG131002 |
| Modified Article: Heat Roller                      |                                                                                                                                                                                                                                                                                                                                                                                      | Prepared by: H.K. |               |
| From: 1st Tech. Support Sec. Service Support Dept. |                                                                                                                                                                                                                                                                                                                                                                                      |                   |               |
| Reason for Modification:                           | <input checked="" type="checkbox"/> Parts catalog correction <input type="checkbox"/> Vendor change <input type="checkbox"/> Other<br><input type="checkbox"/> To facilitate assembly <input type="checkbox"/> To improve reliability <input type="checkbox"/> To meet standards<br><input type="checkbox"/> Part standardization <input type="checkbox"/> Product Safety    (     ) |                   |               |

## Part number correction

| Incorrect part number | Correct part number | Description            | Q'ty | Int | Page | Index | Note |
|-----------------------|---------------------|------------------------|------|-----|------|-------|------|
| B1804300              | B1804107            | HEAT ROLLER:MM30:ASS'Y | 1    |     | 53   | 7     |      |

## Illustration index correction

Please correct Index (7) of the illustration on page 52 as shown.

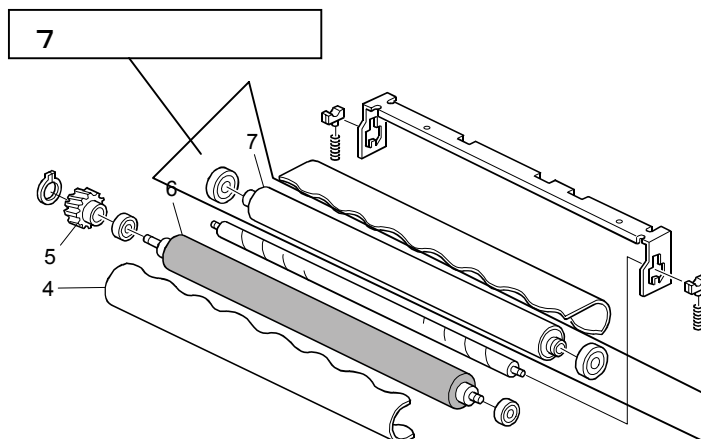

|                                                    |                                                                                                                                                                                                                                                                                                                                                                                       |                        |               |
|----------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------|---------------|
| Model: Model J-P4                                  |                                                                                                                                                                                                                                                                                                                                                                                       | Date: 8-Feb-06         | No.: MG131003 |
| Modified Article: Controller Board                 |                                                                                                                                                                                                                                                                                                                                                                                       | Prepared by: H. Someya |               |
| From: 1st Tech. Support Sec. Service Support Dept. |                                                                                                                                                                                                                                                                                                                                                                                       |                        |               |
| Reason for Modification:                           | <input type="checkbox"/> Parts catalog correction <input type="checkbox"/> Vendor change <input type="checkbox"/> Other<br><input type="checkbox"/> To facilitate assembly <input checked="" type="checkbox"/> To improve reliability <input type="checkbox"/> To meet standards<br><input type="checkbox"/> Part standardization <input type="checkbox"/> Product Safety    (      ) |                        |               |

| Old part number | New part number | Description             | Q'ty | Int | Page | Index | Note |
|-----------------|-----------------|-------------------------|------|-----|------|-------|------|
| G1305791        | G1305792        | Controller Board – G130 |      |     | 87   | 6     |      |
| G1315791        | G1315792        | Controller Board – G131 |      |     | 87   | 6     |      |

**Change:** Addition of the protection rubber for IC20 on the controller board.

**Reason:** To prevent slow warming up under high humidity condition.

### RCL (Japan) Production

| Model                                                                      | V/Hz                | Destination  | Code    | Serial Number |
|----------------------------------------------------------------------------|---------------------|--------------|---------|---------------|
| Ricoh Aficio CL7200<br>Savin CLP128<br>Gestetner C7528n<br>Lanier LP332c   | 120V, 60Hz          | USA, Canada  | G130-17 | Q3751200001   |
| Gestetner C7528n<br>Nashuatec C7528n<br>Rex Rotary C7528n                  | 220 - 240V, 50/60Hz | Europe, etc. | G130-22 | Q3751100612   |
| Lanier LP332c                                                              | 220 - 240V, 50/60Hz | Europe, etc. | G130-24 | Q37512xxxxx   |
| Infotec IPC 2832                                                           | 220 - 240V, 50/60Hz | Europe, etc. | G130-26 | 2S21250001    |
| Ricoh Aficio CL7200                                                        | 220 - 240V, 50/60Hz | Europe, etc. | G130-27 | Q37512xxxxx   |
| Ricoh Aficio CL7200                                                        | 220 - 240V, 50/60Hz | Asia         | G130-29 | Q3751200451   |
| Ricoh Aficio CL7300<br>Savin CLP135<br>Gestetner C7535hdn<br>Lanier LP335c | 120V, 60Hz          | USA, Canada  | G131-17 | Q3851200001   |
| Gestetner C7535hdn<br>Nashuatec C7535hdn<br>Rex Rotary C7535hdn            | 220 - 240V, 50/60Hz | Europe, etc. | G131-22 | Q3851200351   |
| Lanier LP335c                                                              | 220 - 240V, 50/60Hz | Europe, etc. | G131-24 | Q3851200431   |
| Infotec IPC 3535e                                                          | 220 - 240V, 50/60Hz | Europe, etc. | G131-26 | 2S11250001    |
| Ricoh Aficio CL7300                                                        | 220 - 240V, 50/60Hz | Europe, etc. | G131-27 | Q3851200434   |
| Ricoh Aficio CL7300                                                        | 220 - 240V, 50/60Hz | Asia         | G131-29 | Q3851200484   |

|                                                    |                                                                                                                                                                                                                                                                                                                                                                                       |                        |               |
|----------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------|---------------|
| Model: Model J-P4                                  |                                                                                                                                                                                                                                                                                                                                                                                       | Date: 10-Feb-06        | No.: MG131004 |
| Modified Article: Controller Board                 |                                                                                                                                                                                                                                                                                                                                                                                       | Prepared by: H. Someya |               |
| From: 1st Tech. Support Sec. Service Support Dept. |                                                                                                                                                                                                                                                                                                                                                                                       |                        |               |
| Reason for Modification:                           | <input type="checkbox"/> Parts catalog correction <input type="checkbox"/> Vendor change <input type="checkbox"/> Other<br><input type="checkbox"/> To facilitate assembly <input checked="" type="checkbox"/> To improve reliability <input type="checkbox"/> To meet standards<br><input type="checkbox"/> Part standardization <input type="checkbox"/> Product Safety    (      ) |                        |               |

| Old part number | New part number | Description             | Q'ty | Int | Page | Index | Note |
|-----------------|-----------------|-------------------------|------|-----|------|-------|------|
| G1305792        | G1305794        | Controller Board – G130 |      |     | 87   | 6     |      |
| G1315792        | G1315794        | Controller Board – G131 |      |     | 87   | 6     |      |

**Change:** The attachment method for the heat sink on the controller board CPU was changed.

**Reason:** To further ensure the heat sink stays properly attached to the controller board.

### RCL (Japan) Production

| Model                                                                      | V/Hz                | Destination  | Code    | Serial Number |
|----------------------------------------------------------------------------|---------------------|--------------|---------|---------------|
| Ricoh Aficio CL7200<br>Savin CLP128<br>Gestetner C7528n<br>Lanier LP332c   | 120V, 60Hz          | USA, Canada  | G130-17 | Q3751200001   |
| Gestetner C7528n<br>Nashuatec C7528n<br>Rex Rotary C7528n                  | 220 - 240V, 50/60Hz | Europe, etc. | G130-22 | Q3751100612   |
| Lanier LP332c                                                              | 220 - 240V, 50/60Hz | Europe, etc. | G130-24 | Q37512xxxxx   |
| Infotec IPC 2832                                                           | 220 - 240V, 50/60Hz | Europe, etc. | G130-26 | 2S21250001    |
| Ricoh Aficio CL7200                                                        | 220 - 240V, 50/60Hz | Europe, etc. | G130-27 | Q37512xxxxx   |
| Ricoh Aficio CL7200                                                        | 220 - 240V, 50/60Hz | Asia         | G130-29 | Q3751200451   |
| Ricoh Aficio CL7300<br>Savin CLP135<br>Gestetner C7535hdn<br>Lanier LP335c | 120V, 60Hz          | USA, Canada  | G131-17 | Q3851200001   |
| Gestetner C7535hdn<br>Nashuatec C7535hdn<br>Rex Rotary C7535hdn            | 220 - 240V, 50/60Hz | Europe, etc. | G131-22 | Q3851200351   |
| Lanier LP335c                                                              | 220 - 240V, 50/60Hz | Europe, etc. | G131-24 | Q3851200431   |
| Infotec IPC 3535e                                                          | 220 - 240V, 50/60Hz | Europe, etc. | G131-26 | 2S11250001    |
| Ricoh Aficio CL7300                                                        | 220 - 240V, 50/60Hz | Europe, etc. | G131-27 | Q3851200434   |
| Ricoh Aficio CL7300                                                        | 220 - 240V, 50/60Hz | Asia         | G131-29 | Q3851200484   |

|                                                    |                                                              |                                                 |                                            |
|----------------------------------------------------|--------------------------------------------------------------|-------------------------------------------------|--------------------------------------------|
| Model: Model J-P4                                  |                                                              | Date: 6-Sep-06                                  | No.: MG131005                              |
| Modified Article: Parts Catalog Correction         |                                                              | Prepared by: H. Someya                          |                                            |
| From: 1st Tech. Support Sec. Service Support Dept. |                                                              |                                                 |                                            |
| Reason for Modification:                           | <input checked="" type="checkbox"/> Parts catalog correction | <input type="checkbox"/> Vendor change          | <input type="checkbox"/> Other             |
|                                                    | <input type="checkbox"/> To facilitate assembly              | <input type="checkbox"/> To improve reliability | <input type="checkbox"/> To meet standards |
|                                                    | <input type="checkbox"/> Part standardization                | <input type="checkbox"/> Product Safety         | (      )                                   |

| Old part number | New part number | Description        | Q'ty | Int | Page | Index | Note |
|-----------------|-----------------|--------------------|------|-----|------|-------|------|
| G1311283        | G1301283        | Inner Cover: Upper | 1-1  |     | 11   | 3     |      |

**Change:** P/N change only.

**Reason:** The wrong P/N was listed in the Parts Catalog.

|                                                    |                                                                                                                                                                                                                                                                                                                                                                                       |                         |               |
|----------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------|---------------|
| Model: J-P4                                        |                                                                                                                                                                                                                                                                                                                                                                                       | Date: 14-Mar-07         | No.: MG131006 |
| Modified Article: Parts Catalog Correction         |                                                                                                                                                                                                                                                                                                                                                                                       | Prepared by: S. Yoshiki |               |
| From: 1st Tech. Support Sec. Service Support Dept. |                                                                                                                                                                                                                                                                                                                                                                                       |                         |               |
| Reason for Modification:                           | <input checked="" type="checkbox"/> Parts catalog correction <input type="checkbox"/> Vendor change <input type="checkbox"/> Other<br><input type="checkbox"/> To facilitate assembly <input type="checkbox"/> To improve reliability <input type="checkbox"/> To meet standards<br><input type="checkbox"/> Part standardization <input type="checkbox"/> Product Safety    (      ) |                         |               |

| Old part number | New part number | Description      | Q'ty | Int | Page | Index | Note |
|-----------------|-----------------|------------------|------|-----|------|-------|------|
| 14071362        | 14076362        | EEPROM:BR24L64-W |      |     | 83   | 106   |      |

**Change:** P/N change only.

**Reason:** The wrong P/N was listed in the Parts Catalog.

|                                                    |                                                                                                                                                                                                                                                                                                                                                                                       |                        |               |
|----------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------|---------------|
| Model: Model J-P4                                  |                                                                                                                                                                                                                                                                                                                                                                                       | Date: 20-Sep-07        | No.: MG131007 |
| Modified Article: Drum Motor                       |                                                                                                                                                                                                                                                                                                                                                                                       | Prepared by: S.Yoshiki |               |
| From: 1st Tech. Support Sec. Service Support Dept. |                                                                                                                                                                                                                                                                                                                                                                                       |                        |               |
| Reason for Modification:                           | <input type="checkbox"/> Parts catalog correction <input type="checkbox"/> Vendor change <input checked="" type="checkbox"/> Other<br><input type="checkbox"/> To facilitate assembly <input type="checkbox"/> To improve reliability <input type="checkbox"/> To meet standards<br><input type="checkbox"/> Part standardization <input type="checkbox"/> Product Safety    (      ) |                        |               |

| Old part number | New part number | Description              | Q'ty  | Int | Page | Index | Note |
|-----------------|-----------------|--------------------------|-------|-----|------|-------|------|
| AX060288        | <b>AX060340</b> | BRUSHLESS MOTOR - DC 8W  | 1 - 1 | X/O | 75   | 7     |      |
| AX060289        | <b>AX060341</b> | BRUSHLESS MOTOR - DC 18W | 1 - 1 | X/O | 75   | 8     |      |

**Change:** A cover was added to the drum motor.

**Reason:** To ensure that nothing touches the rotor area of the motor during machine maintenance.

**Note:** See RTB #RG131010, which mentions important notes about installing the new parts.

### RCL (Japan) Production

| Model                                                                      | V/Hz                | Destination  | Code    | Serial Number |
|----------------------------------------------------------------------------|---------------------|--------------|---------|---------------|
| Ricoh Aficio CL7200<br>Savin CLP128<br>Gestetner C7528n<br>Lanier LP332c   | 120V, 60Hz          | USA, Canada  | G130-17 | Q3751000091   |
| Gestetner C7528n<br>Nashuatec C7528n<br>Rex Rotary C7528n                  | 220 - 240V, 50/60Hz | Europe, etc. | G130-22 | Q3751000361   |
| Lanier LP332c                                                              | 220 - 240V, 50/60Hz | Europe, etc. | G130-24 | Q37511xxxxx   |
| Infotec IPC 2832                                                           | 220 - 240V, 50/60Hz | Europe, etc. | G130-26 | 2S2115xxxx    |
| Ricoh Aficio CL7200                                                        | 220 - 240V, 50/60Hz | Europe, etc. | G130-27 | Q3751000655   |
| Ricoh Aficio CL7200                                                        | 220 - 240V, 50/60Hz | Asia         | G130-29 | Q37511xxxxx   |
| Ricoh Aficio CL7300<br>Savin CLP135<br>Gestetner C7535hdn<br>Lanier LP335c | 120V, 60Hz          | USA, Canada  | G131-17 | Q3851000031   |
| Gestetner C7535hdn<br>Nashuatec C7535hdn<br>Rex Rotary C7535hdn            | 220 - 240V, 50/60Hz | Europe, etc. | G131-22 | Q3851000171   |
| Lanier LP335c                                                              | 220 - 240V, 50/60Hz | Europe, etc. | G131-24 | Q3851100326   |
| Infotec IPC 3535e                                                          | 220 - 240V, 50/60Hz | Europe, etc. | G131-26 | 2S11150001    |
| Ricoh Aficio CL7300                                                        | 220 - 240V, 50/60Hz | Europe, etc. | G131-27 | Q3851000231   |
| Ricoh Aficio CL7300                                                        | 220 - 240V, 50/60Hz | Asia         | G131-29 | Q3851000301   |

|                                                    |                                                                                                                                                                                                                                                                                                                                                                                      |                         |               |
|----------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------|---------------|
| Model: J-P4                                        |                                                                                                                                                                                                                                                                                                                                                                                      | Date: 27-Feb-08         | No.: MG131008 |
| Modified Article: Lead & Chrome-Free Directive     |                                                                                                                                                                                                                                                                                                                                                                                      | Prepared by: N. Yoshida |               |
| From: 1st Tech. Support Sec. Service Support Dept. |                                                                                                                                                                                                                                                                                                                                                                                      |                         |               |
| Reason for Modification:                           | <input type="checkbox"/> Parts catalog correction <input type="checkbox"/> Vendor change <input type="checkbox"/> Other<br><input type="checkbox"/> To facilitate assembly <input checked="" type="checkbox"/> To improve reliability <input type="checkbox"/> To meet standards<br><input type="checkbox"/> Part standardization <input type="checkbox"/> Product Safety    (     ) |                         |               |

| Old part number | New part number | Description                    | Q'ty | Int | Page | Index | Note |
|-----------------|-----------------|--------------------------------|------|-----|------|-------|------|
| G0602457        | G1312457        | PCB: NEW ARTICLE SENSOR<br>: P | 1    | X/O |      |       |      |

**Change:** The material of this part was changed.

**Reason:** To comply with the Lead & Chrome-free Directive (parts standardization).

|                                                    |                                                                                                                                                                                                                                                                                                                                                                                       |                         |               |
|----------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------|---------------|
| Model: Model J-P4                                  |                                                                                                                                                                                                                                                                                                                                                                                       | Date: 29-Jul-08         | No.: MG131009 |
| Modified Article: Parts Catalog Correction         |                                                                                                                                                                                                                                                                                                                                                                                       | Prepared by: N. Yoshida |               |
| From: 2nd Tech. Support Sec. Service Support Dept. |                                                                                                                                                                                                                                                                                                                                                                                       |                         |               |
| Reason for Modification:                           | <input type="checkbox"/> Parts catalog correction <input type="checkbox"/> Vendor change <input checked="" type="checkbox"/> Other<br><input type="checkbox"/> To facilitate assembly <input type="checkbox"/> To improve reliability <input type="checkbox"/> To meet standards<br><input type="checkbox"/> Part standardization <input type="checkbox"/> Product Safety    (      ) |                         |               |

| Old Number | New Number | Description             | Q'ty | Int | Page | Index | Note |
|------------|------------|-------------------------|------|-----|------|-------|------|
| G1305791   | G1305794   | Controller Board – G130 | 1    | X/O | 87   | 6     |      |
| G1315791   | G1315794   | Controller Board – G131 | 1    | X/O | 87   | 6     |      |



Part Change Information List

Date: December 29, 2009

| Model | Code | PCIL Nr. | PCIL<br>Correction | Old part<br>number | New part<br>number | Description | Old Q'ty | New Q'ty | Int | 3DPC | Page | Index | Set | Set Int | RTB | Note | Ref. Nr. | ECN Nr. |
|-------|------|----------|--------------------|--------------------|--------------------|-------------|----------|----------|-----|------|------|-------|-----|---------|-----|------|----------|---------|
| J-P4  | G131 | 200912   |                    | G1311854           | G1311853           | Image Unit  | 1        | 1        |     |      | 15   | *     |     |         |     |      |          |         |
| J-P4  | G132 | 200912   |                    | G1311854           | G1311853           | Image Unit  | 1        | 1        |     |      | 15   | *     |     |         |     |      |          |         |



Part Change Information List

Date: January 29, 2010

| Model | Code | PCIL Nr. | PCIL<br>Correction | Old part<br>number | New part<br>number | Description      | Old<br>Q'ty | New<br>Q'ty | Int | 3DPC | Page | Index | Set | Set Int | RTB | Note | Ref. Nr. | ECN Nr. |
|-------|------|----------|--------------------|--------------------|--------------------|------------------|-------------|-------------|-----|------|------|-------|-----|---------|-----|------|----------|---------|
| J-P4  | G130 | 201001   |                    | G0801272           | G1306204           | COVER:UPPER:REAR | 1           | 1           | X/O |      | 11   | 8     |     |         |     |      |          |         |
| J-P4  | G131 | 201001   |                    | G0801272           | G1306204           | COVER:UPPER:REAR | 1           | 1           | X/O |      | 11   | 8     |     |         |     |      |          |         |



Part Change Information List

Date: May 31, 2010

| Model | Code | PCIL Nr. | PCIL Correction | Old part number | New part number | Description            | Old Q'ty | New Q'ty | Int | 3DPC | Page | Index | Set | Set Int | RTB | Note | Ref. Nr. | ECN Nr. |
|-------|------|----------|-----------------|-----------------|-----------------|------------------------|----------|----------|-----|------|------|-------|-----|---------|-----|------|----------|---------|
| J-P4  | G131 | 201005   |                 | G5714811        | B1804803        | LINK:DC SOLENOID:ASS'Y | 1        | 1        | O/O |      | 67   | 2     |     |         |     |      | V0903246 |         |



Part Change Information List

Date: September 30, 2011

| Model | Code | PCIL Nr. | PCIL Correction | Old part number | New part number | Description              | Old Q'ty | New Q'ty | Int | 3DPC | Page | Index | Set | Set Int | RTB | Note | Ref. Nr. | ECN Nr. |
|-------|------|----------|-----------------|-----------------|-----------------|--------------------------|----------|----------|-----|------|------|-------|-----|---------|-----|------|----------|---------|
| J-P4  | G130 | 201109   |                 | B1805321        | G1315321        | HARNESS:MAIN:MIDDLE:ASSY | 1        | 1        | X/O |      | 83   | 14    |     |         |     |      | V1101948 |         |
| J-P4  | G131 | 201109   |                 | B1805321        | G1315321        | HARNESS:MAIN:MIDDLE:ASSY | 1        | 1        | X/O |      | 83   | 14    |     |         |     |      | V1101948 |         |



Part Change Information List

Date: June 28, 2013

| Model | Code | PCIL<br>Number | PCIL<br>Correction | Old part<br>number | New part<br>number | Description              | Old<br>Q'ty | New<br>Q'ty | Int | 3DPC | Page | Index | Set | Set<br>Int | RTB | Note | Ref Number | ECN<br>Number |
|-------|------|----------------|--------------------|--------------------|--------------------|--------------------------|-------------|-------------|-----|------|------|-------|-----|------------|-----|------|------------|---------------|
| J-P4  | G131 | 201306         |                    | G3820250           | G3820251           | REVERSE UNIT:DUPLEX:ASSY | 1           | 1           | O/O |      | 65   | 1     |     |            |     |      | V1202499   | 11110797      |



Part Change Information List

Date: June 4, 2015

| Model | Code | PCIL<br>Number | PCIL<br>Correction | Old part<br>number | New part<br>number | Description                        | Old Q'ty | New Q'ty | Int | 3DPC | Page | Index | Set | Set Int | RTB | Note | Ref Number | ECN<br>Number |
|-------|------|----------------|--------------------|--------------------|--------------------|------------------------------------|----------|----------|-----|------|------|-------|-----|---------|-----|------|------------|---------------|
| J-P4  | G131 | 201505         |                    | G5715542           | B1805402           | HARNESS:REVERSE UNIT:SAFETY SWITCH | 1        | 1        | O/O | N    | 71   | 4     |     |         |     |      | V1501197   |               |



## Part Change Information List

Date: September 1, 2017

| Model | Code | PCIL Number | PCIL Correction | Old part number | New part number | Description                     | Old Q'ty | New Q'ty | Int | 3DPC | Page | Index | Set | Set Int | RTB | Note | Ref Number | ECN Number |
|-------|------|-------------|-----------------|-----------------|-----------------|---------------------------------|----------|----------|-----|------|------|-------|-----|---------|-----|------|------------|------------|
| J-P4  | G131 | 201708      |                 | 11500373        | 11500438        | POWER SUPPLY CODE:AC125V:15A:NA | 1        | 1        | O/O | N    | 11   | 105   |     |         |     |      | V1701407   |            |