


Model: S-C3		Date: 5-Mar-07	No.: MB262001
Modified Article: SD card cover		Prepared by: Y. Yoshida	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☒ To improve reliability ☐ To meet standards (RoHs compliant) ☐ Part standardization ☐ Product Safety		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B2621253	B2621255	IC card cover	1	X/O	7	5	

Change: The shape of the part was changed.

Reason: To further ensure that the SD card stays locked in place.

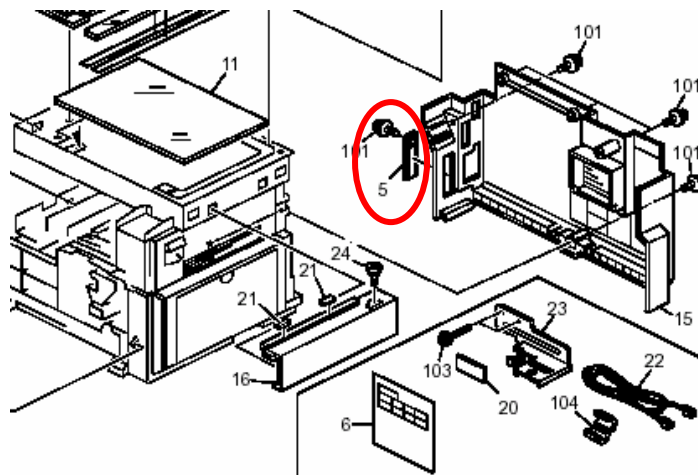


Model: S-C3		Date: 21-Jun-07	No.: MB262002
Modified Article: Operation panel		Prepared by: Y. Yoshida	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction	☐ Vendor change	☐ Other
	☐ To facilitate assembly	☐ To improve reliability	☐ To meet standards (RoHs compliant)
	☐ Part standardization	☐ Product Safety	

This MB applies to the following models:

Basic model: ☒ B262 ☒ B292 GDI model: ☒ B280 ☒ B293
 GW model: ☒ B284 ☒ B288

Change/Reason: The index numbers of the following parts were corrected.

Part number	Description	Q'ty	Int	Page	Old index	New Index	Note
B2621452	Lower Cover	1		8	NA	11	
B2621495	LCD	1		8	11	13	

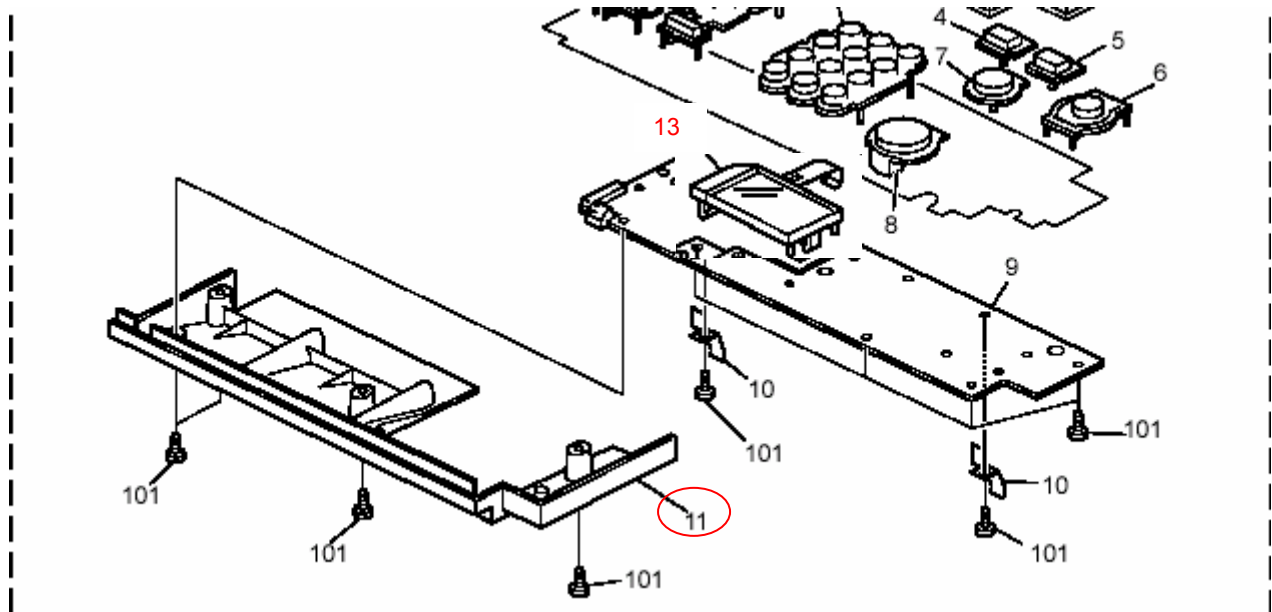

Model: ARDF for S-C3		Date:27-Jun-07	No.: MB872002
Modified Article: Spring Plate : Reverse : Pressure		Prepared by: M. Ishihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction	☐ Vendor change	☐ Other
	☐ To facilitate assembly	☒ To improve reliability	☐ To meet standards
	☐ Part standardization	☐ Product Safety	()


Old Part Number	New Part Number	Description	Q'ty	Int	Page	Index	Note
B8722212	B8722251	Spring Plate:Reverse:Pressure	1-1	X/O	7	15	ARDF P/C
					23	15	MainUnit P/C

Change: The thickness of the spring plate was reduced from 0.2 mm to 0.15 mm (which reduces the spring pressure).

Reason: To further ensure that multi-feeds do not occur.

Note:

- Difference between the old and new parts: The new part has two small holes.
- This MB will be reissued later to announce the cut-in serial numbers for this change.

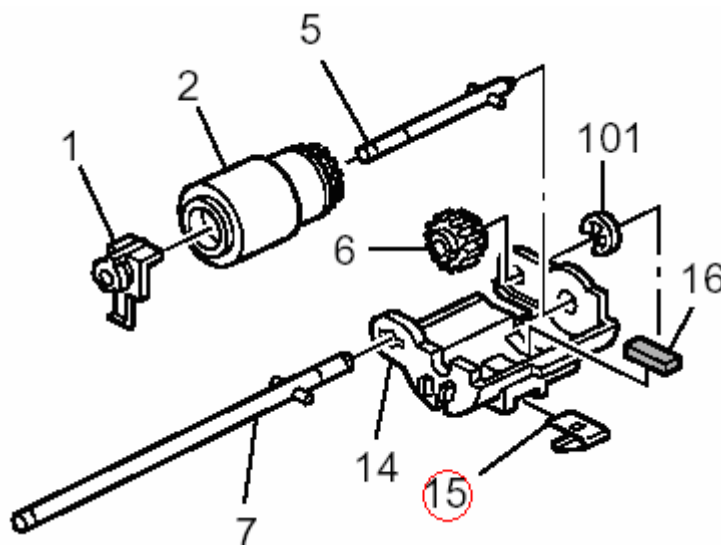

Model: S-C3		Date: 24-Jul-07	No.: MB262003
Modified Article: Cover :Rear		Prepared by: M. Ishihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ Vendor change ☐ Other		
	☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards		
	☐ Part standardization ☐ Product Safety ()		

Part Number	Old Description	New Description	Q'ty	Int	Page	Index	Note
B2621250	Cover: Rear: EU	Cover : Rear	1		7	15	

Change: The description (name) of this part was changed.

Reason: This part can be used for all destinations (EU, NA and Asia).


Model: S-C3		Date: 31-Jul-07	No.: MB262004
Modified Article: PCB:Sdram-dimm:256mb:chn:Ass'y		Prepared by: M. Ishihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction	☐ Vendor change	☐ Other
	☐ To facilitate assembly	☐ To improve reliability	☐ To meet standards
	☐ Part standardization	☐ Product Safety	()

This MB applies to the following models:

Basic model: ☐ B262 ☐ B292 GDI model: ☐ B280 ☐ B293
 GW model: ☒ B284 ☒ B288

Change/Reason: The index numbers of the following parts were corrected.

Part number	Description	Q'ty	Int	Page	Old index	New Index	Note
G3325730	PCB:Sdramdimm:256mb:Chn:Ass'y	1		46	4	14	
B6225832	Rail:Left	1		46	14	18	

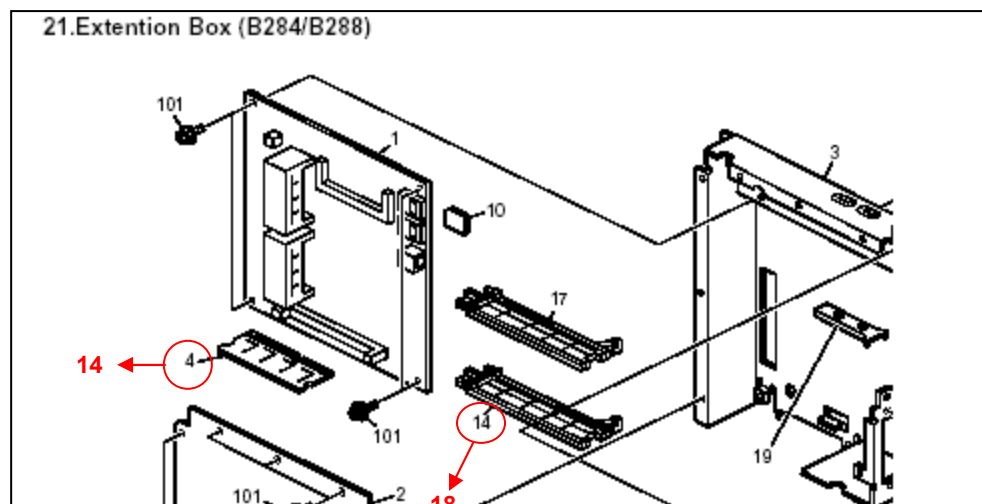

Model: S-C3		Date: 03-Dec-07	No.: MB262005
Modified Article: Holder: Hinge		Prepared by: M. Ishihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		


This MB applies to the following models:

Basic model: ☒ B262 ☒ B292 GDI model: ☒ B280 ☒ B293
GW model: ☒ B284 ☒ B288


Change/Reason: The following parts were missing in the parts catalog.

Part number	Description	Q'ty	Int	Page	Old index	New Index	Note
B2621667	Holder: Hinge: Left	1		27		17	New
B2621668	Holder: Hinge: Right	1		27		18	New

B2621667 (Holder: Hinge: Left) New Index No.17

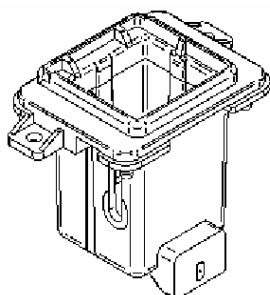

B2621668 (Holder: Hinge: Right) New Index No.18

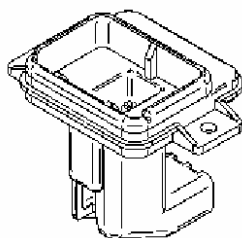

Model: S-C3		Date: 31-Jan-08	No.: MB262006
Modified Article: Operation Panel		Prepared by: M. Ishihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☒ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

This MB applies to the following models:

Basic model: ☒ B262 ☒ B292 GDI model: ☒ B280 ☒ B293
GW model: ☒ B284 ☒ B288

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B2621550	B2621551	PCB:OPU	1-1	O/O	9*,9**	9*,9**	
B2621411	B2621431	Operation Panel: NA (B288)	1-1	O/O	7**,9**	3*,(*)	***
B2621412	B2621432	Operation Panel: NA (B262/B292)	1-1	O/O	7*,9*	3*,(*)*	
B2621413	B2621433	Operation Panel: EU (B262/B292)	1-1	O/O	7*,9*	3*,(*)*	
B2621414	B2621434	Operation Panel: Asia (B280/B288)	1-1	O/O	7*,9*, 7**,9**	3*,(*)*, 3**, (*)**	
B2621415	B2621435	Operation Panel: EU (B280/B293/B288)	1-1	O/O	7*,9*, 7**,9**	3*,(*)*, 3**, (*)**	
B2621416	B2621436	Operation Panel: NA (B284)	1-1	O/O	7**,9**	3**, (*)**	
B2621417	B2621437	Operation Panel: EU (B284)	1-1	O/O	7**,9**	3**, (*)**	
B2621418	B2621438	Operation Panel: Asia (B284)	1-1	O/O	7**,9**	3**, (*)**	

* Parts Catalog for the S-C3 (B262/B280/B292/B293)

** Parts Catalog for the S-C3 (B284/B288)

(*)=Index Number is *.

*** B2621411 was missing in the Page 9**, Index Number *.

Change: The treatment of the IC (GOPPC2) terminal of the PCB: OPU has been changed.
 The PCB: OPU is a component part of the Operation Panel. The part numbers the operation panels have been changed because the PCB: OPU part number has been changed.

Reason: To increase reliability.


Model: S-C3		Date: 12-Feb-08	No.: MB262007
Modified Article: Cover: Fax: Dummy		Prepared by: M. Ishihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

This MB applies to the following models:

Basic model: ☒ B262 ☒ B292	GDI model: ☒ B280 ☒ B293
GW model: ☐ B284 ☐ B288	

Part Number	Description	Q'ty	Int	Page	Incorrect Index	Correct Index	Note
B2621473	Cover: Fax: Dummy	1		9	1	12	

Change/Reason: The index for this part was corrected as shown.

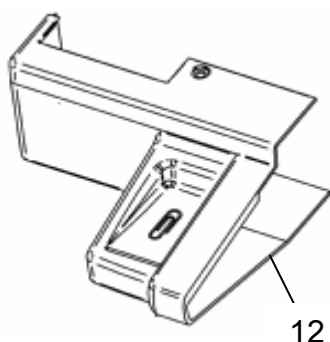

Model: S-C3		Date: 04-Mar-08	No.: MB262008
Modified Article: PCB: Controller		Prepared by: M. Ishihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☒ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

This MB applies to the following models:

Basic model: ☐ B262 ☐ B292	GDI model: ☐ B280 ☐ B293
GW model: ☒ B284 ☒ B288	

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B2845150	B2845151	PCB: Controller	1-1	X/O	47	1	

Change: The firmware of the controller board has been changed. See RTB No. RB262009c.

Reason: To increase reliability.

Model: S-C3		Date: 08-May-08	No.: MB262009
Modified Article: PM Parts Index		Prepared by: M. Ishihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

This MB applies to the following models:

Basic model: ☒ B262 ☒ B292 GDI model: ☒ B280 ☒ B293
GW model: ☒ B284 ☒ B288

Change/Reason: The following tables were missing from the Parts Catalog.

PM Parts Index

<Model S-C3 (B262/B280/B292/B293) PARTS CATALOG>

Section Name	Part No.	Description Service Manual	Description in Parts Catalog	Q'ty Per Asse mbly	Page and Index No.
TRANSPORT SECTION (B262/B292/B280/B293)	B2623802	Transfer Roller	Transfer Roller	1	15-8
PAPER CASSETTE (B262/B292/B280/B293)	B0443857	Separation Plate	Separation Plate	1	15-19
ARDF 2 (B292)	AF031061	Paper Feed Roller	Paper Feed Roller	1	17-12
	B0442710	Friction Pad	Friction Pad	1	17-13
	AF031062	Feed Roller	Feed Roller	1	21-18
	AF030363	Pickup Roller	Pickup Roller	1	21-26
ARDF 3 (B292)	AF032030	Reverse Roller	Reverse Roller	1	23-2
FUSING UNIT (B262/B292/B280/B293)	AE044059	Stripper Pawls	Stripper Pawls	3	37-21
	AE020149	Pressure Roller	Pressure Roller	1	37-26
	AE031044	Fusing Bushing	Fusing Bushing	2	37-39
	AE011086	Hot Roller	Hot Roller	1	37-40

PM Parts Index

<Model S-C3GW (B284/B288) PARTS CATALOG>

Section Name	Part No.	Description Service Manual	Description in Parts Catalog	Q'ty Per Asse mbly	Page and Index No.
TRANSPORT SECTION (B284/B288)	B2623802	Transfer Roller	Transfer Roller	1	15-8
PAPER CASSETTE (B284/B288)	B0443857	Separation Plate	Separation Plate	1	15-19
ARDF 2 (B284/B 288)	AF031061	Paper Feed Roller	Paper Feed Roller	1	17-12
	B0442710	Friction Pad	Friction Pad	1	17-13
	AF031062	Feed Roller	Feed Roller	1	21-18
	AF030363	Pickup Roller	Pickup Roller	1	21-26
ARDF 3 (B284/B288)	AF032030	Reverse Roller	Reverse Roller	1	23-2
FUSING UNIT (B284/B288)	AE044059	Stripper Pawls	Stripper Pawls	3	37-21
	AE020149	Pressure Roller	Pressure Roller	1	37-26
	AE031044	Fusing Bushing	Fusing Bushing	2	37-39
	AE011086	Hot Roller	Hot Roller	1	37-40

Model: S-C3		Date: 13-May-08	No.: MB262010
Modified Article: Shaft: Pressure Plate		Prepared by: M. Ishihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		


This MB applies to the following models:

Basic model:	☒ B262	☐ B292	GDI model:	☒ B280	☒ B293
GW model:	☐ B284	☐ B288			


Change/Reason: The following parts were missing from the parts catalog.

Part number	Description	Q'ty	Int	Page	Old index	New Index	Note
B2621393	Shaft: Pressure Plate: Left	1		7		22	New
B2621394	Shaft: Pressure Plate: Right	1		7		23	New

B2621393 (Shaft: Pressure Plate: Left) New Index No.22

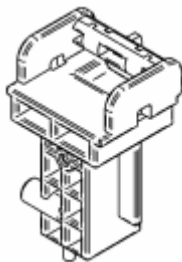


B2621394 (Shaft: Pressure Plate: Right) New Index No.23

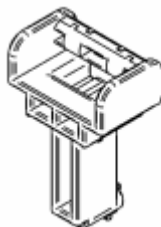

Model: Stella-C3 ARDF (DF1000)		Date: 02-Jul-08	No.: MB872006
Modified Article: Guide Mylar		Prepared by: M. Ishihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction ☐ Vendor change ☐ Other ☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards ☐ Part standardization ☐ Product Safety ()		

Change/Reason: The following part was missing from the parts catalog.

Part number	Description	Q'ty	Int	Page	Old index	New Index	Note
B8724712	Guide Mylar	1		3		30	New(B872 P/C)
B8724712	Guide Mylar			19		30	New(B292 P/C)
B8724712	Guide Mylar			19		23	New(B284/B288 P/C)

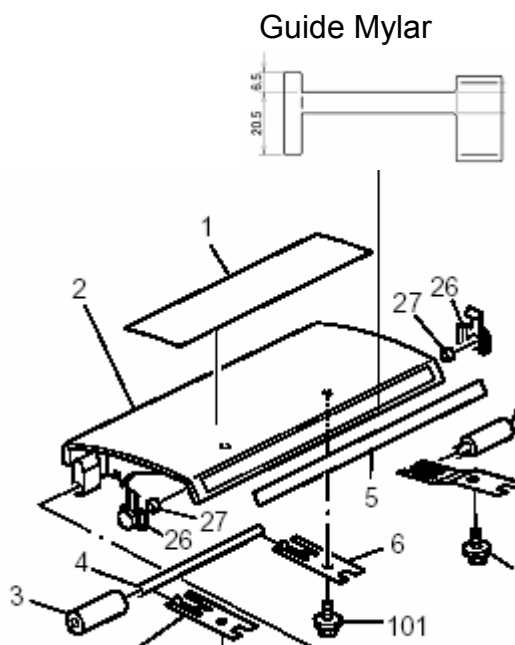

Model: S-C3		Date: 24-Oct-08	No.: MB262011
Modified Article: Harness		Prepared by: M. Ishihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☐ Parts catalog correction ☐ Vendor change ☒ Other		
	☐ To facilitate assembly ☐ To improve reliability ☐ To meet standards		
	☐ Part standardization ☐ Product Safety ()		

This MB applies to the following models:

Basic model: ☒ B262 ☒ B292 GDI model: ☒ B280 ☒ B293
GW model: ☒ B284 ☒ B288

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B2625235	D0675235	Ground Wire: Cassette	2-2	O/O	43	3	
B2625207	D0675207	Harness: DC Polygon Mirror Motor	1-1	O/O	33	4	
B2625204	D0675204	Harness: LDDR: Interface	1-1	O/O	33	2	
B2625218	D0675218	Harness: Manual Feed:Paper End Sensor	1-1	O/O	13	21	
B1295203	D0675203	Harness:PaperFeedSensor:Connecting	1-1	O/O	37	12	
H5565106	D0675251	Harness: Sensor Gate	1	O/O	37	58	
B2625200	D0675200	Harness: Toner: Connecting	1	O/O	41	7	
B2625201	D0675201	Harness: HPS	1	O/O	41	4	
B2625202	D0675202	Harness: Paper Feed Sensor	1	O/O	41	5	
B2625206	D0675206	Harness: Power Supply Unit	1	O/O	41	8	
B2625210	D0675210	Harness: Door Switch	1	O/O	41	11	
B1295211	D0675211	Harness: Switch: Front Right	1	O/O	13	12	
B1295213	D0675213	Harness: Registration Sensor	1	O/O	41	6	
B2625216	D0675216	Harness: Motor: Main	1	O/O	41	9	
B2625217	D0675217	Harness: HVP	1	O/O	41	26	
B1295223	D0675223	Harness: Feed Table: Connecting	1	O/O	41	27	

Change: Harness

Reason: To unify with Stella-C4.


Model: S-C3		Date: 28-Oct-08	No.: MB262012
Modified Article: Pressure Plate Pad		Prepared by: M. Ishihara	
From: 1st Tech. Support Sec. Service Support Dept.			
Reason for Modification:	☒ Parts catalog correction	☐ Vendor change	☐ Other
	☐ To facilitate assembly	☐ To improve reliability	☐ To meet standards
	☐ Part standardization	☐ Product Safety	()

This MB applies to the following models:

Basic model: ☒ B262 ☒ B292 GDI model: ☒ B280 ☒ B293
 GW model: ☐ B284 ☐ B288

Incorrect part number	Correct part number	Description	Q'ty	Int	Page	Index	Note
B8592352	A8592352	Pressure Plate Pad	1-1	-	19	28	

7.ARDF 1 (B292)

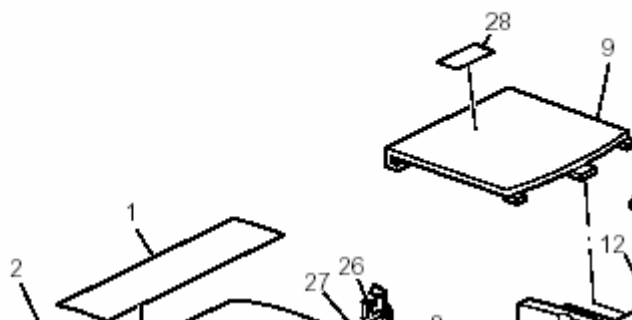



Part Change Information List

Date: April 30, 2009

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number
Stella-C3	B293	200904			B2621313	COVER:FAX CONTROL UNIT:C3	0	1			47	20			Y		V0804422
Stella-C3	B880	200904			B2621313	COVER:FAX CONTROL UNIT:C3	0	1			47	20			Y		V0804422
Stella-C3	B892	200904			B2621313	COVER:FAX CONTROL UNIT:C3	0	1			47	20			Y		V0804422
Stella-C3	B262	200904			B2621313	COVER:FAX CONTROL UNIT:C3	0	1			47	20			Y		V0804742
Stella-C3	B284	200904			B2621313	COVER:FAX CONTROL UNIT:C3	0	1			47	20			Y		V0804742
Stella-C3	B288	200904			B2621313	COVER:FAX CONTROL UNIT:C3	0	1			47	20			Y		V0804742
Stella-C3	B292	200904			B2621313	COVER:FAX CONTROL UNIT:C3	0	1			47	20			Y		V0804742
Stella-C3	B262	200904		B0441068	D0671068	SHEET:BLOCK LIGHT:DISCHARGE LAMP	1	1	O/O		35	6					V0804747
Stella-C3	B280	200904		B0441068	D0671068	SHEET:BLOCK LIGHT:DISCHARGE LAMP	1	1	O/O		35	6					V0804747
Stella-C3	B284	200904		B0441068	D0671068	SHEET:BLOCK LIGHT:DISCHARGE LAMP	1	1	O/O		35	6					V0804747
Stella-C3	B288	200904		B0441068	D0671068	SHEET:BLOCK LIGHT:DISCHARGE LAMP	1	1	O/O		35	6					V0804747
Stella-C3	B292	200904		B0441068	D0671068	SHEET:BLOCK LIGHT:DISCHARGE LAMP	1	1	O/O		35	6					V0804747
Stella-C3	B293	200904		B0441068	D0671068	SHEET:BLOCK LIGHT:DISCHARGE LAMP	1	1	O/O		35	6					V0804747
Stella-C3	B262	200904		B0444165	D0674165	DISCHARGE BRUSH:EXIT	1	1	O/O		37	1					V0804747
Stella-C3	B280	200904		B0444165	D0674165	DISCHARGE BRUSH:EXIT	1	1	O/O		37	1					V0804747
Stella-C3	B284	200904		B0444165	D0674165	DISCHARGE BRUSH:EXIT	1	1	O/O		37	1					V0804747
Stella-C3	B288	200904		B0444165	D0674165	DISCHARGE BRUSH:EXIT	1	1	O/O		37	1					V0804747
Stella-C3	B292	200904		B0444165	D0674165	DISCHARGE BRUSH:EXIT	1	1	O/O		37	1					V0804747
Stella-C3	B293	200904		B0444165	D0674165	DISCHARGE BRUSH:EXIT	1	1	O/O		37	1					V0804747
Stella-C3	B262	200904		B0442710	D0672710	FRICTION PAD:ADHESION	1	1	O/O		17	13					V0900680
Stella-C3	B280	200904		B0442710	D0672710	FRICTION PAD:ADHESION	1	1	O/O		17	13					V0900680
Stella-C3	B284	200904		B0442710	D0672710	FRICTION PAD:ADHESION	1	1	O/O		17	13					V0900680
Stella-C3	B288	200904		B0442710	D0672710	FRICTION PAD:ADHESION	1	1	O/O		17	13					V0900680
Stella-C3	B292	200904		B0442710	D0672710	FRICTION PAD:ADHESION	1	1	O/O		17	13					V0900680
Stella-C3	B293	200904		B0442710	D0672710	FRICTION PAD:ADHESION	1	1	O/O		17	13					V0900680
Stella-C3	B284	200904		14076100	14077244	CMOS LOGIC:74LVC1G04GW	1	1	X/O		58	126					V0900706
Stella-C3	B288	200904		14076100	14077244	CMOS LOGIC:74LVC1G04GW	1	1	X/O		58	126					V0900706
Stella-C3	B892	200904		14076100	14077244	CMOS LOGIC:74LVC1G04GW	1	1	X/O		58	126					V0900706
Stella-C3	B284	200904		14076101	14077239	CMOS LOGIC:74LVC2G17GW	2	2	X/O		58	127					V0900706
Stella-C3	B288	200904		14076101	14077239	CMOS LOGIC:74LVC2G17GW	2	2	X/O		58	127					V0900706
Stella-C3	B892	200904		14076101	14077239	CMOS LOGIC:74LVC2G17GW	2	2	X/O		58	127					V0900706
Stella-C3	B284	200904		14076123	14077237	CMOS LOGIC:74LVC2G125DC	1	1	X/O		58	128					V0900706
Stella-C3	B288	200904		14076123	14077237	CMOS LOGIC:74LVC2G125DC	1	1	X/O		58	128					V0900706
Stella-C3	B892	200904		14076123	14077237	CMOS LOGIC:74LVC2G125DC	1	1	X/O		58	128					V0900706



Part Change Information List

Date: May 30, 2009

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number
S-C3	B280	200905			B2621313	COVER:FAX CONTROL UNIT:C3	0	1			47	20			RB262026		V0804422



Part Change Information List

Date: June 30, 2009

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
S-C3	B262	200906		B2622510	D0672510	PAPER TRAY UNIT:EU	1	1	O/O		17	*					V0901249	
S-C3	B280	200906		B2622510	D0672510	PAPER TRAY UNIT:EU	1	1	O/O		17	*					V0901249	
S-C3	B284	200906		B2622510	D0672510	PAPER TRAY UNIT:EU	1	1	O/O		17	*					V0901249	
S-C3	B288	200906		B2622510	D0672510	PAPER TRAY UNIT:EU	1	1	O/O		17	*					V0901249	
S-C3	B293	200906		B2622510	D0672510	PAPER TRAY UNIT:EU	1	1	O/O		17	*					V0901249	



Part Change Information List

Date: July 31, 2009

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
S-C3	B284	200907		B2845234	D0685234	HARNESS:SPEAKER:CONNECTING	1	1	O/O		47	13					V0803491	8050400
S-C3	B288	200907		B2845234	D0685234	HARNESS:SPEAKER:CONNECTING	1	1	O/O		47	13					V0803491	8050400



Part Change Information List

Date: October 30, 2009

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
S-C3	B262	200910		B2621250	D0671250	COVER:REAR	1	1	O/O		7	15					V0804742	8110766
S-C3	B262	200910			B0443428	SHUTTER:DISCHARGE USED TONER	0	1			35	34			RB262027		V0901841	
S-C3	B262	200910			B0443432	SPRING:SHUTTER:DISCHARGE USED TONER	0	1			35	35			RB262027		V0901841	
S-C3	B262	200910			B0443466	COVER:DISCHARGE USED TONER:SUB-ASS'Y	0	1			35	36			RB262027		V0901841	
S-C3	B280	200910		B2621250	D0671250	COVER:REAR	1	1	O/O		7	15					V0804742	8110766
S-C3	B280	200910			B0443428	SHUTTER:DISCHARGE USED TONER	0	1			35	34			RB262027		V0901841	
S-C3	B280	200910			B0443432	SPRING:SHUTTER:DISCHARGE USED TONER	0	1			35	35			RB262027		V0901841	
S-C3	B280	200910			B0443466	COVER:DISCHARGE USED TONER:SUB-ASS'Y	0	1			35	36			RB262027		V0901841	
S-C3	B284	200910		B2621250	D0671250	COVER:REAR	1	1	O/O		7	15					V0804742	8110766
S-C3	B284	200910			B0443428	SHUTTER:DISCHARGE USED TONER	0	1			35	34			RB262027		V0901841	
S-C3	B284	200910			B0443432	SPRING:SHUTTER:DISCHARGE USED TONER	0	1			35	35			RB262027		V0901841	
S-C3	B284	200910			B0443466	COVER:DISCHARGE USED TONER:SUB-ASS'Y	0	1			35	36			RB262027		V0901841	
S-C3	B288	200910		B2621250	D0671250	COVER:REAR	1	1	O/O		7	15					V0804742	8110766
S-C3	B288	200910			B0443428	SHUTTER:DISCHARGE USED TONER	0	1			35	34			RB262027		V0901841	
S-C3	B288	200910			B0443432	SPRING:SHUTTER:DISCHARGE USED TONER	0	1			35	35			RB262027		V0901841	
S-C3	B288	200910			B0443466	COVER:DISCHARGE USED TONER:SUB-ASS'Y	0	1			35	36			RB262027		V0901841	
S-C3	B292	200910		B2621250	D0671250	COVER:REAR	1	1	O/O		7	15					V0804742	8110766
S-C3	B292	200910			B0443428	SHUTTER:DISCHARGE USED TONER	0	1			35	34			RB262027		V0901841	
S-C3	B292	200910			B0443432	SPRING:SHUTTER:DISCHARGE USED TONER	0	1			35	35			RB262027		V0901841	
S-C3	B292	200910			B0443466	COVER:DISCHARGE USED TONER:SUB-ASS'Y	0	1			35	36			RB262027		V0901841	
S-C3	B293	200910		B2621250	D0671250	COVER:REAR	1	1	O/O		7	15					V0804742	8110766
S-C3	B293	200910			B0443428	SHUTTER:DISCHARGE USED TONER	0	1			35	34			RB262027		V0901841	
S-C3	B293	200910			B0443432	SPRING:SHUTTER:DISCHARGE USED TONER	0	1			35	35			RB262027		V0901841	
S-C3	B293	200910			B0443466	COVER:DISCHARGE USED TONER:SUB-ASS'Y	0	1			35	36			RB262027		V0901841	



Part Change Information List

Date: February 26, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
S-C3	B262	201002		B2622511	D0672511	PAPER TRAY UNIT:NA	1	1	O/O		17	*					V0902210	
S-C3	B284	201002		B2622511	D0672511	PAPER TRAY UNIT:NA	1	1	O/O		17	*					V0902210	
S-C3	B288	201002		B2622511	D0672511	PAPER TRAY UNIT:NA	1	1	O/O		17	*					V0902210	
S-C3	B292	201002		B2622511	D0672511	PAPER TRAY UNIT:NA	1	1	O/O		17	*					V0902210	
S-C3	B262	201002		B2625207	D0675207	HARNESS:DC POLYGON MIRROR MOTOR	1	1	O/O		33	4					V0803491	8050400
S-C3	B280	201002		B2625207	D0675207	HARNESS:DC POLYGON MIRROR MOTOR	1	1	O/O		33	4					V0803491	8050400
S-C3	B284	201002		B2625207	D0675207	HARNESS:DC POLYGON MIRROR MOTOR	1	1	O/O		33	4					V0803491	8050400
S-C3	B288	201002		B2625207	D0675207	HARNESS:DC POLYGON MIRROR MOTOR	1	1	O/O		33	4					V0803491	8050400
S-C3	B292	201002		B2625207	D0675207	HARNESS:DC POLYGON MIRROR MOTOR	1	1	O/O		33	4					V0803491	8050400
S-C3	B293	201002		B2625207	D0675207	HARNESS:DC POLYGON MIRROR MOTOR	1	1	O/O		33	4					V0803491	8050400



Part Change Information List

Date: March 31, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
S-C3	B284	201008		B2845151	B2845152	PCB:CTL:STL-C3	1	1	O/O		47 58	1 *					V1000536	10021209
S-C3	B288	201008		B2845151	B2845152	PCB:CTL:STL-C3	1	1	O/O		47 58	1 *					V1000536	10021209
S-C3	B892	201008		B2845151	B2845152	PCB:CTL:STL-C3	1	1	O/O		47 58	1 *					V1000536	10021209

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
S-C3	B284	201010		H5211350	H3101360	PAD:PICKUP	1	1	O/O		21	2					V1002155	10070068
S-C3	B288	201010		H5211350	H3101360	PAD:PICKUP	1	1	O/O		21	2					V1002155	10070068
S-C3	B292	201010		H5211350	H3101360	PAD:PICKUP	1	1	O/O		21	2					V1002155	10070068
S-C3	B280	201010			16071460	FERRITE CORE:RFC-9	0	1			41	108			RB262029		V1002174	10080552
S-C3	B293	201010			16071460	FERRITE CORE:RFC-9	0	1			41	108			RB262029		V1002174	10080552



Part Change Information List

Date: December 29, 2010

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
S-C3	B262	201012		AZ500073	AZ500077	STABILIZER:XENON LAMP:CHN	1	1	O/O		29	3					V1001925	10070525
S-C3	B280	201012		AZ500073	AZ500077	STABILIZER:XENON LAMP:CHN	1	1	O/O		29	3					V1001925	10070525
S-C3	B284	201012		AZ500073	AZ500077	STABILIZER:XENON LAMP:CHN	1	1	O/O		29	3					V1001925	10070525
S-C3	B288	201012		AZ500073	AZ500077	STABILIZER:XENON LAMP:CHN	1	1	O/O		29	3					V1001925	10070525
S-C3	B292	201012		AZ500073	AZ500077	STABILIZER:XENON LAMP:CHN	1	1	O/O		29	3					V1001925	10070525
S-C3	B293	201012		AZ500073	AZ500077	STABILIZER:XENON LAMP:CHN	1	1	O/O		29	3					V1001925	10070525



Part Change Information List

Date: January 31, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
S-C3	B262	201101		AZ230162	AZ230249	POWER SUPPLY UNIT:200V	1	1	X/O		41	20			RB262030		V1002174	10080552
S-C3	B280	201101		AZ230162	AZ230249	POWER SUPPLY UNIT:200V	1	1	X/O		41	20			RB262030		V1002174	10080552
S-C3	B284	201101		AZ230162	AZ230249	POWER SUPPLY UNIT:200V	1	1	X/O		41	20			RB262030		V1002174	10080552
S-C3	B288	201101		AZ230162	AZ230249	POWER SUPPLY UNIT:200V	1	1	X/O		41	20			RB262030		V1002174	10080552
S-C3	B293	201101		AZ230162	AZ230249	POWER SUPPLY UNIT:200V	1	1	X/O		41	20			RB262030		V1002174	10080552



Part Change Information List

Date: February 28, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
S-C3	B262	201102		B0441734	D1081630	CARRIAGE:NO.2:PEEN	1	1	O/O		29	14					V1100228	11010041
S-C3	B280	201102		B0441734	D1081630	CARRIAGE:NO.2:PEEN	1	1	O/O		29	14					V1100228	11010041
S-C3	B284	201102		B0441734	D1081630	CARRIAGE:NO.2:PEEN	1	1	O/O		29	14					V1100228	11010041
S-C3	B288	201102		B0441734	D1081630	CARRIAGE:NO.2:PEEN	1	1	O/O		29	14					V1100228	11010041
S-C3	B292	201102		B0441734	D1081630	CARRIAGE:NO.2:PEEN	1	1	O/O		29	14					V1100228	11010041
S-C3	B293	201102		B0441734	D1081630	CARRIAGE:NO.2:PEEN	1	1	O/O		29	14					V1100228	11010041
S-C3	B262	201102		B1291163	D1081635	PLATE:DRIVE:REAR:1:ASS'Y	1	1	O/O		39	30					V1100228	11010041
S-C3	B280	201102		B1291163	D1081635	PLATE:DRIVE:REAR:1:ASS'Y	1	1	O/O		39	30					V1100228	11010041
S-C3	B284	201102		B1291163	D1081635	PLATE:DRIVE:REAR:1:ASS'Y	1	1	O/O		39	30					V1100228	11010041
S-C3	B288	201102		B1291163	D1081635	PLATE:DRIVE:REAR:1:ASS'Y	1	1	O/O		39	30					V1100228	11010041
S-C3	B292	201102		B1291163	D1081635	PLATE:DRIVE:REAR:1:ASS'Y	1	1	O/O		39	30					V1100228	11010041
S-C3	B293	201102		B1291163	D1081635	PLATE:DRIVE:REAR:1:ASS'Y	1	1	O/O		39	30					V1100228	11010041
S-C3	B280	201102		AZ230162	AZ230249	POWER SUPPLY UNIT:200V	1	1	X/O		41	20			RB262030		V1002839	10080552



Part Change Information List

Date: May 31, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
S-C3	B284	201105		B2621654	D1081637	RAIL:REAR	1	1	O/O		31	5					V1100228	11010041
S-C3	B284	201105		B2621653	D1081636	RAIL:FRONT	1	1	O/O		31	6					V1100228	11010041
S-C3	B288	201105		B2621654	D1081637	RAIL:REAR	1	1	O/O		31	5					V1100228	11010041
S-C3	B288	201105		B2621653	D1081636	RAIL:FRONT	1	1	O/O		31	6					V1100228	11010041



Part Change Information List

Date: July 28, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
S-C3	B284	201107			D3235004	SD-CARD:PS3:STL-C3:EXP:ASS'Y	0	1			None	None			RB262031		V1101309	
S-C3	B288	201107			D3235004	SD-CARD:PS3:STL-C3:EXP:ASS'Y	0	1			None	None			RB262031		V1101309	



Part Change Information List

Date: September 30, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
S-C3	B262	201109		B2621255	D0671255	COVER:IC CARD:C3	1	1	O/O		7	5			RB262026		V0804742	08110766
S-C3	B280	201109		B2621255	D0671255	COVER:IC CARD:C3	1	1	O/O		7	5			RB262026		V0804742	08110766
S-C3	B284	201109		B2621255	D0671255	COVER:IC CARD:C3	1	1	O/O		7	5			RB262026		V0804742	08110766
S-C3	B288	201109		B2621255	D0671255	COVER:IC CARD:C3	1	1	O/O		7	5			RB262026		V0804742	08110766
S-C3	B292	201109		B2621255	D0671255	COVER:IC CARD:C3	1	1	O/O		7	5			RB262026		V0804742	08110766
S-C3	B293	201109		B2621255	D0671255	COVER:IC CARD:C3	1	1	O/O		7	5			RB262026		V0804742	08110766



Part Change Information List

Date: October 31, 2011

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
S-C3	B284	201110		16051397	16051762	CERAMIC CHIP CAPACITOR:560PF;+5%:630V	2	2	O/O		75	166					V1101296	08010189
S-C3	B288	201110		16051397	16051762	CERAMIC CHIP CAPACITOR:560PF;+5%:630V	2	2	O/O		75	166					V1101296	08010189



Part Change Information List

Date: January 31, 2012

Model	Code	PCIL Nr.	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref. Nr.	ECN Nr.
S-C3	B284	201201		11027604	11035377	CONNECTOR:MJ-62J-RD315	2	2	O/O		75	103					V1102576	11091329
S-C3	B288	201201		11027604	11035377	CONNECTOR:MJ-62J-RD315	2	2	O/O		75	103					V1102576	11091329



Part Change Information List

Date: November 29, 2013

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set Int	RTB	Note	Ref Number	ECN Number
S-C3	B262	201311		B2623802	D1273802	TRANSFER ROLLER:ASS'Y	1	1	O/O		15	8				V1302126	
S-C3	B280	201311		B2623802	D1273802	TRANSFER ROLLER:ASS'Y	1	1	O/O		15	8				V1302126	
S-C3	B284	201311		B2623802	D1273802	TRANSFER ROLLER:ASS'Y	1	1	O/O		15	8				V1302126	
S-C3	B288	201311		B2623802	D1273802	TRANSFER ROLLER:ASS'Y	1	1	O/O		15	8				V1302126	
S-C3	B292	201311		B2623802	D1273802	TRANSFER ROLLER:ASS'Y	1	1	O/O		15	8				V1302126	
S-C3	B293	201311		B2623802	D1273802	TRANSFER ROLLER:ASS'Y	1	1	O/O		15	8				V1302126	



Part Change Information List

Date: August 29, 2014

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
S-C3	B262	201408		AX500096	AX500106	XENON LAMP:MM8	1	1	O/O		29	4					V1400578	14020831
S-C3	B280	201408		AX500096	AX500106	XENON LAMP:MM8	1	1	O/O		29	4					V1400578	14020831
S-C3	B284	201408		AX500096	AX500106	XENON LAMP:MM8	1	1	O/O		29	4					V1400578	14020831
S-C3	B288	201408		AX500096	AX500106	XENON LAMP:MM8	1	1	O/O		29	4					V1400578	14020831
S-C3	B292	201408		AX500096	AX500106	XENON LAMP:MM8	1	1	O/O		29	4					V1400578	14020831
S-C3	B293	201408		AX500096	AX500106	XENON LAMP:MM8	1	1	O/O		29	4					V1400578	14020831



Part Change Information List

Date: August 3, 2015

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
S-C3	B262	201507		14075299	14077818	RAM:FM1608B-PG(REV.AA)	1	1	O/O	N	57	319					V1400643	
S-C3	B280	201507		14075299	14077818	RAM:FM1608B-PG(REV.AA)	1	1	O/O	N	57	319					V1400643	
S-C3	B292	201507		14075299	14077818	RAM:FM1608B-PG(REV.AA)	1	1	O/O	N	57	319					V1400643	
S-C3	B293	201507		14075299	14077818	RAM:FM1608B-PG(REV.AA)	1	1	O/O	N	57	319					V1400643	



Part Change Information List

Date: October 4, 2016

Model	Code	PCIL Number	PCIL Correction	Old part number	New part number	Description	Old Q'ty	New Q'ty	Int	3DPC	Page	Index	Set	Set Int	RTB	Note	Ref Number	ECN Number
S-C3	B284	201609		14075454		IC - SN74LV86APW		---	X/O	N	70	156					V1603062	
S-C3	B288	201609		14075454		IC - SN74LV86APW		---	X/O	N	70	156					V1603062	