
Model: Iris/Lilac/Cattleya Platen Cover Date					1	No.: MA749001			
Modified Article: Platen Cover Hinge					Prepared by: M. Tsuyuki				
From: Technical Services Dept., GTS Division									
Reason for	☐ Parts catalog correction	☐ Vendor ch		ange	☐ To n	neet standards			
Modification:	odification:		∑ To improve reliability		(	)			
	☐ Part standardization	☐ Other							

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
A7491021	A7491121	Platen Cover Hinge	2	X/O	3	8	
04504016B		Tapping Screw – M4x16	4→8	X/O	3	101	
	04504025H	Tapping Screw – M4x25					

To prevent the mounting position of the platen cover hinge from being damaged, the platen cover has been modified and the number of screws which mount the hinge on the platen cover changed from two to four.

This modification has been done from June 2000 production.

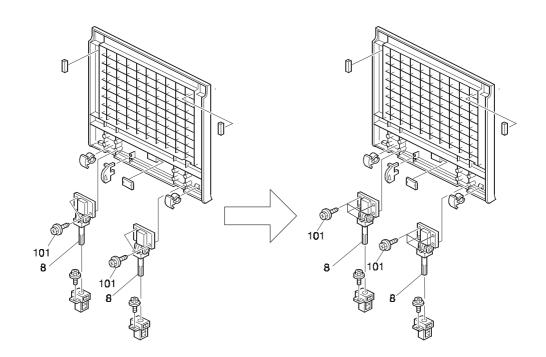

П	回	ന	巾巾
	(Մ)	(0)	لآبا

## **M**odification **B**ulletin

**PAGE: 1/1** 


Model: Iris/Lilac /Cattleya Platen Cover Date:				e: 24-Oct-01	1	No.: MA749002		
Modified Article: Hinge Holder				Prepared by: M. Tsuyuki				
From: Technical Services Dept., GTS Division								
Reason for	☐ Parts catalog correction	☐ Vendo	r cha	ange	☐ To n	neet standards		
Modification:	odification:		☐ To improve reliability		(	)		
	☐ Part standardization	⊠ Other						

To ensure that the original is flat and secure against the exposure glass, the Platen Cover Cushion has been thickened and the height of the Hinge Holder has been increased.

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
A7491007	A7491107	Platen Cover Cushion	1	X/X	3	1	*
A7491035	A7491135	Hinge Holder	2	X/X	3	9	*

\*Note: The two new parts should be replaced together as a set.

## 1. Platen Cover Type 100 (A749)

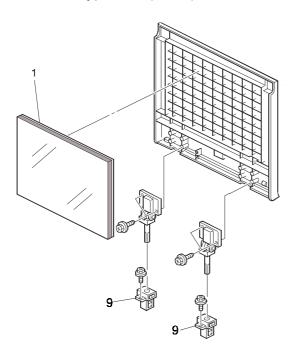

## Modification Bulletin

<b>PAGE: 1/</b>
-----------------

Model: Iris/Lilac/Cattleya Platen Cover Date					1	No.: MA749003
Modified Article: Platen Cover Hinge					by: M.	Tsuyuki
From: Technical S	Services Dept., GTS Division					
Reason for	☐ Parts catalog correction	☐ Vendor c		ange	☐ To n	neet standards
Modification:	☐ To facilitate assembly	∕ ⊠ To improv		☑ To improve reliability		)
Part standardization Other						

To maximize user safety, the Platen Cover Hinge has been strengthened and a Cover added during assembly. This cover has also been registered as a new service part.

Pleaser refer to RTB RA749001

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
A7491121	A7491122	Platen Cover Hinge	2	X/O	3	8	
	A7491029	Cover – Platen Cover Hinge	2		3	12*	

<sup>\*</sup> New Index No.

Note: The Hinge was modified from August '01, and the Cover added from October '01.

1. Platen Cover Type 100 (A749)

